



1.0 Introduction

This document describes how to modify 373-5448 Rocker Stand to 525-1901 Rocker Stand in quick and simple three steps. Using One Point Lesson describes the steps for drilling a hole with a jig made for the task.

2.0 Best Practice Description

The improvement consists of the use of a simple procedure OPL to modify 373-5448 into 525-1901 Rocker Stand.

For machining the oil hole, it is necessary to follow these three steps:

Step 1: Prepare a jig and locate it on a vertical milling machine.

Step 2: Install the 373-5448 Rocker Stand on the jig

Step 3: Drill the oil hole

3.0 Implementation Steps

Manufacture a simple jig, like the figure show below:

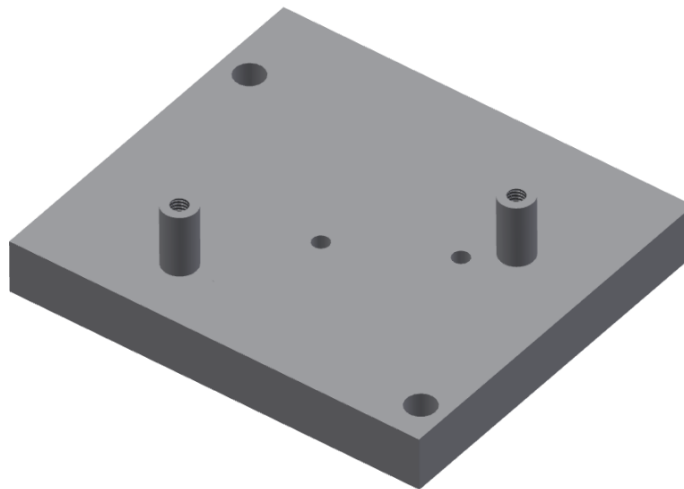


Figure 1: Jig for drilling 0.063 inch hole
Own design


Note:

Use two 3/8"NC x 60mm bolts and grade 5
two 8mm washers

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR			
Jig to Assist in Modifying C175 373-5448 Rocker Stand to 525-1901 Rocker Stand	DATE 2/4/2019	CHG NO 00	NUMBER 4.03-171229-04

Then follow the One Point Lesson:

OPL SOP009: Apply M0082927 in n/p 373-5448

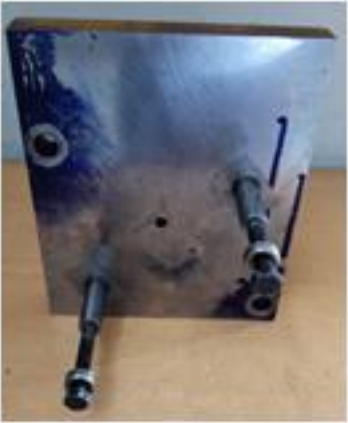AREA: MACHINE SHOP	ONE POINT LESSON		Code SOP0009
	Basic knowledge Improvement	☐ ☒	
TITLE: Drill 0.06" hole on n/p 373-5448 to convert to n/p 525-1901 REASON: Apply M0082927 on n/p 373-5448		Elaborated Rómulo Olarte Vargas Reviewed: Julio Quito Aguayo Aproved: César Inga Schemiel	
Step 1: Use the device below in a milling machine  Step 2: Locate n/p 373-5448 as showed. This position on the milling machine gets the required angle  Step 3: Use a Ø1.5mm drill whith 2" length. Disassemble and clean.  Nota: * Use 3/8"NC x 60mm bolts with 5 grade ** Two washers 8mm thick			
DATE	30/07/2017		
Supervisor	Rómulo Olarte		
Technician			

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Jig to Assist in Modifying C175 373-5448 Rocker Stand
to 525-1901 Rocker Stand

DATE
2/4/2019

CHG
NO
00

NUMBER
4.03-171229-04

4.0 Benefits

- Reduce the machine time from 01hour to 15minutes.
- The time improvement is about 75% for each 373-5448 Rocker Stand.

5.0 Resources Required

- Resources to manufacture the jig
- Drill Ø1.5mm x 2"


6.0 Supporting Attachments / References

[M0082927 – Procedure to Modify 867-0491 Rocker Stand and the 373-5448 Rocker Stand to the 525-1901 Rocker Stand](#)

(if the above hyperlink does not work, please copy the following link on your browser:

<https://sis.cat.com/sisweb/servlet/cat.dcs.sis.controller.integration.CSSISIntegrationServlet?operation=fromsplashscreen>)

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR			
Jig to Assist in Modifying C175 373-5448 Rocker Stand to 525-1901 Rocker Stand	DATE 2/4/2019	CHG NO 00	NUMBER 4.03-171229-04

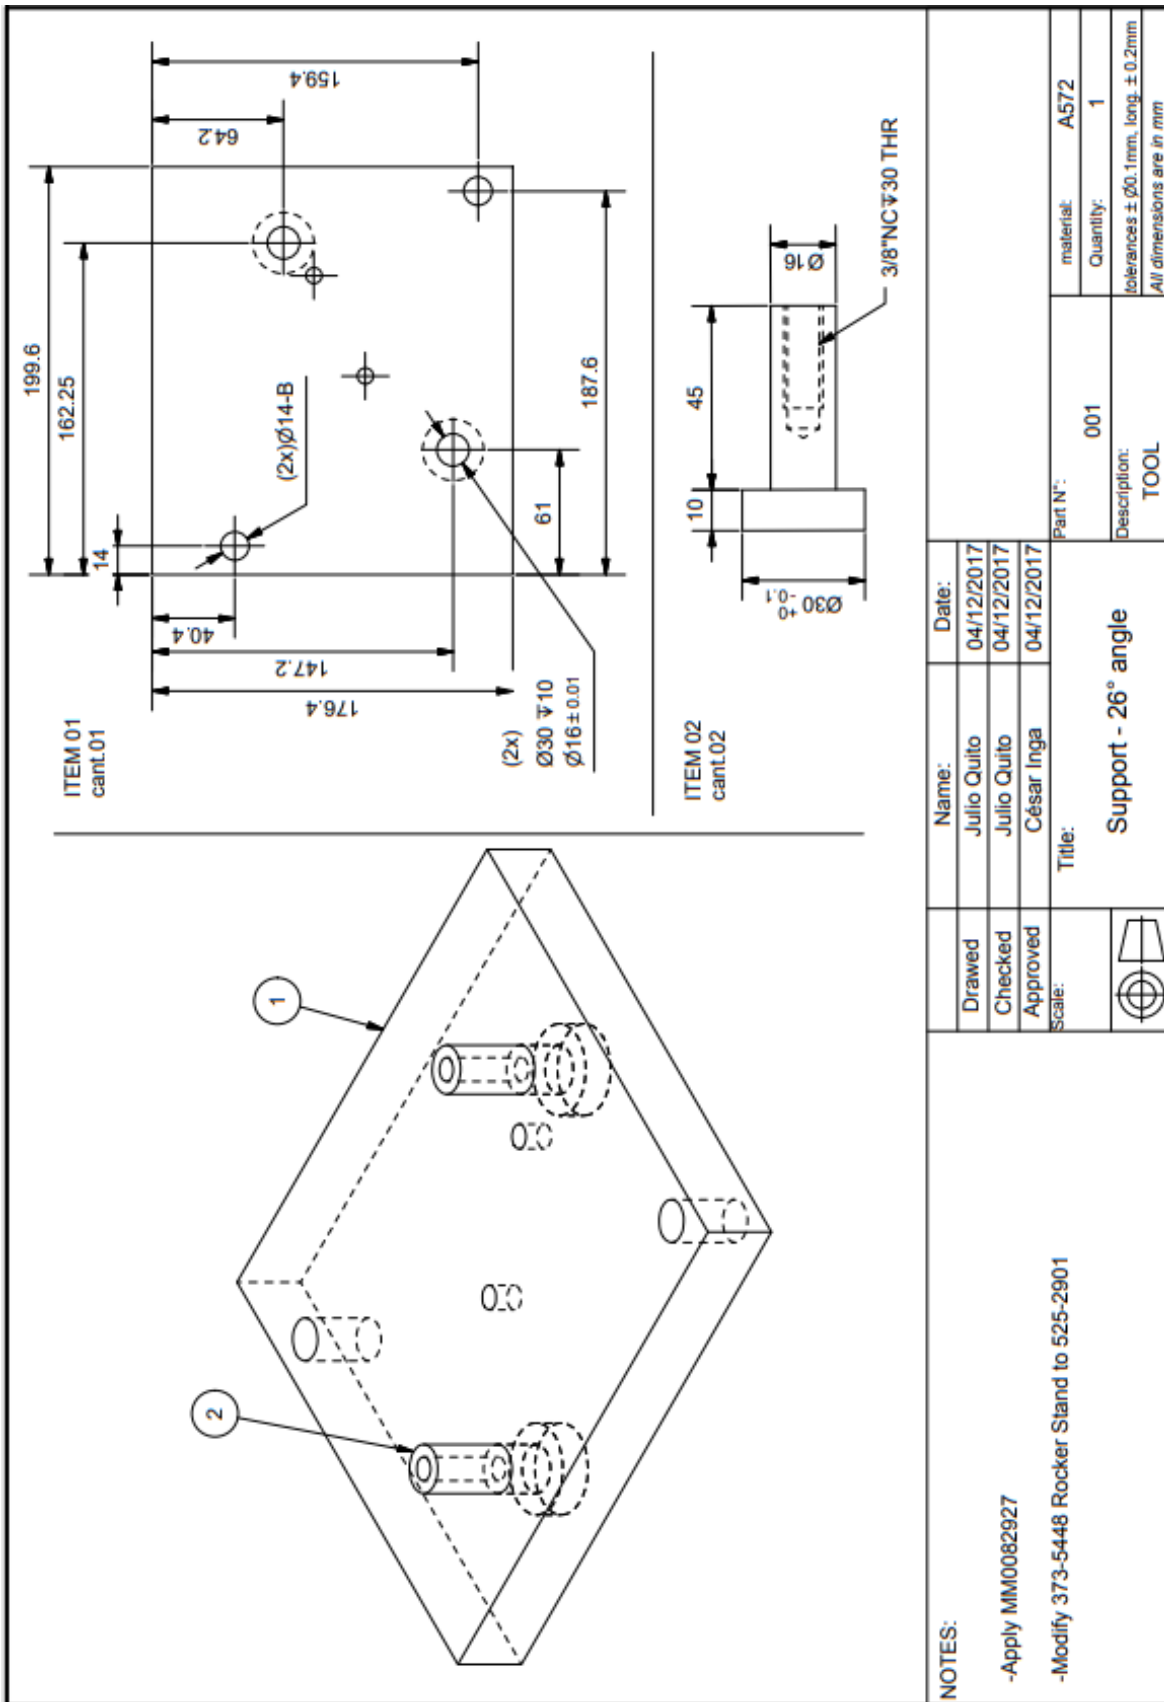

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Jig to Assist in Modifying C175 373-5448 Rocker Stand
to 525-1901 Rocker Stand

DATE
2/4/2019

CHG
NO
00

NUMBER
4.03-171229-04

7.0 Related Best Practices

None

8.0 Acknowledgements

This Best Practice was written by:
César Inga Schemiel
Cesar.inga@ferreyros.com.pe

This Best Practice was revised by:
Aninu Mitacc Vizcardo
aninu.mitacc@ferreyros.com.pe

This Best Practice procedure was developed by:
Rómulo Olarte Vargas
Julio Quito Aguayo
César Inga Schemiel

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Jig to Assist in Modifying C175 373-5448 Rocker Stand to 525-1901 Rocker Stand	DATE 2/4/2019	CHG NO 00	NUMBER 4.03-171229-04
---	------------------	-----------------	--------------------------