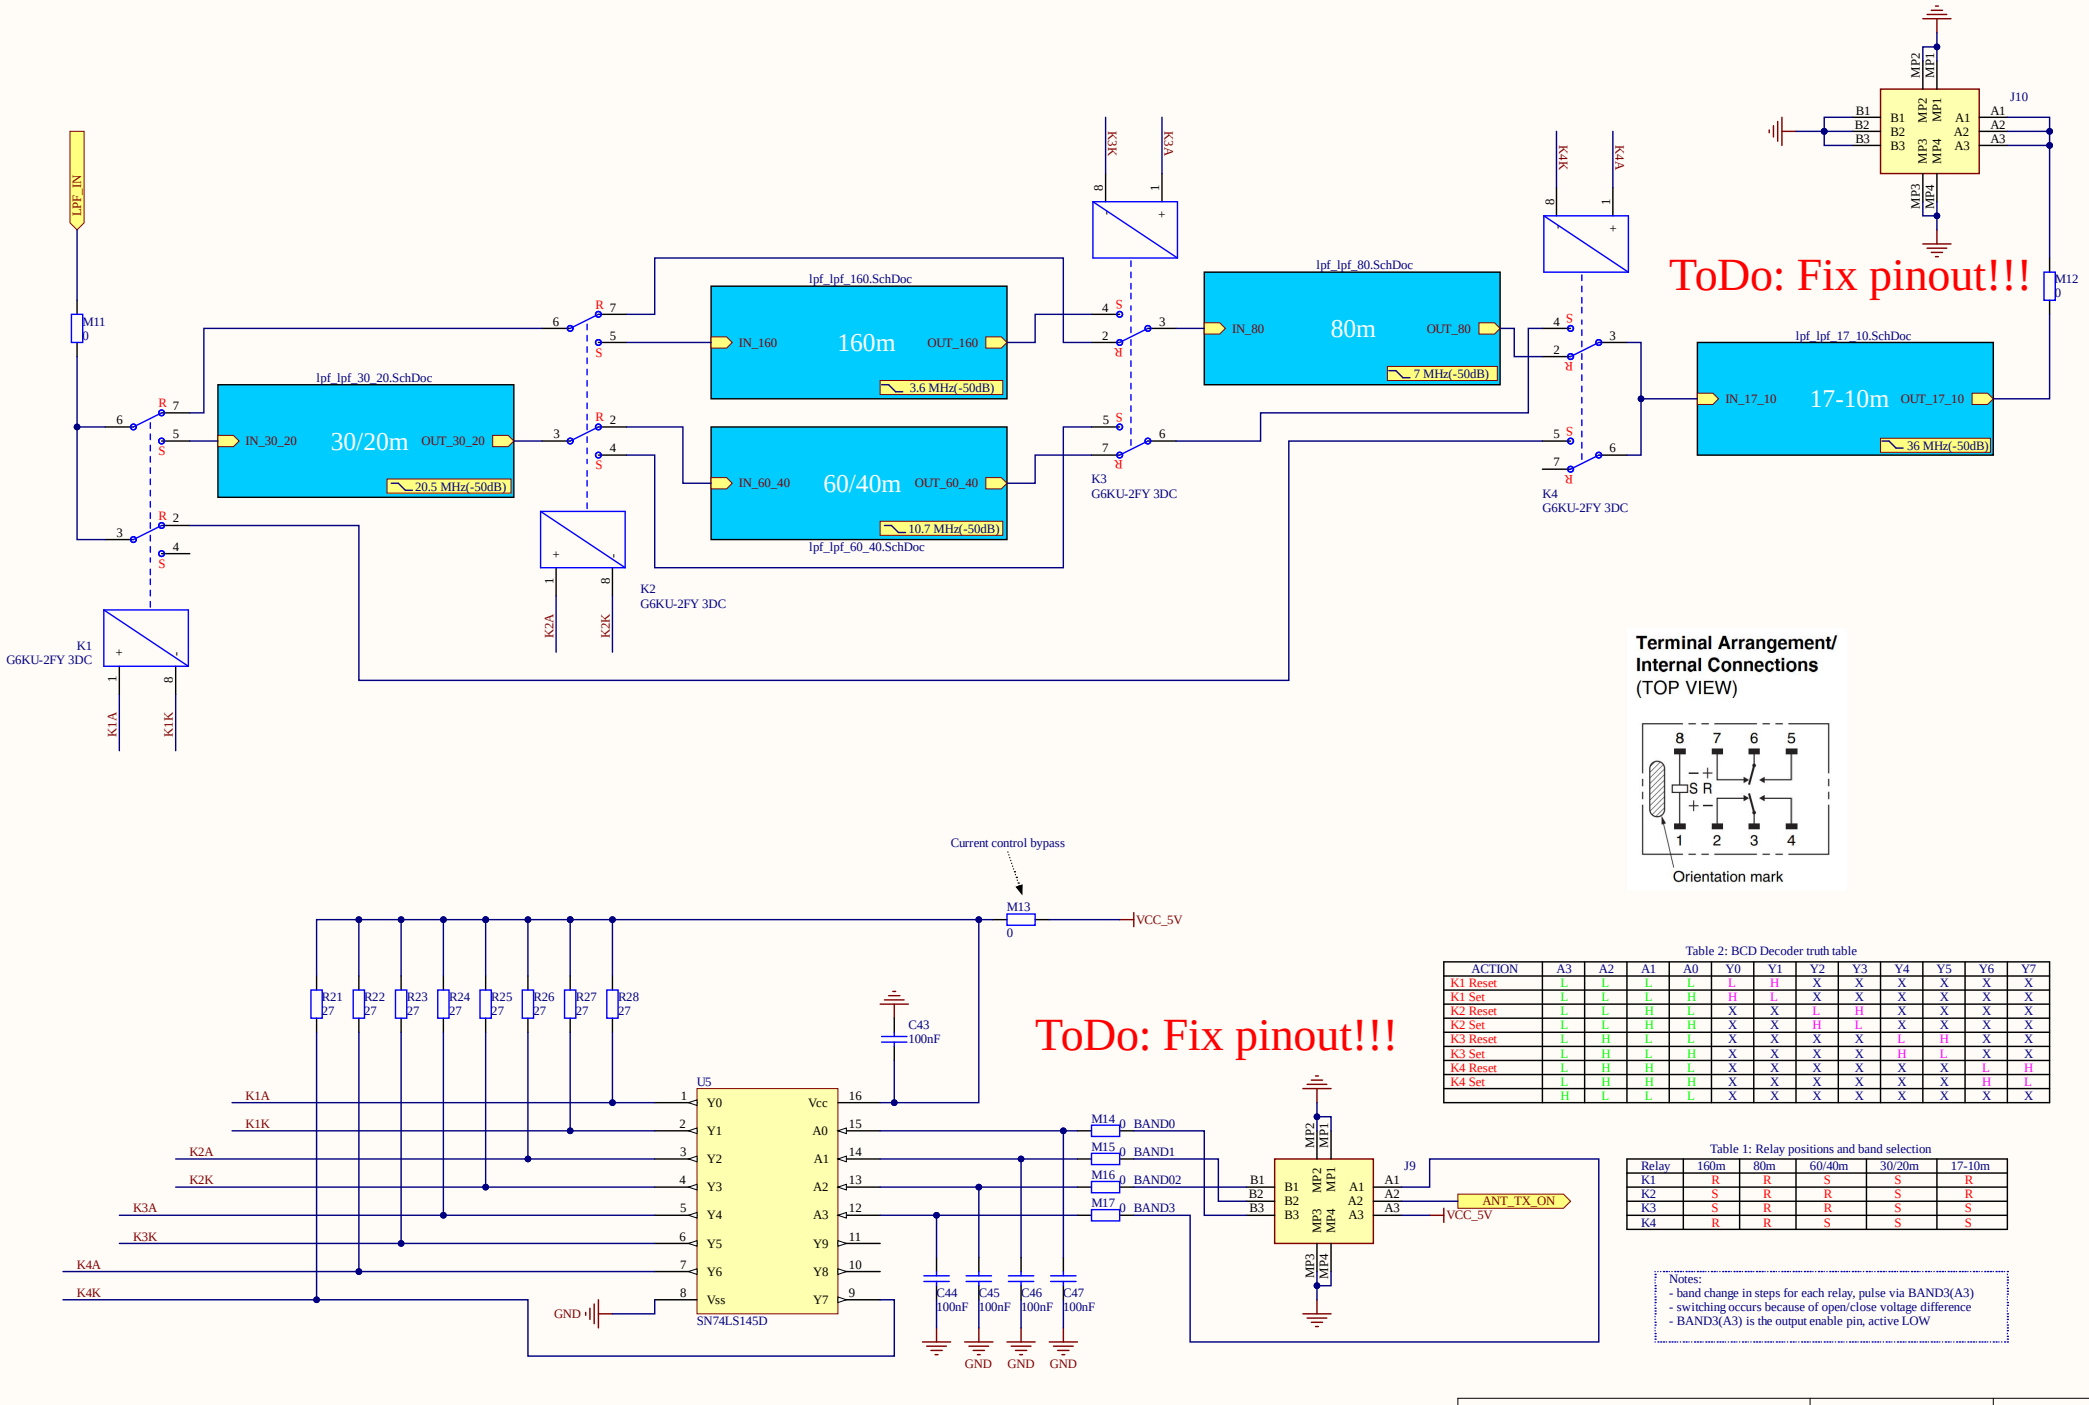


Table 2: BCD Decoder truth table

ACTION	A3	A2	A1	A0	Y0	Y1	Y2	Y3	Y4	Y5	Y6	Y7
K1 Reset	L	L	L	L	L	H	X	X	X	X	X	X
K1 Set	L	L	L	H	H	L	X	X	X	X	X	X
K2 Reset	L	L	H	L	X	X	L	H	X	X	X	X
K2 Set	L	L	H	H	X	X	H	L	X	X	X	X
K3 Reset	L	H	L	L	X	X	X	X	L	H	X	X
K3 Set	L	H	L	H	X	X	X	X	H	L	X	X
K4 Reset	L	H	H	L	X	X	X	X	X	X	L	H
K4 Set	L	H	H	H	X	X	X	X	X	X	H	L
	H	L	L	L	X	X	X	X	X	X	X	X


Table 1: Relay positions and band selection

Relay	160m	80m	60/40m	30/20m	17-10m
K1	R	R	S	S	R
K2	S	R	R	S	R
K3	S	R	R	S	S
K4	R	R	S	S	S


Notes:
- band change in steps for each relay, pulse via BAND3(A3)
- switching occurs because of open/close voltage difference
- BAND3(A3) is the output enable pin, active LOW

mcHF PA LPF board		Lowpass filters	*Krassi Atanassov MØNKA*
Date: 26/10/2026	Revision: 0.9 rev A	Sheet 3 of 10	
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_lpf.SchDoc			
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!			

NOTE: Real Life Performance dips are bit off in Graphic2 due to tolerances of caps installed at the factory and turns spacing of inductors not achieving ideal inductance. If you need to meet strict regulatio n requirements, like second harmonic -50 dB below fundamental, then care should be taken when winding inductors and maybe caps replaced wit h very high tolerance ones.

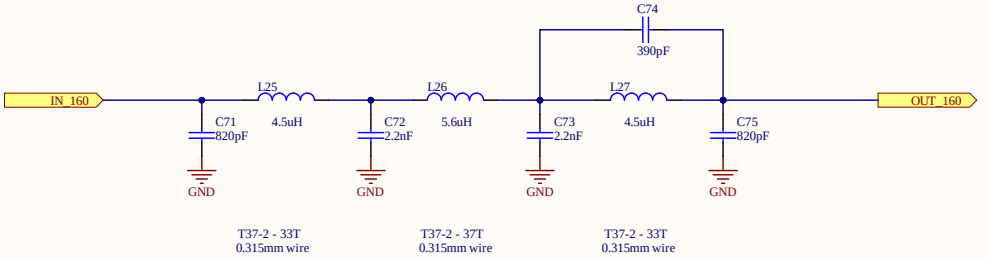


Graphic1: Cascaded with 80 and 17/10 filters (design)

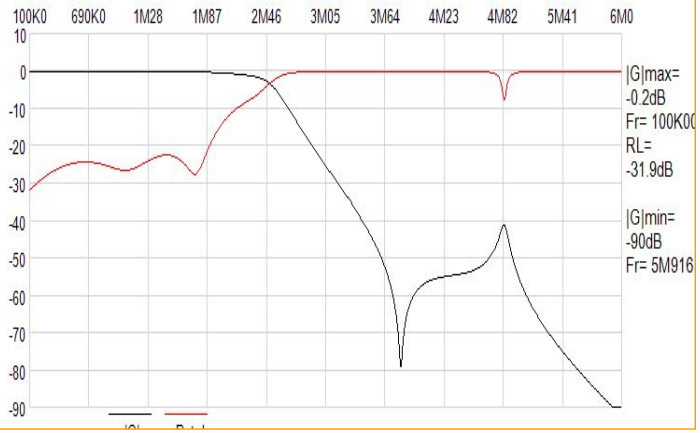

Graphic2: IRL performance (R26,R27, C104 removed)



Graphic3: Filter standalone (design)

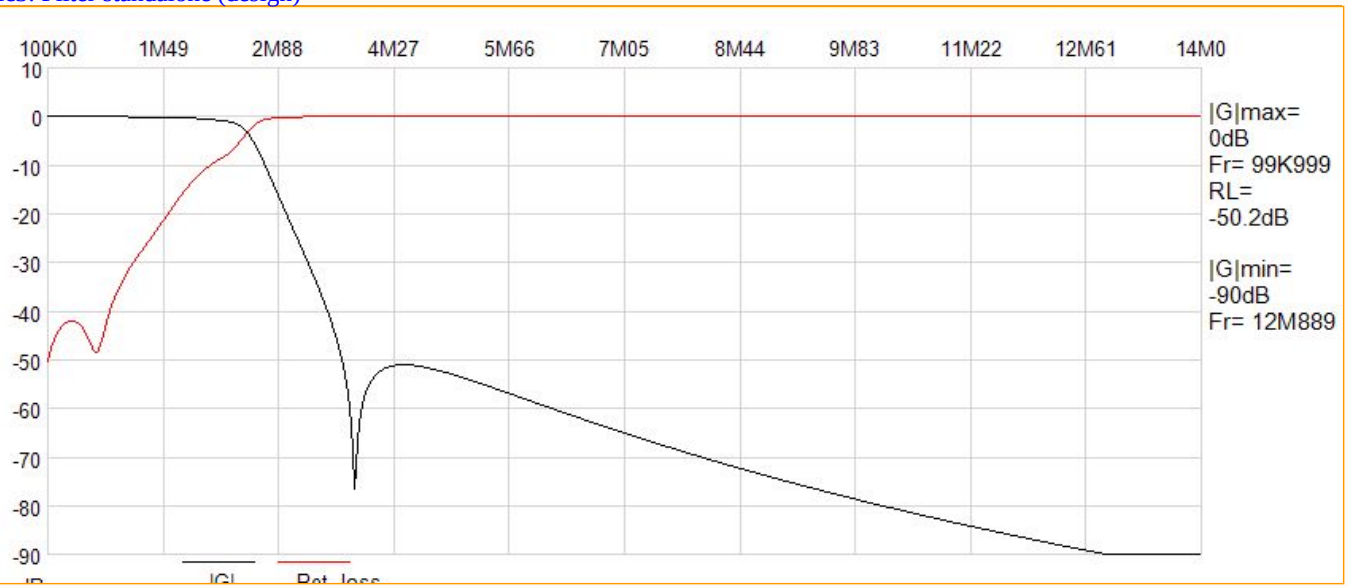


LPF 0.8 re-design, special thanks to:
Paolo IZ6MAF & Wayne NB6M & MM0GYX

mcHF PA LPF board		LPF 160m	*Krassi Atanassov MØNKA*
Date: 26/10/2026	Revision: 0.9 rev A	Sheet 8 of 10	
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_lpf_160.SchDoc			
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!			


Graphic1: IRL performance (R26,R27, C104 removed)



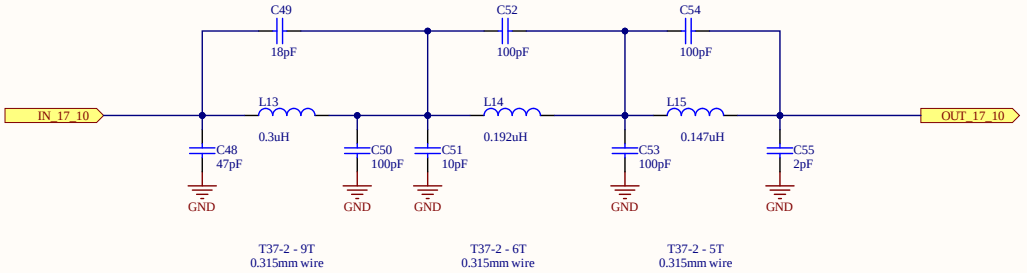

NOTE: Real Life Performance dips are bit off in Graphic1 due to tolerances of caps installed at the factory and turns spacing of inductors not achieving ideal inductance. If you need to meet strict regulatio n requirements, like second harmonic -50 dB below fundamental, then care should be taken when winding inductors and maybe caps replaced wit h very high tolerance ones.


Graphic2: Filter standalone (design)

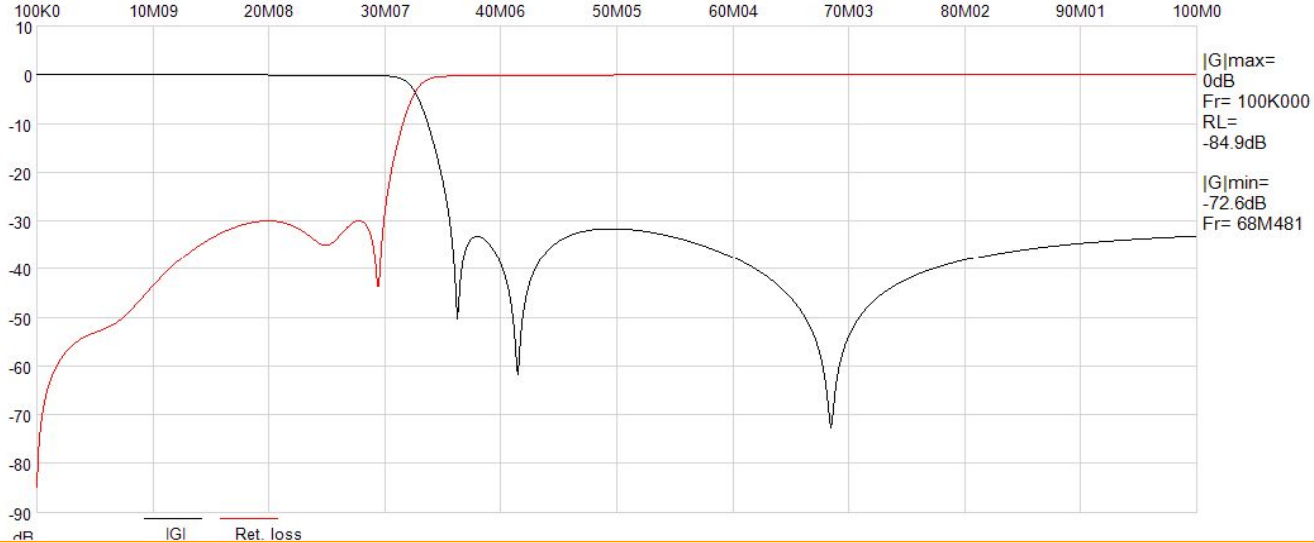


LPF 0.8 re-design, special thanks to:
Paolo IZ6MAF & Wayne NB6M & MM0GYX

mcHF PA LPF board	LPF 17-10m	*Krassi Atanassov MØNKA*
Date: 26/10/2026 | Revision: 0.9 rev A | Sheet 4 of 10		
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_lpf_17_10.SchDoc		
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!		

NOTE: Real Life Performance dips are bit off in Graphic2 due to tolerances of caps installed at the factory and turns spacing of inductors not achieving ideal inductance. If you need to meet strict regulatio n requirements, like second harmonic -50 dB below fundamental, then care should be taken when winding inductors and maybe caps replaced wit h very high tolerance ones.

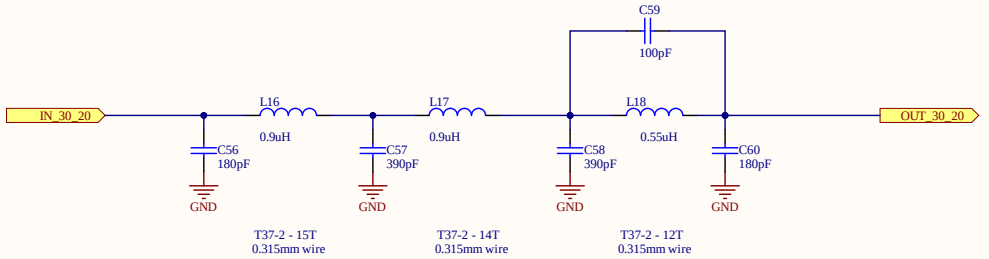


Graphic1: Cascaded with 17/10 filter (design)

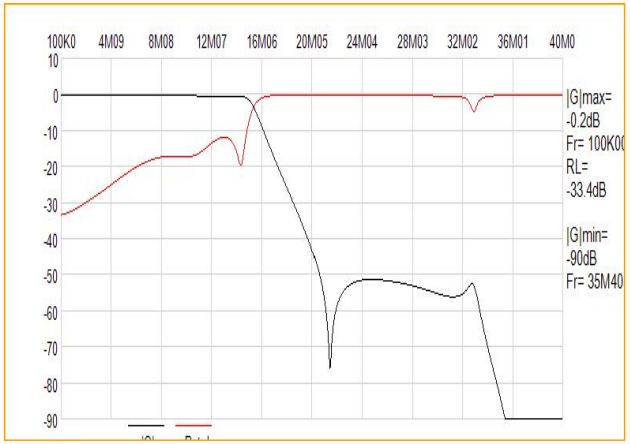

Graphic2: IRL performance (R26,R27, C104 removed)




Graphic3: Filter standalone (design)

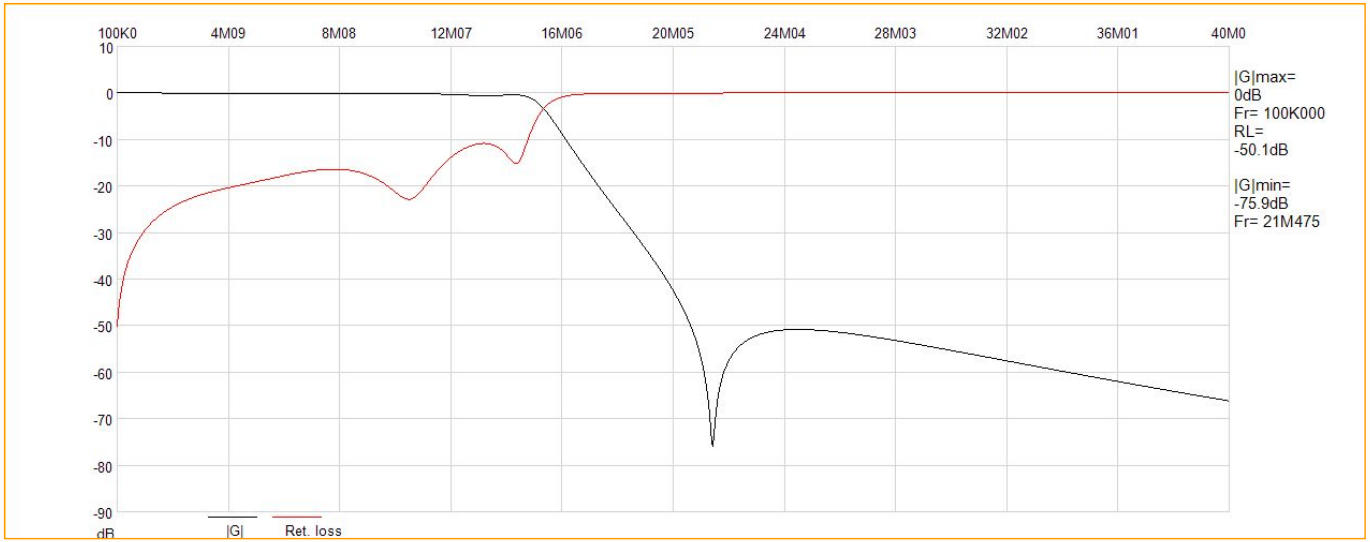


LPF 0.8 re-design, special thanks to:
Paolo IZ6MAF & Wayne NB6M & MM0GYX

mcHF PA LPF board	LPF 30/20m	*Krassi Atanassov MØNKA*
Date: 26/10/2026 | Revision: 0.9 rev A | Sheet 5 of 10		
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_lpf_30_20.SchDoc		
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!		

NOTE: Real Life Performance dips are bit off in Graphic2 due to tolerances of caps installed at the factory and turns spacing of inductors not achieving ideal inductance. If you need to meet strict regulatio n requirements, like second harmonic -50 dB below fundamental, then care should be taken when winding inductors and maybe caps replaced wit h very high tolerance ones.

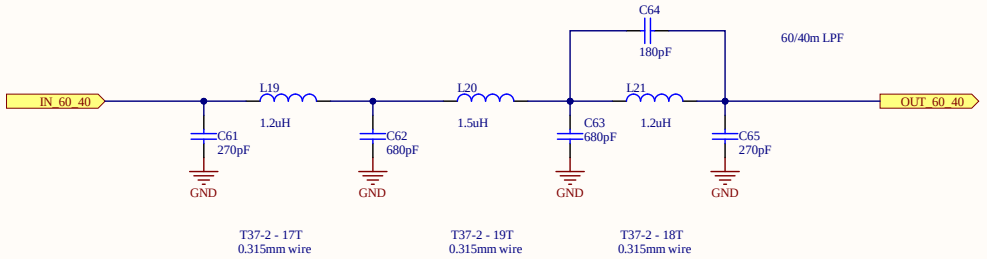


Graphic1: Cascaded with 20/30 and 17/10 filters (design)

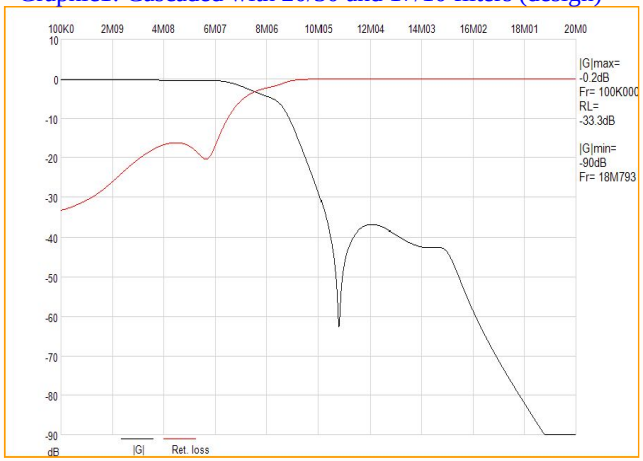

Graphic2: IRL performance (R26,R27, C104 removed)




Graphic3: Filter standalone (design)

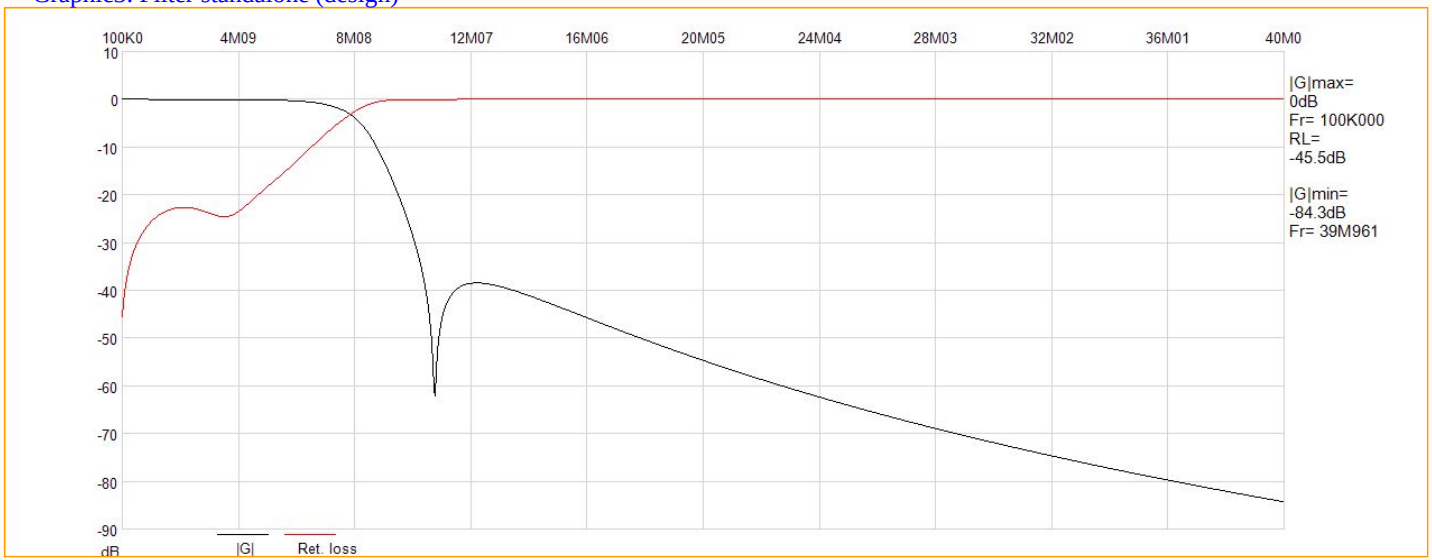


LPF 0.8 re-design, special thanks to:
Paolo IZ6MAF & Wayne NB6M & MM0GYX

mcHF PA LPF board	LPF 60/40m	*Krassi Atanassov MØNKA*
Date: 26/10/2026 | Revision: 0.9 rev A | Sheet 6 of 10		
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_lpf_60_40.SchDoc		
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!		

NOTE: Real Life Performance dips are bit off in Graphic2 due to tolerances of caps installed at the factory and turns spacing of inductors not achieving ideal inductance. If you need to meet strict regulatio n requirements, like second harmonic -50 dB below fundamental, then care should be taken when winding inductors and maybe caps replaced wit h very high tolerance ones.

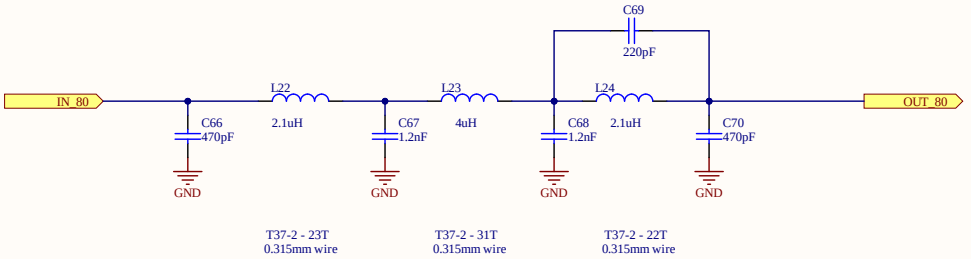


Graphic1: Cascaded with 17/10 filter (design)

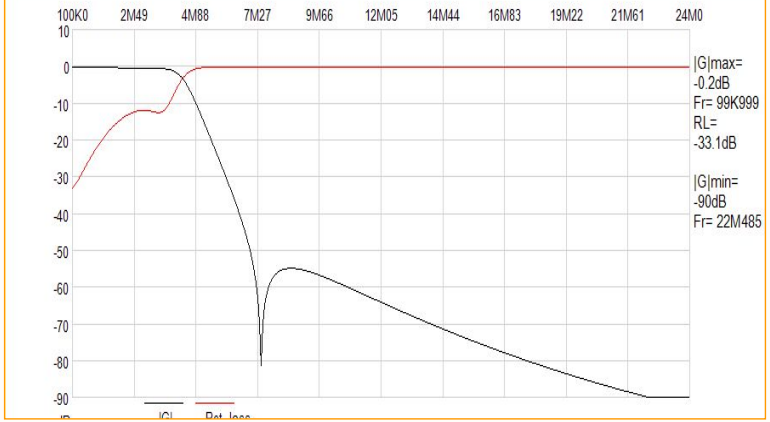

Graphic2: IRL performance (R26,R27, C104 removed)




Graphic3: Filter standalone (design)

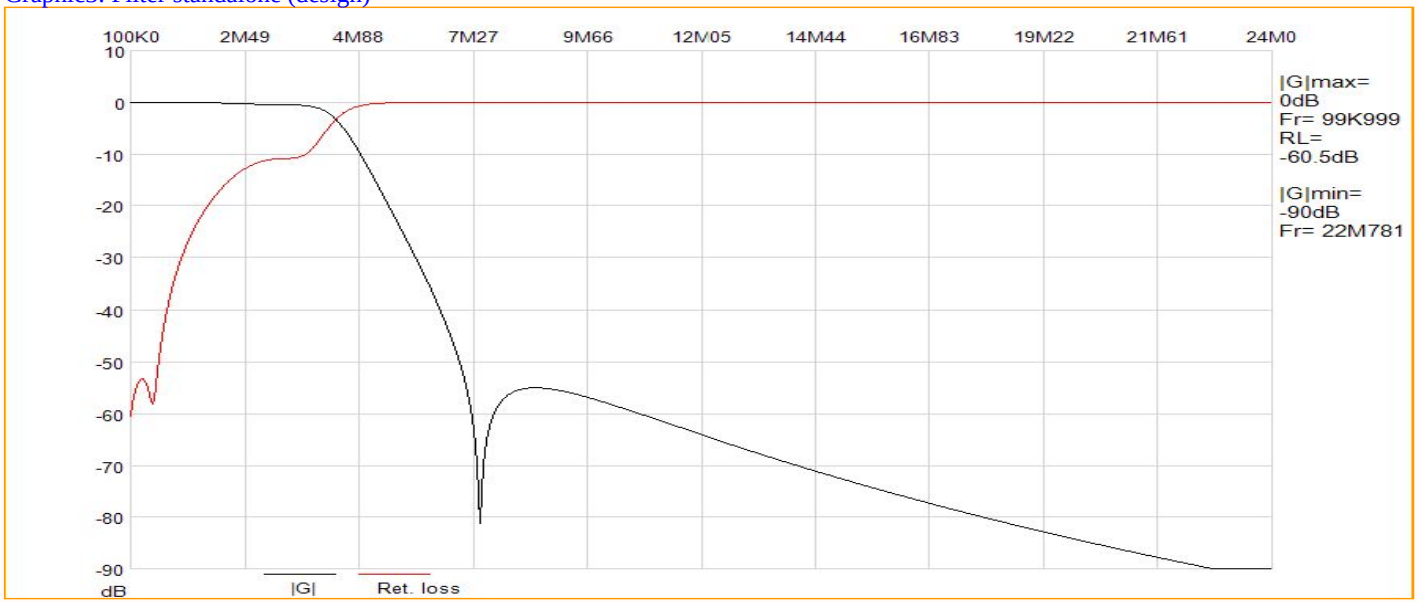


LPF 0.8 re-design, special thanks to:
Paolo IZ6MAF & Wayne NB6M & MM0GYX

mcHF PA LPF board		LPF 80m	*Krassi Atanassov MØNKA*
Date: 26/10/2026	Revision: 0.9 rev A	Sheet 7 of 10	
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_lpf_80.SchDoc			
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!			

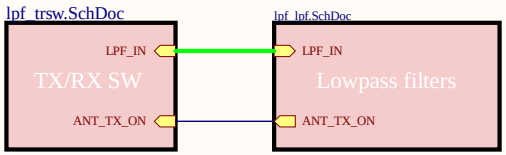

mcHF PA LPF board		Block diagram	*Krassi Atanassov MØNKA*
Date: 26/10/2026	Revision: 0.9 rev A	Sheet 1 of 10	
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_main.SchDoc			
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!			

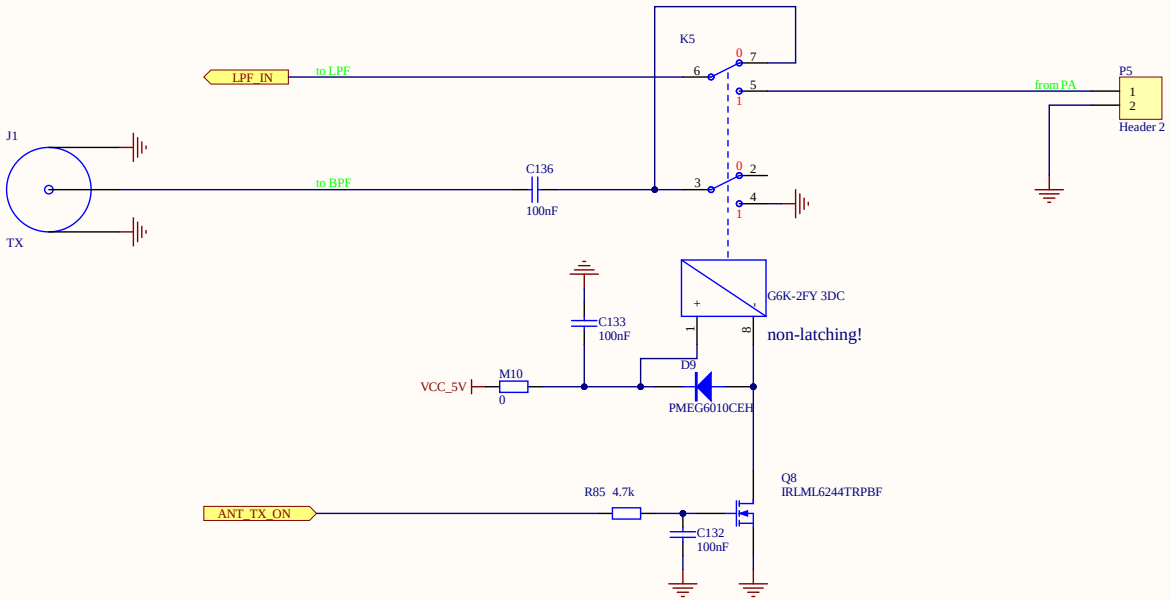

ea8arx modifications

mcHF PA LPF board		RX Antenna Switching	*Krassi Atanassov MØNKA*
Date: 26/10/2026	Revision: 0.9 rev A	Sheet 9 of 10	
File: C:\Projects\wip\mcHF_v9\pcb\revB\lpf\schematics\lpf_trsw.SchDoc			
Licence: For radio amateurs experimentation, non-commercial use only. Thank you!			