

50069942

Heavy Duty Pressure TransducersPX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Issue I



DESCRIPTION

Honeywell's PX2 Series Heavy Duty Pressure Transducers are a portfolio of configurable pressure sensors that use piezoresistive sensing technology with ASIC (Application Specific Integrated Circuit) signal conditioning in a stainless steel housing. The PX2 Series is fully calibrated and compensated for offset, sensitivity, temperature effects and non-linearity using the on-board ASIC. These transducers measure absolute, sealed gage, or vented gage pressure. The absolute versions have an internal vacuum reference and an output value proportional to absolute pressure, sealed gage versions have an internal pressure reference of one atmosphere at sea level, and vented gage versions measure pressure with respect to ambient pressure. They are RoHS compliant and are designed and manufactured according to ISO 9001 standards.

VALUE TO CUSTOMERS

- Media compatibility: Common HFC (hydrofluorocarbon) refrigerants such as R410A and R134A, next generation low global warming potential (GWP) refrigerants such as R448A (Solstice® N40), R32 and R1234ZE, engine oil, petroleumbased hydraulic fluids, DOT 3 brake fluid, and dry air. For ammonia and other corrosive media, see Honeywell's SPT Series.
- Enhanced durability: The PX2 Series can operate in the rigorous environments commonly found in HVAC/R and air compressor applications. The sensor can survive at least 10 million pressure cycles and has an ingress protection rating up to IP69K.

FEATURES

- Pressure range: 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi
- Pressure reference: Absolute, sealed gage or vented gage
- Pressure port types: 7/16-20 UNF 1/4 in 45° Flare Female Schrader (SAE J512), 7/16-20 UNF 45° Flare Male (SAE J513), 7/16-20 UNF 37° Flare Male (SAE J514), G1/4 (ISO 1179-3), G1/8 (ISO 1179-3), M12 x 1.5 (ISO 6149-3), 1/4-18 NPT, 1/8-27 NPT, 9/16-18 UNF, (SAE J1926-3), or 7/16-20 UNF (SAE J1926-3)
- Electrical connector types: Metri-Pack 150 (UL 94 HB or V-0 options), Micro M12, DIN, Deutsch, or cable harness (1 m, 2 m, 3 m, or 5 m)
- Total Error Band: ±2.0 %
- Operating and compensated temperature range: -40°C to 125°C [-40°F to 257°F]
- Response time: <2 ms
- Life: Minimum of 10 million cycles to operating pressure
- Output transfer function: Ratiometric, regulated or current
- Mechanical shock rating: 100 G per MIL-STD-202F, Method 213B. Cond. F
- Vibration rating: 20 G sweep, 10 Hz to 2000 Hz
- Ingress protection: Up to IP69K
- Radiated immunity protection: Up to 100 V/m (ISO 11452-2)
- Flame retardant options: UL 94 HB standard on all electrical terminations; UL 94 V-0 available upon request

POTENTIAL APPLICATIONS

- Industrial: Refrigerant pressure monitoring in HVAC/R systems; air compressor system pressure
- Transportation: Air system monitoring; hydraulic oil pressure monitoring

The PX2 Series is not recommended for use with media involving water, saturated air such as steam and vapor, and ammonia.

PORTFOLIO

Honeywell's PX2 Series joins the PX3 Series, MLH Series, and SPT Series heavy duty pressure transducers.

Heavy Duty Pressure Transducers

PX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Table 1. Performance Specifications¹

Characteristic	Parameter
Operating temperature range ²	-40°C to 125°C [-40°F to 257°F]
Storage temperature range ³	-40°C to 125°C [-40°F to 257°F]
Compensated temperature range ⁴	-40°C to 125°C [-40°F to 257°F]
Overpressure minimum rating ⁵	(See Table 3.)
Burst pressure minimum rating ⁶	(See Table 3.)
Long term stability	±0.5 %FSS ⁹ (1000 hr at 25°C [77°F])
Accuracy ⁷	±0.25 %FSS ⁹ (See Figure 1.)
Offset error ⁸	±1 %FSS ⁹
Total Error Band ¹⁰	±2 %FSS ⁹ (-40°C to 125°C [-40°F to 257°F]) (See Figure 1.)
Response time ¹¹	<2 ms
Turn on time ¹²	<7 ms
Life ¹³	minimum of 10 million cycles to operating pressure

- ¹ All specifications apply at 25°C and under operating conditions unless otherwise noted.
- Operating Temperature Range: The temperature range over which the product will produce an output proportional to pressure but may not remain within the specified performance limits.
- ³ Storage Temperature Range: The temperature range over which the product may safely be exposed without excitation or pressure applied. Under these conditions the product will remain in specification after excursion to any temperatures within this range. Exposure to temperatures outside this range may cause permanent damage to the product.
- 4 Compensated Temperature Range: The temperature range (or ranges) over which the product will produce an output proportional to pressure within the specified performance limits.
- Overpressure: The absolute maximum rating for pressure which may be safely applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressure may cause permanent damage to the product.
- ⁶ Burst Pressure: The maximum pressure that may be applied to the product without causing escape of the pressure media. The product should not be expected to function after exposure to any pressure beyond the rated burst pressure. This rating is also the case burst rating of the product.
- Accuracy: The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the pressure range at 25°C. Includes all errors due to pressure non-linearity, pressure hysteresis, and non-repeatability.
- Offset Error: the maximum deviation in the output signal obtained when the reference pressure is applied at 25°C relative to the ideal transfer function.
- ⁹ Full Scale Span (FSS): The algebraic difference between the output signal measured at the maximum (Pmax.) and minimum (Pmin.) limits of the pressure range.
- ¹⁰ Total Error Band: The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range. Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span, and thermal hysteresis.
- 11 Response Time: The response time of the transducer is the maximum amount of time that the transducer will take for the transducer to output a change from 10% to 90% of full scale in response to a 0% to 100% full scale step input pressure range.
- $^{\rm 12}$ Turn On Time: Duration from power applied until first valid output.
- ¹³ Life may vary depending on the application in which transducer is used.

Figure 1. Total Error Band (TEB) for the Total Error Band Series

All Possible Errors Offset Full Scale Span Pressure Non-Linearity Pressure Hysteresis Pressure Non-Repeatability Thermal Effect on Offset Thermal Hysteresis Thermal Hysteresis

Heavy Duty Pressure TransducersPX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Table 2. Electrical Specifications


		Current Output	Regulated Output							
Characteristic	Output Transfer Function Order Code ¹									
	AA	АВ	AC	AD	СН	ВС	BD	BE	BG	
Output transfer function ¹ : null output value full scale output value full scale span (FSS) operating supply voltage, min.(Vs) ² operating supply voltage, typ. (Vs) ² operating supply voltage, max. (Vs) ²	90% of Vs	5% of Vs 95% of Vs 90% of Vs 4.5 V 5 V 5.5 V		95% of Vs	4 mA 4 mA 16 mA 8 V — 30 V ⁴	1 V 6 V 5 V 9 V - 30 V ³	0.25 V 10.25 V 10 V 13 V - 30 V ³	0.5 V 4.5 V 4 V 8 V - 30 V ³	1 V 5 V 4 V 8 V - 30 V ³	
Supply current (typ.)	51	5 mA 4 mA				5.5 mA				
Output load (pull up or down): minimum maximum		2 k(-	2 kOhm —		– (Vs - 8) x 50 Ohm ⁴	2 kOhm —				
Absolute voltage ratings ⁵ : minimum ⁶ maximum ⁶ maximum applied to output pin (short circuit protection) ⁷	-16 V 16 V Vs			-16 V 30 V —	-16 V 30 V 12 V					
EMC rating8: CE compliance: electrostatic discharge radiated immunity fast transient burst immunity to conducted disturbances radiated emissions	±4 kV contact, ±8 kV air per IEC 61000-4-2 10 V/m (80 MHz to 1000 MHz) per IEC 61000-4-3 ±1 kV per IEC61000-4-4 3 V per IEC61000-4-6 40 dB 30 MHz to 230 MHz; 47 dB 230 MHz to 1000 MHz per CISPR 11									
ISO 11452-2 radiated immunity	100 V/m 200 MHz to 2 GHz 20 V/m 200 MHz to 2 GH						GHz			

- Output transfer function options are shown in the Nomenclature and Order Guide. (See Figure 4.)
- Transducer will not produce valid output when supply voltage is outside of operating range.
- Applies at 25°C. See Figure 2 for Regulated Output Supply Voltage.
- Applies at 25°C. See Figure 3 for Current Output Supply Voltage.
- Absolute maximum ratings are the extreme limits the device can withstand without damage to the product. Voltages above these ratings may cause permanent damage. Exposure to absolute maximum conditions for extended periods may degrade device reliability.
- Absolute voltage applies to potential across power and ground terminals.
- Short circuit protection between output pin and ground, and output pin and supply pin.
- All EMC ratings verified with the Metri-Pack 150 electrical connector type.

Figure 2. Regulated Output Supply Voltage

32 30 28 Supply Voltage (V) 26 24 22 20 18 16 100 105 110 115 120 125 Operating Temperature (°C)

Figure 3. Current Output Supply Voltage

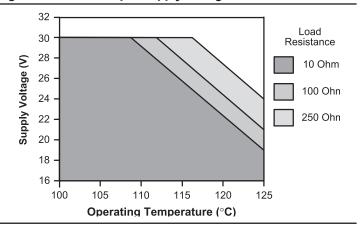

Heavy Duty Pressure TransducersPX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Table 3. Pressure Ratings

	bar			kPa			MPa			psi		
Operating Pressure	Over- pressure	Burst Pressure	Operating Pressure	Over- pressure	Burst Pressure	Operating Pressure	Over- pressure	Burst Pressure	Operating Pressure	Over- pressure	Burst Pressure	
1	5	8	100	500	800	1	3.1	5.1	15	70	115	
1.6	5	8	160	1000	1700	1.6	5.2	8.6	30	150	250	
2	10	17	250	1000	1700	2.5	6.9	10.3	50	250	400	
2.5	10	17	400	1700	2700	4	6.9	10.3	100	450	750	
4	17	27	600	3100	5100	4.6	6.9	10.3	150	450	750	
6	31	51	_	_	_	6	13.8	20.6	200	750	1250	
8	31	51	_	_	_	7	13.8	20.6	250	750	1250	
10	31	51	_	_	_	_	_	_	300	1000	1500	
16	52	86	_	_	_	_	_	_	500	1000	1500	
25	69	103	_	_	_	_	_	_	600	1000	1500	
34	69	103	_	_	_	_	_	_	667	1000	1500	
40	69	103	_	_	_	_	_	_	750	1500	2250	
46	69	103	_	_	_	_	_	_	800	1500	2250	
60	138	206	_	_	_	_	_	_	850	2000	3000	
70	138	206	_	_	_	_	_	_	1000	2000	3000	

Table 4. Pressure Reference Types

Pressure Reference	Description
Absolute	Output is proportional to the difference between applied pressure and a built-in fixed reference to vacuum (zero pressure), where the minimum operating pressure is set to absolute zero pressure (perfect vacuum).
Sealed gage ¹	Output is proportional to the difference between applied pressure and a built-in fixed reference to 1 atmA, where the minimum operating pressure is set to 14.7 psiA (1 atmA).
Vented gage ²	Sensor measures pressure relative to ambient pressure. Output is proportional to the difference between applied pressure and atmospheric (ambient) pressure, where the minimum operating pressure is set to atmospheric pressure.

 $^{^{\}mathrm{1}}$ Sealed gage option only available in pressure ranges at or above 100 psi.

 $^{^{2}}$ Vented gage option only available in pressure ranges between 100 psi and 667 psi.

Heavy Duty Pressure Transducers

PX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Table 5. Environmental and Mechanical Characteristics

Characteristic	Parameter
Mechanical shock	100 G per MIL-STD-202F, Method 213B, Cond. F (at 25°C)
Vibration	20 G sweep, 10 Hz to 2000 Hz (at 25°C)
Enclosure rating	per electrical connector type selection (See Figure 5.)
Wetted materials:	
port	304 stainless steel
substrate	alumina ceramic
adhesives	ероху
electronics	glass, silicon
External materials:	
housing	304 stainless steel
connector:	
UL 94 HB (standard)	PBT 30% GF, black
UL 94 V-0 (optional)	PBT 30% GF, natural (beige)
cable jacket	TPE
Installation torque	per pressure port type (See Figure 6.)

CAUTION

PRODUCT DAMAGE DUE TO MECHANICAL ISSUES

- Ensure torque specifications are determined for the specific application. Values provided are for reference only. (Mating materials and thread sealants can result in significantly different torque values from one application to the next.)
- When using mating parts made of stainless steel, use a thread sealant with anti-seize properties to prevent thread galling. Ensure the sealant is rated for the application.
- Use appropriate tools (such as an open ended wrench or deep well socket) to install transducers.
- Always hand-start transducers into the hole to prevent cross threading and damage.
- Ensure that torque is not applied to the electrical connector.
- Ensure that the proper mating electrical connector with a seal is used to connect the transducer. Improper or damaged seals can compromise ingress protection, leading to short circuits.

Failure to comply with these instructions may result in product damage.


CAUTION

PRODUCT DAMAGE DUE TO PARTICULATES

- Ensure that a filter is used upstream of the transducer to keep media flow free of larger particulates and increased humidity. All PX2 Series transducers are dead-ended devices; particulate accumulation and condensing moisture may affect sensor output.
- It is recommend that the transducer be positioned with the port facing downwards; any particulates in the system are less likely to enter and settle within the pressure transducer if it is in this position.
- Ensure that the media does not create a residue when dried. Build-up inside the transducer may affect transducer output; rinsing of a dead-ended transducer is potentially difficult and has limited effectiveness in removing residue.


Failure to comply with these instructions may result in product damage.

Figure 4. Nomenclature and Order Guide

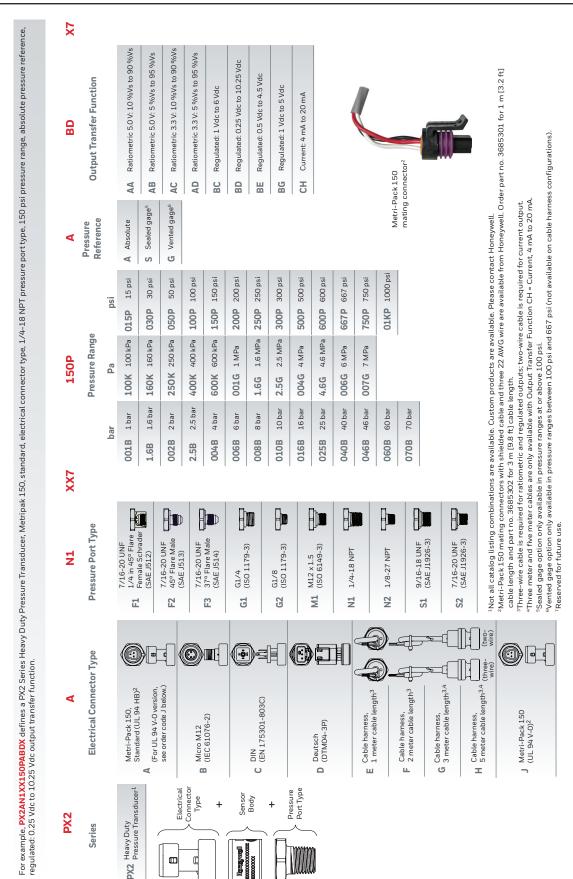

Heavy Duty Pressure TransducersPX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Figure 5. Electrical Connector Type Dimensions (For reference only: mm/[in].)



Metri-Pack 150, Standard (UL 94 HB)

Metri-Pack 150 (UL 94 V-0)

В Micro M12 (IEC 61076-2)

C DIN (EN 175301-803C)

Connector: DELPHI 12078088 Mating Connector: DELPHI 12110192 IP Rating¹: IP65 (all versions)

Connector: IEC 61076-2-101 Mating Connector: 4 POS TYPE D IP Rating1: IP65/IP67 (absolute, sealed gage versions), IP65 (vented gage

versions)


Connector: EN 175301-803C


Mating Connector: EN 175301-803C


DIN 43650C 8MM

IP Rating¹: IP65 (all versions)

Pin	Voltage Output	Current Output	Pin	Voltage Output	Current Output	Pin	Voltage Output	Current Output
А	GND	RTN	1	V+	supply	1	GND	RTN
В	V+	supply	3	GND	RTN	2	V+	supply
C Vout	\/at	/out NC	4	Vout	NC	3	Vout	NC
	vout					PE	NC	NC

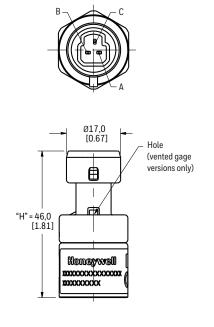


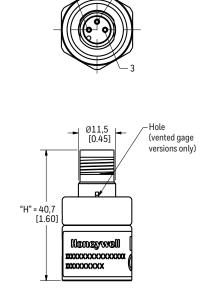

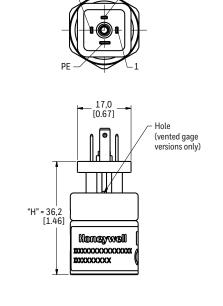

¹ IP rating is determined by the electrical connection chosen.

Figure 5. Electrical Connector Type Dimensions (continued)



Deutsch (DTM04-3P) E Cable Harness, 1 Meter²

F Cable Harness, 2 Meter²

G Cable Harness, 3 Meter^{2,3}

H Cable Harness, 5 Meter^{2,3}

Connector: Deutsch DTM04-3P Mating Connector: DTM06-3S IP Rating¹: IP65, IP67, IP69K (absolute,


sealed gage versions), IP65 (vented gage


versions)


Connector: 24 AWG with TPE Jacket Mating Connector: Flying leads

IP Rating¹: IP65, IP67, IP69K (absolute, sealed gage versions)

Pin	Voltage Output	Current Output	Wire Color	Voltage Output	Wire Color	Current Output
1	GND	RTN	red	V+	red	supply
2	Vout	NC	black	GND	blook	DTN
3	V+	supply	white	Vout	black	RTN

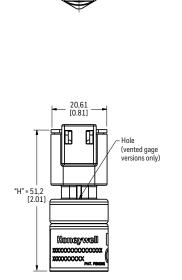

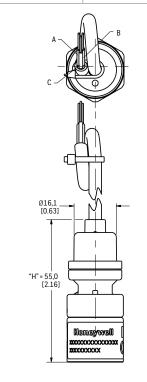

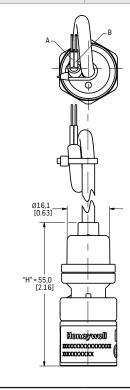

¹ IP rating is determined by the electrical connector type chosen.


 $^{^2}$ Three-wire cable is required for ratiometric and regulated outputs; two wire cable is required for current output.

³ Three meter and five meter cables are only available with Output Transfer Function **CH** = Current, 4 mA to 20 mA.

Heavy Duty Pressure Transducers

PX2 Series, 1 bar to 70 bar | 100 kPa to 7 MPa | 15 psi to 1000 psi

Figure 6. Pressure Port Type Dimensions (For reference only: mm/[in].)1




F1 7/16-20 UNF 1/4 in 45° Flare Female Schrader (SAE J512)

F2 7/16-20 UNF 45° Flare Male (SAE J513)

Seal: 45° cone

Mating geometry: SAE J512


Installation torque²: 17 N m [12.5 ft-lb]



Seal: 45° cone

Mating geometry: SAE J513

Installation torque²: 1/4 Turn from finger tight




F3 7/16-20 UNF 37° Flare Male (SAE J514)

Seal^{3,4}: 37° cone

Mating Geometry: SAE J514

Installation Torque²: 16 N m [11.8 ft-lb]




G1 G1/4(ISO 1179-3)

Seal^{3,4}: O-ring

Mating geometry: ISO 1179-1

Installation torque²: 50 N m [38.9 ft-lb]




G2 G1/8 (ISO 1179-3)

Seal^{3,4}: O-ring

Mating geometry: ISO 1179-1

Installation torque²: 25 N m [18.4 ft-lb]




M1 M12 X 1.5 (ISO 6149-3)

Seal^{2,3}: O-ring

Mating geometry: ISO 6149-1

Installation torque²: 25 N m [18.4 ft-lb]




N1 1/4-18 NPT

Seal: pipe thread

Mating geometry: ANSI B1.20.1 Installation torque²: 2 to 3 turns

from finger tight




N2 1/8-27 NPT

Seal: pipe thread

Mating geometry: ANSI B1.20.1 Installation torque²: 2 to 3 turns

from finger tight




S1 9/16-18 UNF (SAE J1926-3)

Seal^{3,4}: O-ring

Mating geometry: SAE J1926-1

Installation torque²: 30 N m [22.1 ft-lb]




S2 7/16-20 UNF (SAE J1926-3)

Seal^{3,4}: O-ring

Mating geometry: SAE J1926-1

Installation torque²: 18 N m [12.3 ft-lb]



¹ See CAUTION "PRODUCT DAMAGE DUE TO MECHANICAL ISSUES" on page 5.

 $^{^{2}\,}$ Straight thread maximum torque is validated to 150% of installation torque.

³ Seals for pressure port type order codes **S1**, **S2**, **M1**, **G1** and **G2** are included and assembled to the sensors.

 $^{^4\,}$ O-ring material is nitrile 70 durometer -30°C to 125°C [-22°F to 257°F].

ADDITIONAL INFORMATION

The following associated literature is available on the Honeywell web site at sensing.honeywell.com:

- Product line guide
- Product range guide
- Product installation instructions
- Application notes:
 - Heavy Duty Pressure Transducers, PX2 Series and PX3 Series
 - PX2 Series and PX3 Series Heavy Duty Pressure
 Transducers for Potential Use in Industrial Refrigeration
 - PX2 Series and PX3 Series Heavy Duty Pressure Transducers for Potential Use in Industrial HVAC/R Applications
- Technical notes:
 - Total Error Band Specification for Honeywell Heavy Duty Pressure Transducers, PX2 Series and PX3 Series
 - Media Compatibility for Honeywell Heavy Duty Pressure Transducers, PX2 Series and PX3 Series
- CAD models

Find out more

Honeywell serves its customers through a worldwide network of sales offices and distributors. For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact your local sales office.

To learn more about Honeywell's sensing and switching products, call +1.815.235.6847 or 1.800.537.6945, visit sensing.honeywell.com, or e-mail inquiries to info.sc@honeywell.com

A WARNING PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

▲ WARNINGMISUSE OF DOCUMENTATION

- The information presented in this datasheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

Warranty/Remedy

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

