

How To Gear Oil Change - Stark VARG MX 1.2

Video link: <https://www.youtube.com/watch?v=MzsXAV4Ee1E>

Source video: How To Gear Oil Change - Stark VARG MX 1.2 by Stark Future Official

Scope

This guide converts the official Stark Future tutorial video into a step-by-step workshop procedure. It documents each action shown in the video in sequence and pairs every step with a dedicated screenshot.

Preparation

- Place the bike on a stable stand or work area before starting the procedure.
- Prepare the correct tools for the fasteners, clips, brackets, and components shown in the video.
- Keep removed hardware organized in sequence so reassembly follows the same order as the video.
- Have a torque wrench ready for any tightening steps that specify a torque value.

Procedure

1. Remove the four skid plate screws

Remove the four skid plate screws



2. Carefully remove the skid plate from the battery

Carefully remove the skid plate from the battery.



3. Unscrew the oil drain plug


Unscrew the oil drain plug.

Carefully remove and dispose the copper washer.



4. Place a container underneath to collect the used oil

Place a container underneath to collect the used oil.

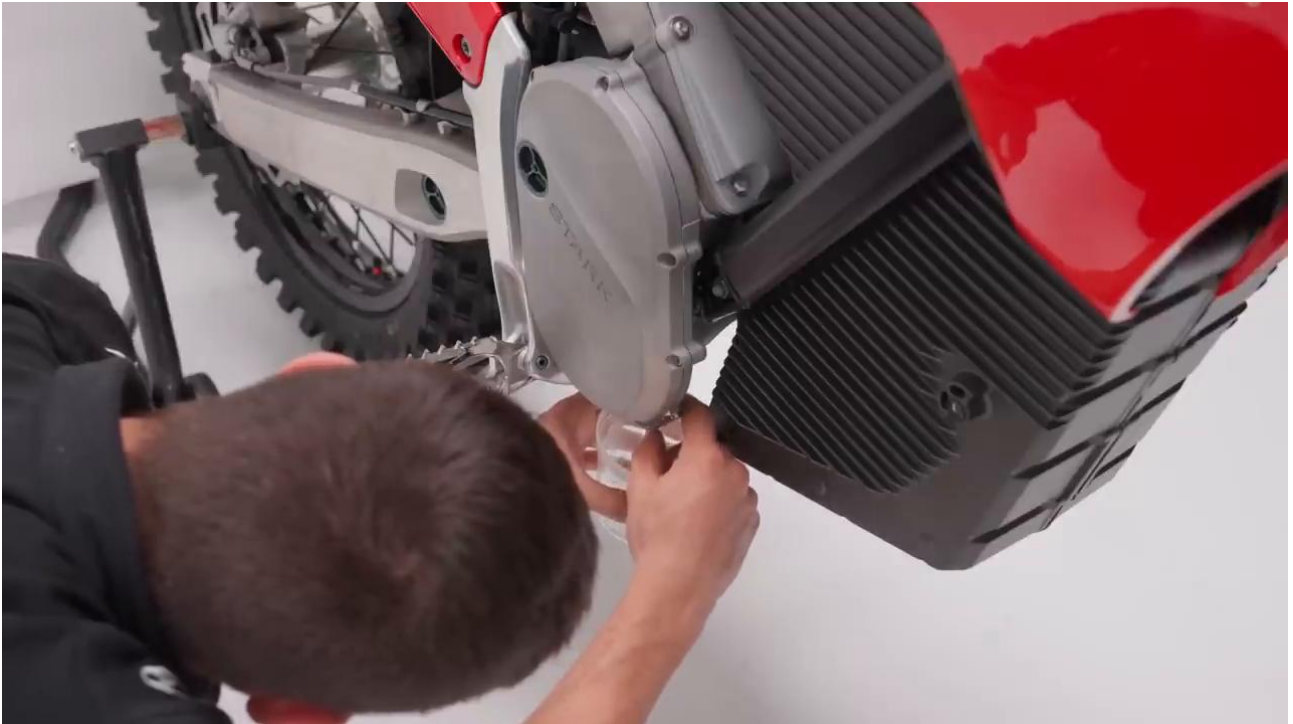

5. Unscrew the motor case side cap

Unscrew the motor case side cap.



6. Place a copper washer on the oil drain plug, then tighten it to 15 Nm

Place a copper washer on the oil drain plug, then tighten it to **15 Nm**.



7. Fill the transmission with 80 ml of SAE 75W-90 oil

Fill the transmission with 80 ml of SAE 75W-90 oil.



8. Tighten the motor case side cap to 5 Nm

Tighten the motor case side cap to **5 Nm**.



9. Place the skid plate into its position

Place the skid plate into its position.



10. Tighten the four skid plate bolts to 15 Nm

Tighten the four skid plate bolts to **15 Nm**.



Torque Summary

Component	Torque
Place a copper washer on the oil drain plug, then tighten it	15 Nm
Tighten the motor case side cap	5 Nm
Tighten the four skid plate bolts	15 Nm

Video-sourced torque items:

- Place a copper washer on the oil drain plug, then tighten it: **15 Nm** from the official Stark tutorial video.
- Tighten the motor case side cap: **5 Nm** from the official Stark tutorial video.
- Tighten the four skid plate bolts: **15 Nm** from the official Stark tutorial video.

Critical Checks Before Riding

- Confirm the serviced component is fully seated and all fasteners are tightened in the correct order.
- Recheck all torque-critical hardware before riding.
- Make sure all routed cables, clips, brackets, and surrounding parts are returned to their original positions.
- Inspect the bike visually for any missing hardware before returning it to service.