

1

2

3

4

5

6

7

8

9

10

11

A

B

C

D

E

F

G

H

NATIVE SOURCE. Power development; safety/PHY/PCB/bench qualification remain OPEN.

01_carrier_interface

01_carrier_interface.kicad_sch

10_input_protection

10_input_protection.kicad_sch

20_positive_rails

20_positive_rails.kicad_sch

30_negative_reference

30_negative_reference.kicad_sch

40_power_supervision

40_power_supervision.kicad_sch

03_peripheral_boundaries

03_peripheral_boundaries.kicad_sch

04_dac_0_3

04_dac_0_3.kicad_sch

05_dac_4_7

05_dac_4_7.kicad_sch

06_analog_outputs

06_analog_outputs.kicad_sch

41_power_status



41_power_status.kicad_sch

Sheet: /
File: servohl_io_revB.kicad_sch

Title: ServoHIL Rev.B – native editable single–SoC expansion

Size: A2Date:KICad E.D.A. 10.0.6

Rev: B–power–developmentId: 1/11

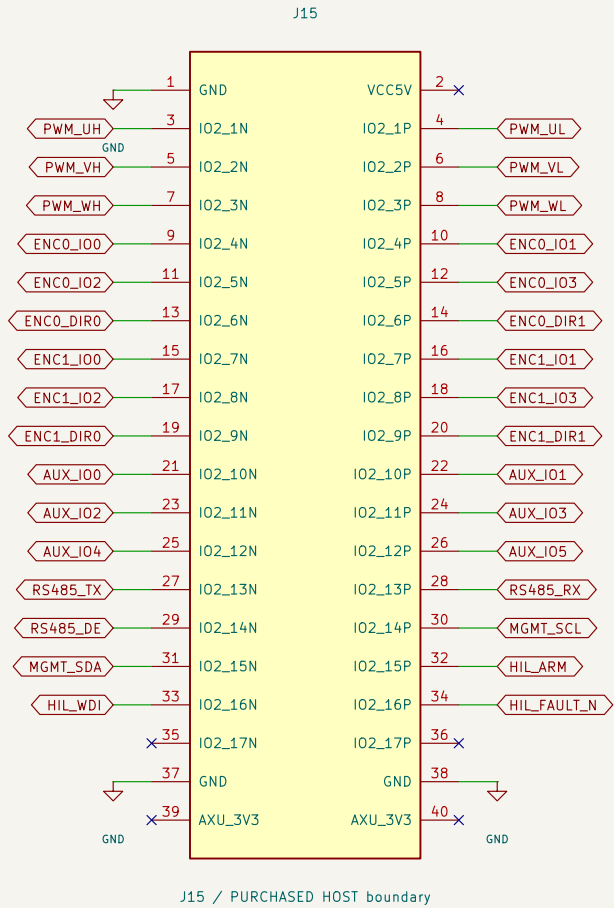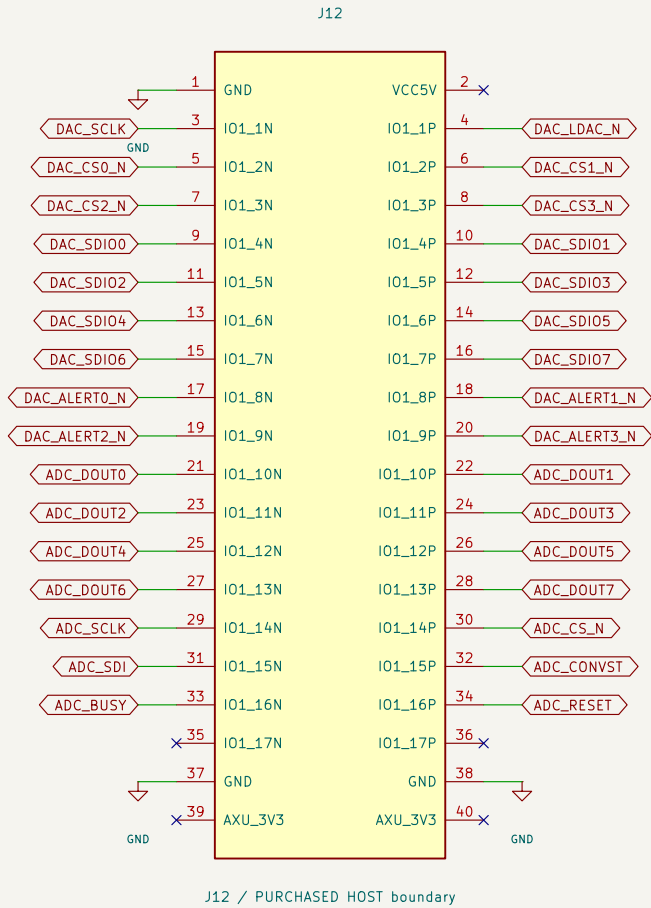

Connector power contacts remain NC. 64 assigned GPIO; unused GPIO also NC. No secondary compute chip.

J12 and J15 are ORIGINAL AXU2CGB interfaces, not AXU2CGB-I or -E. No board-power backfeed through contacts.

Signal-pin backfeed, output enable and bank power sequencing STILL REQUIRE electrical review.

NON-RELEASE: physical power, safety, timing and package reviews remain open

magic-att/servoHIL

Sheet: /01_carrier_interface/

File: 01_carrier_interface.kicad_sch

Title: 01 carrier interface


Size: A3

Date:



Rev: B-review

KiCad E.D.A. 10.0.6

Id: 2/11

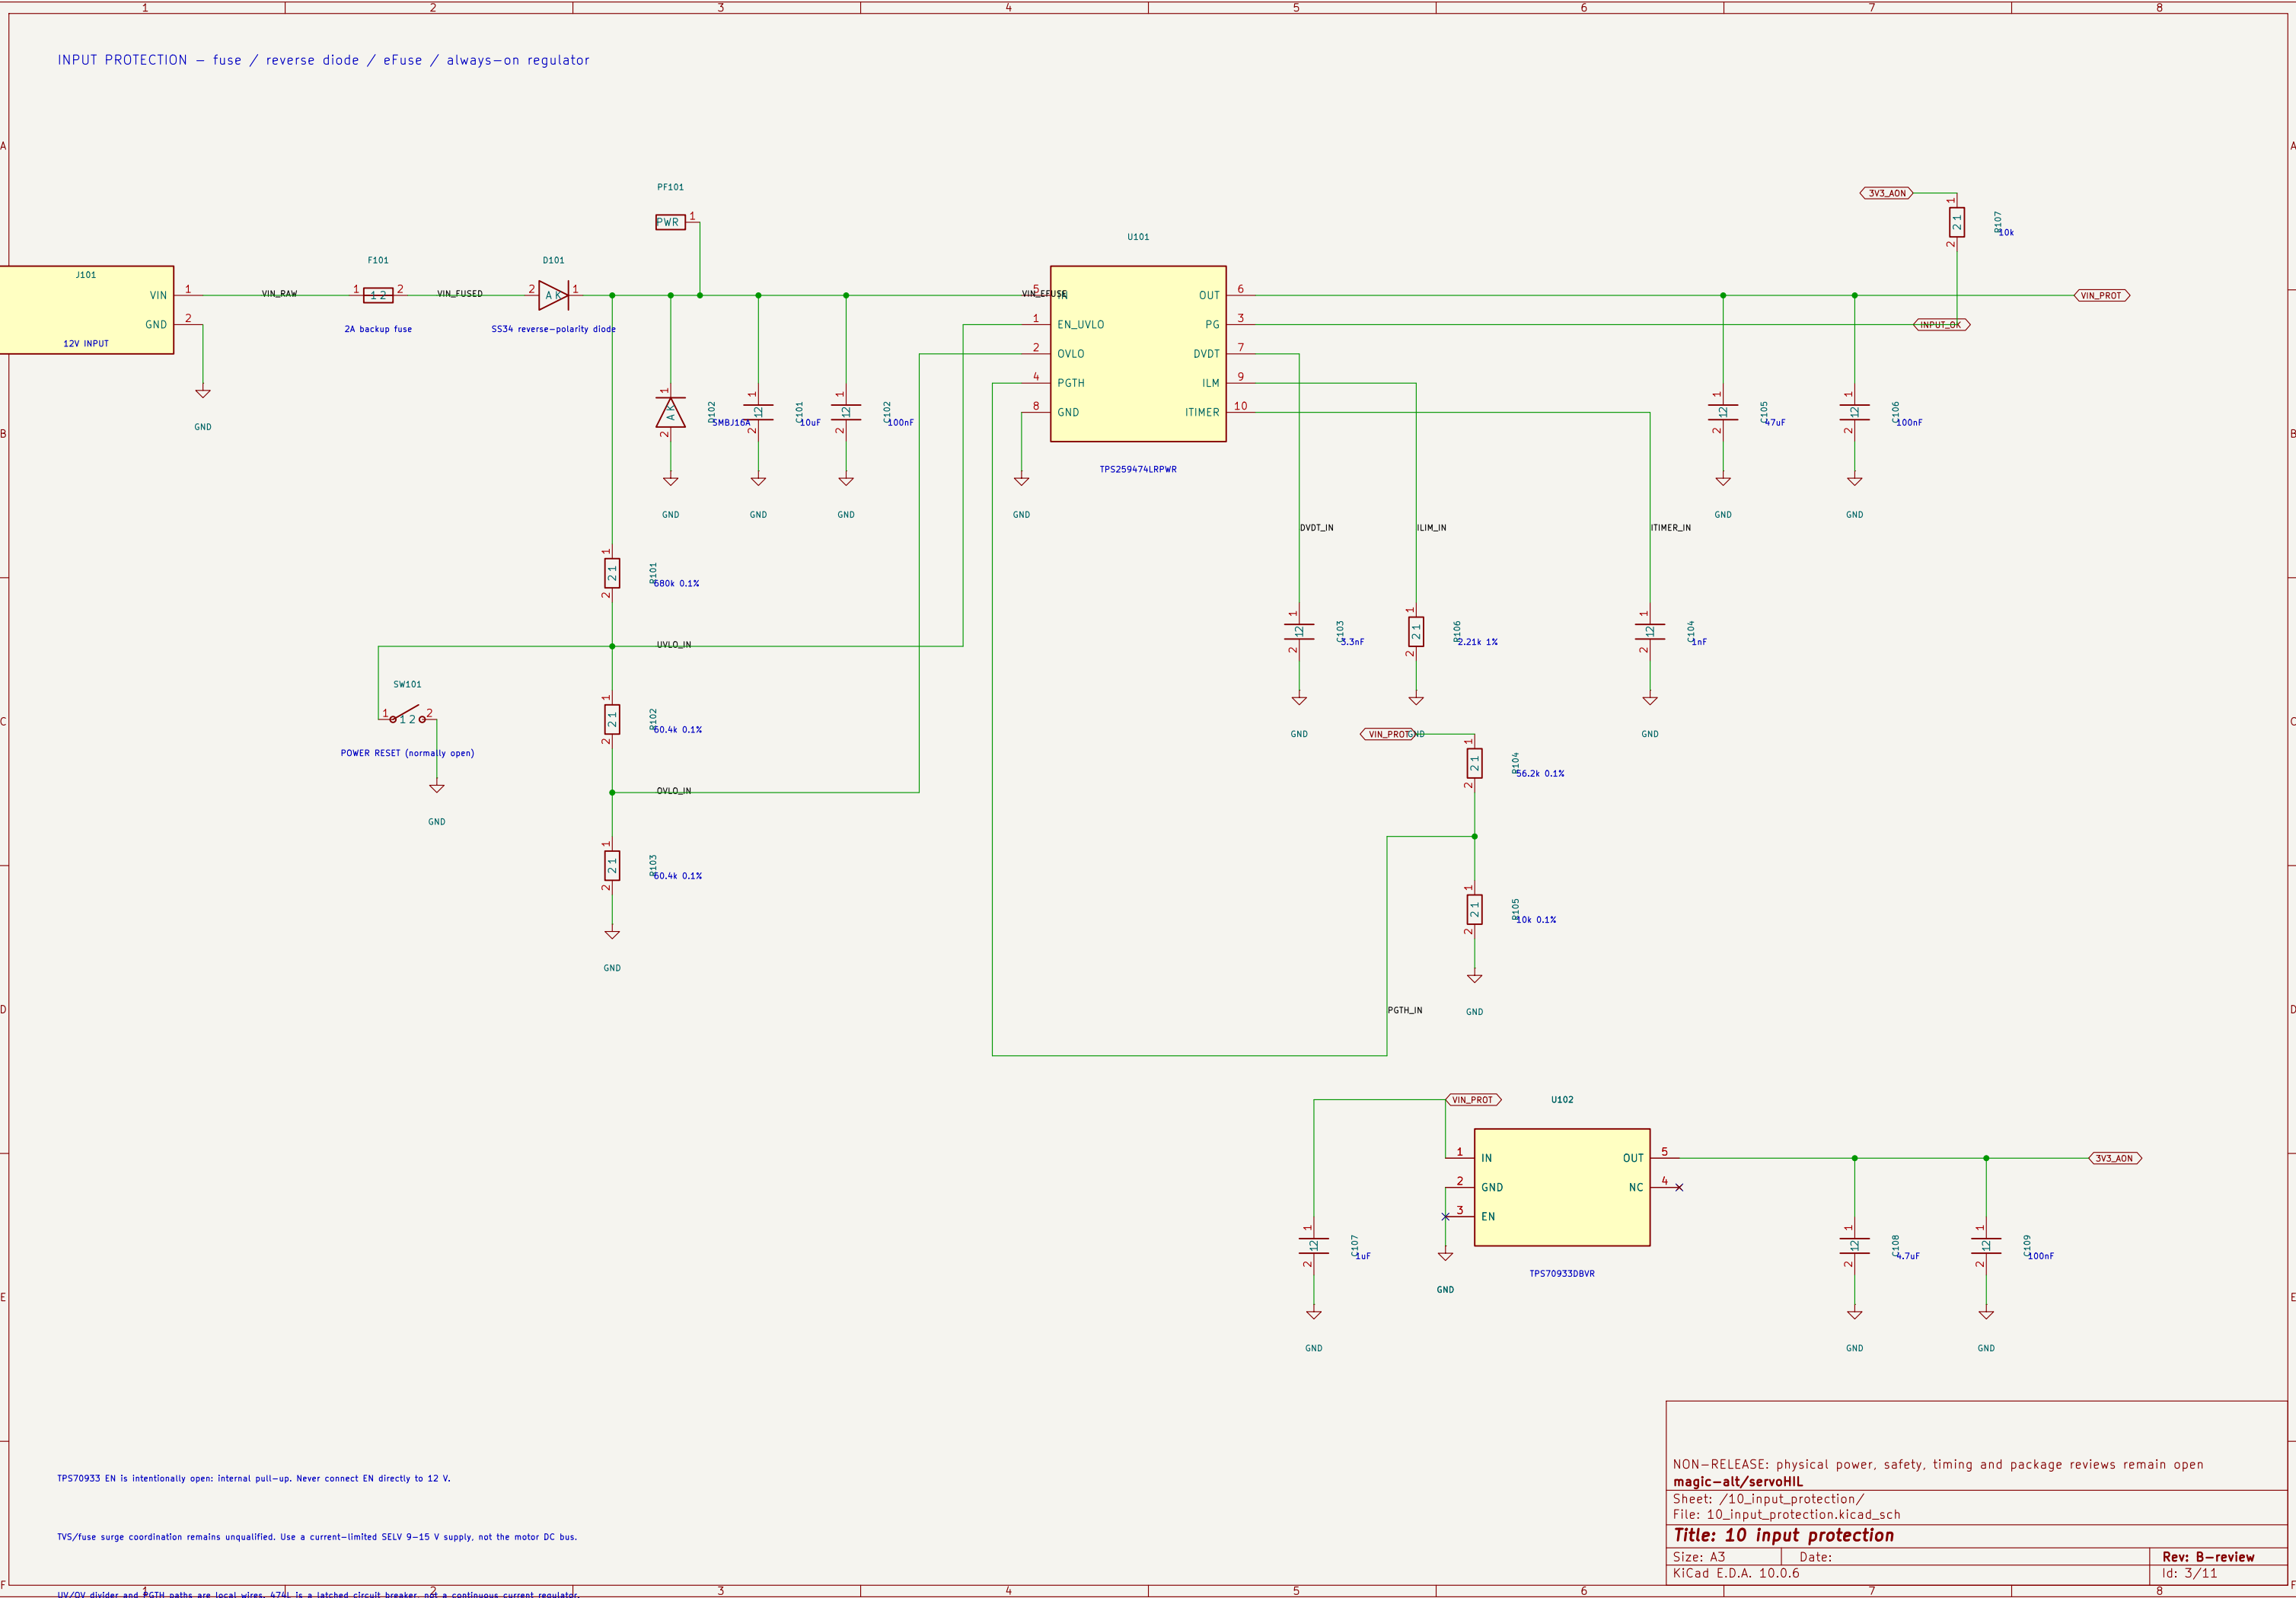

POSITIVE RAILS – direct power path, local feedback, cross-sheet interfaces only

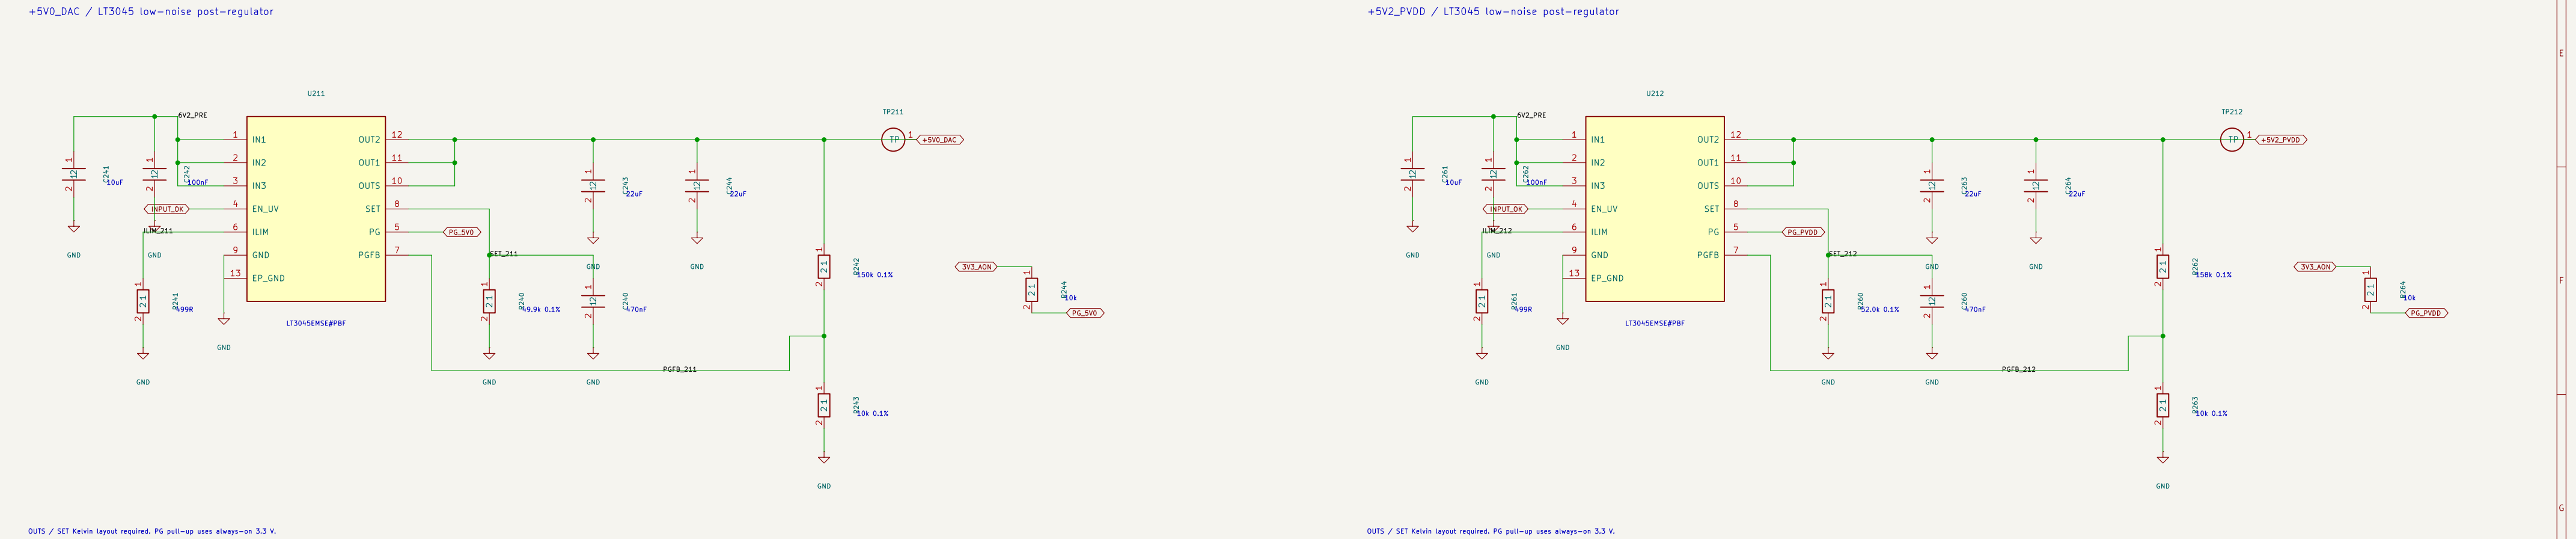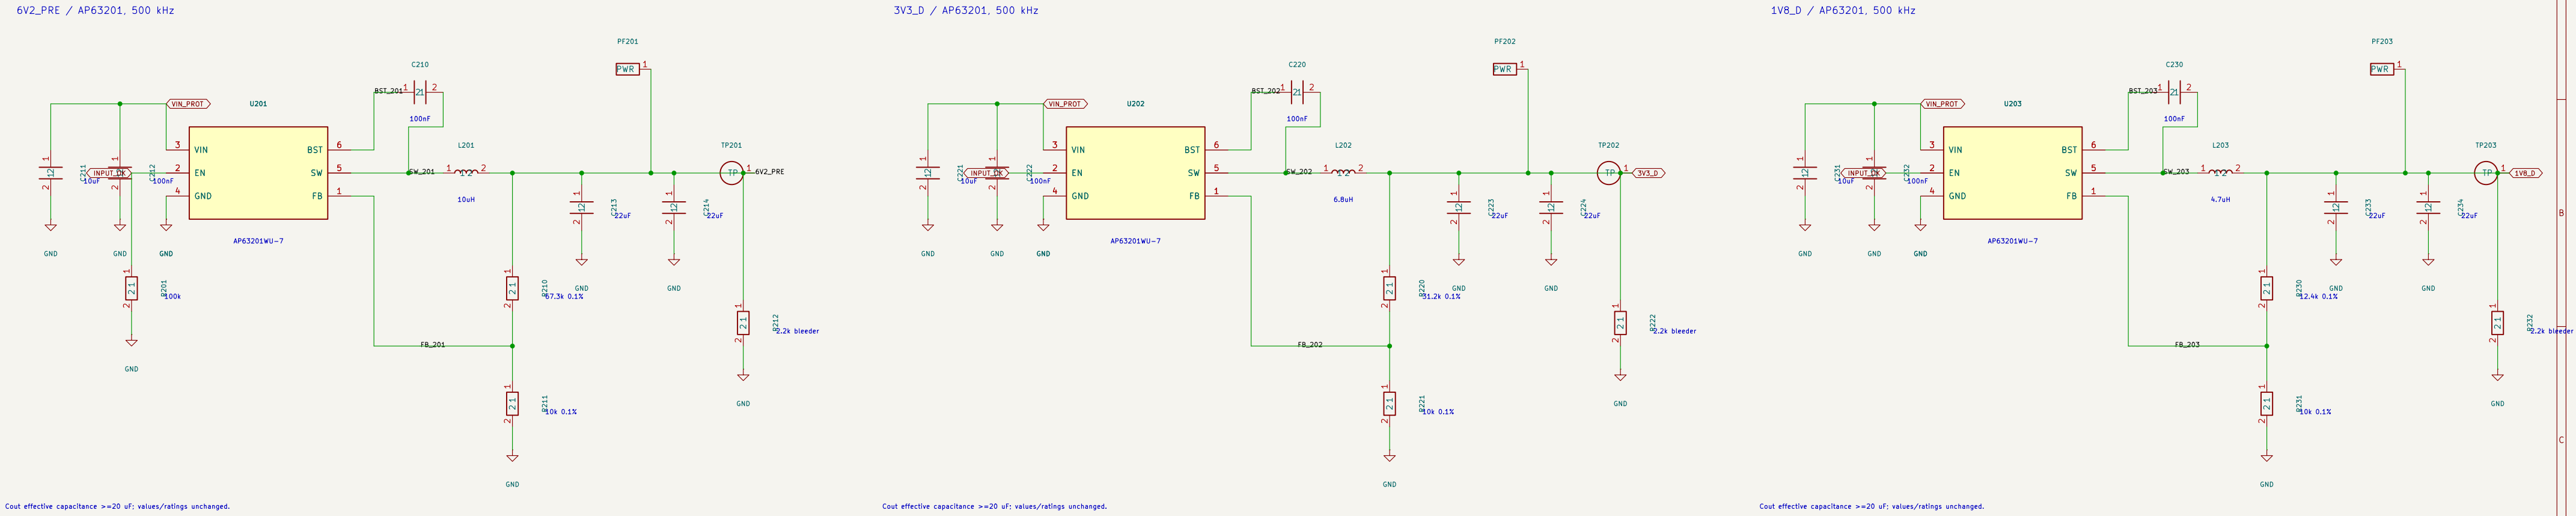

All parts, pin numbers, values and footprints match the previous native circuit. These drawings do not establish bench qualification.

No second FPGA. Output current, capacitor DC bias, startup, ripple, thermal and safety behavior remain hardware review gates.

NON-RELEASE: physical power, safety, timing and package reviews remain open

magic-alt/servoHIL

Sheet: /20_positive_rails/

File: 20_positive_rails.kicad_sch

Title: 20 positive rails

Size: A2


Date:

Rev: B-review

KiCad E.D.A. 10.0.6



Id: 4/11

NEGATIVE RAIL / REFERENCE – wired Cuk converter, LT3094 and ADR4525

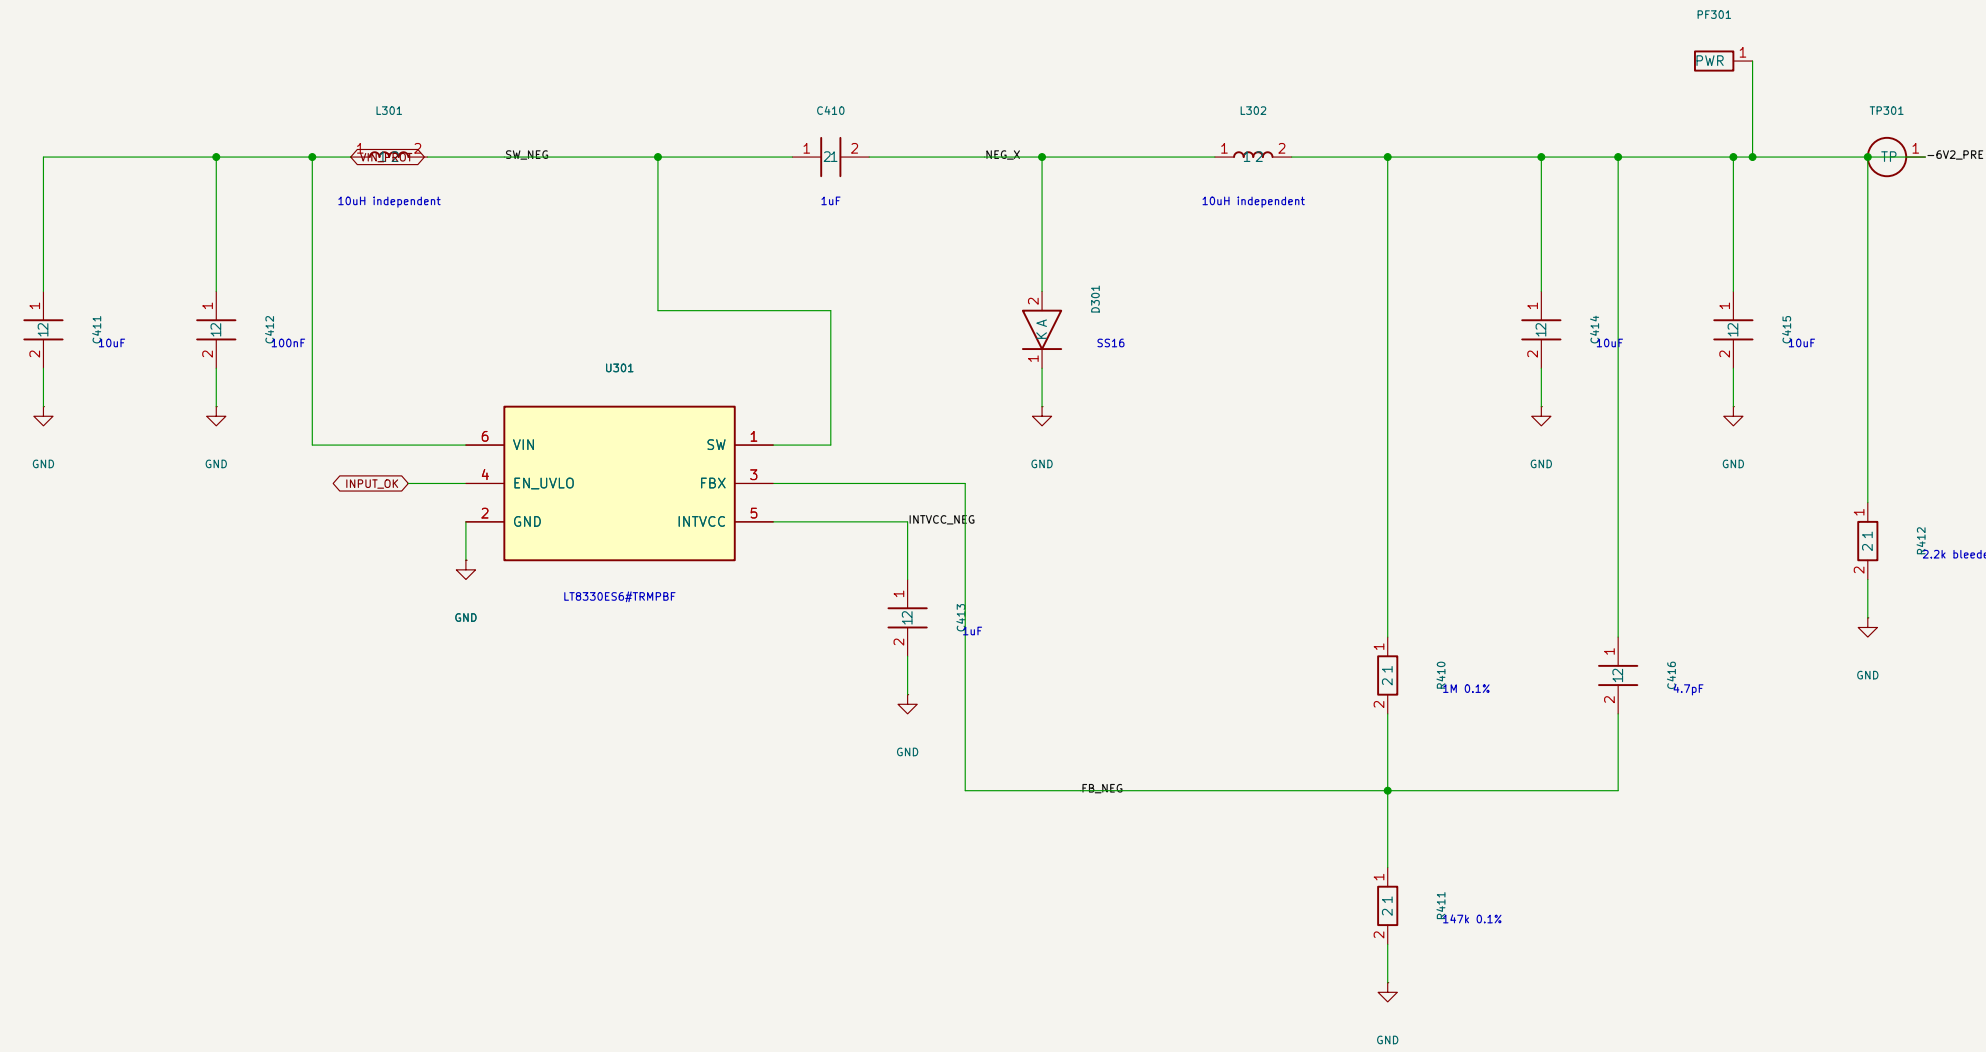

Cuk current path: VIN -> L301 -> C410 -> L302 -> negative output. D301 cathode is grounded.

Independent inductors; transfer capacitor sees $V_{IN} + |V_{OUT}|$. Existing component values are preserved.

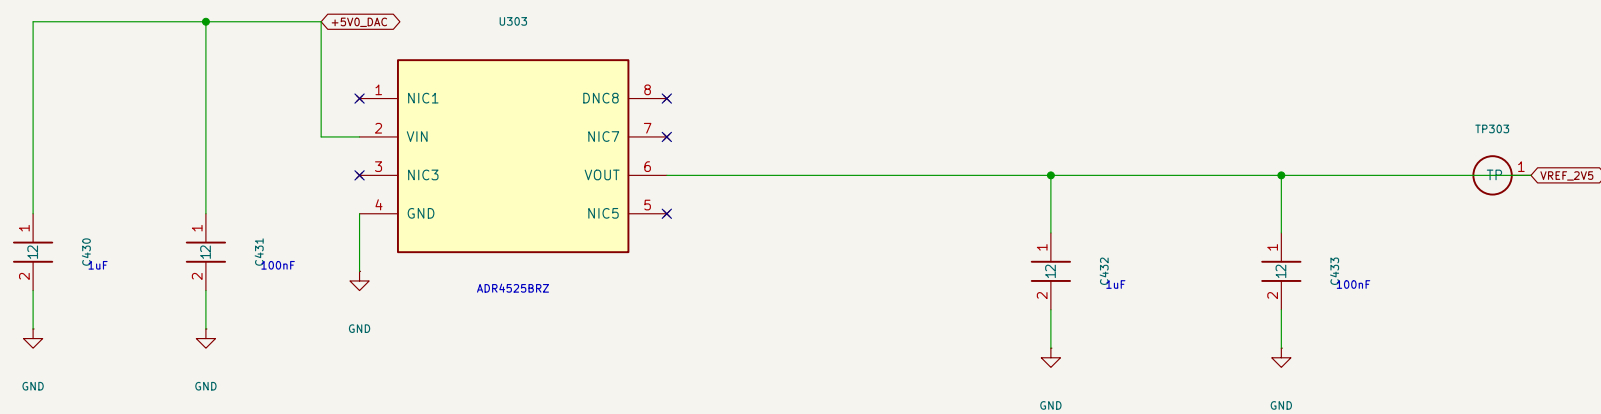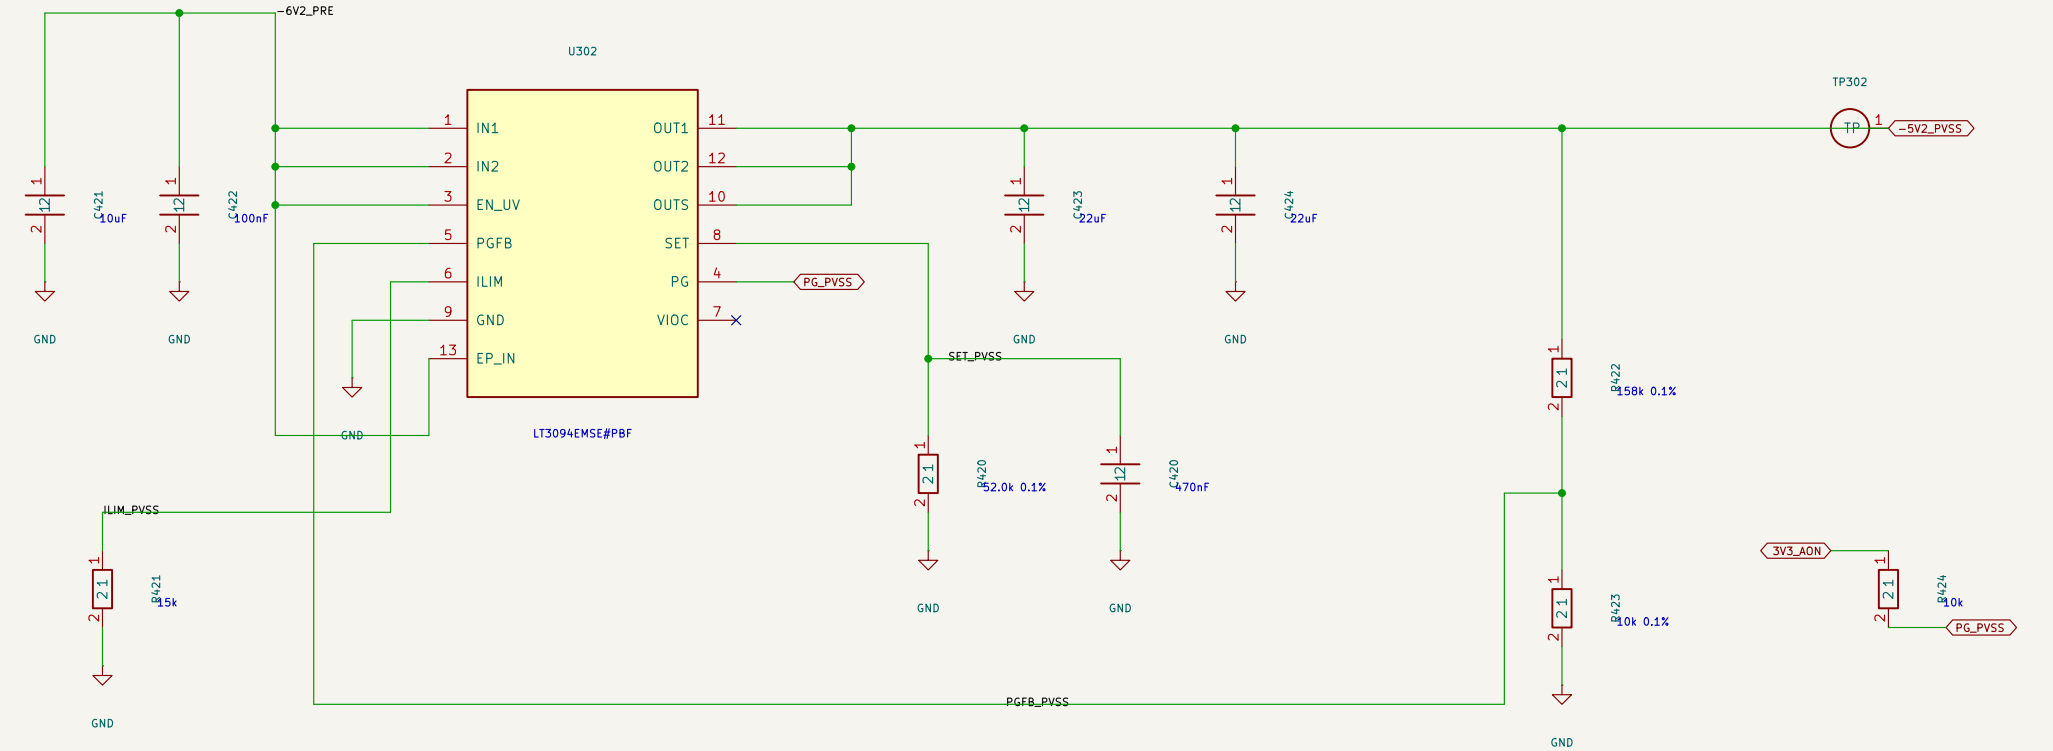


LT3094 EP13 / EN3 connect to negative IN. OUTS/SET require Kelvin layout. No startup/ripple/thermal PASS is implied.


ADR4525: unused NIC/DNC pads remain NC. DAC external—reference configuration and actual fanout/load require validation.

POWER QUALIFICATION – rail monitors, negative sense, deliberate re–arm and reset driver


1V8_D rail supervision

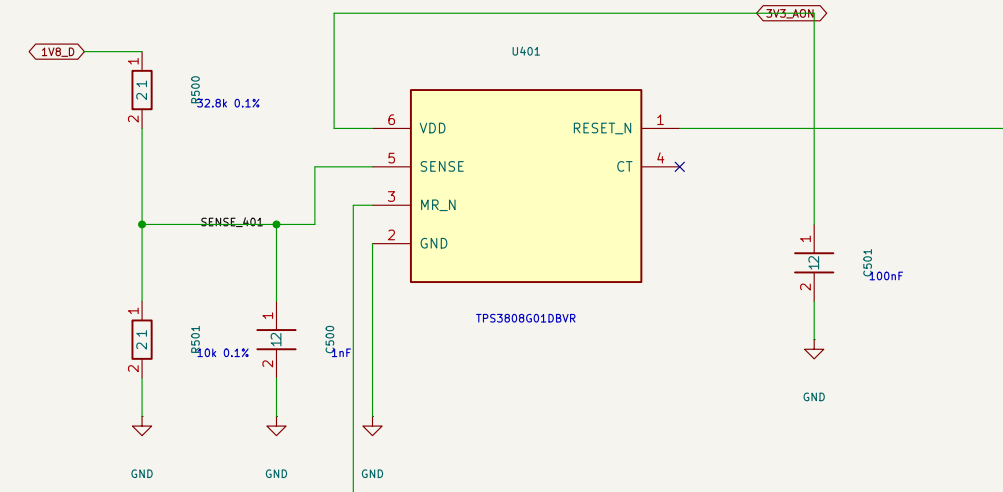


3V3_D rail supervision

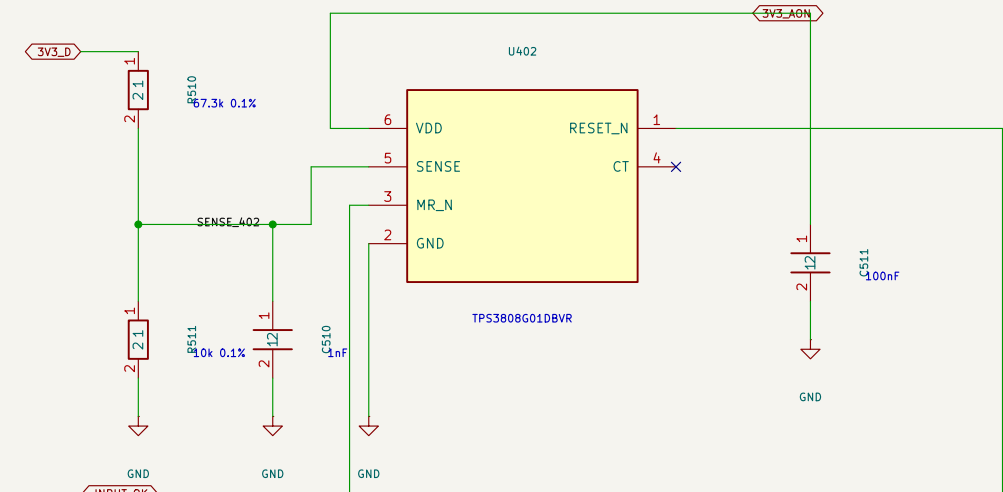


VREF_2V5 rail supervision

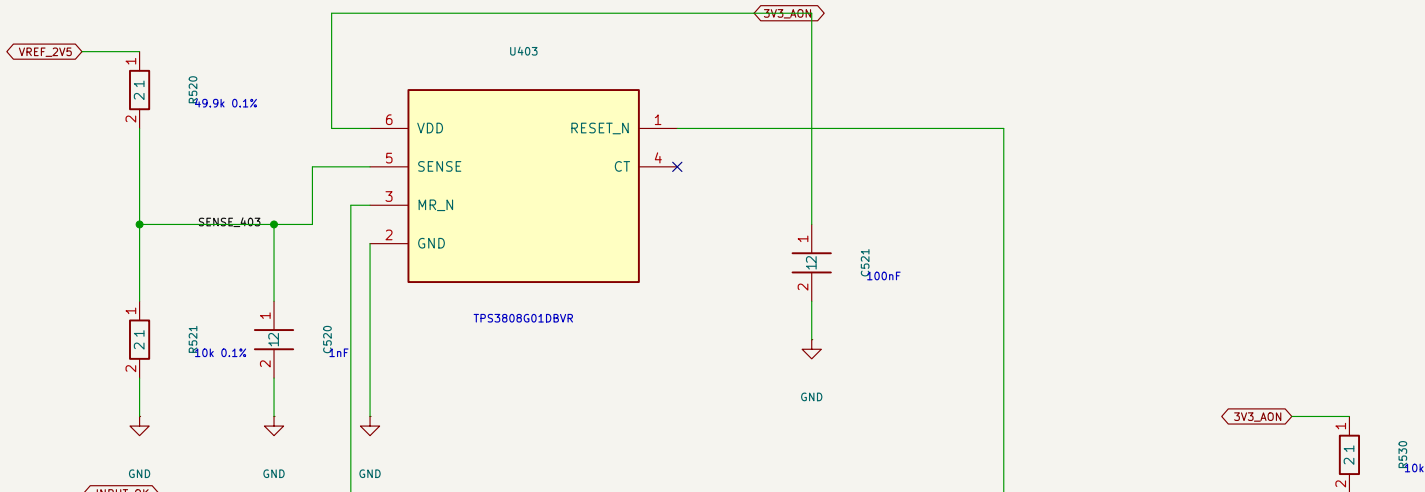


PVSS independent sense / hysteresis

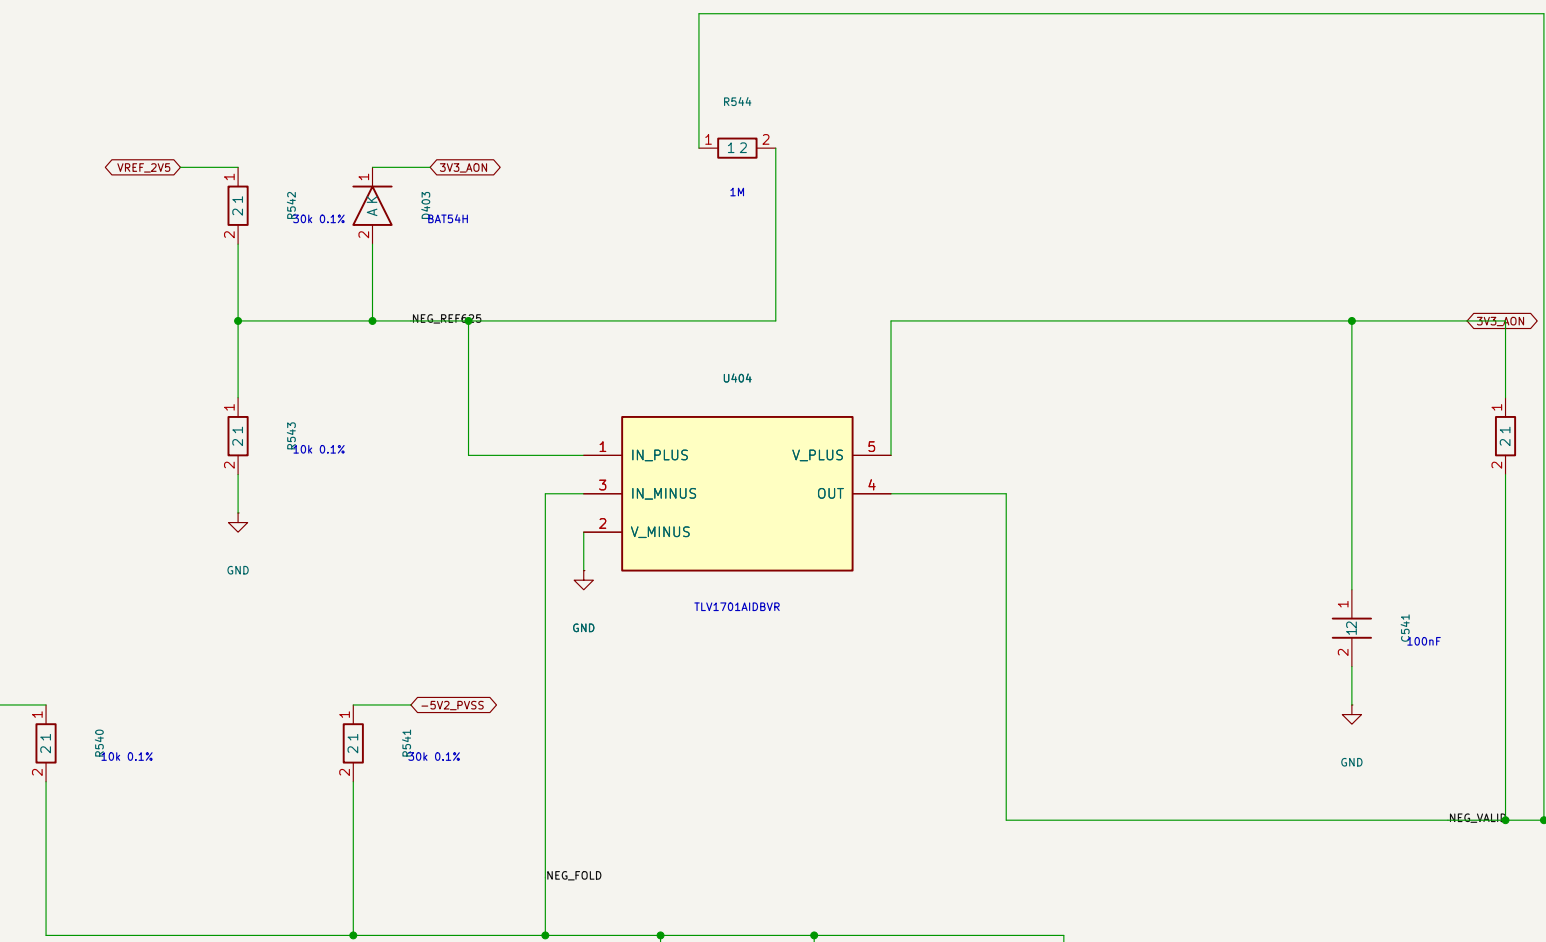

Supply qualification

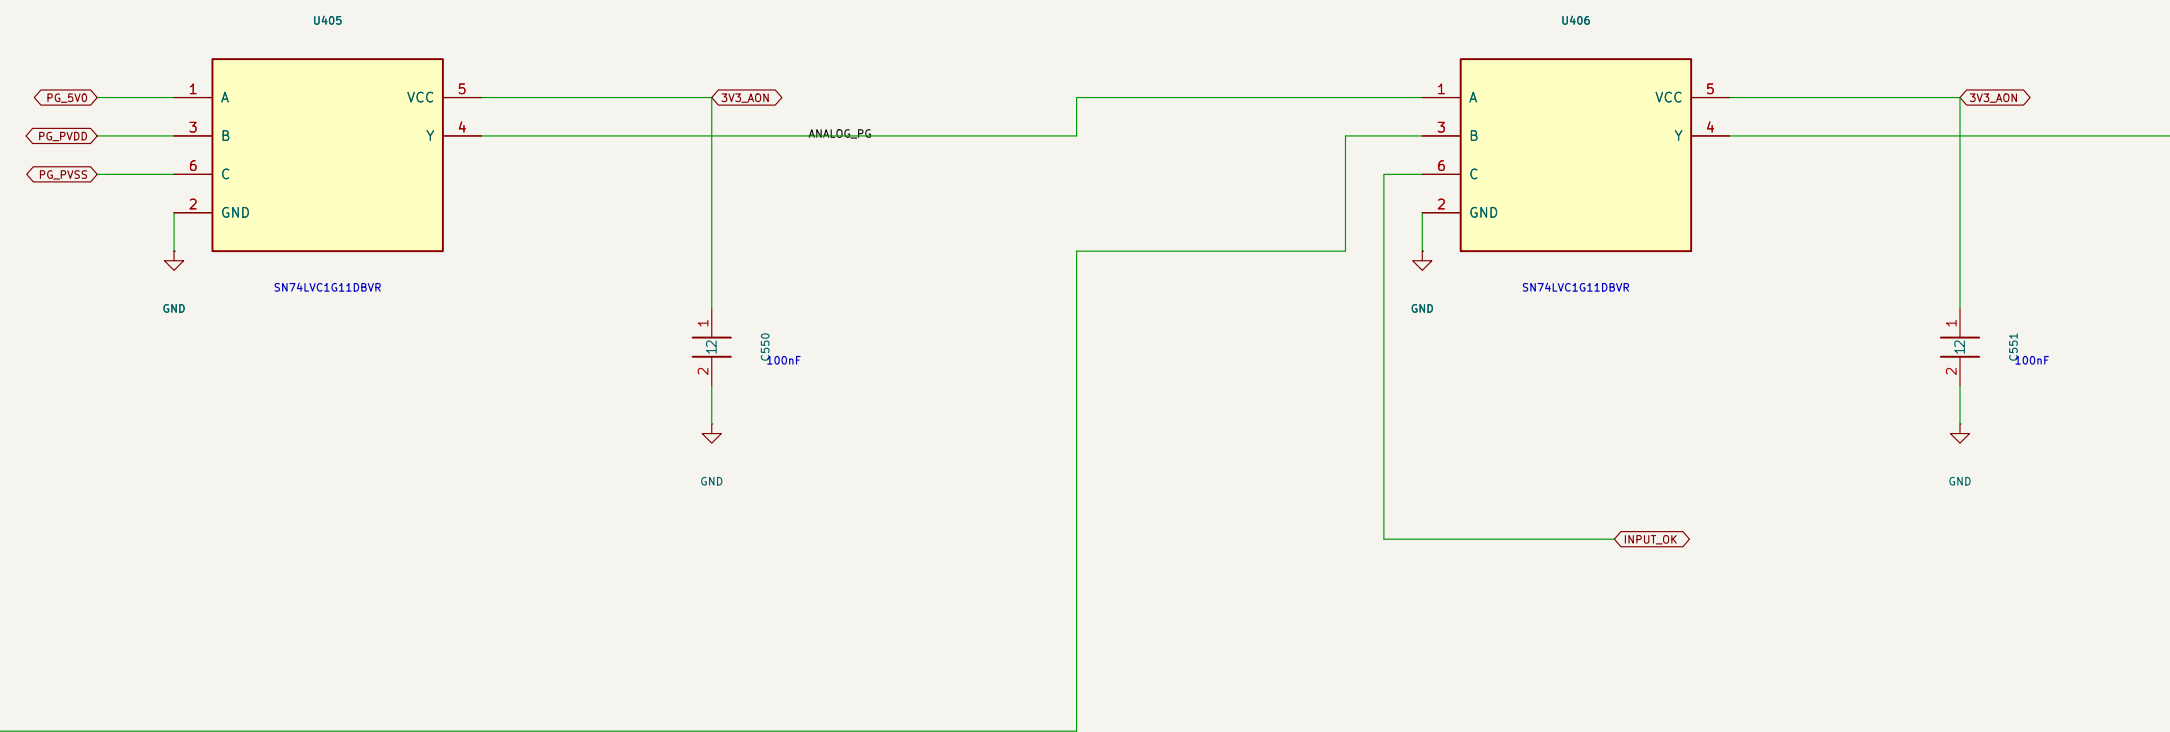

Re–arm latch / immediate disarm


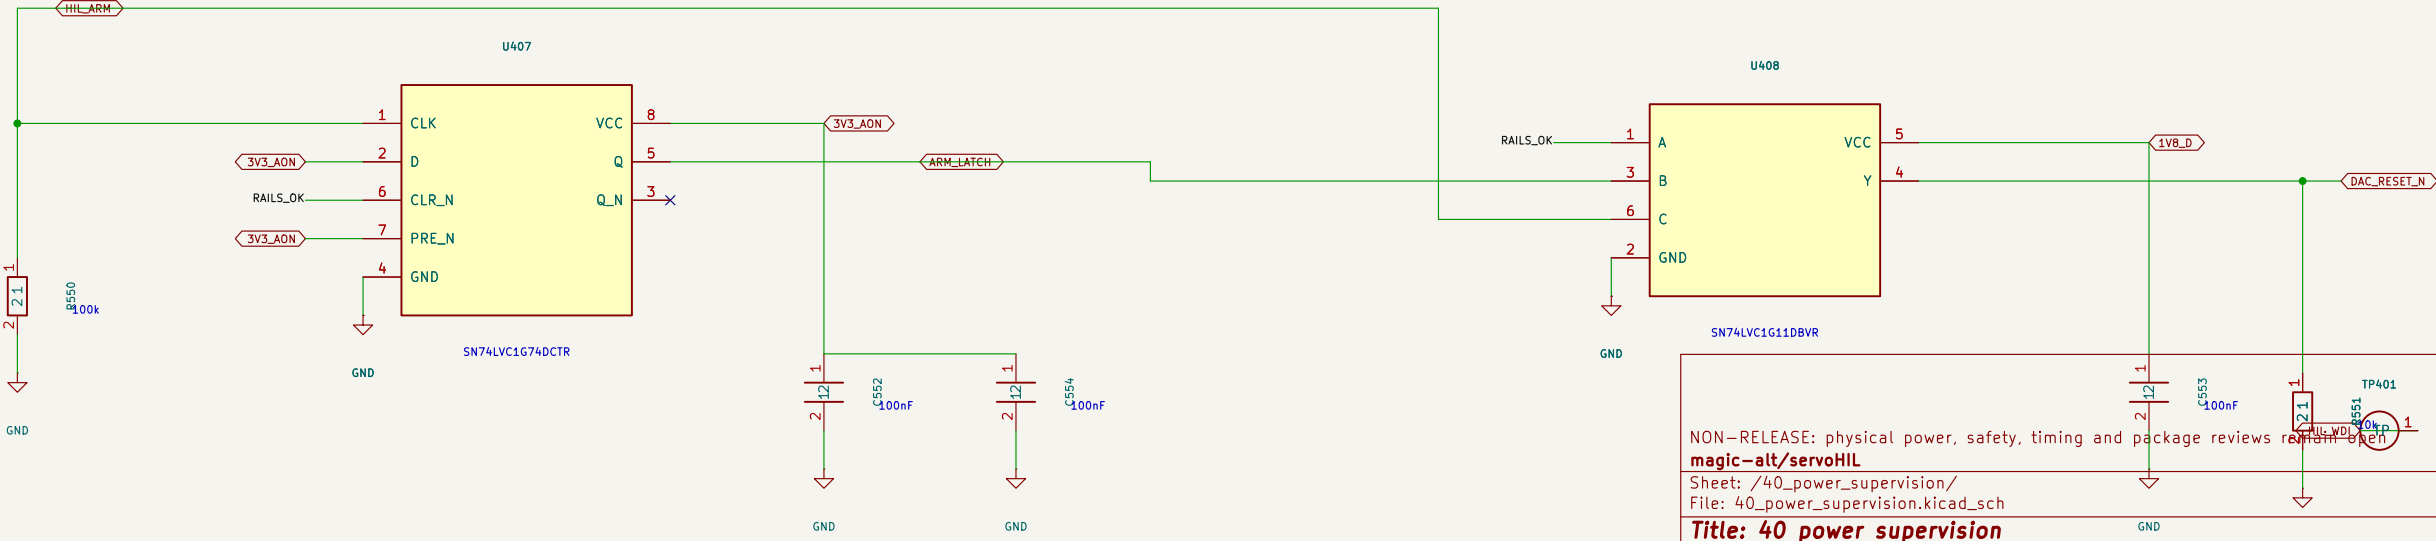


TPA01_HIL_WDI is a reserved Input. NOT a watchdog. Complete heartbeat, AO disconnect and DUT gate inhibit remain OPEN.

Power fault clears the latch: a fresh ARM edge is required. HIL_ARM LOW immediately holds DAC reset asserted. Hardware validation remains pending.

NON–RELEASE: physical power, safety, timing and package reviews remain pending.
magic–alt/servoHIL
Sheet: /40_power_supervision/
File: 40_power_supervision.kicad_sch
Title: 40 power supervision
Size: A2 Date: Rev: B–review
KiCad E.D.A. 10.0.6 Id: 6/11

03 – ADC and digital PHY integration interfaces (reserved)

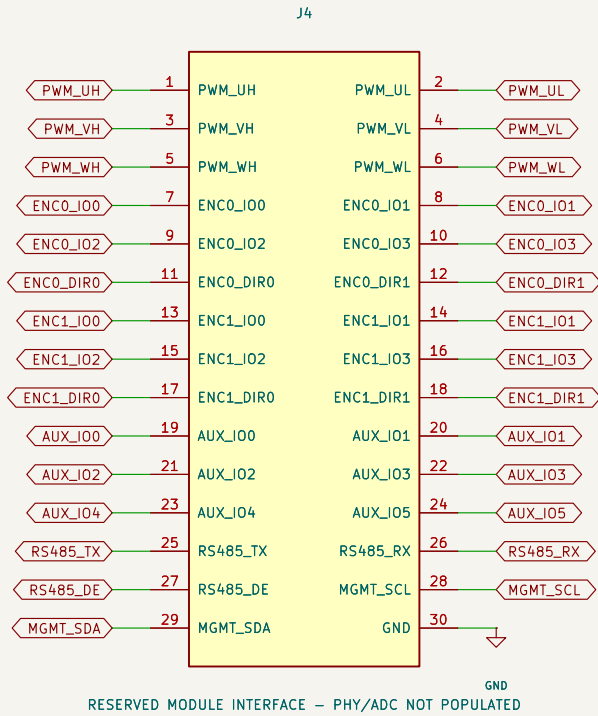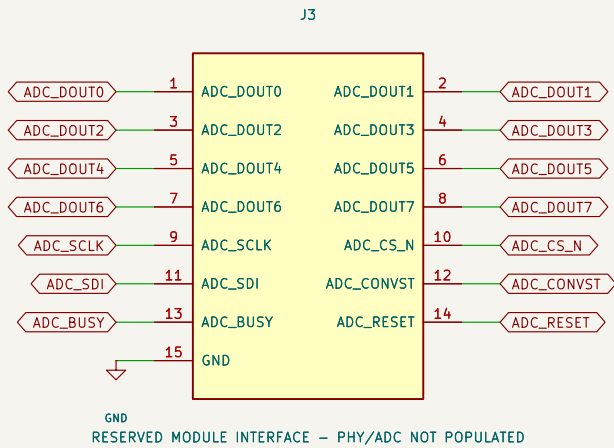

Eight AI channels are an interface reservation. No 1 MSPS verification is implied; 1.8V serial timing must be closed.

Each encoder uses one selected profile; ABZ/SSI/BISS/SPI are NOT simultaneously independent ports.

NON–RELEASE: physical power, safety, timing and package reviews remain open

magic–alt/servoHIL

Sheet: /03_peripheral_boundaries/

File: 03_peripheral_boundaries.kicad_sch

Title: 03 peripheral boundaries

Size: A3


Date:

Rev: B–review

KiCad E.D.A. 10.0.6

Id: 7/11


DAC – direct RFB2 feedback / CFB / output resistors; independent channels preserved

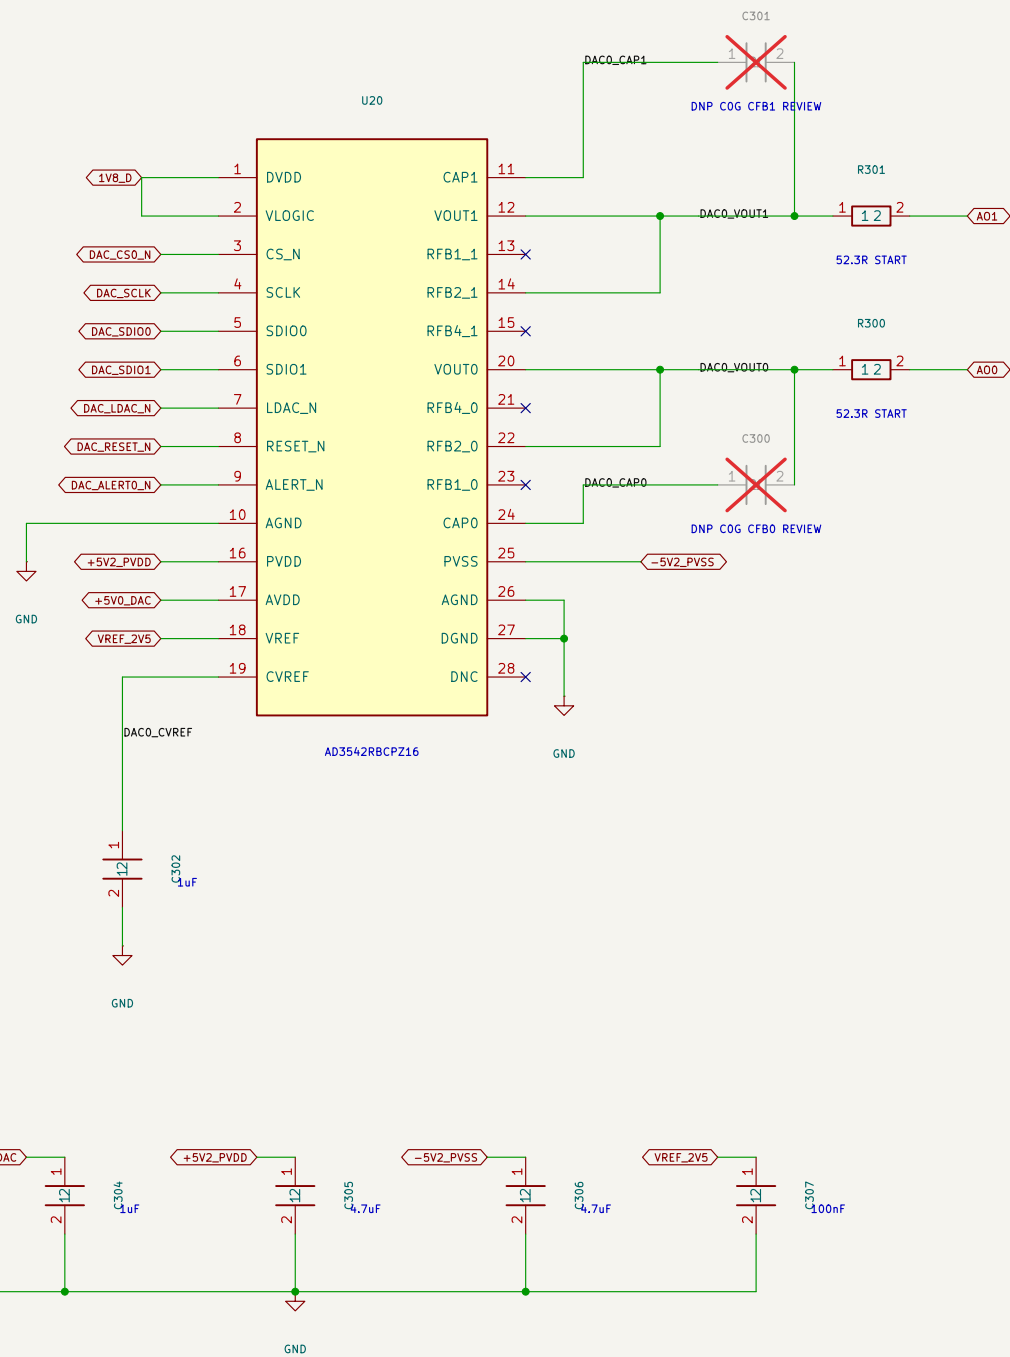

U20: A00 / A01. CFB remains DNP pending analog stability review.

Only inter-sheet signals use global labels. Feedback and output networks are drawn as visible closed local connections.

No electrical component/value change. CFB, output loading, package land pattern and hardware-safe AO behavior remain OPEN.

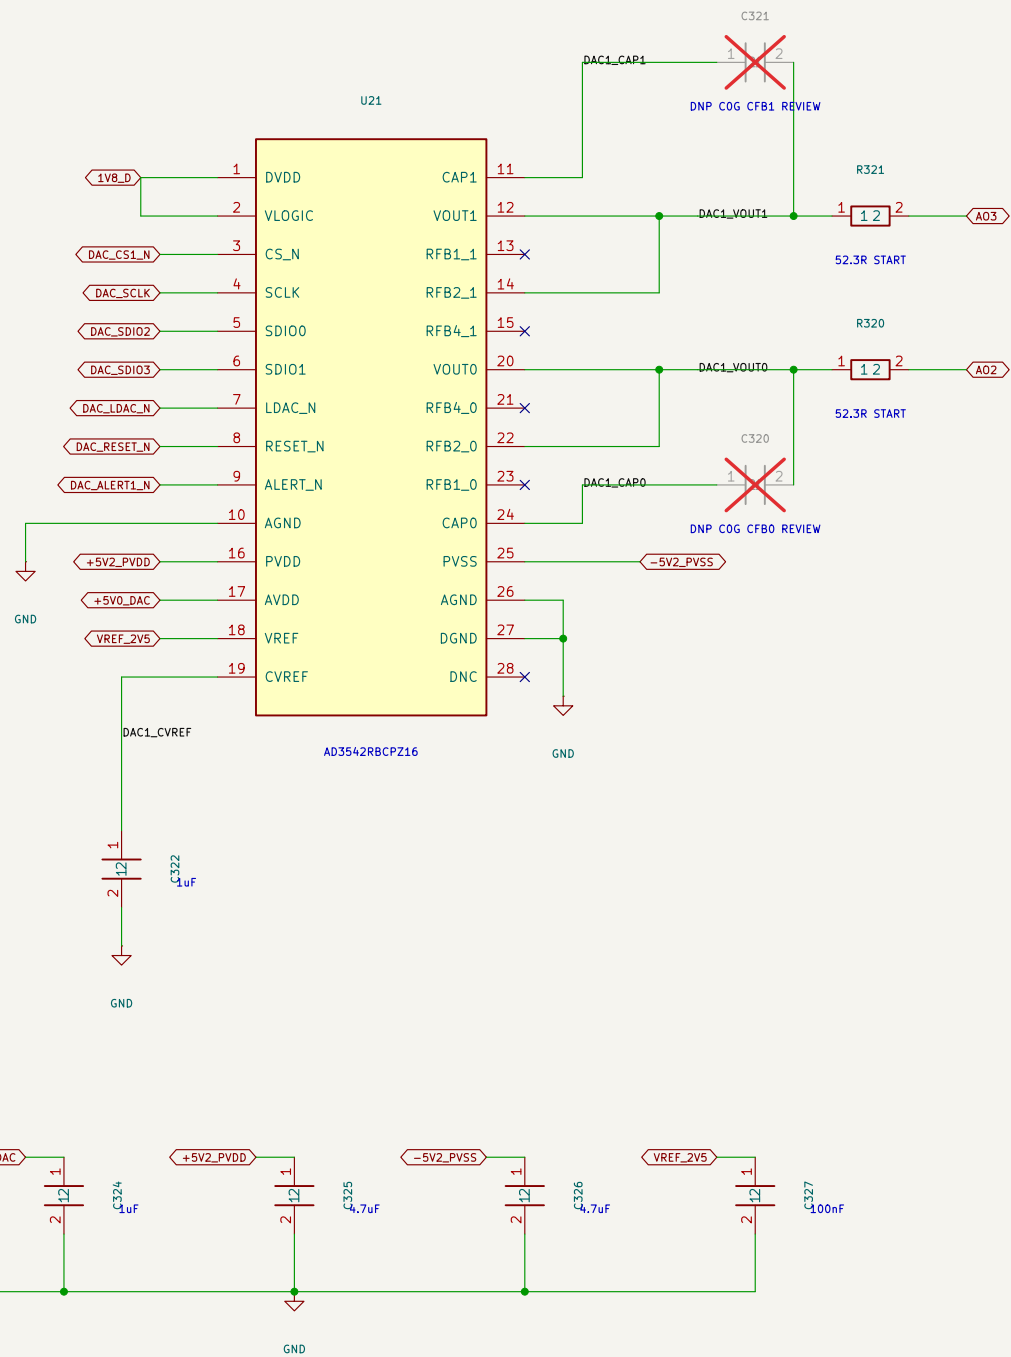

U21: A02 / A03. CFB remains DNP pending analog stability review.

NON-RELEASE: physical power, safety, timing and package reviews remain open

magic-alt/servoHIL

Sheet: /04_dac_0_3/

File: 04_dac_0_3.kicad_sch

Title: 04 dac 0 3

Size: A3


Date:

Rev: B-review

KiCad E.D.A. 10.0.6

Id: 8/11


DAC – direct RFB2 feedback / CFB / output resistors; independent channels preserved

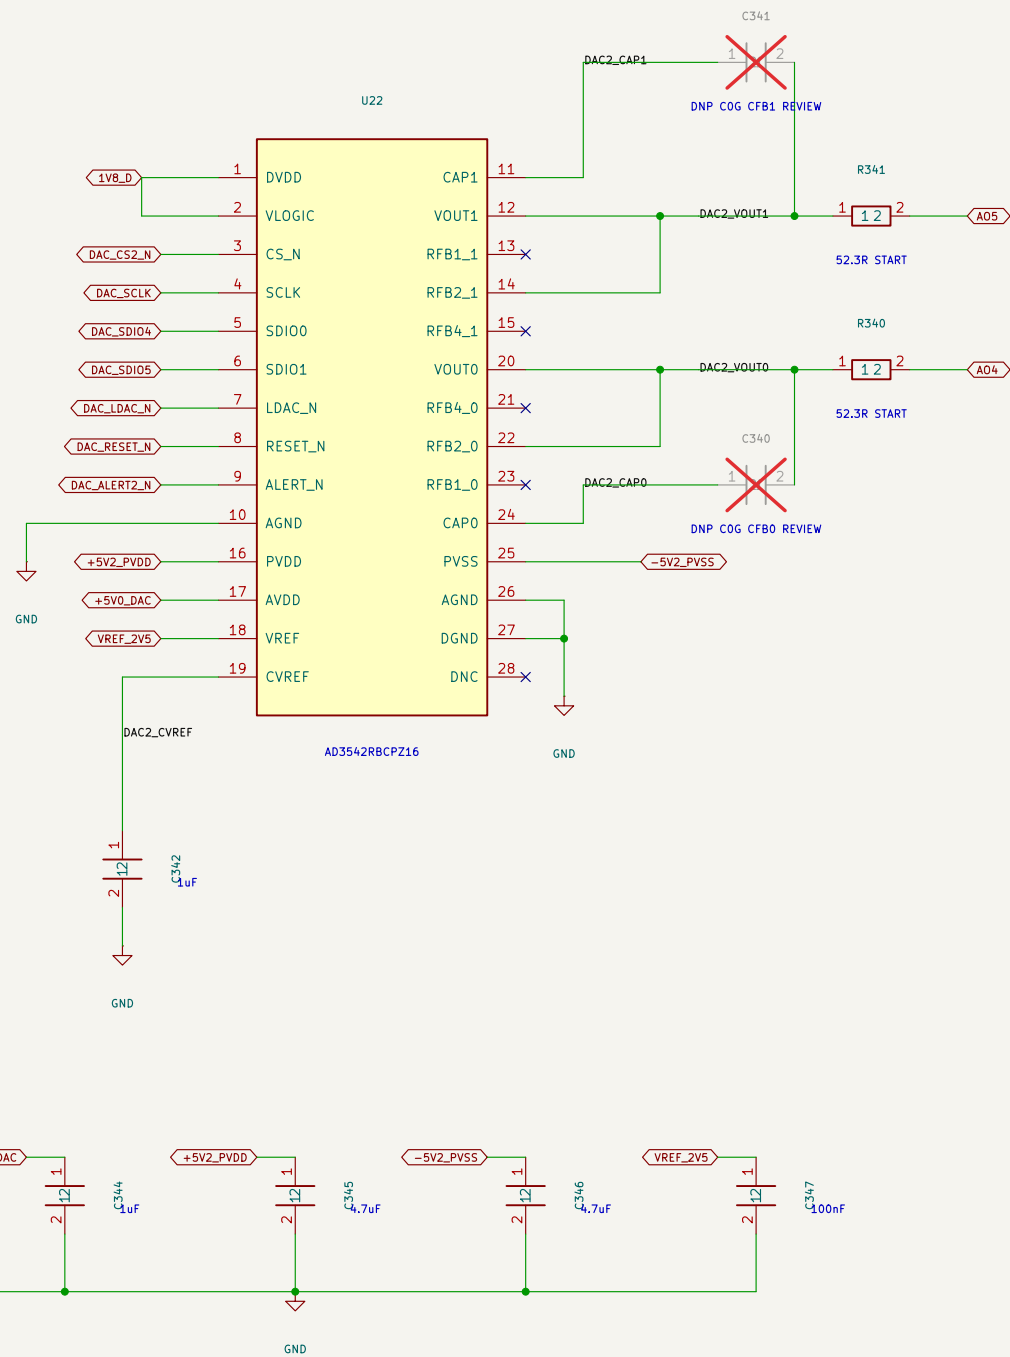

U22: A04 / A05. CFB remains DNP pending analog stability review.

Only inter-sheet signals use global labels. Feedback and output networks are drawn as visible closed local connections.

No electrical component/value change. CFB, output loading, package land pattern and hardware–safe AO behavior remain OPEN.

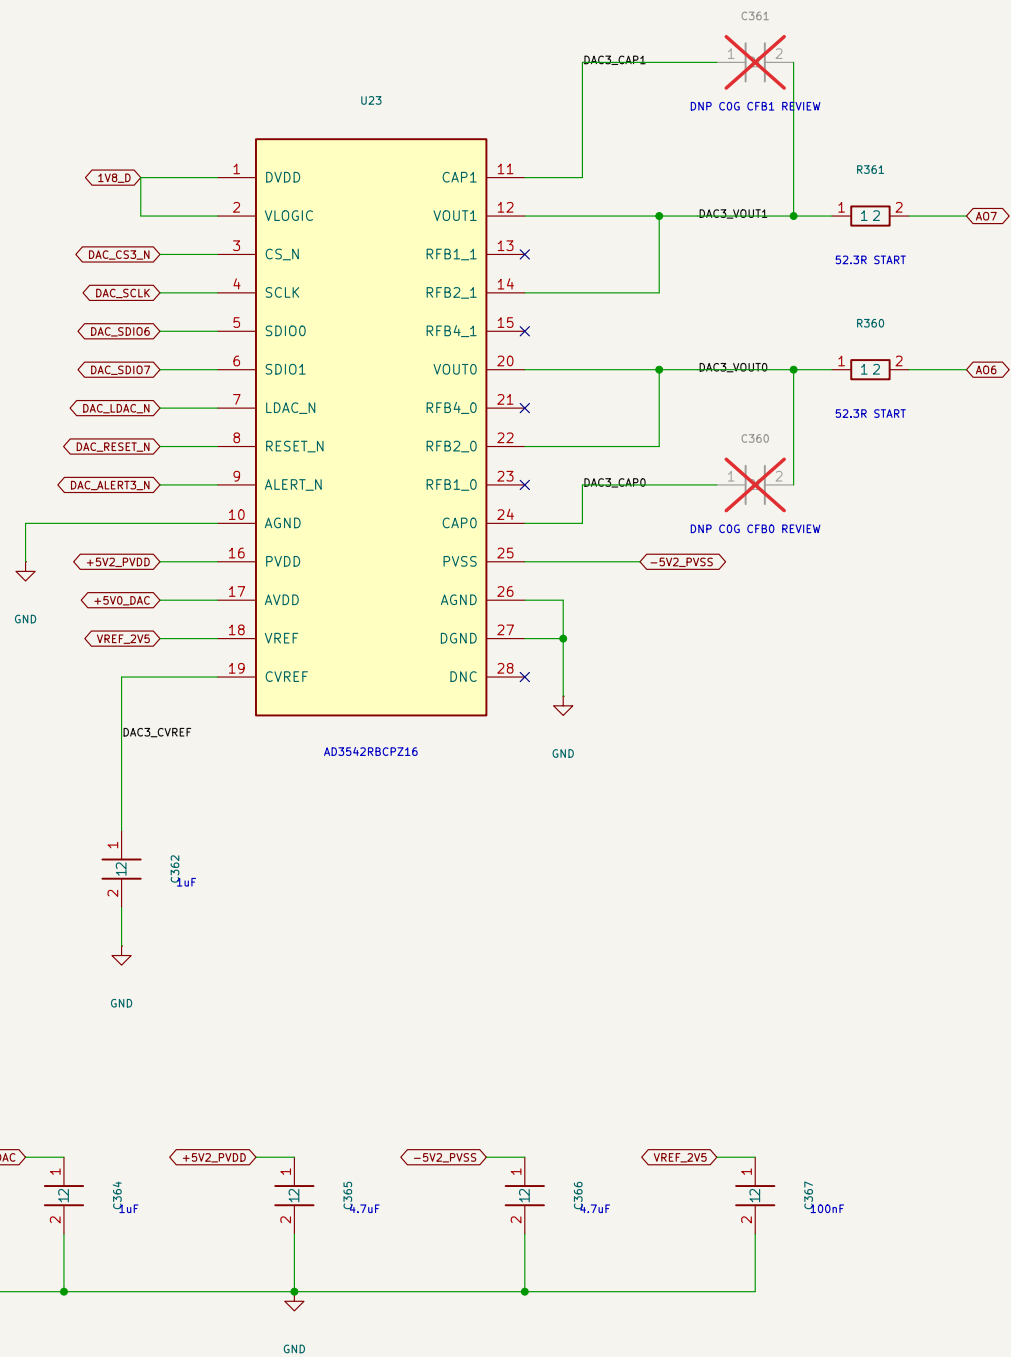

U23: A06 / A07. CFB remains DNP pending analog stability review.

NON–RELEASE: physical power, safety, timing and package reviews remain open

magic–alt/servoHIL

Sheet: /05_dac_4_7/

File: 05_dac_4_7.kicad_sch

Title: 05 dac 4 7

Size: A3


Date:

Rev: B–review

KiCad E.D.A. 10.0.6

Id: 9/11


06 – Eight analog outputs to reviewed DUT adapter

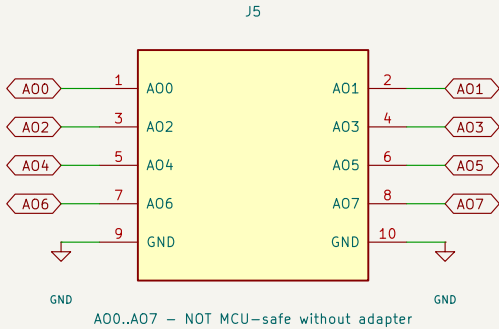

Default metadata: Ia, Ib, Ic, Vbus, torque, temperature, AUX0, AUX1. Electrical channels are equivalent.

DUT adapter supplies scaling/clamping and hardware inhibition. No direct +/-5V connection to MCU ADC.

HOST-REFERENCED POWER STATUS: no expansion-rail pull-up on HIL_FAULT_N

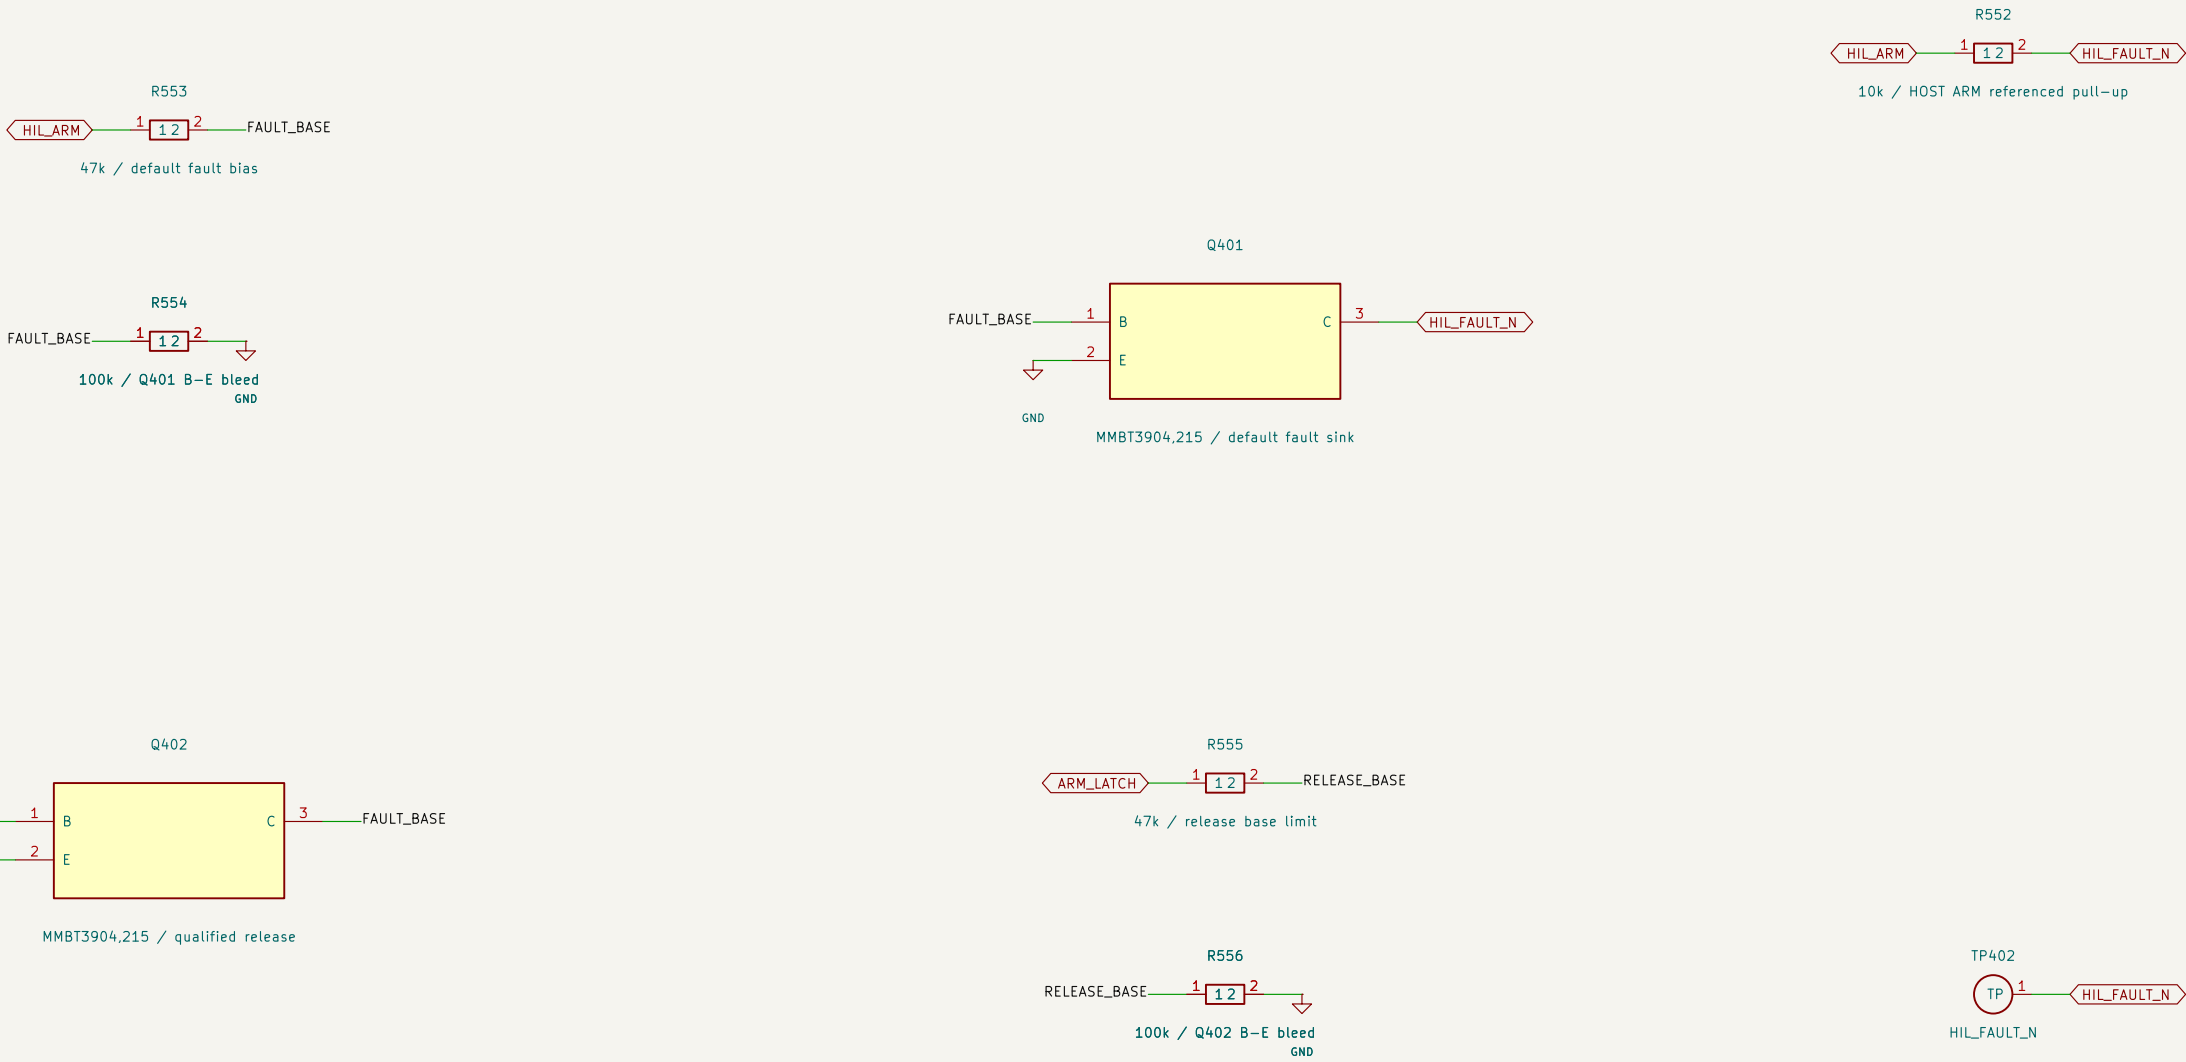

HIL_ARM is generated by the powered HOST, NOT an expansion rail. Q401 defaults ON while HOST requests ARM.

Only a power-qualified ARM_LATCH turns Q402 on and releases Q401. Board power lost -> Q402 off -> Q401 reports fault.

HIL_FAULT_N=HIGH means power-qualified AND armed; LOW also means disarmed. At HOST off, no expansion supply drives this pin high.

Nominal fault sink <0.33mA and HOST ARM total load <0.4mA. Check transient/partial-power behavior physically; not certified safety.

Other direct DAC/ADC pins STILL require power-off backfeed protection. This diagnostic alone does not authorize hot plugging.

NON-RELEASE: physical power, safety, timing and package reviews remain open

magic-alt/servoHIL

Sheet: /41_power_status/

File: 41_power_status.kicad_sch

Title: 41 power status

Size: A3

Date:

Rev: B-review

KiCad E.D.A. 10.0.6

Id: 11/11