


SR-001 Wall-column concrete ownership and force-transfer review

SIMULATED COORDINATION REVIEW CASE STUDY | NOT FOR CONSTRUCTION | 2026-09-13

Same physical frame and core. Coloured partitions identify concrete ownership; they do not change member outlines.

B2 PLAN / 1:10 / analytical slice z = +2.00 m

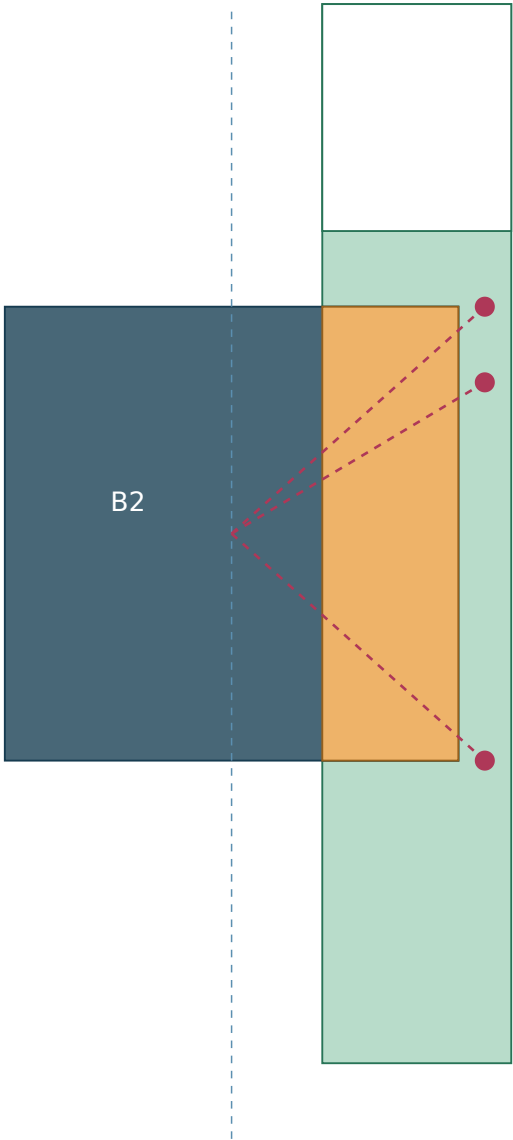

Blue: column-owned; orange: shared volume counted in column.

Green: remaining wall; magenta: selected eccentric constraint links.

Wall x = 6.12..6.37; remaining strip x = 6.30..6.37 m.


Column axis x = 6.00; remaining wall midplane x = 6.335 m.

The 70 mm strip belongs to one monolithic wall-column section; it is not a separate proposed thin wall.

B2 north face y = 4.50; portal starts y = 4.60. Finished portal width remains 1.28 m.

Elastic contact forces are available in case_joint_actions.csv. Bond slip, joint shear flexibility and RC reinforcement remain open.

B3 PLAN / 1:10 / analytical slice z = +2.00 m

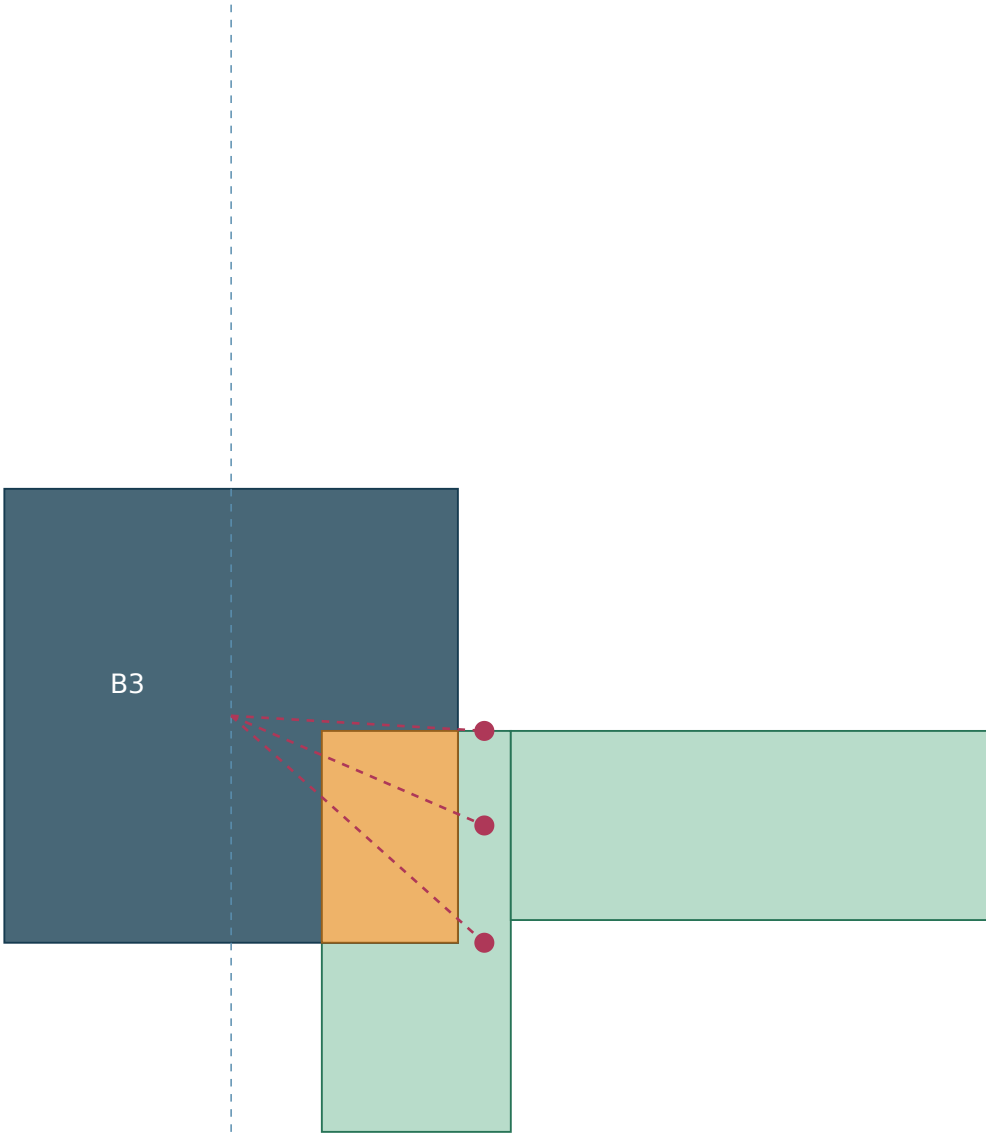

Blue: column-owned; orange: shared volume counted in column.

Green: remaining wall; magenta: selected eccentric constraint links.

Wall x = 6.12..6.37; remaining strip x = 6.30..6.37 m.


Column axis x = 6.00; remaining wall midplane x = 6.335 m.

SR-002 Beam-wall section, diagnostic results and remaining design gates

SIMULATED COORDINATION REVIEW CASE STUDY | NOT FOR CONSTRUCTION | 2026-09-13

Section through the B-line rear-bay beam at 2F. Concrete outlines are unchanged; the analytical web centroid is corrected.

B-Y-B-23-2F / transverse section / 1:9.52

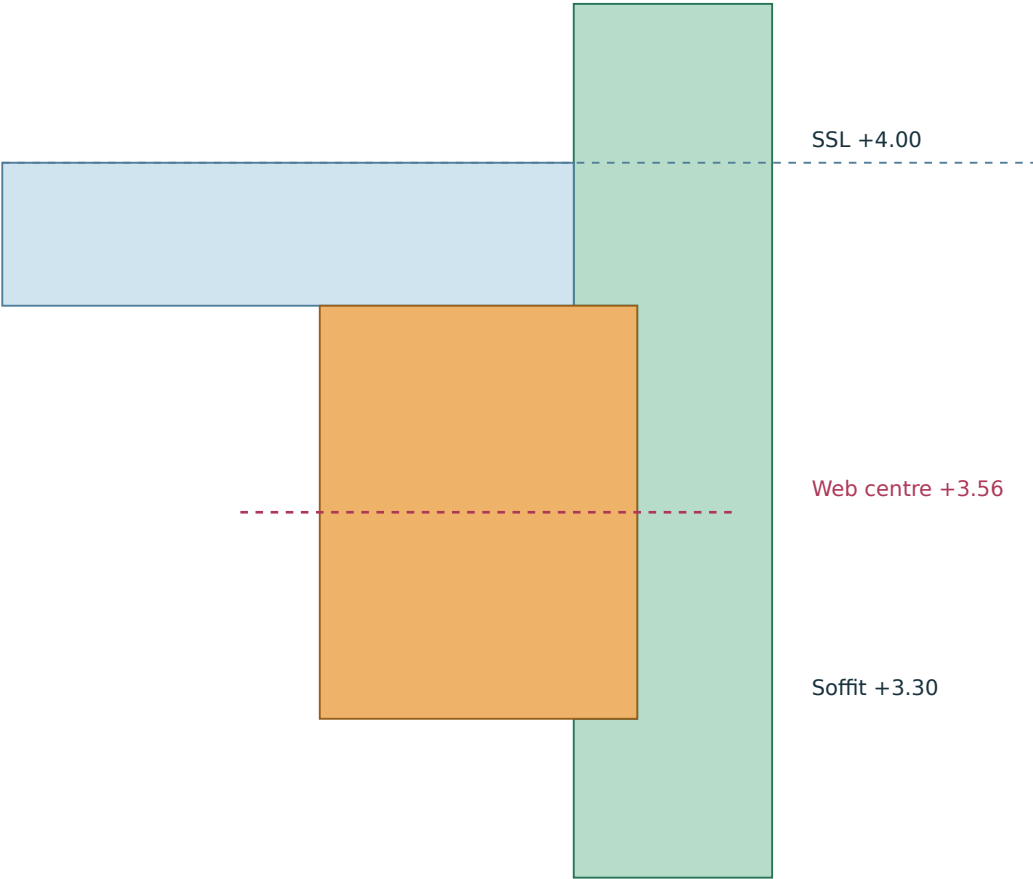

Web: 0.40 x 0.52 m; centroid 0.44 m below SSL.

Slab flange: 0.18 m; no second full-depth beam section.

Beam-owned overlap leaves 0.17 m wall at this section.

Remaining wall midplane x = 6.285 m; corner/contact offsets are explicit.

100 kN cases use uniform floor-area distribution, independent of mesh mass. They are not wind or earthquake actions.

The -1.80 m fixed base is diagnostic. Synthetic equipment inputs and uncracked elastic stiffness are not final design criteria.

Use with AR-001/002 and the structural report. These are coordination/review sheets; reinforcement is not drawn or approved.

ACCOUNTING CORRECTION

Wall / column: 2.05920 m3

Wall / beam web: 2.00928 m3

Total counted once: 4.06848 m3 / 97.64352 kN

This is duplicated accounting removed, not physical concrete saved.

DIAGNOSTIC ANALYSIS RESULTS

Service gravity: 11878.409 kN

Max vertical displacement: 3.0484 mm

X100 / Y100: 0.11938 / 0.07057 mm

First period: 0.182024 s

Direct wall-frame intersections: 31; MPCs: 2323

REMAINING DESIGN

Code wind/earthquake and combinations; cracking and system checks;

all-member reinforcement, stairs/joints and anchorage;

soil/foundations, coherent bar drawings and schedules;

priced quantities, congestion and construction feasibility.