National RV
NRVIA
Inspectors Association

RV Inspection Report

Prepared for: JW Malcolm

RV Location:
9024 US Hwy 175, Athens, Tx 75751



Inspection Date / RV Model:
2026-6-23 / 2025 Forest River Rockwood MiniLite 2515s

VIN: 4X4TRLB23SD461721

ProfessorJerryRV

Jerry W. Malcolm
13016 Scofield Farms
Austin, Texas 78727
512-589-7372


N
NRVIA
CERTIFIED RV
INSPECTOR

Table of Contents

Cover Page 1
Table of Contents 3
Intro Page 5
Life Safety Issue 7
Major Issue 9
Minor Issue 11
1 Vehicle Information 14
2 Hot Skin Test 18
3 Roof Exterior 19
4(A) Front Cap / Wall 27
4(B) Curbside Sidewall 28
4(C) Rear Cap / Wall 30
4(D) Streetside Sidewall 33
5(A) Main Entry Door (Kitchen) 36
5(B) Second Entry Door (Bedroom) 40
6 Awnings 41
7(A) Streetside - Rear Slideout (Recliners) 43
7(B) Streetside - Front Slideout (Closet) 44
8(A) Curbside - Front Wheel Assembly 45
8(B) Curbside - Rear Wheel Assembly 47
8(C) Streetside - Rear Wheel Assembly 49
8(D) Streetside - Front Wheel Assembly 51
8(E) Spare Tire Assembly 53
9 Hitch and Stabilizing System 54
10 Running Gear 57
11 12-Volt DC Chassis Lights 60
13 Exterior Water Systems 61
14 Propane Container(s), Lines and Connections 67
15 LP System Leak Test 69
16 Life Safety Components 70
17 Electrical System 120-Volts AC and 12-Volts DC 75

18 Appliances: Kitchen 83
19 Appliances: Other 85
20(A) Front Air Conditioner (Zone 2 - Bedroom) 86
20(B) Rear Air Conditioner (Zone 1 - Living Rm / Kitchen) 89
21 Interior Water Systems 90
22 Interior 94
23 Furniture 98
24(A) Living Room Television 100
24(B) Radio / Stereo 100
24(C) Backup Camera 101
24(D) Front-Facing Camera 101

Inspection Date / Year,Make,Model :	**Time:**	**VIN Number:**
2026-6-23 / 2025 Forest River Rockwood MiniLite 2515s		4X4TRLB23SD461721
RV Location:	**Customer:**	
9024 US Hwy 175, Athens, Tx 75751	JW Malcolm	

This time sensitive document was prepared for the client listed on the Cover Page of this report. Any reproduction, use, or resale of this document by individuals other than who is listed on the report cover page, or their assigns, is not supported by the inspector and company.

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this RV home. Any recommendations by the inspector to repair suggests further action by a qualified RV technician. All costs associated with repair or replacement of items and components identified in this report should be considered before purchasing this RV home..

Acceptable (A) = A visually observed item, component or unit and if no other comments were made then it appeared to be performing its intended function with little or no deterioration visible.

Fair (F)= The item or its components is not in need of immediate repair as it is performing its intended function but deterioration is visible. Some may elect to repair or replace this item now while others may wait.

Poor (P) = The item, component or unit is not functioning as intended and replacement is recommended, or needs further action by a qualified RV technician.

Not Inspected (NI)= The item, unit or component was not inspected, and no representations were made as to whether or not it was functioning as intended and a statement for the reason for not inspecting will be made.

Not Present (NP) = This item, component or unit is not in this RV.

NRVIA Standards of Practice

Purpose, Scope and General Statements

1 – The purpose of the Standards of Practice is to establish a uniform standard for the companies RV Inspector to inspect and report in an objective manner the conditions of a Recreational Vehicle and its components.

2 – The Standards describe the components, and systems included in an RV Inspection.

3 – The Standards apply to motorized and towable types of RVs as defined by the RV Industry.

4 – The Standards apply to a visual inspection of those areas, components and systems that are readily accessible to determine at the time of inspection that they are performing their intended function without regard to life expectancy.

5 – The purpose of the RV inspection is to identify visible and operational defects as permitted by the current conditions that in the judgment of the RV Inspector will adversely affect the function or integrity of the items, components and systems of the Recreational Vehicle.

6 – RV Inspections performed under the Standards of Practice are basically visual and rely upon the judgment, education and experience of the RV Inspector and are not intended to be technically exhaustive.

7 – RV inspections shall be performed on a calendar day which will allow compliance with the provisions of the NRVIA Standards of Practice.

8 – RV Inspections performed under the Standards shall not be construed as being a compliance inspection of any code, governmental regulation or manufacturer's installation instructions or procedures. In the event a law, statute or ordinance prohibits a procedure recommended in the Standards, the RV Inspector is relieved of the obligation to adhere to the prohibited part of the Standards.

9 – RV Inspections performed under the Standards are not an expressed, implied warranty or guarantee of adequacy, performance or useful life of any RV, any of its components or systems.

10 – Only those items specifically listed on the RV Inspection Report will be included in the RV Inspectors evaluation.

11 – The RV Inspector shall report any system or component included in the Standards of Practice which were present at the time of the RV Inspection but were NOT inspected and provide the reason they were not inspected.

General Limitations and Exclusions

1 – RV Inspections performed under the companies Standards of Practice exclude any items concealed or not readily accessible to the RV Inspector. The RV Inspector is not required to move furniture, personal or stored items. Lifting floor covering, accessing interior walls and ceilings in which could damage or destroy the components or systems being evaluated is not part of the RV Inspection.

2 – The determination of the presence of damage caused by insects or water is only to be evaluated by observation with a statement being rendered by RV Inspector that is to make the client aware of the issue.

3 – Excluded from the Standards of Practice is the determination of indoor air quality of the RV and it's consequence of physical damage, toxicity, odors, waste products and noxiousness.

4 – The RV Inspection and report are based upon the visual observation of the existing conditions of the RV at the time of the RV Inspection. The report is not intended to be or construed as a guarantee, warranty or any form of insurance. The RV Inspector will not be responsible for any repairs or replacement with regard to the RV or its contents.

5 – The RV Inspector is not required to enter any premises that visibly show a threat to the safety of the RV Inspector or others nor inspect any area or component that poses a danger to the RV Inspector or others.

6 – The NRVIA Certified RV Inspector inspected and reported on the RV items listed in this report and their condition during the RV Inspection. Any additional items of inspection were dependent upon any agreements that were made between the client and the RV Inspector.

Weather:	**Type of Inspection:**	**Style of RV:**
Clear & Windy	Other	Travel Trailer
RV Status:	**Client Is Present:**	**Start Temperature:**
Occupied at the Time of the Inspection	Yes	85 degrees

Life Safety Issue

National RV NRVIA Inspectors Association

ProfessorJerryRV

Customer
JW Malcolm
Inspection Date / Year,Make,Model:
2026-6-23 / 2025 Forest River Rockwood MiniLite 2515s
VIN Number:
4X4TRLB23SD461721

The following items indicate that the condition is a LIFE SAFETY ISSUE. It is recommended that a qualified RV technician correct the identified issue, and before the unit is occupied.

8(A) . Curbside - Front Wheel Assembly

8.2.A Tire Tread - Condition

Poor
The curbside front tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

8(B) . Curbside - Rear Wheel Assembly

8.2.B Tire Tread - Condition

Poor
The curbside rear tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

8(C) . Streetside - Rear Wheel Assembly

8.2.C Tire Tread - Condition

Poor
The streetside rear tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

8(D) . Streetside - Front Wheel Assembly

8.2.D Tire Tread - Condition

Poor
The streetside front tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

8(E) . Spare Tire Assembly

8.1.E Tire/Rim - Condition

Poor

The spare tire pressure is below the recommended value. This is a LIFE SAFETY issue. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Jerry W. Malcolm

Major Issue

ProfessorJerryRV

Customer
JW Malcolm
Inspection Date / Year,Make,Model:
2026-6-23 / 2025 Forest River Rockwood MiniLite 2515s
VIN Number:
4X4TRLB23SD461721

The following items indicate that the condition is a MAJOR ISSUE. It is recommended that a qualified RV technician correct the identified issue as needed.

3. Roof Exterior

3.1 Front Cap, Joints and Seals - Condition

Poor

The streetside front cap seal has a protrusion. This could allow water intrusion. It is recommended that this be further evaluated by a qualified RV technician.

4(D) . Streetside Sidewall

4.0.D Sidewall - Condition

Poor

There is extensive damage to the streetside side wall J skirt from halfway back to the slideout. The J skirt has been removed in that section and damage exists on the portion that is still present. It is recommended that this be further evaluated by a qualified RV technician.

5(A) . Main Entry Door (Kitchen)

5.0.A Door - Condition

Poor

The pull-up accordion shade in the main entry (kitchen) door will not remain closed. It is recommended that this be further evaluated by a qualified RV technician.

9. Hitch and Stabilizing System

9.3 Travel Trailer - Stabilizers - Condition

Poor

The streetside rear stabilizer is not operational. It is currently in the retracted state. It is recommended that this be further evaluated by a qualified RV technician.

17. Electrical System 120-Volts AC and 12-Volts DC

17.31 Power Converter - Operation - Minimum 0.5 Volt DC Drop

Poor

The power converter voltage difference is 0.3 volt DC drop. This is less than the recommended 0.5 volt DC drop. It is recommended that this be further evaluated by a qualified RV technician.

21. Interior Water Systems

21.8 Toilet - Bowl Holds Water

Poor

The bowl does not hold water. It is recommended that this be evaluated by a qualified RV technician.

22. Interior

22.1 System Controls / Switches - Operation

Poor

On the interior system control panel, the Bluetooth button does not light up when pressed. It is recommended that this be further evaluated by a qualified RV technician.

Prepared Using HomeGauge *http://www.HomeGauge.com* : Licensed To Jerry W. Malcolm

Minor Issue

ProfessorJerryRV

Customer
JW Malcolm
Inspection Date / Year,Make,Model:
2026-6-23 / 2025 Forest River Rockwood MiniLite 2515s
VIN Number:
4X4TRLB23SD461721

The following items indicate that the condition is a MINOR ISSUE. It is recommended that a qualified RV technician correct the identified issue as needed.

4(A) . Front Cap / Wall

4.1.A Paint and/or Decals - Condition

Fair

(1) There are some chips in the front cap wall paint and decals. It is recommended that this be further evaluated by a qualified RV technician.

4(B) . Curbside Sidewall

4.3.B Cargo/Access Doors - Condition

Fair

There are scratches on the curbside side wall cargo door. It is recommended that this be further evaluated by a qualified RV technician.

4(C) . Rear Cap / Wall

4.1.C Paint and/or Decals - Condition

Fair

(1) There is sealant overflow on the rear cap streetside about halfway up and again closer to the top. It is recommended that this be further evaluated by a qualified RV technician.

(2) There are scuff marks on the rear cap streetside. It is recommended that this be further evaluated by a qualified RV technician.

4(D) . Streetside Sidewall

4.3.D Cargo/Access Doors - Condition

Fair

The streetside side wall cargo access door has scratches. It is recommended that this be further evaluated by a qualified RV technician.

5(A) . Main Entry Door (Kitchen)

5.1.A Door - Operation

Fair

The main entry door squeaks when opening. It is recommended that this be further evaluated by a qualified RV technician.

6. Awnings

6.2 Fabric - Condition

Fair

(1) The awning has three tears close to the wall above the bedroom door. It is recommended that this be further evaluated by a certified RV technician.

(2) The awning has a tear close to the wall near the rear cap. It is recommended that this be further evaluated by a certified RV technician.

9. Hitch and Stabilizing System

9.0 Travel Trailer - Tongue Jack - Condition

Fair

The light switch on the motorized tongue jack is not present. It is recommended that this be further evaluated by a qualified RV technician.

13. Exterior Water Systems

13.0 City Water - Connection - Condition

Fair

The city water inlet connection screen has some debris on it. It is recommended that this be further evaluated by a qualified RV technician.

13.12 Black Water Tank #1 - Condition

Fair

The black tank flush inlet's washer is present, but is missing the filter screen. It is recommended that this be further evaluated by a qualified RV technician.

13.13 Black Water Tank #1 - Valve Operation and Condition

Fair

The black water tank valve is tight. It is recommended that this be further evaluated by a qualified RV technician.

13.25 Gray Water Tank #1 - Valve Operation and Condition

Fair

The gray water tank #1 valve is tight. It is recommended that this be further evaluated by a qualified RV technician.

13.31 Gray Water Tank #2 - Valve Operation and Condition

Fair

The gray water tank #2 valve is tight. It is recommended that this be further evaluated by a qualified RV technician.

21. Interior Water Systems

21.7 Toilet - Operation and Condition

Fair

There is discoloration in the bowl near some of the water inlets. It is recommended that this be evaluated by a qualified RV technician.

22. Interior

22.36 Interior Doors - Condition

Fair

There are scrapes at the bottom, bathroom-side, of the sliding doors between the bathroom and bedroom. It is recommended that this be further evaluated by a qualified RV technician.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Jerry W. Malcolm

1. Vehicle Information

Styles & Materials

VIN:
Photo Included
VIN : 4X4TRLB23SD461721

VIN Location:
Streetside Front

Gross Vehicle Weight Rating (GVWR):
From Data Plate
Specify in lbs or kg : 3484 lbs

RV - Manufacturer Name and Location:
Forest River / Wakarusa, IN

RV - Date of Manufacturer:
August
Year : 2024

RV - Brand:
Manufacturer's Brand Name
Brand Name : Rockwood

RV - Model Number / Floor Plan Number:
RV Model
Model Number : 2515s

RVIA Seal Number:
Located by Entrance Door
Seal Number : B2388061

State Inspection Sticker Current:
Not Required


State License Plate Current:
Yes
State and Plate Number : B74-6223

Items

1.0 VIN / VIN Data Plate Photo


Yes

(1) Overview

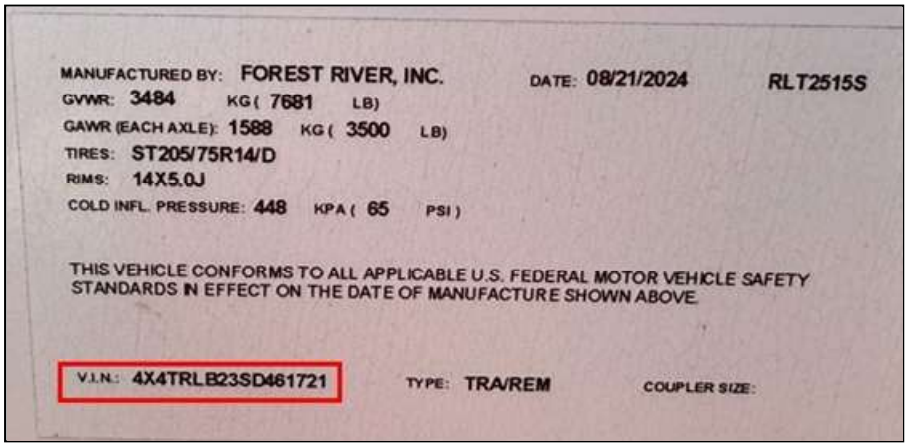

VIN Data Plate

(2) Overview

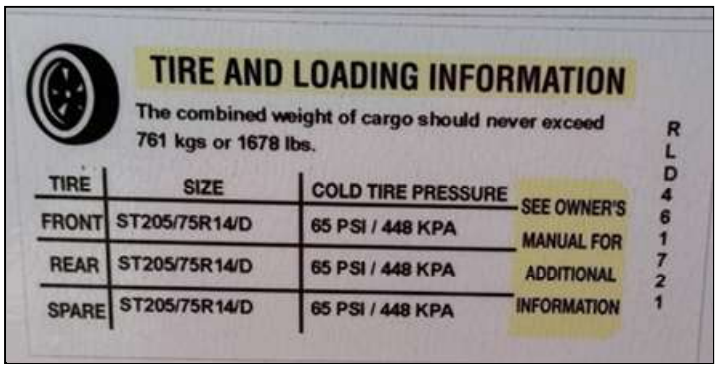

Tire Data Plate

1.1 RVIA Seal Photo

Yes

Overview



RVIA Seal

1.5 State License Plate Photo

Yes

Overview




License Plate

1.7 Build Sheet Photo

Yes

Overview

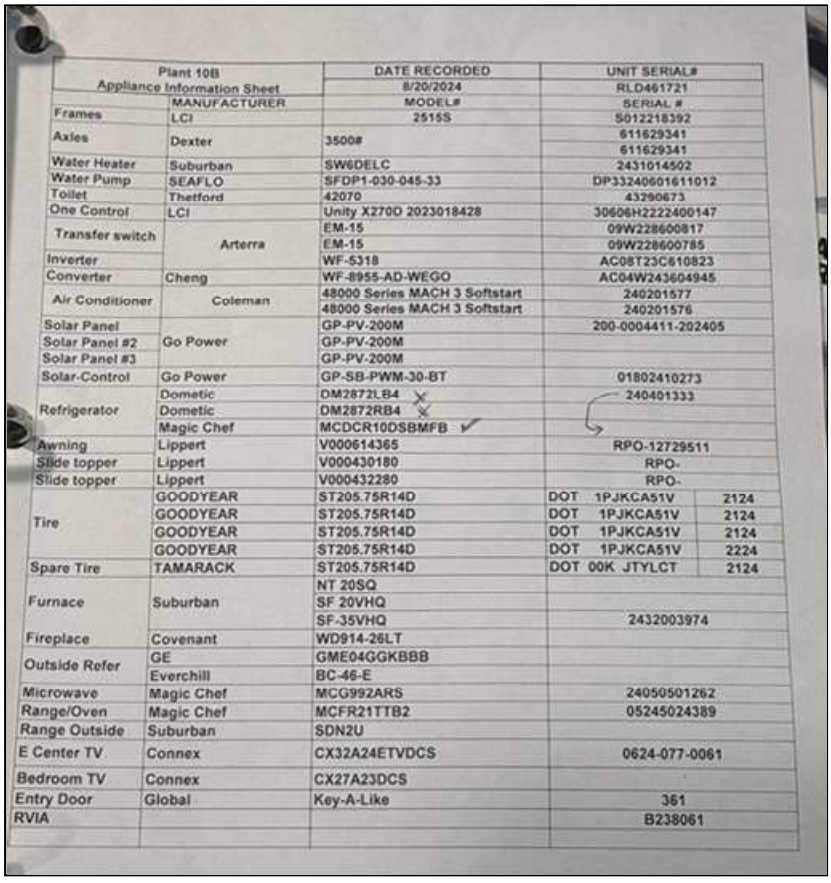

Plant 10B Appliance Information Sheet		DATE RECORDED 8/20/2024	UNIT SERIAL# RLD461721
	MANUFACTURER	MODEL#	SERIAL #
Frames	LCI	2515S	5012218392
Axles	Dexter	3500#	611629341
			611629341
Water Heater	Suburban	SW6DELC	2431014502
Water Pump	SEAFLO	SFDP1-030-045-33	DP33240601611012
Toilet	Thetford	42070	43290673
One Control	LCI	Unity X270D 2023018428	30606H2222400147
Transfer switch	Arterra	EM-15	09W228600817
		EM-15	09W228600785
Inverter		WF-5318	AC08T23C610823
Converter	Cheng	WF-8955-AD-WEGO	AC04W243604945
Air Conditioner	Coleman	48000 Series MACH 3 Softstart	240201577
		48000 Series MACH 3 Softstart	240201576
Solar Panel		GP-PV-200M	200-0004411-202405
Solar Panel #2	Go Power	GP-PV-200M	
Solar Panel #3		GP-PV-200M	
Solar-Control	Go Power	GP-SB-PWM-30-BT	01802410273
Refrigerator	Dometic	DM2872LB4	240401333
	Dometic	DM2872RB4	
	Magic Chef	MCDCR10DSBMFB	
Awning	Lippert	V000614365	RPO-12729511
Slide topper	Lippert	V000430180	RPO-
Slide topper	Lippert	V000432280	RPO-
Tire	GOODYEAR	ST205.75R14D	DOT 1PJKCA51V 2124
	GOODYEAR	ST205.75R14D	DOT 1PJKCA51V 2124
	GOODYEAR	ST205.75R14D	DOT 1PJKCA51V 2124
	GOODYEAR	ST205.75R14D	DOT 1PJKCA51V 2224
Spare Tire	TAMARACK	ST205.75R14D	DOT 00K JTYLCT 2124
Furnace	Suburban	NT 20SQ	
		SF 20VHQ	
		SF-35VHQ	2432003974
Fireplace	Covenant	WD914-26LT	
Outside Refer	GE	GME04GGKBBB	
	Everchill	BC-46-E	
Microwave	Magic Chef	MCG992ARS	24050501262
Range/Oven	Magic Chef	MCFR21TTB2	05245024389
Range Outside	Suburban	SDN2U	
E Center TV	Connex	CX32A24ETVDCS	0624-077-0061
Bedroom TV	Connex	CX27A23DCS	
Entry Door	Global	Key-A-Like	361
RVIA			B238061

Build Sheet


1.8 Manuals

Yes

Overview



Manuals

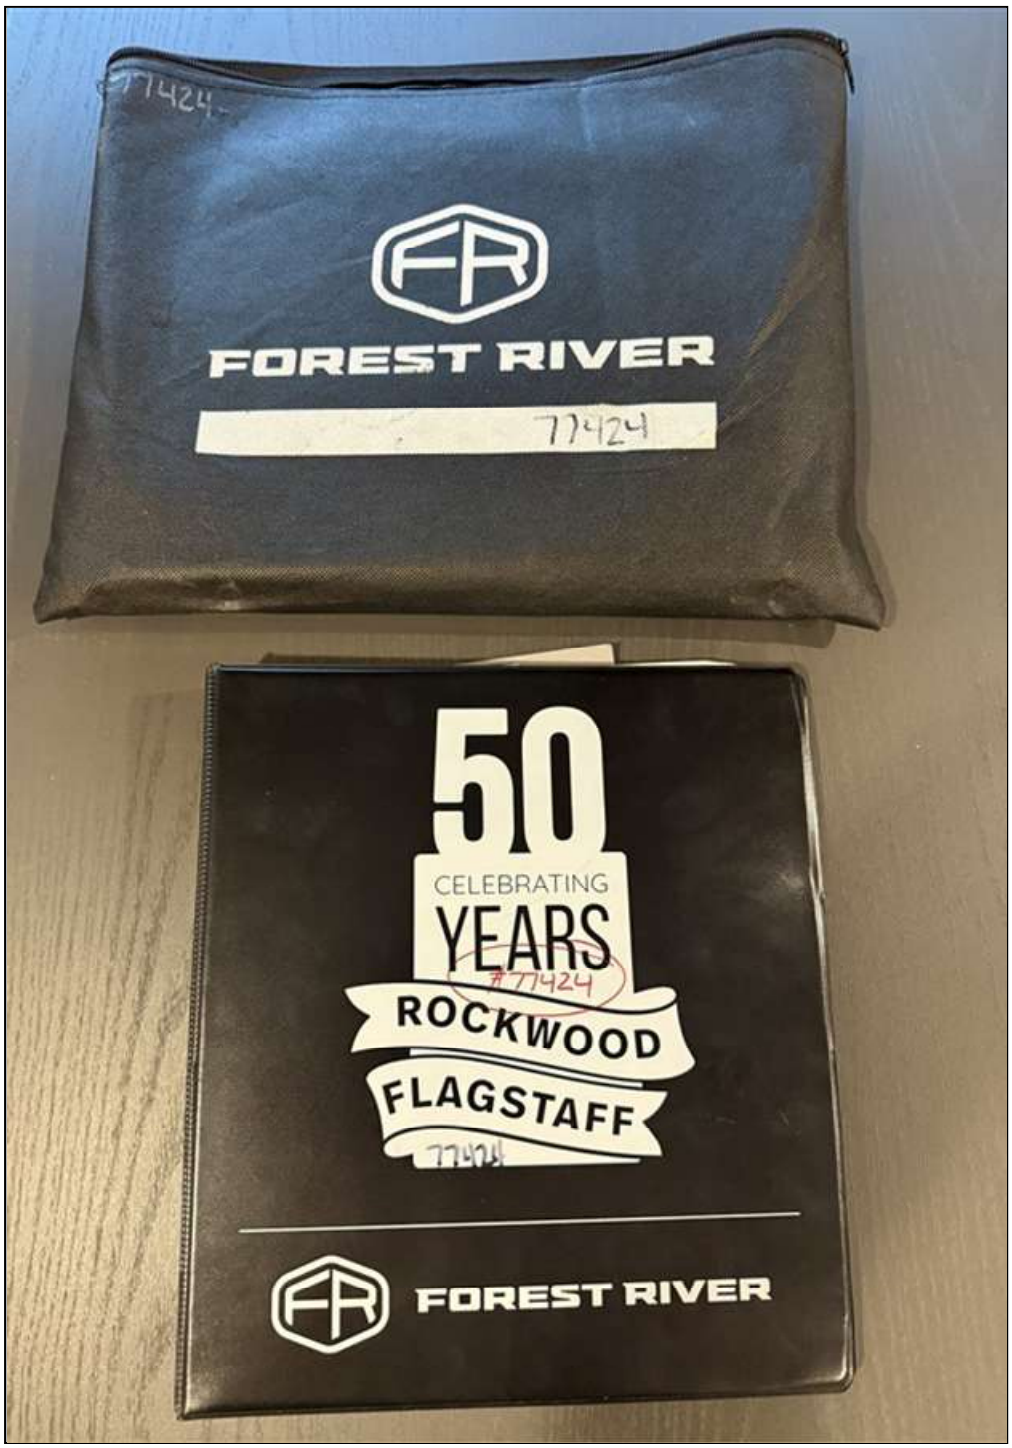

Manuals

2. Hot Skin Test

NOTE: Hot Skin is when stray or leak voltage from the 120 voltage AC system is somehow redirected from its normally safe path to some metal component(s) of your RV.

NOTE: Most hot skin issues may not be a direct short of power to ground but rather a high resistive short. In many cases, they may not trip the circuit breakers or blow fuses. However, the frame, chassis, copper tubing and metal trim pieces on the coach can conduct voltage.

NOTE: Any reading below 5 volts is considered safe. Conversely, any reading above 5 volts can be dangerous.

Items

2.0 Hot Skin Test - Frame and Running Gear Voltage

Acceptable

2.1 Hot Skin Test - Exterior Wall Surface Voltage

Acceptable

2.2 Hot Skin Test - Door Handles and Frames Voltage

Acceptable

2.3 Hot Skin Test - Window Frames and Trim Voltage

Acceptable

2.4 Hot Skin Test - Other Voltage

Acceptable

3. Roof Exterior

NOTE: Lap sealant should appear soft, pliable and rubbery. If the lap sealant around roof edges, skylights, vents and appliances looks cracked, brittle, loose or turned up at the edges, it is very possible that this could allow water intrusion which can become a major issue.

NOTE: It is recommended that the roof and seams be checked, at a minimum, every 6 months and repaired whenever necessary to prevent water intrusion.

Styles & Materials

Roof Type:
TPO (Rubber)

Areas of Possible Water Intrusion:
Yes

Roof Ladder Type:
Mounted

Number of Solar Panels:
One

Items

3.0 Roof - Condition

Acceptable

(1) Overview




Roof Overview Rear to Front



Roof Overview Front to Rear

(2) Repair work has been performed on the streetside from the middle to the front.

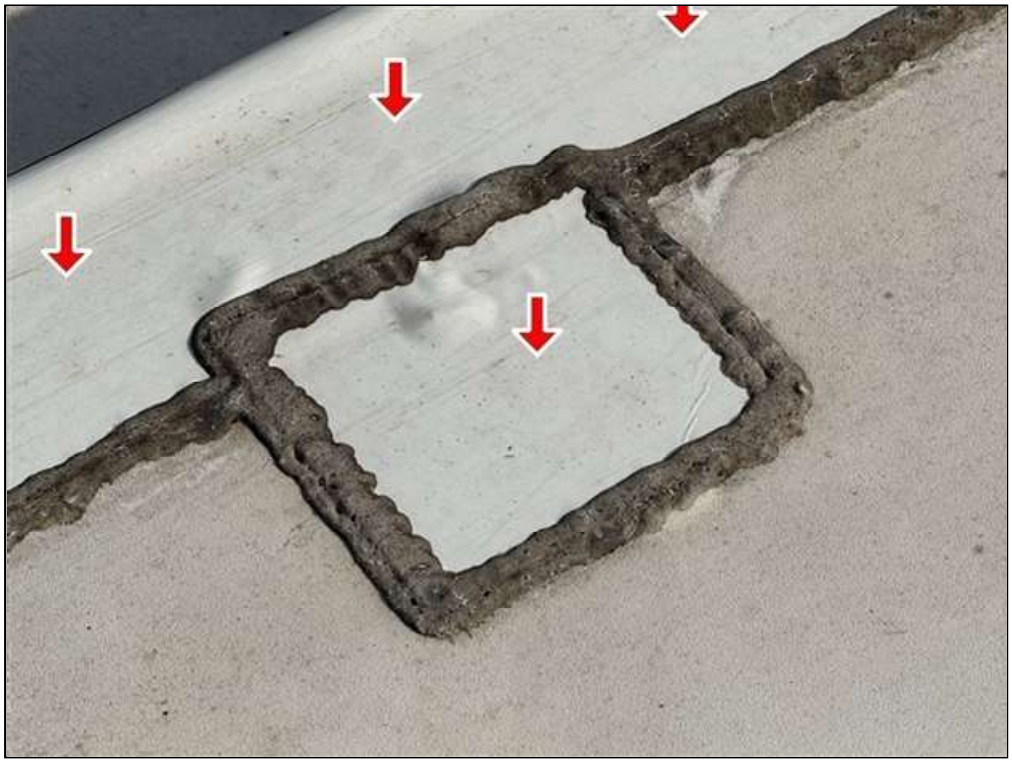

Roof Streetside Middle



Roof Streetside Middle

3.1 Front Cap, Joints and Seals - Condition

Poor

The streetside front cap seal has a protrusion. This could allow water intrusion. It is recommended that this be further evaluated by a qualified RV technician.



Front Cap Streetside



Streetside Front Cap Seal

3.2 Trim Rail (Curbside) - Condition

Acceptable

3.3 Rear Cap, Joints and Seals - Condition

Acceptable

3.4 Trim Rail (Streetside) - Condition

Acceptable

3.5 Vents - Manual Crank (14 x 14) - Condition

Acceptable

Overview



Vent Fan with Exterior Shroud Attached



Vent Fan Cover Open



Vent Cover with Exterior Shroud Removed Showing Shroud Cotter Pins

3.6 Vents - Powered (14 x 14) - Condition

Acceptable

3.7 Exterior Vent Covers - Condition

Acceptable

3.8 Plumbing Vent Covers - Condition

Acceptable

3.10 Skylights - Condition

Acceptable

Overview



Skylight

3.11 Front Air Conditioner - Shroud

Acceptable

3.12 Front Air Conditioner - Exterior Coils

Acceptable

3.15 Rear Air Conditioner - Shroud

Acceptable

3.16 Rear Air Conditioner - Exterior Coils

Acceptable

3.22 Solar Panels - Condition

Acceptable

Overview



Solar Panel

3.23 Ladder - Condition

Acceptable

4(A) . Front Cap / Wall

Styles & Materials

Exterior Wall - Construction Type:
Molded Fiberglass Cap

Exterior Wall - Surface Type:
Paint with Decals

Any Damage or Discoloration or Delamination?:
No

Windows:
Glass with No Frame

Cargo / Access Door - Type:
None

Items


4.0.A Sidewall - Condition

Acceptable

4.1.A Paint and/or Decals - Condition

Fair

(1) There are some chips in the front cap wall paint and decals. It is recommended that this be further evaluated by a qualified RV technician.

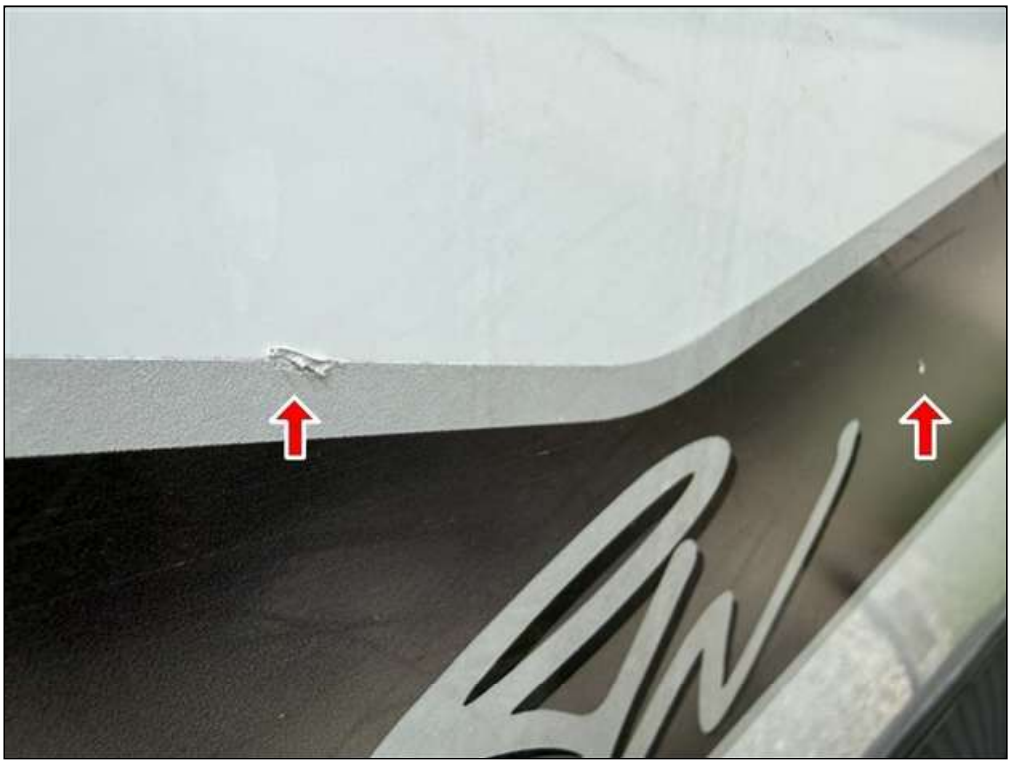

Front Cap

(2) On the front cap on the top curve, the decals have a slight amount of streaking. It is recommended that this be further evaluated by a qualified RV technician.



Front Cap

4.2.A Windows - Condition

Acceptable

4(B) . Curbside Sidewall

Styles & Materials

Exterior Wall - Construction Type:
Hung Fiberglass Panel

Exterior Wall - Surface Type:
Paint with Decals

Any Damage or Discoloration or Delamination?:
No

Windows:
Glass with No Frame

Cargo / Access Door - Type:
Door(s) with Keyed Lock

Items

4.0.B Sidewall - Condition

Acceptable

4.1.B Paint and/or Decals - Condition

Acceptable

4.2.B Windows - Condition

Acceptable

4.3.B Cargo/Access Doors - Condition

Fair

There are scratches on the curbside side wall cargo door. It is recommended that this be further evaluated by a qualified RV technician.



Curbside Cargo Access Door

4.4.B Cargo Interior Compartment - Condition

Not Inspected

The curbside cargo interior compartment is not accessible



Curbside Cargo Compartment

4.5.B Cargo Interior Compartment Lights - Operation

Acceptable

4(C) . Rear Cap / Wall

Styles & Materials

Exterior Wall - Construction Type:
Hung Fiberglass Panel

Exterior Wall - Surface Type:
Paint with Decals

Any Damage or Discoloration or Delamination?:
No

Windows:
Glass with No Frame

Cargo / Access Door - Type:
None

Items

4.0.C Sidewall - Condition

Acceptable

(2) There are some black marks behind the ladder on the left side just to the left of the window on the rear cap. It is recommended that this be further evaluated by a qualified RV technician.



Rear Cap

4.1.C Paint and/or Decals - Condition

Fair

(1) There is sealant overflow on the rear cap streetside about halfway up and again closer to the top. It is recommended that this be further evaluated by a qualified RV technician.



Rear Cap Streetside



Rear Cap Streetside

(2) There are scuff marks on the rear cap streetside. It is recommended that this be further evaluated by a qualified RV technician.



Rear Cap Streetside

4.2.C Windows - Condition

Acceptable

4(D) . Streetside Sidewall

Styles & Materials

Exterior Wall - Construction Type:
Hung Fiberglass Panel

Exterior Wall - Surface Type:
Paint with Decals

Any Damage or Discoloration or Delamination?:
No

Windows:
Glass with No Frame


Cargo / Access Door - Type:
Door(s) with Keyed Lock

Items

4.0.D Sidewall - Condition

Poor

There is extensive damage to the streetside side wall J skirt from halfway back to the slideout. The J skirt has been removed in that section and damage exists on the portion that is still present. It is recommended that this be further evaluated by a qualified RV technician.

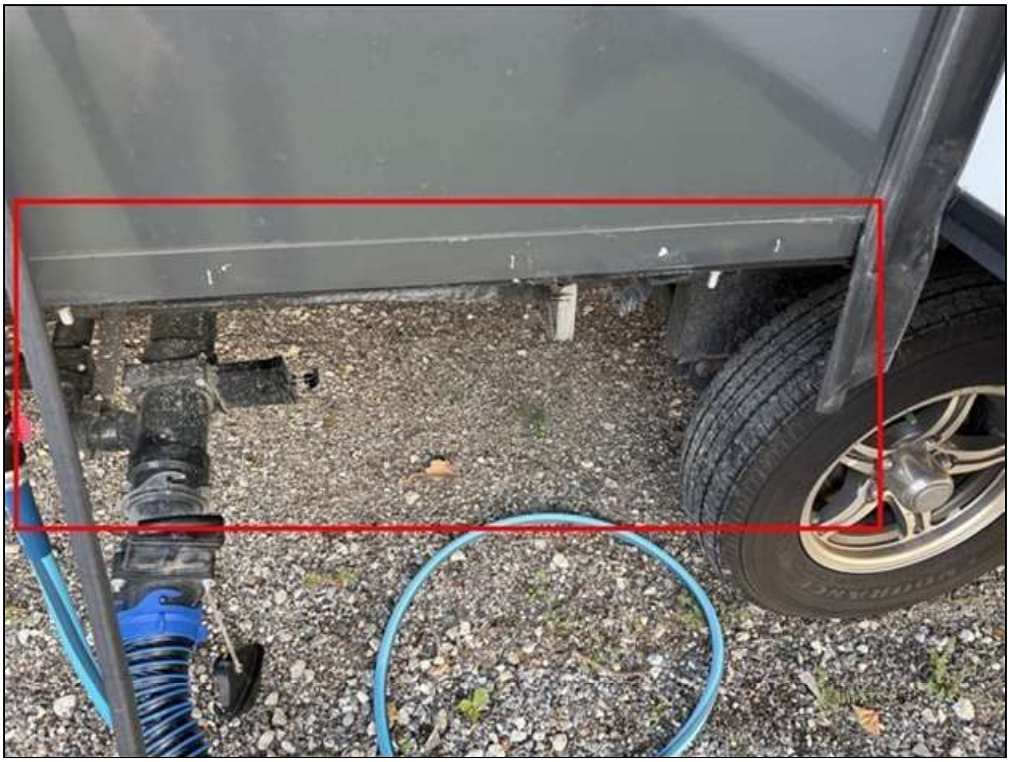

Area With Missing Streetside J Skirt



Streetside J Skirt

4.1.D Paint and/or Decals - Condition

Acceptable

4.2.D Windows - Condition

Acceptable

4.3.D Cargo/Access Doors - Condition

Fair

The streetside side wall cargo access door has scratches. It is recommended that this be further evaluated by a qualified RV technician.




Streetside Cargo Door

4.4.D Cargo Interior Compartment - Condition

Not Inspected

The streetside cargo interior compartment is not accessible.

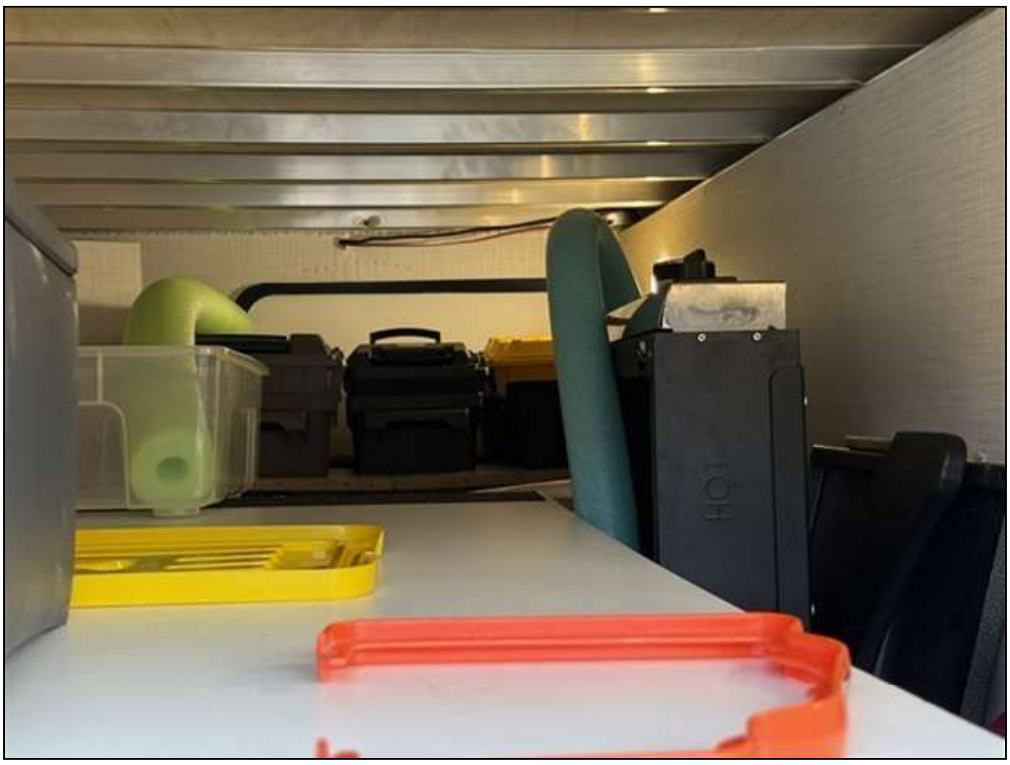

Streetside Cargo Interior

4.5.D Cargo Interior Compartment Lights - Operation

Acceptable

5(A) . Main Entry Door (Kitchen)

Styles & Materials

Entrance Door - Type:
Fiberglass

Step System - Type:
Manual

Number of Steps:
Three

Grab Bar - Type:
D-Ring Handle

Items

5.0.A Door - Condition

Poor

The pull-up accordion shade in the main entry (kitchen) door will not remain closed. It is recommended that this be further evaluated by a qualified RV technician.



Main Entry Door (Kitchen) Shade

5.1.A Door - Operation

Fair

The main entry door squeaks when opening. It is recommended that this be further evaluated by a qualified RV technician.



Main Entry Door (Kitchen)



Main Entry Door (Kitchen)

5.2.A Screen Door - Condition

Acceptable

5.3.A Screen Door - Operation

Acceptable

5.4.A Keyed Door Lock - Operation

Acceptable

5.5.A Keyed Door Lock - Deadbolt Operation

Acceptable

5.6.A Keyless Entry - Door Lock Function

Acceptable

Overview



Main Entry Door Keyless Lock

5.7.A Steps - Condition

Acceptable

5.8.A Steps - Operation

Acceptable

5.9.A Grab Bar - Condition

Acceptable

5.10.A Grab Bar - Operation

Acceptable

5(B) . Second Entry Door (Bedroom)

Styles & Materials

Entrance Door - Type:
Fiberglass

Step System - Type:
Manual

Number of Steps:
Three

Grab Bar - Type:
D-Ring Handle

Items

5.0.B Door - Condition

Acceptable

5.1.B Door - Operation

Acceptable

5.2.B Screen Door - Condition
Acceptable

5.3.B Screen Door - Operation
Acceptable

5.4.B Keyed Door Lock - Operation
Acceptable

5.5.B Keyed Door Lock - Deadbolt Operation
Acceptable

5.7.B Steps - Condition
Acceptable

5.8.B Steps - Operation
Acceptable

5.9.B Grab Bar - Condition
Acceptable

5.10.B Grab Bar - Operation
Acceptable

6. Awnings

Styles & Materials

Awning - Brand:
Solera

Awning - Type:
Electric

Awning - Material:
Vinyl

Awning - Metal Cover:
No

Awning - Length:
18 Feet


Items

6.0 Awning - Operation
Acceptable

6.1 Frame and Latching Mechanism - Operation
Acceptable

6.2 Fabric - Condition
Fair

(1) The awning has three tears close to the wall above the bedroom door. It is recommended that this be further evaluated by a certified RV technician.

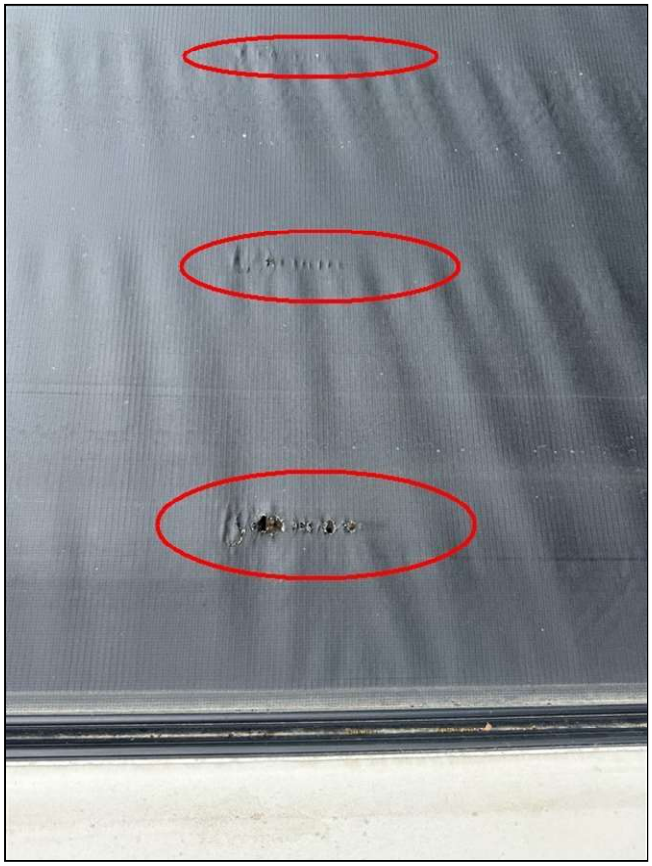

Awning View From Roof

(2) The awning has a tear close to the wall near the rear cap. It is recommended that this be further evaluated by a certified RV technician.



Awning View From Roof

6.3 Awning Lights - Condition

Acceptable

7(A) . Streetside - Rear Slideout (Recliners)

Styles & Materials

Slideout Roof Type:
Fiberglass

Slideout Drive System:
Electric Motor / Gear and Rack System

Items

7.0.A Slideout - Operation

Acceptable

7.1.A Slideout - Alignment

Acceptable

7.2.A Slideout - Roof
Acceptable

7.3.A Slideout - Sidewall
Acceptable

7.4.A Slideout - T-Molding Trim
Acceptable

7.5.A Seals, Sweeps and Gaskets
Acceptable

7.6.A Slideout - Override System
Acceptable

7.7.A Slideout Rail - Gear Rack System
Acceptable

7.8.A Wiring Harness under Slideout
Acceptable

7.9.A 12-Volt DC Control and Switches
Acceptable

7(B) . Streetside - Front Slideout (Closet)

Styles & Materials

Slideout Roof Type:
Fiberglass

Slideout Drive System:
Lippert Schwintek / In-wall Electric Motor

Items

7.0.B Slideout - Operation
Acceptable

7.1.B Slideout - Alignment
Acceptable

7.2.B Slideout - Roof
Acceptable

7.3.B Slideout - Sidewall
Acceptable

7.4.B Slideout - T-Molding Trim
Acceptable

7.5.B Seals, Sweeps and Gaskets
Acceptable

7.6.B Slideout - Override System
Acceptable

7.7.B Slideout Rail - Gear Rack System
Acceptable

7.8.B Wiring Harness under Slideout
Acceptable

7.9.B 12-Volt DC Control and Switches

Acceptable

8(A) . Curbside - Front Wheel Assembly

NOTE: The National Transportation Safety Board (NTSB) and some tire manufacturers are recommending that all tires older than six years should be replaced, regardless of their condition.

Styles & Materials

Tire Brand:
Goodyear

Tire Size:
205/75R14
Other
Size : ST205/75R14

DOT Date:
Visually Verified
DOT Date Code (WWYY) : 2224

Load Capacity:
Single Tire Rating
lbs or kg : 2040 lbs

Load Range:
D

Tire - Maximum Cold Inflation Pressure:
65 PSI

Tire - RV Manufacturer's Recommended Inflation Pressure:
65 PSI

Tire - Current Air Pressure:
Tire Gauge Reading
PSI : 61.4

Items

8.0.A Tire - Age

Acceptable

8.1.A Tire/Rim - Condition

Acceptable

8.2.A Tire Tread - Condition

Poor

The curbside front tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.



Curbside Front Tire



Curbside Front Tire



Curbside Front Tire



Curbside Front Tire

8.4.A Tire Pressure Monitor System

Yes

8(B) . Curbside - Rear Wheel Assembly

Styles & Materials

Tire Brand:
Goodyear

Tire Size:
Other
Size : ST205/75R14

DOT Date:
Visually Verified
DOT Date Code (WWYY) : 2224

Load Capacity:
Single Tire Rating
lbs or kg : 2040 lbs

Load Range:
D

Tire - Maximum Cold Inflation Pressure:
65 PSI

Tire - RV Manufacturer's Recommended Inflation Pressure:
65 PSI

Tire - Current Air Pressure:
Tire Gauge Reading
PSI : 61.2

Items

8.0.B Tire - Age

Acceptable

8.1.B Tire/Rim - Condition

Acceptable


8.2.B Tire Tread - Condition

Poor

The curbside rear tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.



Curbside Rear Tire

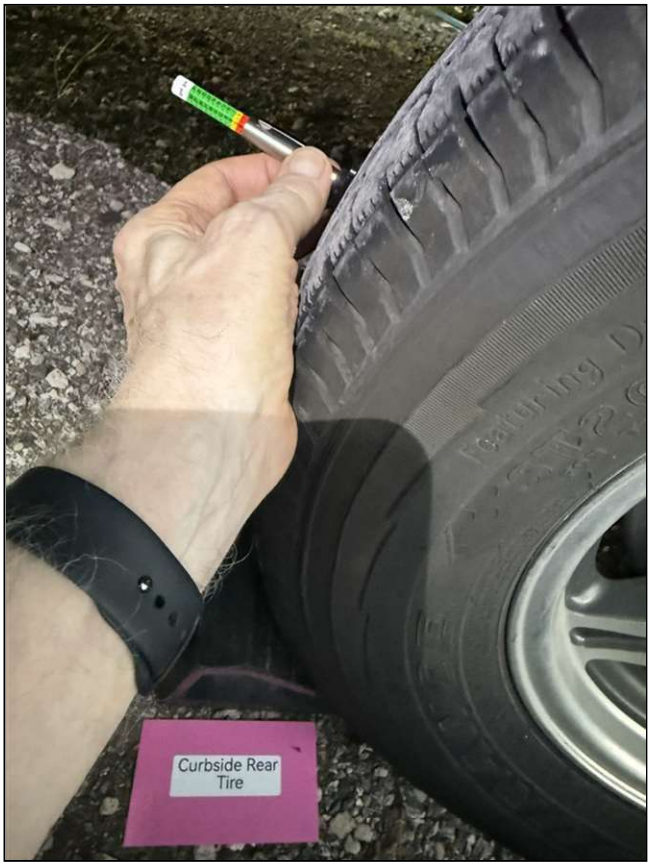

Curbside Rear Tire



Curbside Rear Tire



Curbside Rear Tire

8.4.B Tire Pressure Monitor System

Yes

8(C) . Streetside - Rear Wheel Assembly

Styles & Materials

Tire Brand:
Goodyear

Tire Size:
Other
Size : ST205/75R14

DOT Date:
Visually Verified
DOT Date Code (WWYY) : 2224

Load Capacity:
Single Tire Rating
lbs or kg : 2040 lbs

Load Range:
D

Tire - Maximum Cold Inflation Pressure:
65 PSI

Tire - RV Manufacturer's Recommended Inflation Pressure:
65 PSI

Tire - Current Air Pressure:
Tire Gauge Reading
PSI : 64.1

Items

8.0.C Tire - Age

Acceptable

8.1.C Tire/Rim - Condition

Acceptable

8.2.C Tire Tread - Condition

Poor

The streetside rear tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.



Streetside Rear Tire



Streetside Rear Tire



Streetside Rear Tire

8.3.C Valve Extensions - Condition

Not Present

8.4.C Tire Pressure Monitor System

Yes

8(D) . Streetside - Front Wheel Assembly

Styles & Materials

Tire Brand:
Goodyear

Tire Size:
Other
Size : ST205/75R14

DOT Date:
Visually Verified
DOT Date Code (WWYY) : 2224

Load Capacity:
Single Tire Rating
lbs or kg : 2040 lbs

Load Range:
D

Tire - Maximum Cold Inflation Pressure:
65 PSI

Tire - RV Manufacturer's Recommended Inflation Pressure:
65 PSI

Tire - Current Air Pressure:
Tire Gauge Reading
PSI : 58.0

Items

8.0.D Tire - Age

Acceptable


8.1.D Tire/Rim - Condition

Acceptable

8.2.D Tire Tread - Condition

Poor

The streetside front tire tread depth is less than the recommended value. This is a LIFE SAFETY ISSUE. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

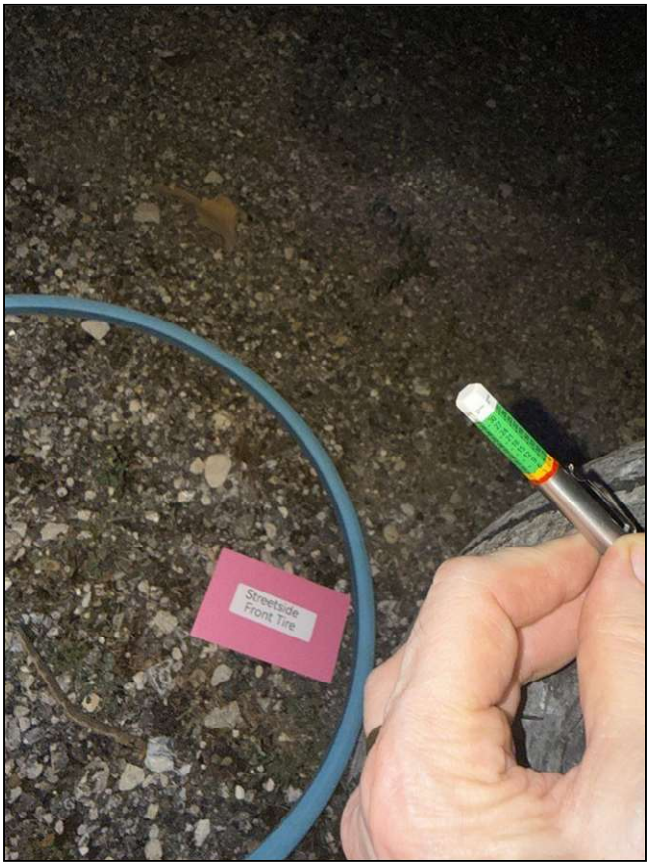

Streetside Front Tire



Streetside Front Tire



Streetside Front Tire



Streetside Front Tire

8.4.D Tire Pressure Monitor System

Yes

8(E) . Spare Tire Assembly

Styles & Materials

Tire Brand:
Other
Brand : Tamarack

Tire Size:
Other
Size : ST205/75R14

DOT Date:
Visually Verified
DOT Date Code (WWYY) : 2124

Load Capacity:
Single Tire Rating
lbs or kg : 2040 lbs

Load Range:
D

Tire - Maximum Cold Inflation Pressure:
65 PSI

Tire - RV Manufacturer's Recommended Inflation Pressure:
65 PSI

Tire - Current Air Pressure:
Tire Gauge Reading
PSI : 49.0

Items

8.0.E Tire - Age

Acceptable

8.1.E Tire/Rim - Condition

Poor

The spare tire pressure is below the recommended value. This is a LIFE SAFETY issue. It is recommended that this be further evaluated by a qualified RV technician prior to towing.

8.2.E Tire Tread - Condition

Acceptable

Overview



Spare Tire

8.3.E Valve Extensions - Condition

Acceptable

8.4.E Tire Pressure Monitor System

No

9. Hitch and Stabilizing System

Styles & Materials

Travel Trailer - Tongue Jack:
Electric

Travel Trailer - Stabilizer:
Electric

Travel Trailer - Weight Distribution System:
Yes

Travel Trailer - Sway Control System:
Yes

Items

9.0 Travel Trailer - Tongue Jack - Condition

Fair

The light switch on the motorized tongue jack is not present. It is recommended that this be further evaluated by a qualified RV technician.



Tongue Jack

9.1 Travel Trailer - Coupler - Operation

Acceptable


9.2 Travel Trailer - Safety Chains - Condition

Acceptable

9.3 Travel Trailer - Stabilizers - Condition

Poor

The streetside rear stabilizer is not operational. It is currently in the retracted state. It is recommended that this be further evaluated by a qualified RV technician.

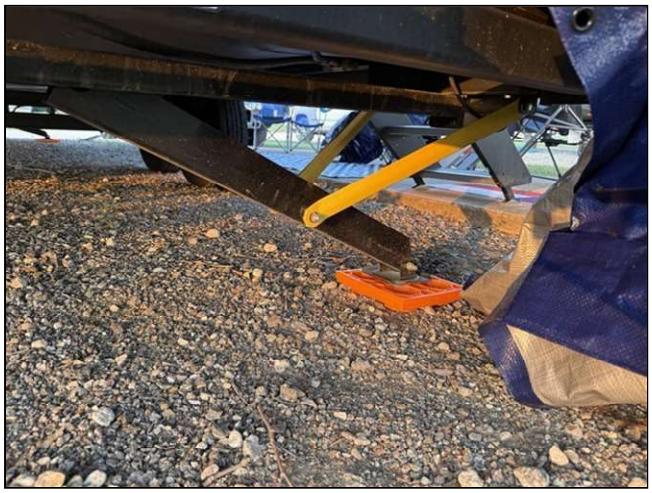

Correctly Extended Curbside Rear Stabilizer for Reference



Streetside Rear Stabilizer



Streetside Rear Stabilizer

10. Running Gear

NOTE: Due to the lack of clearance under the RV and safety concerns, the inspector will conduct the following visual inspections from the outer perimeter of the RV.

Styles & Materials

Axle - Type:
Torsion Axle

Axle - Quantity:
Two

Front Axle Weight Rating:
lbs
Weight Rating : 3500

Rear Axle Weight Rating:
lbs
Weight Rating : 3500

Brake Type:
Electric

Suspension Bolts - Type:
Not Present

Underbelly - Type:
Enclosed

Items

10.0 Frame - Condition

Acceptable

Overview



Frame Overview Back to Front



Frame Overview Front to Back

10.1 Frame - Visible Signs of Rust
Acceptable

10.2 Frame - Visible Signs of Bent or Damaged Components
Acceptable

10.3 Frame - Visible Signs of Oil Stains
Acceptable

10.4 Running Gear (Axles, Springs, Other Components) - Condition
Acceptable

10.5 Running Gear - Scraping or Drag Damage
Acceptable

10.6 Axle - Visible Signs of Rust
Acceptable

10.7 Axle - Visible Signs of Bent or Damaged Components
Acceptable

10.8 Axle - Visible Signs of Oil Stains
Acceptable

10.16 Underbelly - Condition
Acceptable

10.17 Rear Hitch Receiver - Condition
Acceptable

11. 12-Volt DC Chassis Lights

NOTE: The inspector has verified all the items in this section are functional.

The inspector tested the Breakaway switch by pulling the break away cable and checked DC amperage at the Breakaway switch. However, this does not indicate that the brakes engaged at all wheel assemblies. It is recommended that the trailer be attached to a tow vehicle and with the Breakaway switch engaged, test resistance to movement. The best way to be sure this system is functioning is to have the wheels pulled and the brakes be evaluated by a qualified RV technician.

Styles & Materials

Chassis Light Bulbs - Type:
LED

Trailer Brake Amp Draw:
Amps
DC Amps : 12.5 A

Items

11.0 Breakaway Switch
Acceptable

11.1 7-Pin Cord - Condition
Acceptable

11.2 Trailer Brakes
Acceptable

11.3 Clearance Lights - Front
Acceptable

11.4 Clearance Lights - Rear
Acceptable

11.5 Marker Lights - Streetside
Acceptable

11.6 Marker Lights - Curbside
Acceptable

11.7 Turn and Brake Light - Left
Acceptable

11.8 Turn and Brake Light - Right
Acceptable

11.9 Tail Lights
Acceptable

11.13 Hitch Lights
Acceptable

11.14 Porch Lights
Acceptable

13. Exterior Water Systems

NOTE: Due to the inability to determine the age and quality of the water in the fresh water tank, the tank should be drained and sanitized before refilling for use.

NOTE: Due to the types of materials and waste used in the tanks and depending on previous maintenance, fresh and waste monitor sensor probes may perform inaccurately between applications due to build up.

NOTE: The onboard in-line water filter will be visually inspected but the canister assembly will not be removed to verify the presence of a filter or to determine its condition at the time of the inspection.

Styles & Materials

Black Water Tank #1 - Valve Type:
Manual Pull T-Handle

Black Tank #1 - Flush - Present and Labeled:
Yes

Gray Water Tank #1 - Valve Type:
Manual Pull T-Handle

Gray Water Tank #2 - Valve Type:
Manual Pull T-Handle

Items

13.0 City Water - Connection - Condition

Fair

The city water inlet connection screen has some debris on it. It is recommended that this be further evaluated by a qualified RV technician.



City Water Inlet

13.1 City Water - System Holds Pressure

Acceptable

13.2 City Water - Pressure Regulator Available

Not Present

13.3 City Water - Food Grade Hose Available for Test

Acceptable

13.4 Outside Shower - Operation and Condition

Acceptable

13.5 On-Board Water Filtration System

Not Present

13.6 On-Board Water System - Tank, Water Pump and Fixtures for Tank Fill Condition
Acceptable

13.7 On-Board Water System - Tested Fresh Water Fill
Acceptable

13.8 On-Board Water System - Operation
Acceptable

13.9 On-Board Water System - Pump Creates and Holds Pressure
Acceptable

13.10 In-Line Check Valve - Operation
Acceptable

13.11 Waste Water - Sewer / Hose Fittings
Acceptable

13.12 Black Water Tank #1 - Condition
Fair

The black tank flush inlet's washer is present, but is missing the filter screen. It is recommended that this be further evaluated by a qualified RV technician.



Black Tank Flush Water Inlet

13.13 Black Water Tank #1 - Valve Operation and Condition

Fair

The black water tank valve is tight. It is recommended that this be further evaluated by a qualified RV technician.



Black Water Tank Valve

13.14 Black Water Tank #1 - Tank or Valve or Line Leaks

Acceptable

13.15 Black Water Tank #1 - Drain Cap Condition

Acceptable

13.16 Black Water Tank #1 - Drain Cap in Place

Acceptable

13.17 Black Water Tank #1 - Drain Cap Holds Waste Water Back

Acceptable

13.24 Gray Water Tank #1 - Condition

Acceptable

13.25 Gray Water Tank #1 - Valve Operation and Condition

Fair

The gray water tank #1 valve is tight. It is recommended that this be further evaluated by a qualified RV technician.



Gray Tank #1 Valve

13.26 Gray Water Tank #1 - Tank or Valve or Line Leaks

Acceptable

13.27 Gray Water Tank #1 - Drain Cap Condition

Acceptable

13.28 Gray Water Tank #1 - Drain Cap in Place

Acceptable

13.29 Gray Water Tank #1 - Drain Cap Holds Waste Water Back

Acceptable


13.30 Gray Water Tank #2 - Condition

Acceptable

13.31 Gray Water Tank #2 - Valve Operation and Condition

Fair

The gray water tank #2 valve is tight. It is recommended that this be further evaluated by a qualified RV technician.

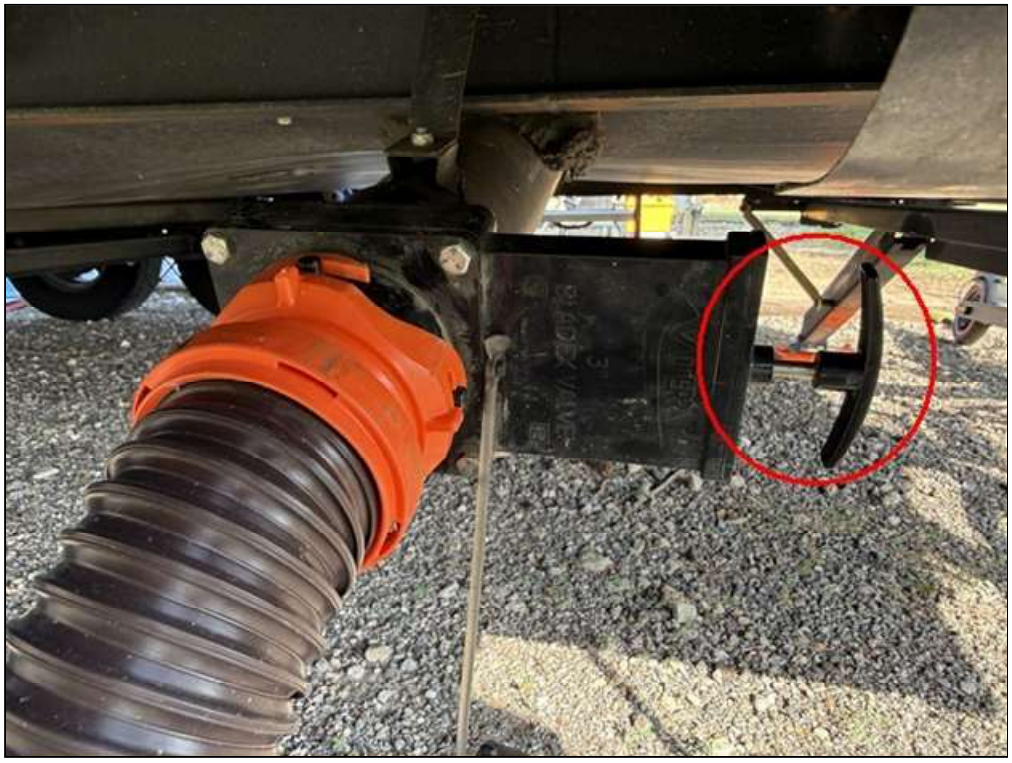

Gray Tank #2 Valve

13.32 Gray Water Tank #2 - Tank or Valve or Line Leaks

Acceptable

13.33 Gray Water Tank #2 - Drain Cap Condition

Acceptable

13.34 Gray Water Tank #2 - Drain Cap in Place

Acceptable

14. Propane Container(s), Lines and Connections

Styles & Materials

DOT - Cylinder Location:
Tongue

DOT - Cylinder Arrangement:
Dual

DOT - Regulator Type:
Dual Input - Auto Change Over

DOT #1 - Cylinder Size:
30 LBS

DOT #1 - Date of Manufacture:
2023

DOT #2 - Cylinder Size:
30 LBS


DOT #2 - Date of Manufacture:
2023

Items


14.7 DOT Cylinder(s) - Condition

Acceptable

Overview

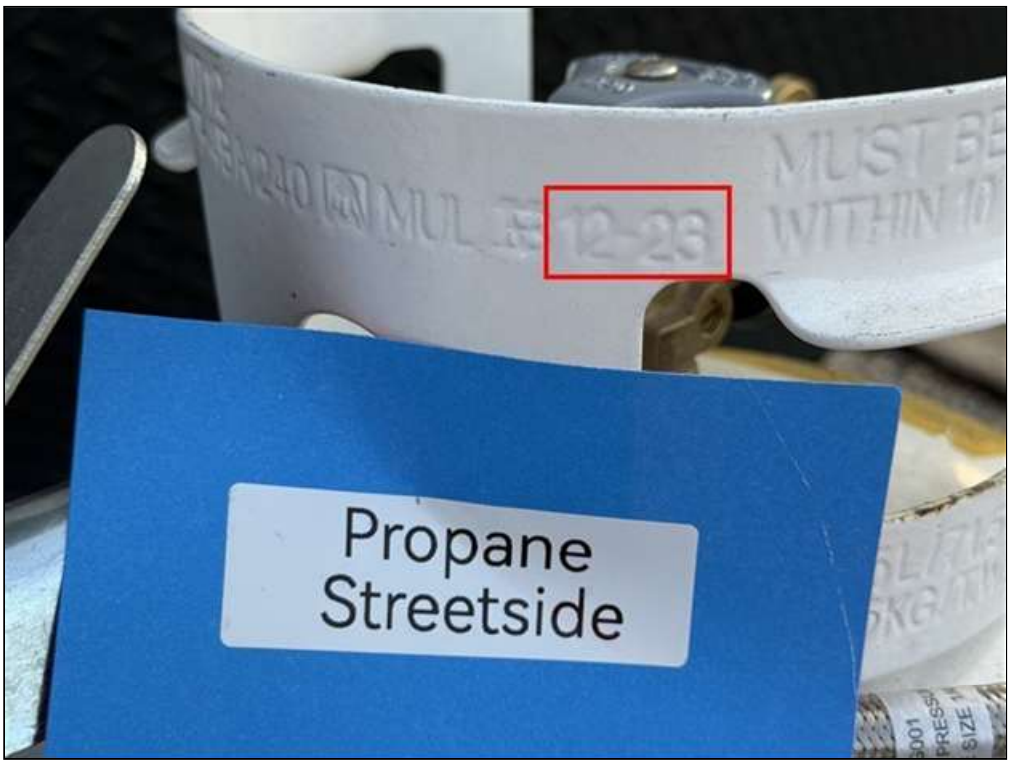

Streetside Propane Tank

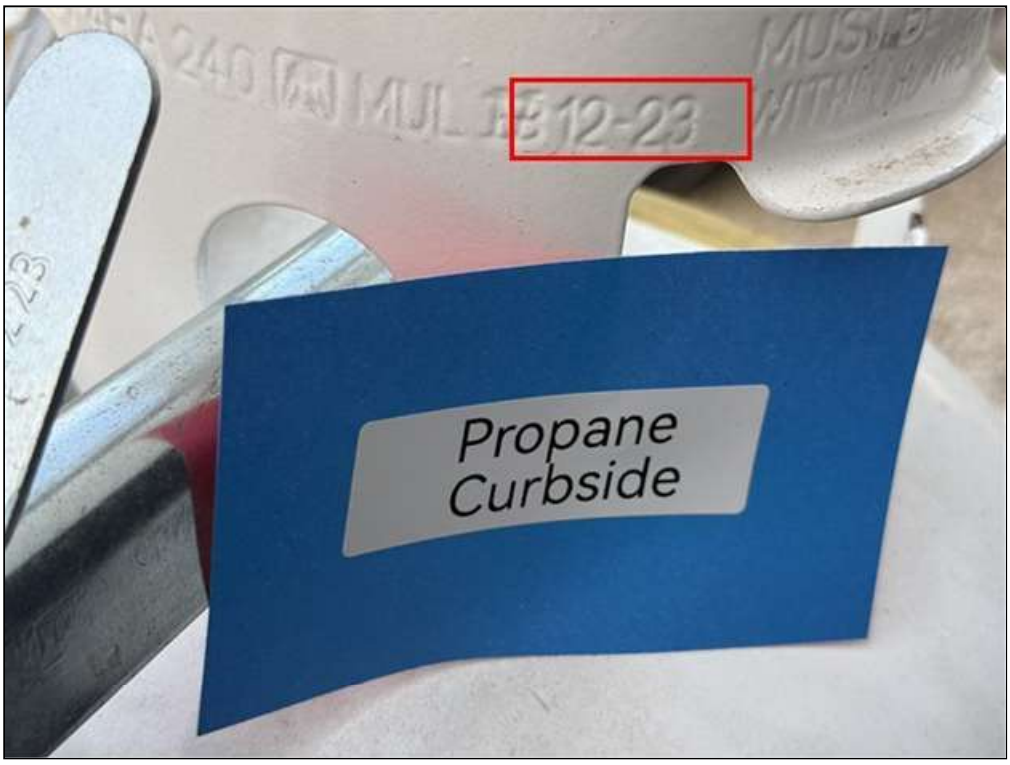

Curbside Propane Tank

14.8 DOT Cylinder #1 - Rust or Damage

Acceptable

14.9 DOT Cylinder #1 - Regulator Vents Downward

Acceptable

14.10 DOT Cylinder #2 - Rust or Damage
Acceptable

14.11 DOT Cylinder #2 - Regulator Vents Downward
Acceptable

14.17 DOT Cylinder(s) - Hoses and Regulators - Condition
Acceptable

15. LP System Leak Test

Styles & Materials


LP System - Leak Test - Start Time:
AM
Time : 8:30

LP System - Leak Test - End Time:
AM
Time : 8:37

LP System - Leak Test - Did Pressure Change During Test:
No

Items

15.0 LP System Leak Test
Acceptable
Overview

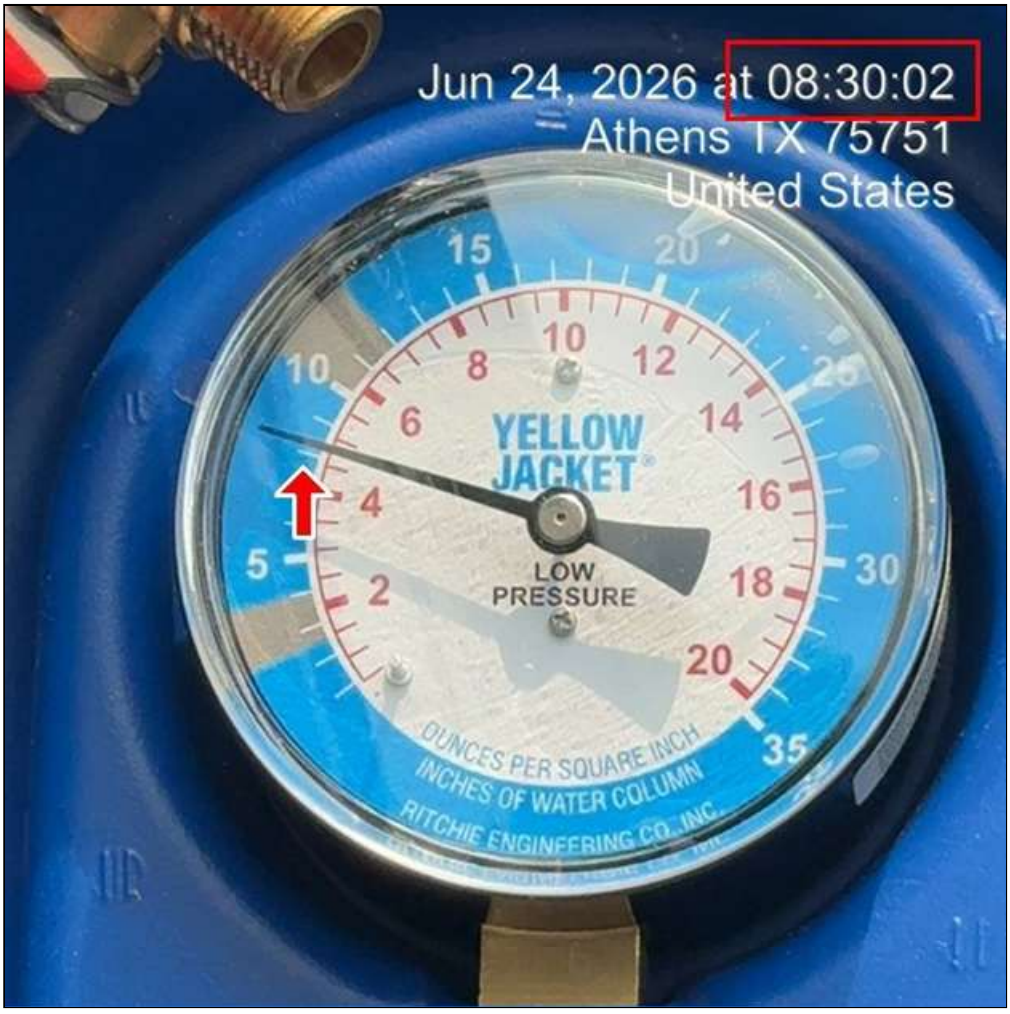

Liquid Propane System Leak Test Start



Liquid Propane System Leak Test Complete

16. Life Safety Components

NOTE: Liquid Propane gas detectors have an estimated service life of five years after which time it is recommended they be replaced.

NOTE: Carbon Monoxide detectors have an estimated service life of five years after which time it is recommended they be replaced.

NOTE: Smoke Detectors have an estimated service life of five to ten years after which time it is recommended they be replaced.

Styles & Materials

Combination LP/CO Detector - Brand:
RV Safe

Combination LP/CO Detector - Date:
Two Years Old

Combination LP/CO Detector - Test Method:
Tested by Spraying LP
Tested By Pushing Button

Combination LP/CO Detector - Alarm During Test:
Yes, When Button Pressed
Yes, With CO Test Spray

Smoke Detector - Brand:
Unknown

Smoke Detector - Date:
Less Than One Year Old

Smoke Detector - Test Method:
Tested By Pushing Button

Smoke Detector - Alarm During Test:
Yes, When Button Pressed

Fire Extinguisher - Brand:
Unknown

Fire Extinguisher - Size:
1A-10B:C - Minimum 1A-10B:C Required

Fire Extinguisher - Meets Minimum Size Requirement:
Yes

Fire Extinguisher - Mounted Within 24 Inches of Entrance Door:
Yes

Fire Extinguisher - Secured in Bracket:
Yes

Fire Extinguisher - Gauge Indicates Charged State:
Yes

Items

16.2 Combination Propane (LP) / Carbon Monoxide (CO) Detector Condition and Operation

Acceptable

Overview



Combination LP/CO Detector

16.3 Smoke Detector - Condition and Operation

Acceptable

Overview




Smoke Detector


16.5 Fire Extinguisher - Condition

Acceptable

Overview

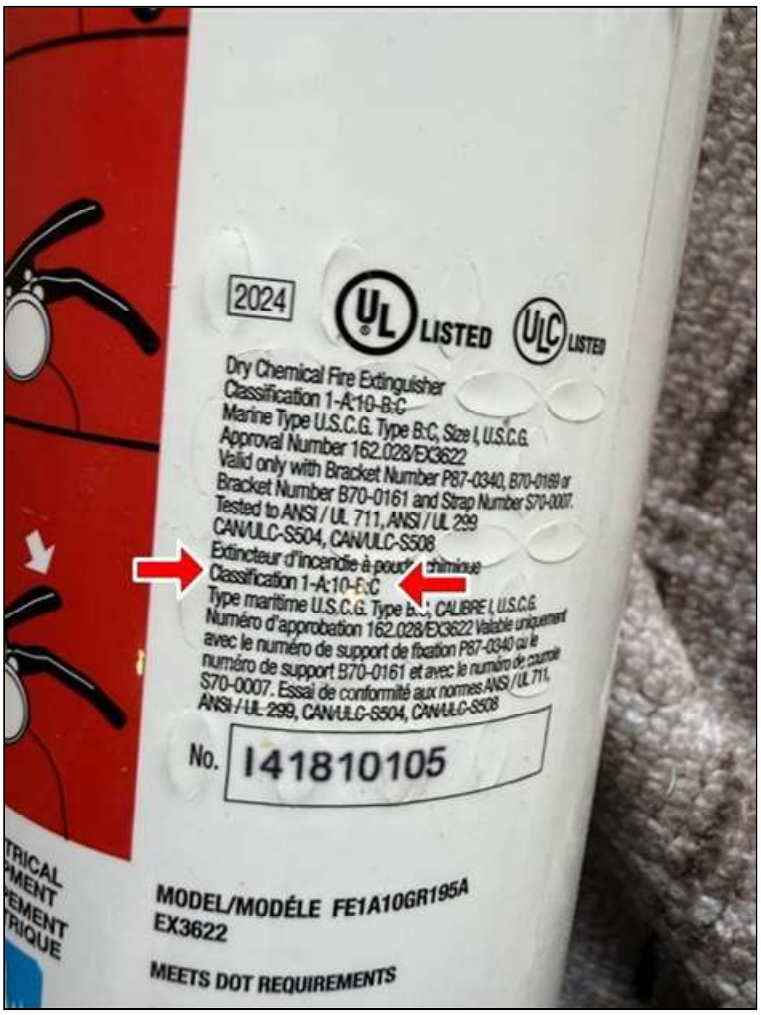

Fire Extinguisher

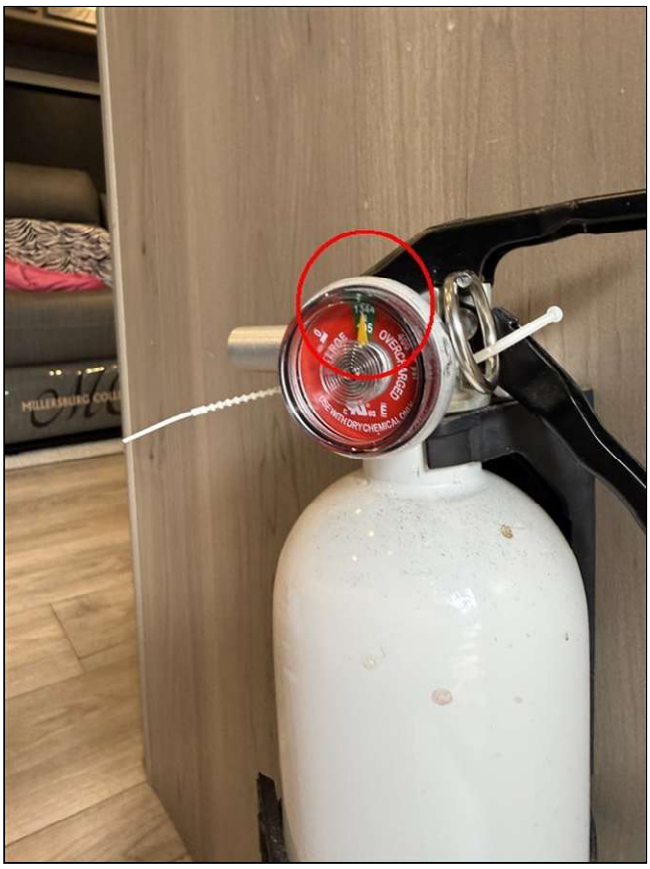

Fire Extinguisher

17. Electrical System 120-Volts AC and 12-Volts DC

Styles & Materials

Power Source:
30 Amp Plug - 120 VAC - 3,600 Watts

Power Converter - AC Power On:
Operational Test
DC Voltage : 14.16

Power Converter - AC Power Off:
Operational Test
DC Voltage : 13.86

Inverter - Brand:
Other
Brand: : LanderPow

Inverter - Model Number:
Not Visible

Inverter - Serial Number:
Not Visible

Inverter - Voltage Output:
Measured Under 50% Load
Voltage Reading in AC Volts : 118.4

Inverter - Frequency Output:
Measured Under 50% Load
Frequency Reading in Hertz : 60.42

12-Volt DC House Battery Disconnect Switch Present:
Yes

12 Volt DC House Battery - Location:
Trailer Tongue

Items

17.0 Polarity / Voltage Test - Exterior Receptacles

Acceptable

Overview



Electrical Panel - Consumer Access Area



Electrical Panel - Consumer Access Area



Electrical Panel - Qualified Technician Access Only Area

17.1 Polarity / Voltage Test - Storage Bay Receptacles

Acceptable

17.3 Polarity / Voltage Test - Kitchen Receptacles

Acceptable

17.4 Polarity / Voltage Test - Living Room Receptacles

Not Inspected

17.5 Polarity / Voltage Test - Dining Area Receptacles
Acceptable

17.6 Polarity / Voltage Test - Bedroom Receptacles
Acceptable

17.7 Polarity / Voltage Test - Bath and Toilet Area Receptacles
Acceptable

17.8 Polarity / Voltage Test - Receptacles Behind all Electronics and Appliances
Acceptable

17.9 Voltage Test - 12-Volt DC Power Outlet(s) - Condition and Operation
Acceptable

17.10 Voltage Test - USB Ports - Condition and Operation
Acceptable

17.11 GFCI Trip Testing - Exterior Receptacles
Acceptable

17.13 GFCI Trip Testing - Kitchen Receptacles
Acceptable

17.14 GFCI Trip Testing - Bathroom Receptacles
Acceptable

17.15 GFCI Trip Testing - Bedroom Receptacle
Acceptable

17.16 GFCI Trip Testing - All Receptacles Behind Electronics and Appliances
Acceptable

17.17 GFCI Trip Testing - Circuit Breaker in Panel Box
Not Present

17.18 Power Cord - Condition
Acceptable

17.19 Electrical Panel Box - Condition
Acceptable

17.20 Electrical Panel Box - Wiring Secure
Acceptable

17.21 Electrical Panel Box - Signs of Repair or Service
No

17.22 Electrical Panel Box - Circuit Breakers in Place
Yes

17.23 Electrical Panel Box - Wiring with Signs of Discoloration from Heat
No

17.24 Electrical Panel Box - All White, Black, and Ground Wires Kept Separate
Yes

17.25 12 Volt DC Fuse Panel - Condition
Acceptable

17.26 12 Volt DC Fuse Panel - Wires and Terminals Tight
Yes

17.27 12 Volt DC Fuse Panel - Fuse Connections - Condition
Acceptable

17.28 12 Volt DC Fuses - Condition

Acceptable

17.29 Power Converter - AC On

Acceptable

Overview



Power Converter - AC On Battery Voltage

17.30 Power Converter - AC Off

Acceptable

Overview



Power Converter - AC Off Battery Voltage

17.31 Power Converter - Operation - Minimum 0.5 Volt DC Drop

Poor

The power converter voltage difference is 0.3 volt DC drop. This is less than the recommended 0.5 volt DC drop. It is recommended that this be further evaluated by a qualified RV technician.



Battery Voltage With Converter (AC) Operating



Battery Voltage With Converter (AC) Not Operating

17.32 12 Volt DC House Battery(s) - Condition
Acceptable

17.33 12 Volt DC House Battery Box(es) - Condition
Acceptable

17.34 12 Volt DC House Battery Box(es) - Vented and Secured
Acceptable

17.35 12-Volt DC House Battery(s) - Matched for Size and Age
Acceptable

17.36 12-Volt DC House Battery(s) - Cables and Terminals - Condition
Acceptable

17.37 12-Volt DC House Battery(s) - Positive and Negative Cables Matched for Load
Acceptable

17.38 12-Volt DC House Battery(s) - Have They Been Maintained?
Acceptable

17.39 12-Volt DC House Battery(s) - Operational
Acceptable

17.40 Inverter - Condition
Acceptable

17.41 Inverter - Cables, Wiring and Fuses - Condition
Acceptable

17.53 Cable and Satellite TV Hookup Visually Acceptable
Acceptable

18. Appliances: Kitchen

NOTE: Refrigerators need to be on for a minimum of 12 hours to be at full cooling condition. This inspection may not reveal a problem if during the inspection the refrigerator was not on for the minimum recommended time.

Styles & Materials

Refrigerator - Brand:
Magic Chef

Refrigerator - Type:
Residential Style – 12 VDC Compressor

Refrigerator - Cooling Source(s):
12 Volts DC

Refrigerator - User Control Panel Location:
Interior Wall in Refrigerator

Refrigerator - Has Unit been Running 12 + Hours:
Yes

Refrigerator - Thermistor Sensor Type:
Not Present

Refrigerator - Vent Panels - Location:
Not Present - Residential Style Refrigerator

Refrigerator - Current Temperature:
Degrees F
Degrees : 48

Refrigerator - Freezer - Current Temperature:
Degrees F
Degrees : 31

Cooktop - Brand:
Magic Chef

Cooktop - Regulator Installed on Propane Line:
Not Visible - Sealed Unit

Cooktop - Burner Ignition Source:
Auto Piezo Ignition - Push Button Creates a Repetitive Spark

Oven - Brand:
Magic Chef

Oven - Burner Ignition Source:
Auto Piezo Ignition - Push Button Creates a Repetitive Spark

Cooktop Exhaust Vent - Part of Microwave:
No

Cooktop Exhaust Vent - Venting Type:
Vents to Exterior

Microwave - Brand:
Magic Chef

Microwave - Type:
Microwave Only

Microwave - Output Wattage Rating:
900 Watts

Microwave - Temperature of Water after 60 Seconds:
Degrees F
Degrees : 121

Microwave - Rack and Turntables are Installed:
Yes

Items

18.2 Refrigerator - Exterior - Dauber Screens Installed
No

18.5 Refrigerator - Condition
Acceptable

18.6 Refrigerator - User Control Panel
Acceptable

18.7 Refrigerator - Front Side Door Panels
Acceptable

18.8 Refrigerator - Front Side Door Frame
Acceptable

18.9 Refrigerator - Front Side Door Seals
Acceptable

18.10 Refrigerator - Door Latch Secure
Acceptable

18.11 Refrigerator - Inside Light - Operation
Acceptable

18.13 Refrigerator - Inside Walls
Acceptable

18.14 Refrigerator - Shelves / Door Racks
Acceptable

18.15 Refrigerator - Crisper Trays and Drawers
Acceptable

18.16 Refrigerator - Odor Detectable
No

18.17 Refrigerator - Water & Ice Dispenser - Condition and Operation
Not Present

18.18 Refrigerator - Ice Maker - Operation
Not Present

18.19 Refrigerator - Freezer - Inside Walls
Acceptable

18.20 Refrigerator - Freezer - Shelves / Door Racks
Acceptable

18.21 Refrigerator - Freezer - Odor Detectable
No

18.22 Cooktop - Condition
Acceptable

18.23 Cooktop - Condition of Knobs / Controls
Acceptable

18.24 Cooktop - Burner Grate / Cover Condition
Acceptable

18.25 Cooktop - Color of Burner Flame
Acceptable

18.26 Cooktop - All Burners Operate
Acceptable

18.27 Cooktop - Rubber Grommets for Stovetop Grate
Acceptable

18.29 Oven - Condition
Acceptable

18.30 Oven - Racks Condition
Acceptable

18.31 Oven - Burner Lights
Acceptable

18.32 Oven - Color of Burner Flame
Acceptable

18.33 Oven - Verified Temperature of 350 Degrees F
Acceptable

18.34 Cooktop Exhaust Vent - Condition
Acceptable

18.35 Cooktop Exhaust Vent - Fan Speeds and Vent Condition
Acceptable

18.36 Cooktop Exhaust Vent - Filter and Lighting Condition
Acceptable

18.37 Microwave - Condition
Acceptable

19. Appliances: Other

NOTE: Mud Dauber screens are stainless steel screens and springs that are designed to keep mud daubers, wasps and spiders from nesting in the appliances. Verify the appliance manufacturers approve of their use prior to installation.

Styles & Materials

Water Heater - Brand:
Suburban

Water Heater - Type:
Tank Type

Water Heater - Heat Source(s):
Propane and Electric

Water Heater - Type of Ignition:
Direct Spark Ignition (DSI)

Water Heater – Water Output Temperature:
Degrees F
Degrees : 121

Water Heater - Bypass Valves in Correct Position:
Yes

Furnace #1 - Brand:
Suburban

Items

19.0 Water Heater - Condition
Acceptable

19.1 Water Heater - Operates on all Sources
Acceptable

19.2 Water Heater - Exterior - Condition of Burner Assembly Area
Acceptable

19.3 Water Heater - Exterior - Rubber Grommet Around Gas Line Sealed
Acceptable

19.4 Water Heater - Exterior - Dauber Screens Installed
No

19.5 Water Heater - Exterior - Leaks at Pressure Relief Valve
No

19.6 Water Heater - Exterior - Proper Drain Plug Installed
Yes

19.7 Furnace #1 - Operation
Acceptable

19.8 Furnace #1 - Floor Vents Blocked or Covered
Acceptable

19.9 Furnace #1 - Warm Air Discharge out of Vents
Acceptable

19.10 Furnace #1 - Return Air Blocked
No

19.11 Furnace #1 - Exterior - Air Intake / Exhaust Area Condition

Acceptable

19.12 Furnace #1 - Exterior - Dauber Screens Installed

Yes

20(A) . Front Air Conditioner (Zone 2 - Bedroom)

NOTE: The Delta-T average acceptable performance range is 14 to 22 degrees F (8 to 12 degrees C). In high humidity areas the range may be lower, 12 to 16 degrees F (12 to 16 degrees C) and in desert areas, it may be higher, 23 to 26 degrees F (13 to 15 degrees C).

Styles & Materials

Air Conditioner - Brand:
Coleman

Air Conditioner - Thermostatic Controls:
Zoned

Air Conditioner - Options:
Air Conditioner Only


Air Conditioner - Delta-T:
Degrees F
Degrees : 20

Items


20.0.A Air Conditioner - Condition

Acceptable


Overview

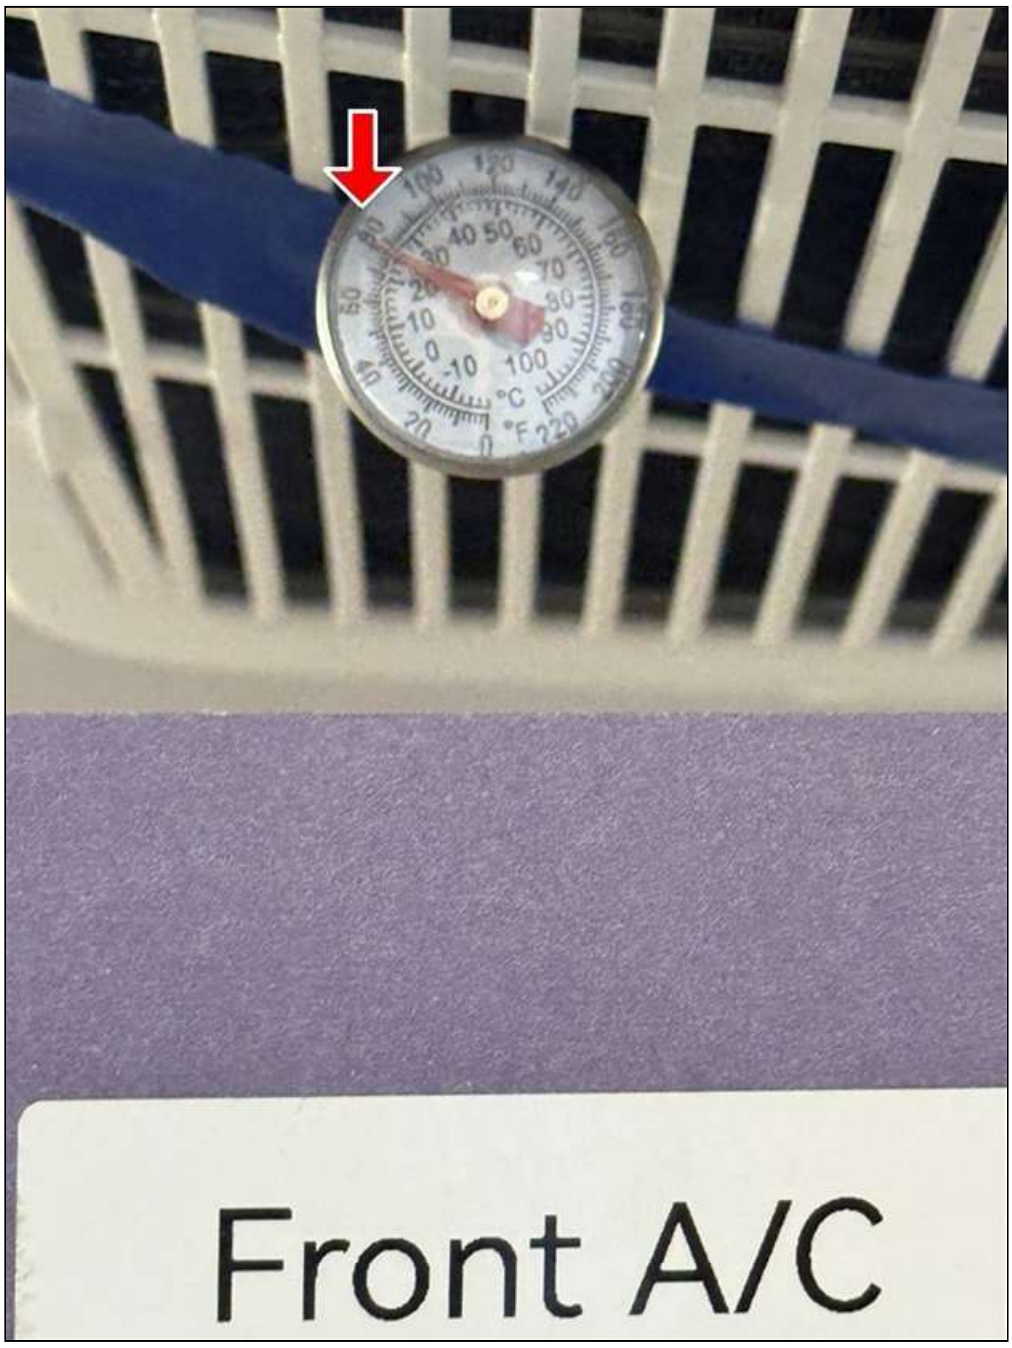

Air Conditioner Air Intake Temperature

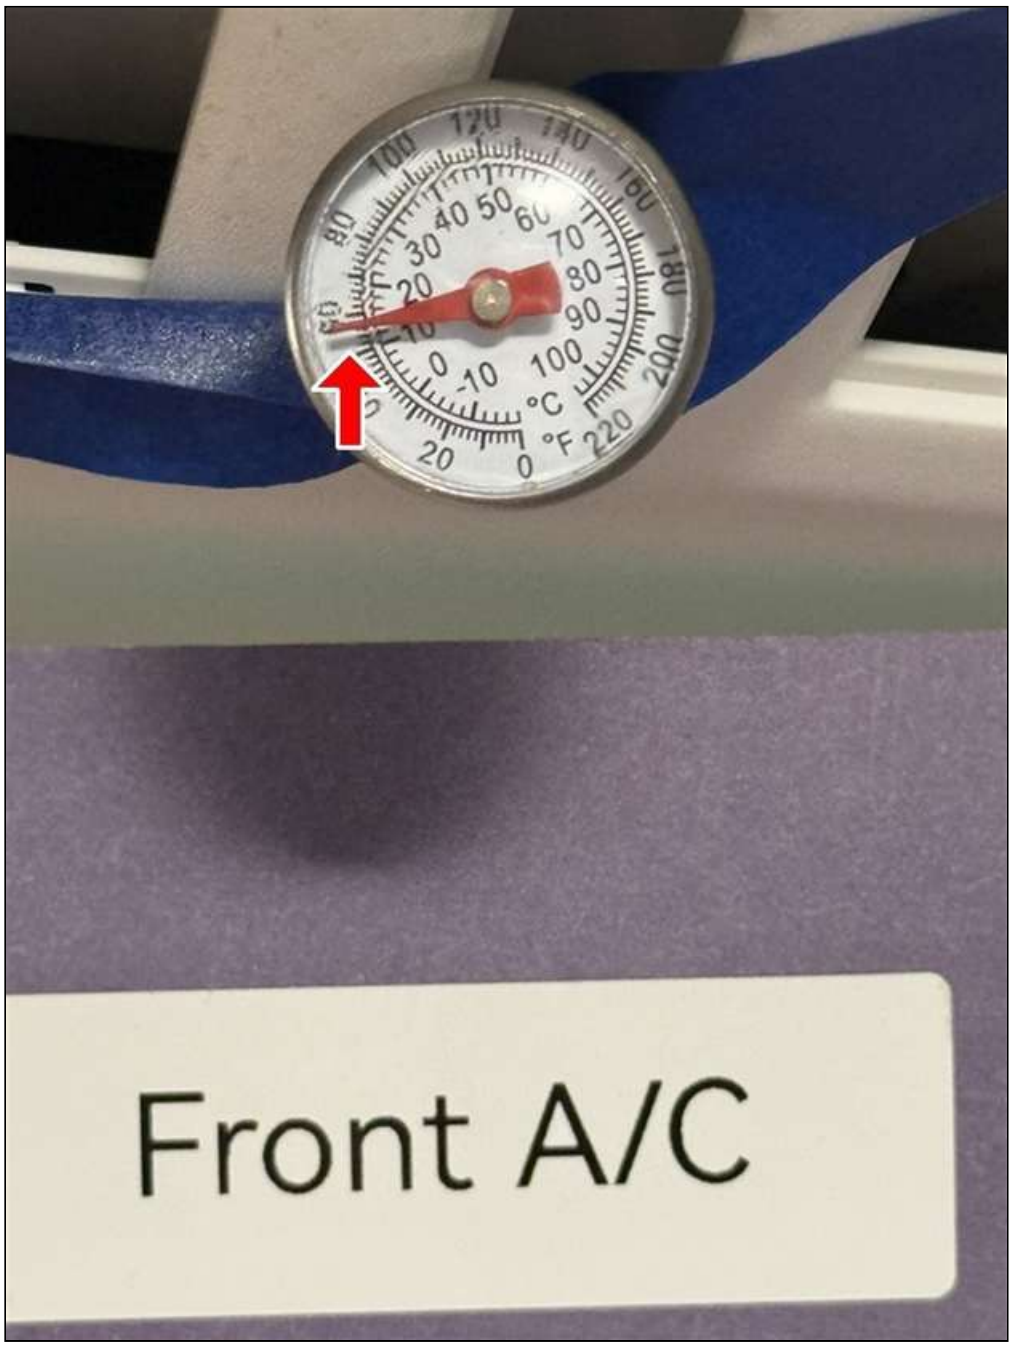

Air Conditioner Cool Air Output Temperature

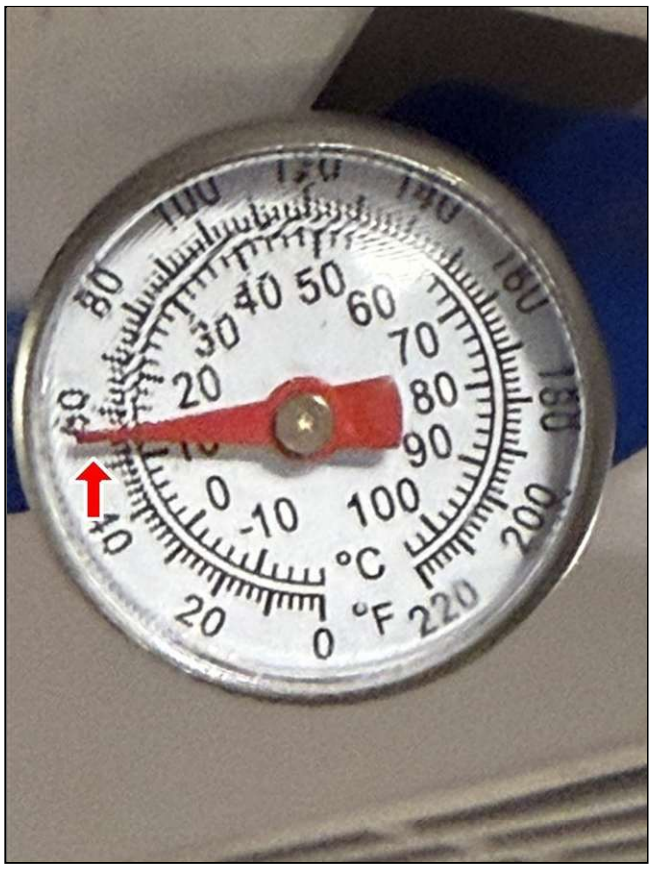

Air Conditioner Cool Air Output Temperature

20.1.A Air Conditioner - Filter Condition
Acceptable

20.2.A Air Conditioner - Plenum - Condition
Acceptable

20.3.A Air Conditioner - Exhaust Condition
Acceptable

20.4.A Air Conditioner - Heat Mode - Operation
Not Present

20(B) . Rear Air Conditioner (Zone 1 - Living Rm / Kitchen)

Styles & Materials

Air Conditioner - Brand:
Coleman
Model # / Serial # : 16

Air Conditioner - Delta-T:
Degrees F
Degrees : 16

Air Conditioner - Thermostatic Controls:
Zoned


Air Conditioner - Options:
Air Conditioner

Items

20.0.B Air Conditioner - Condition

Acceptable

Overview

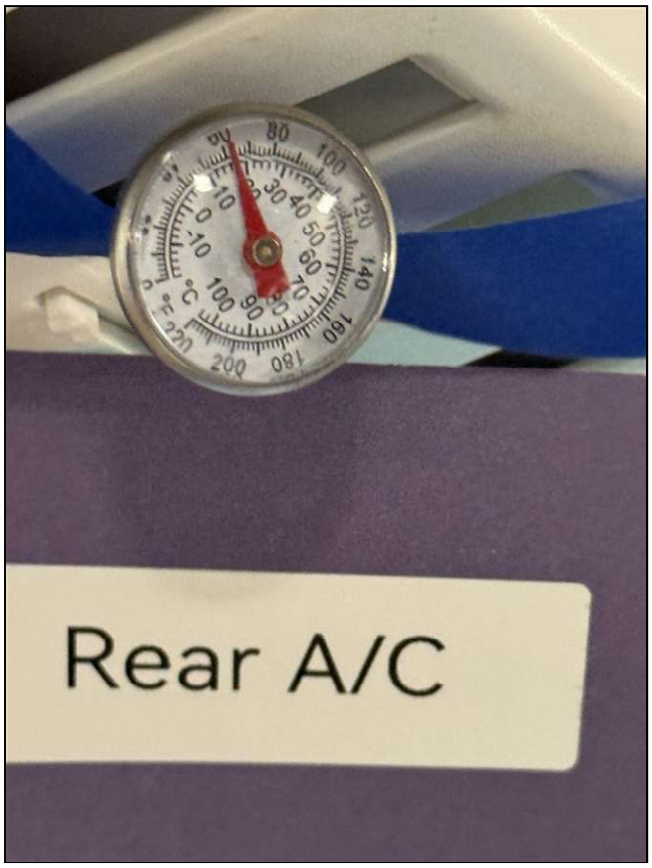

Air Conditioner Cool Air Output Temperature



Air Conditioner Air Intake Temperature

20.1.B Air Conditioner - Filter Condition

Acceptable

20.2.B Air Conditioner - Plenum - Condition

Acceptable

20.3.B Air Conditioner - Exhaust Condition

Acceptable

20.4.B Air Conditioner - Heat Mode - Operation

Not Present

21. Interior Water Systems

Styles & Materials

Kitchen Sink - Style:
Single Bowl

Kitchen Sink - Type:
Stainless

Toilet - Brand:
Dometic
Model / Serial # : Model 310

Toilet - Bowl - Type:
Ceramic

Toilet - Flush - Type:
Foot Flush

Bathroom Sink - Style:
Single Bowl

Bathroom Sink - Type:
Plastic

Shower / Tub - Style:
Shower Stall

Shower / Tub - Enclosure Type:
Glass Doors

Battery Monitor Reading:
Charged

Fresh Water Tank Reading:
Owner asked to not empty or fill the tank

Black Water Tank #1 Reading:
1/3

Gray Water Tank #1 Reading:
Empty

Gray Water Tank #2 / Galley Reading:
Empty

Items

21.0 Kitchen Faucet - Operation and Condition
Acceptable

21.1 Kitchen Faucet - Hot and Cold Water Available
Yes

21.2 Kitchen Faucet - Leaks at Stem
No

21.3 Kitchen Sink - Condition
Acceptable

21.4 Kitchen Sink - Sink(s) Holds Water
Acceptable

21.5 Kitchen Sink - P-Trap Holds Water
Acceptable

21.6 Kitchen Sink - Under Sink Condition
Acceptable

21.7 Toilet - Operation and Condition
Fair

There is discoloration in the bowl near some of the water inlets. It is recommended that this be evaluated by a qualified RV technician.



Toilet Bowl

21.8 Toilet - Bowl Holds Water

Poor

The bowl does not hold water. It is recommended that this be evaluated by a qualified RV technician.



Toilet Bowl

21.9 Toilet - Mounting Problems

No

21.10 Toilet - Water Leaks

No

21.11 Toilet - Indication of Previous Damage or Repair

No

21.17 Shower / Tub - Condition

Acceptable

21.18 Shower / Tub - Operation

Acceptable

21.19 Shower / Tub - Hot and Cold Water Available

Acceptable

21.20 Shower / Tub - Stains, Chemical Buildup in Stall / Tub

No

21.21 Shower / Tub - Discoloration

No

21.22 Shower / Tub - Water Damage or Leaks

No

21.23 Shower / Tub - Glass Doors - Operation
Acceptable

21.24 Shower / Tub - Door and Frame and Seals Condition
Acceptable

21.25 Shower / Tub - Door Latch - Operation
Acceptable

21.27 Shower / Tub - Soap Dish in Place
Acceptable

21.28 Shower / Tub - Towel Racks in Place
Not Present

21.29 Bathroom Faucet - Operation and Condition
Acceptable

21.30 Bathroom Faucet - Hot and Cold Water Available
Acceptable

21.31 Bathroom Faucet - Leaks at Stem
No

21.32 Bathroom Sink - Condition
Acceptable

21.33 Bathroom Sink - Sink(s) Holds Water
Acceptable

21.34 Bathroom Sink - P-Trap Holds Water
Acceptable

21.35 Bathroom Sink - Under Sink Condition
Acceptable

21.43 Battery / Waste / Water Monitor Panel - Condition
Acceptable

22. Interior

Styles & Materials

Ceiling Vents - Type:
Manual Crank Vent - 12V Fan

System Controls / Switches - Type:
Other
Type : WeRV Panel (with Bluetooth)

Lights - Light Bulb – Type:
LED

Cabinets / Pantries - Types of Hinges:
Hidden


Window Coverings / Blinds - Type:
Single Roller - not attached at bottom

Flooring - Type:
Plank

Items

22.0 Interior - Condition
Acceptable

Overview

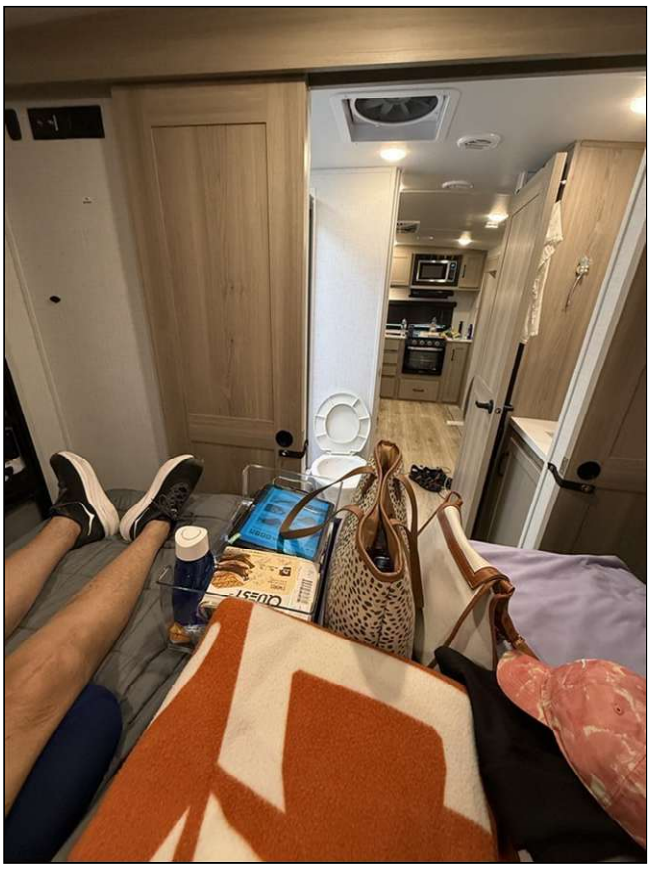

Overview of Interior - Front to Back



Overview of Interior - Back to Front

22.1 System Controls / Switches - Operation

Poor

On the interior system control panel, the Bluetooth button does not light up when pressed. It is recommended that this be further evaluated by a qualified RV technician.

22.2 System Controls / Switches - Condition

Acceptable

22.3 Ceiling - Condition

Acceptable

22.4 Ceiling - Panels Loose

No

22.5 Ceiling - Discoloration or Stains

No

22.6 Ceiling - Damaged Ceiling Panels

No

22.7 Ceiling - Trim Work Missing or Damaged

No

22.8 Ceiling Vents and Skylights - Condition

Acceptable

22.9 Ceiling Vents and Skylights - Thermostatic Controls and Switches Work

Not Present

22.10 Ceiling Vents and Skylights - Trim Ring Around Vents and Skylights

No

22.11 Ceiling Vents and Skylights - Stains Around Roof Vents and Skylights
No

22.12 Ceiling Vents - Manual - Operation
Acceptable

22.13 Ceiling Vents - 12-Volt DC Fans - Operation
Acceptable

22.14 Ceiling Vents - 120-Volt AC Fans - Operation
Not Present

22.18 Lights and Light Fixtures - Condition
Acceptable

22.19 Lights and Light Fixtures - 12-Volt DC Lights - Operation
Acceptable

22.20 Lights and Light Fixtures - 120-Volt AC Lights - Operation
Not Present

22.21 Lights and Light Fixtures - Wall Mounted Light Fixtures - Operation
Acceptable

22.22 Lights and Light Fixtures - Rope Lights - Operation
Not Present

22.23 Lights and Light Fixtures - Spot Lights - Operation
Not Present

22.24 Lights and Light Fixtures - Floor Lights - Operation
Not Present

22.25 Lights and Light Fixtures - Entry Lights inside RV - Operation
Not Present

22.26 Lights and Light Fixtures - Missing or Broken Lenses
No

22.27 Lights and Light Fixtures - Missing Shades or Broken Covers
No

22.28 Walls - Condition
Acceptable

22.29 Walls - Panels Loose
No

22.30 Walls - Damaged Wall Panels
No

22.31 Walls - Panels Discolored or Stained
No

22.32 Walls - Soft Spots
No

22.33 Walls - Trim Work - Condition
Acceptable

22.34 Walls - Damage Repairs Performed
No

22.35 Walls - Holes or Wall Repairs
Acceptable

22.36 Interior Doors - Condition

Fair

There are scrapes at the bottom, bathroom-side, of the sliding doors between the bathroom and bedroom. It is recommended that this be further evaluated by a qualified RV technician.



Bedroom Door - Bathroom Side

22.37 Interior Doors - Operation

Acceptable

22.38 Privacy Curtains / Screens - Condition

Not Present

22.39 Privacy Curtains / Screens - Operation

Not Present

22.40 Cabinets / Pantries - Condition

Acceptable

22.41 Cabinets / Pantries - Operation

Acceptable

22.42 Cabinets / Pantries - Door Damage / Scratches

Yes

22.43 Cabinets / Pantries - Wood Rot or Broken

No

22.44 Cabinets / Pantries - Drawer Damage / Scratches

No

22.45 Cabinets / Pantries - Countertop Damage / Scratches

No

22.46 Windows - Condition

Acceptable

22.47 Windows - Operation

Acceptable

22.48 Windows - Screens - Condition
Acceptable

22.49 Windows - Emergency Exit Windows - Operation
Acceptable

22.50 Windows - Emergency Exit Windows - Installed
Yes

22.51 Windows - Window Coverings / Blinds - Operation
Acceptable

22.52 Windows - Window Coverings / Blinds - Condition
Acceptable

22.53 Flooring - Condition
Acceptable

22.58 Flooring - Plank - Condition
Acceptable

22.59 Flooring - Floor Panels Loose
No

22.60 Flooring - Floor Covering Discolored or Stained
No

22.61 Flooring - Water Damage
No

22.64 Flooring - Soft Spots in Floor
No

22.65 Flooring - Previous Repairs Performed
No

23. Furniture

Styles & Materials

Mattress - Type:
Other
Type: : Brooklyn Bedding 12" Thick (2025)

Closets / Cabinets / Dressers - Types of Hinges:
Hidden

Theater Seating - Type:
Back Recline
Leg Recline

Items

23.0 Chairs - Condition
Acceptable

23.1 Chairs - Fabric Tears or Separation
No

23.2 Chairs - Fabric Discolored or Stains
No

23.3 Chairs - Signs of Excess Wear
No

23.4 Chairs - Water Damage
No

23.11 Theater Seating - Condition
Acceptable

23.12 Theater Seating - Operation
Acceptable

23.13 Dinette or Table and Chairs - Condition
Acceptable

23.14 Dinette or Table and Chairs - Operation
Acceptable

23.15 Dinette or Table and Chairs - Fabric Tears or Separation
No

23.16 Dinette or Table and Chairs - Fabric Discolored or Stains
No

23.17 Dinette or Table and Chairs - Signs of Excess Wear
No

23.18 Dinette or Table and Chairs - Water Damage
No

23.19 Dinette or Table and Chairs - Previous Repairs Performed
No

23.20 Bed(s) - Condition
Acceptable

23.21 Bed(s) - Fabric Tears or Separation
No

23.22 Bed(s) - Fabric Discolored or Stains
No

23.23 Bed(s) - Signs of Excess Wear
No

23.24 Bed(s) - Bed Covers Present
Yes

23.25 Bed(s) - Covers Match Decor
No

23.26 Closets / Cabinets / Dressers - Condition
Acceptable

23.27 Closets / Cabinets / Dressers - Operation
Acceptable

23.28 Closets / Cabinets / Dressers - Door Damage or Scratches
No

23.29 Closets / Cabinets / Dressers - Counter Top Damage or Scratches
No

23.30 Closets / Cabinets / Dressers - Wood Rot or Broken
No

23.31 Closets / Cabinets / Dressers - Drawer Damage or Scratches
No

23.32 Closets Doors / Cabinets Door / Drawers - Pull-Out - Condition
Acceptable

23.33 Closets Doors / Cabinets Door / Drawers - Pull-Out - Operation
Acceptable

23.34 Closets Doors / Cabinets Door / Drawers - Previous Repairs Performed
No

24(A) . Living Room Television

Styles & Materials

Unit Brand:
Other
Model # / Serial # : Connexx

Items

24.0.A Unit Works Properly
Acceptable

24.1.A Unit Cleaned and Maintained
Yes

24.2.A Unit Properly Mounted and Secured
Yes

24.3.A Unit Remote Controls Operational
Yes

24.4.A Antenna - Power Booster Operational
Not Present

24.5.A Antenna - Picks Up Local Channels
Not Present

24(B) . Radio / Stereo

Styles & Materials

Unit Brand:
Other
Model # / Serial # : Connexx

Items

24.0.B Unit Works Properly
Yes

24.1.B Unit Cleaned and Maintained
Yes

24.2.B Unit Properly Mounted and Secured
Yes

24.3.B Unit Remote Controls Operational
Yes

24(C) . Backup Camera

Styles & Materials

Unit Brand:
Other
Model # / Serial # : Vekooto

Items

24.0.C Unit Works Properly
Acceptable

24.1.C Unit Cleaned and Maintained
Acceptable

24.2.C Unit Properly Mounted and Secured
Acceptable

24.3.C Unit Remote Controls Operational
Not Present

24(D) . Front-Facing Camera

Styles & Materials

Unit Brand:
Other
Model # / Serial # : Vekooto

Items

24.0.D Unit Works Properly
Acceptable

24.1.D Unit Cleaned and Maintained
Acceptable

24.2.D Unit Properly Mounted and Secured
Acceptable

24.3.D Unit Remote Controls Operational
Not Present