WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION TOPICS INDEX

1.) Air Powered Flux Recovery for Automatic Welding Heads (Standard Duty) 8-19

2.) Electric Powered Flux Recovery for Automatic Welding Heads (Standard Duty) 20-22

3.) Portable Flux Recovery (Standard Duty), Electric and Air Powered 23-24

4.) Air Powered Tractor Flux Recovery Units 25-26

5.) Electric Powered Tractor Flux Recovery Units.....27

6.) Flux Feed Tank Design.....28,75

7.) Portable Pressure Feed and Recovery Systems.....29

8.) Lincoln Pressure Tank Recovery Systems (Standard Duty).....30

9.) Flux Pressure Feed Tanks 31,32,76,77

10.) Submerged Arc Flux Re-Bake Ovens.....31-36

11.) Mighty-Might Flux Handling System Accessories.....37-50

12.) Mighty-Mac Heavy Duty Flux Recovery Equipment 51-56

13.) Portable Heavy Duty Flux Recovery Systems (Heated and Unheated) 57-60

14.) SPS Heavy Duty Flux Recovery Systems.....61,62

15.) MV-5, 3 O'Clock Tank Flux Recovery System.....63

16.) Accessories for Mighty-Mac and SPS Vacuum Systems Vacuums.....64-74,86-96

17.) Pressure Feed and Recovery Systems.....78-83

18.) Pressure Feed Automatic Mixing Systems.....84,85

19.) Recommended Consumable Parts for "Mighty-Might" Flux Recovery System.....50

20.) Recommended Consumable Parts for Heavy Duty Systems.....95-96

WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION EQUIPMENT INDEX

AFV-2.....43,73
AUTOMATIC FLUX PINCH VALVE

AFV-2-1 1/2..... 43
1-1/2" AUTOMATIC FLUX PINCH VALVE

AFV-32.....43,73
AUTOMATIC FLUX SLIDE VALVE

AFV-32-1 1/2.....44
1-1/2" AUTOMATIC FLUX SLIDE VALVE

AFV-2-FH-100.....73
AUTOMATIC FLUX VALVE

AIR JET.....50
AIR JET FOR AIR PUMP IN AIR-POWERED FLUX VACUUMS

AIR PUMP..... 50
AIR PUMP FOR AIR-POWERED FLUX VACUUMS

ALT-2..... 27
MIGHTY MIGHT ELECTRIC FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING

ALT-2-C.....27
MIGHTY MIGHT ELECTRIC FLUX RECOVERY SYSTEM FOR LINCOLN ELECTRIC "CRUISER" TRACTOR MOUNTING

AP-1..... 8,9
MIGHTY MIGHT AIR-POWERED FLUX VACUUM

AP-1-E/P.....11,12
AIR-POWERED FLUX VACUUM WITH AUTOMATIC FLUX TRANSFER TO LOWER HOPPER

AP-1-HD.....49
HEAVY DUTY KIT FOR AIR POWERED FLUX VACUUMS

AP-2-HD.....49
HEAVY DUTY KIT FOR AIR POWERED FLUX VACUUMS

APT-2.....25
AIR-POWERED MIGHTY MIGHT FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING

APT-2-C.....25
AIR-POWERED MIGHTY MIGHT FLUX RECOVERY SYSTEM FOR LINCOLN ELECTRIC "CRUISER" TRACTOR MOUNTING

AS-4.....20,21
MIGHTY MIGHT ELECTRIC FLUX VACUUM WITH AUTOMATIC FLUX TRANSFER TO LOWER HOPPER

AS-4-E/P.....20,22
ELECTRIC FLUX VACUUM

AV-3000-NS.....79
AUTOMATIC FLUX TRANSFER VALVE WITH HIGH/ LOW SENSOR

AV-4.....37
ELECTRIC AIR VALVE

BAC-3000.....92
AIR CONTROL FOR FLUX TROUGH

DC-30.....39
DUST COLLECTOR

DHK-55.....64
DUST HOSE KIT

DUST BAG ASSEMBLY.....50

ELECTRONIC FLUX LEVEL SENSORS
HOPPERS/SEPARATORS 45,46
PRESSURE FEED TANKS.....45,46

EXHAUST ELBOWS.....50

F/A-3000..... 91
FLUX RECOVERY LINE SHUT-OFF VALVE

FCV-3000..... 91
FLUX CONTROL VALVE

FD-1.....48,93
FLUX DAM FOR BUILDING UP SMALL DIAMETER ROLLS

WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION EQUIPMENT INDEX

FD-55..... 64
DUST DRUM

FF-3..... 44,87
FLUX FEED PIPE

FFC-1.....46,89
FLUX FILLING CONE

FH-1.....41,71
35 POUND FLUX HOPPER

FH-100.....65
150 POUND FLUX HOPPER/SEPARATOR CHAMBER

FH-1000.....65
1000 LB. FLUX HOPPER/SEPARATOR CHAMBER

FH-100-E/P.....66
150 POUND AUTOMATIC FLUX HOPPER/
SEPARATOR CHAMBER

FH-100-E/P-MILL.....67
150 POUND SUPER HEAVY DUTY AUTOMATIC
FLUX HOPPER/SEPARATOR CHAMBER

FH-1-60.....41,71
60 POUND FLUX HOPPER

FH-3 & FH-3-60.....42
FLUX HOPPER FOR XP-3 & XP-4T

FH-300.....65
300 LB. FLUX HOPPER/SEPARATOR CHAMBER9

FH-300-E/P.....66
300 POUND AUTOMATIC FLUX HOPPER/
SEPARATOR CHAMBER

FH-600.....65
600 LB. FLUX HOPPER/SEPARATOR CHAMBER

FHM-1..... 37,96
FLUX HOSE MOUNTING BRACKET

FHM-1ADJ.....37,96
FLUX HOSE MOUNTING BRACKET WHICH
ALLOWS RECOVERY NOZZLE TO "FLOAT"
OVER WELD

FILTERS
FINE FLUX FILTER.....50
FLUX FILTER FOR XP-3 50
MIGHTY MAC - CARTRIDGE DUST FILTER..... 95
MIGHTY MAC - TEFLON COATED POLYESTER..... 95
MOTOR FILTER .....,50

FO-700HT.....29
700 POUND HIGH TEMPERATURE SUBMERGED
ARC FLUX OVEN

FO-700HT-AB..... 36
700 POUND HIGH TEMPERATURE AUTO-REBAKE
SUBMERGED ARC FLUX OVEN

FP-1.....43,73
FLUX PORT

FT-100.....86
FLUX TROUGH

FTV-3000..... 78
AUTOMATIC FLUX TRANSFER VALVE

FV-1.....40,90
IN-LINE FLUX VALVE

GHAMX-150..... 71
300 POUND HEATED AUTOMATIC MIXING
GRAVITY FED HOPPER/SEPARATOR

HAMX-50.....70
50 POUND HEATED AUTOMATIC MIXING GRAVITY
FED HOPPER/SEPARATOR

HFH-1.....42,72
35 POUND HEATED FLUX HOPPE

HFH-100.....65
150 POUND HEATED FLUX HOPPER/
SEPARATOR CHAMBER

HFH-1000..... 65
1000 POUND HEATED FLUX HOPPER/
SEPARATOR CHAMBER

HFH-100-E/P..... 66
150 POUND AUTOMATIC HEATED FLUX HOPPER/
SEPARATOR CHAMBER

WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION EQUIPMENT INDEX

HFH-100-E/P-MILL.....67
150 POUND SUPER HEAVY DUTY AUTOMATIC HEATED FLUX HOPPER/SEPARATOR CHAMBER

HFH-1-60.....42,72
60 POUND HEATED FLUX HOPPER

HFH-3 & HFH-3-60.....42
FLUX HOPPER FOR XP-3 & XP-4T

HFH-3-PF..... 72
7 POUND HEATED FLUX HOPPER

HFH-4-PF..... 72
17 POUND CAPACITY HEATED FLUX HOPPER

HFH-300..... 65
300 POUND HEATED FLUX HOPPER/ SEPARATOR CHAMBER

HFH-300-E/P.....66
300 POUND AUTOMATIC HEATED FLUX HOPPER/ SEPARATOR CHAMBER

HFH-600.....65
600 POUND HEATED FLUX HOPPER/ SEPARATOR CHAMBER

HLPFR-3000.....80
HEATED FLUX HOPPER/SEPARATOR FOR FLUX FEED TANK MOUNTING

HOSE
DUST COLLECTOR HOSE.....39
3/4" AND 1" HIGH TEMP. PRESSURE FEED HOSE 46,90
1/2", 3/4", AND 1" PRESSURE FEED HOSE.....46,90
1 1/2" STANDARD DUTY FLUX RECOVERY HOSE 48
1 1/2" HEAVY DUTY FLUX RECOVERY HOSE.....48,90
2" FLUX RECOVERY HOSE.....58.60,62
2" VACUUM HOSE.....90
2 1/2" VACUUM HOSE.....58,60,62

HPFR-3000-H200/100..... 82
100 POUND HEATED PRESSURE FEED TANK AND 150 POUND FLUX HOPPER/SEPARATOR

HPFR-3000-H200/H100..... 83
100 POUND HEATED PRESSURE FEED TANK AND 150 POUND HEATED FLUX HOPPER/SEPARATOR

HPFR-3000-H300/300..... 82
300 POUND PRESSURE FEED TANK AND 300 POUND HEATED FLUX HOPPER/SEPARATOR

HPFR-3000-H300/H300.....83
300 POUND HEATED PRESSURE FEED TANK AND 300 POUND HEATED FLUX HOPPER/ SEPARATOR

HPFR-3000-H400/600..... 82
600 POUND PRESSURE FEED TANK AND 400 POUND HEATED FLUX HOPPER/SEPARATOR

HPFR-3000-H400/H600.....83
600 POUND HEATED PRESSURE FEED TANK AND 600 POUND HEATED FLUX HOPPER/ SEPARATOR

HPFR-3000-H1200/1000..... 82
1000 POUND PRESSURE FEED TANK AND 1200 POUND HEATED FLUX HOPPER/SEPARATOR

HPFR-3000-H1200/H1000.....83
1000 POUND HEATED PRESSURE FEED TANK AND 1200 POUND HEATED FLUX HOPPER/ SEPARATOR

HPFR-3000-H2000/2000.....82
2000 POUND PRESSURE FEED TANK AND 2000 POUND HEATED FLUX HOPPER/SEPARATOR

HPFR-3000-H2000/H2000.....83
2000 POUND HEATED PRESSURE FEED TANK AND 2000 POUND HEATED FLUX HOPPER/ SEPARATOR

HPFR-HAMX-3000-H100/H100..... 85
50 POUND HEATED AUTOMATIC MIXING FLUX HOPPER/SEPARATOR WITH 100 POUND HEATED PRESSURE FEED TANK

HPFR-HAMX-3000-H300/H300..... 85
300 POUND HEATED AUTOMATIC MIXING FLUX HOPPER/SEPARATOR WITH 300 POUND HEATED PRESSURE FEED TANK

WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION EQUIPMENT INDEX

HPS-1500..... 59
1.5 HP HEATED PORTABLE FLUX RECOVERY SYSTEM

HPS-2-A/P..... 23
HEATED AIR-POWERED PORTABLE FLUX VAC

HPS-3000.....59
4 HP HEATED PORTABLE FLUX RECOVERY SYSTEM

HPS-5000.....59
5.5 HP HEATED PORTABLE FLUX RECOVERY SYSTEM

HPS-7500.....60
7.5 HP HEATED PORTABLE FLUX RECOVERY SYSTEM

HPT-100.....31,76
100 POUND HEATED FLUX PRESSURE FEED TANK

HPT-100/D.....32,77
100 POUND HEATED FLUX PRESSURE FEED TANK WITH AIR DRYER

HPT-300.....31,76
300 POUND HEATED FLUX PRESSURE FEED TANK

HPT-600.....31,76
600 POUND HEATED FLUX PRESSURE FEED TANK

HTP-100-850° 33
100 POUND 850°F AUTO-REBAKE SUBMERGED ARC PORTABLE SUPER FLUX OVEN

HTS-700-850° 35
700 POUND 850°F AUTO-REBAKE SUBMERGED ARC STATIONARY SUPER FLUX OVEN

IMPINGEMENT PLATES
HEAVY DUTY / LARGE IMPINGEMENT PLATE.....50,96
STANDARD DUTY / SMALL IMPINGEMENT PLATE.....50,96

INLET NOZZLE..... 96

LAFV-32.....47,74,88
AIR POWERED SLIDE VALVE FOR LINCOLN ELECTRIC K219 FLUX HOPPER

LID-55.....64
DUST DRUM LID

LPFR-3..... 30
ELECTRIC FLUX RECOVERY SYSTEM FOR FLUX FEED TANK MOUNTING

LPFR-3000..... 80
HEAVY DUTY FLUX RECOVERY SYSTEM FOR FLUX FEED TANK MOUNTING

LPFR-3-A/P..... 30
AIR-POWERED FLUX RECOVERY SYSTEM FOR FLUX FEED TANK MOUNTING

MADP-1..... 48
ADAPTER PLATE FOR MILLER HOPPERS

MAFV-32.....47,74,88
AIR POWERED SLIDE VALVE FOR MILLER ELECTRIC FLUX HOPPER

MAGSEP-1.....40,71
MAGNETIC SEPARATOR

MAGSEP-100 40,68,86
MAGNETIC SEPARATOR

MAGSEP-100-E/P.....40,69,86
MAGNETIC SEPARATOR

MAGSEP-2.....40,71
MAGNETIC SEPARATOR

MM-1500X.....51
1 1/2 HP MIGHTY MAC 1500X HEAVY DUTY VACUUM

MM-1500X/P..... 51
1 1/2 HP MIGHTY MAC 1500X/P HEAVY DUTY VACUUM

MM-3000X.....52
3 HP MIGHTY MAC 3000X HEAVY DUTY VACUUM

WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION EQUIPMENT INDEX

MM-3000X/P..... 52
3 HP MIGHTY MAC 3000X/P HEAVY DUTY VACUUM

MM-5000X.....53
5 HP MIGHTY MAC 5000X HEAVY DUTY VACUUM

MM-5000X/P..... 53
5 HP MIGHTY MAC 5000X/P HEAVY DUTY VACUUM

MM-5000X-MILL.....5 4
5 HP MIGHTY MAC 5000X-MILL SUPER HEAVY DUTY VACUUM

MS-1.....69
SEPARATOR

MS-1-E/P..... 70
AUTOMATIC SEPARATOR

MV-5..... 63
LOW COST, HEAVY DUTY RECOVERY SYSTEM

NZ-1.....38,93
STANDARD FLUX PICKUP NOZZLE

NZ-1-4.....38,93
WIDE FLUX PICKUP NOZZLE

NZ-1BUTT.....38,93
BUTT WELD FLUX PICKUP NOZZLE

NZ-1CRN.....38,93
CORNER WELD FLUX PICKUP NOZZLE

NZ-2.....93
2" HOSE DIA. FLUX PICK-UP NOZZLE

PAS-1.....41
PORTABLE FLUX HOPPER

PFO-100.....34
100 POUND PORTABLE SUBMERGED ARC FLUX OVEN

PFO-100-AB..... 34
100 POUND AUTO-REBAKE PORTABLE SUBMERGED ARC FLUX OVEN

PFR-3..... 29
ELECTRIC PORTABLE FLUX PRESSURE FEED AND RECOVERY SYSTEM

PFR-3000-200/100.....81
100 POUND PRESSURE FEED TANK AND 150 POUND FLUX HOPPER/SEPARATOR

PFR-3000-300/300.....81
300 POUND PRESSURE FEED TANK AND 300 POUND FLUX HOPPER/SEPARATOR

PFR-3000-400/600.....81
600 POUND PRESSURE FEED TANK AND 400 POUND FLUX HOPPER/SEPARATOR

PFR-3000-1200/1000.....81
1000 POUND PRESSURE FEED TANK AND 1200 POUND FLUX HOPPER/SEPARATOR

PFR-3000-2000/2000.....81
2000 POUND PRESSURE FEED TANK AND 2000 POUND FLUX HOPPER/SEPARATOR

PFR-3-A/P..... 29
AIR-POWERED PORTABLE FLUX PRESSURE FEED AND RECOVERY SYSTEM

PFR-HAMX-3000.....84
HEATED AUTOMATIC MIXING 50 POUND OR 150 FLUX HOPPER/SEPARATOR WITH 100 POUND PRESSURE FEED TANK

PFR-LD3.....45,87
PRESSURE FEED LID

PIPE MILL ID & OD NOZZLES.....94

POWER WAND.....49,94
ADJUSTABLE FLUX LOADING NOZZLE FOR 1-1/2" AND 2" RECOVERY HOSE

PS-1500..... 58
1.5 HP PORTABLE FLUX RECOVERY SYSTEM

PS-2..... 23
MIGHTY MIGHT PORTABLE ELECTRIC FLUX VAC

WELD
ENGINEERING CO., INC
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842- 3893
Email: sales@weldengineering.com
Website: www.weldengineering.com
March 1, 2018

PRODUCT SELECTION EQUIPMENT INDEX

PS-2-A/P..... 23
AIR-POWERED PORTABLE FLUX VAC

PS-3000.....57
4 HP PORTABLE FLUX RECOVERY SYSTEM

PS-5000.....57
5.5 HP PORTABLE FLUX RECOVERY SYSTEM

PS-7500.....58
7.5 HP PORTABLE FLUX RECOVERY SYSTEM

PT-100..... 31,76
100 POUND FLUX PRESSURE FEED TANK

PT-3.....31
60 POUND FLUX PRESSURE FEED TANK

PT-300..... 31,76
300 POUND FLUX PRESSURE FEED TANK

PT-600..... 31,76
600 POUND FLUX PRESSURE FEED TANK

RFHM-7.....38
REAR HOSE MOUNTING BRACKET FOR TRACTOR FLUX RECOVERY

SPS-1500.....61,62
1.5 HP FLUX RECOVERY SYSTEM

SPS-3000.....61,62
4 HP FLUX RECOVERY SYSTEM

SPS-5000.....61,62
5.5 HP FLUX RECOVERY SYSTEM

SPS-7500.....61,62
7.5 HP FLUX RECOVERY SYSTEM

SUPER AIR PUMP (TWIN AIR PUMP).....49
AIR PUMP FOR SUPER FLUX VACUUMS

SUPER AP-1..... 8,10
MIGHTY MIGHT AIR-POWERED FLUX VAC

SUPER AP-1-E/P.....11,13
AUTOMATIC FLUX TRANSFER MIGHTY MIGHT AIR-POWERED FLUX VAC

SUPER-FH-100-A/P..... 17,19
150 POUND CAPACITY AIR-POWERED FLUX VAC WITH HOPPER/SEPARATOR

SUPER-FH-100-A/P-E/P.....18-19
150 POUND CAPACITY AIR-POWERED FLUX VAC WITH HOPPER/SEPARATOR

SUPER-HFH-100-A/P.....17,19
HEATED 150 POUND CAPACITY AIR-POWERED FLUX VAC WITH HOPPER/SEPARATOR

SUPER-HFH-100-A/P-E/P.....18-19
HEATED 150 POUND CAPACITY AIR-POWERED FLUX VAC WITH HOPPER/SEPARATOR

SUPER-HPS-2-A/P.....24
HEATED AIR-POWERED PORTABLE FLUX VAC

SUPER-LPFR-3-A/P.....30
AIR-POWERED FLUX RECOVERY SYSTEM FOR FLUX FEED TANK MOUNTING

SUPER-PFR-3-A/P.....29
AIR-POWERED PORTABLE FLUX PRESSURE FEED AND RECOVERY SYSTEM

SUPER-PS-2-A/P.....24
AIR-POWERED PORTABLE FLUX VAC

T-NOZ-XX".....45,89
PRESSURE FEED FLUX TANK NOZZLE

V/L-3000..... 92
VACUUM LINE SHUT-OFF VALVE

VACUUM MOTOR 115V or 220V.....50

VFT-3000..... 92
VACUUM LINE CONTROL VALVE

XP-3..... 14,15
MIGHTY MIGHT AIR-POWERED FLUX VAC

XP-3TRAC.....26
ULTRA-LIGHTWEIGHT AIR-POWERED MIGHTY MIGHT FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING

XP-3TRAC-C.....26
ULTRA-LIGHTWEIGHT AIR-POWERED MIGHTY MIGHT FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING

XP-4T.....14,16
MIGHTY MIGHT AIR-POWERED FLUX VAC

Y-3000..... 92
HOSE SPLITTER

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

PRODUCT SELECTION PAGES FOR FLUX RECOVERY EQUIPMENT "MIGHTY-MIGHT" (STANDARD DUTY, PAGES 1 TO 42); AND "MIGHTY-MAC" (HEAVY DUTY, PAGES 43 TO 88).

AIR POWERED FOR AUTOMATIC WELDING HEADS


1. AP-1 MIGHTY-MIGHT *"AIR POWERED"* FLUX VAC.

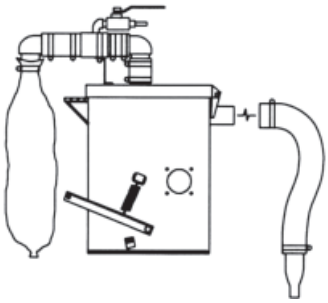

Powerful ***air operated vacuum*** introduces no oil or water into the flux and produces no damage to recovered flux particles since recovered flux is not in compressed air stream. AP-1 mounts directly to standard Lincoln Flux Hopper and newer Miller Flux Hoppers. (Use MADP-1 for FH308B Miller Hoppers (*See page 41). (Can be adapted to any automatic welding head by using optional FH-1 Flux Hopper.) Comes complete with five (5) feet of hose, hopper mounting brackets, NZ-1 nozzle and flux hopper sight glass. (FHM-1 or FHM-1ADJ flux hose mounting brackets and MAGSEP-1 Magnetic Separator are optional; see pages 30 and 33.)
See page 2 for recommended system order list.

Input power: Shop air (8 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

2. SUPER-AP-1 MIGHTY-MIGHT *"AIR POWERED"* FLUX VAC.

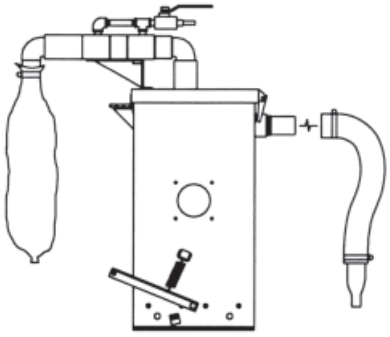

Same as regular AP-1, except this unit has twice the vacuum power and twice the flux capacity of the AP-1. Also has dump valve lever and sight glass windows on both sides of unit. Comes complete with five (5) feet of hose, hopper mounting brackets, NZ-1 nozzle and flux hopper sight glass. (FHM-1 or FHM-1ADJ flux hose mounting brackets and MAGSEP-1 Magnetic Separators are optional; see pages 30 and 33).
See page 3 for recommended system order list.

Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/2" I.D. air hose).


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: WWW.WELDENGINEERING.COM
EMAIL: SALES@WELDENGINEERING.COM

FIG. 1

AP-1 FLUX-VAC MOUNTED TO LINCOLN OR OTHER O.E.M. AUTOMATIC WELDING EQUIPMENT.

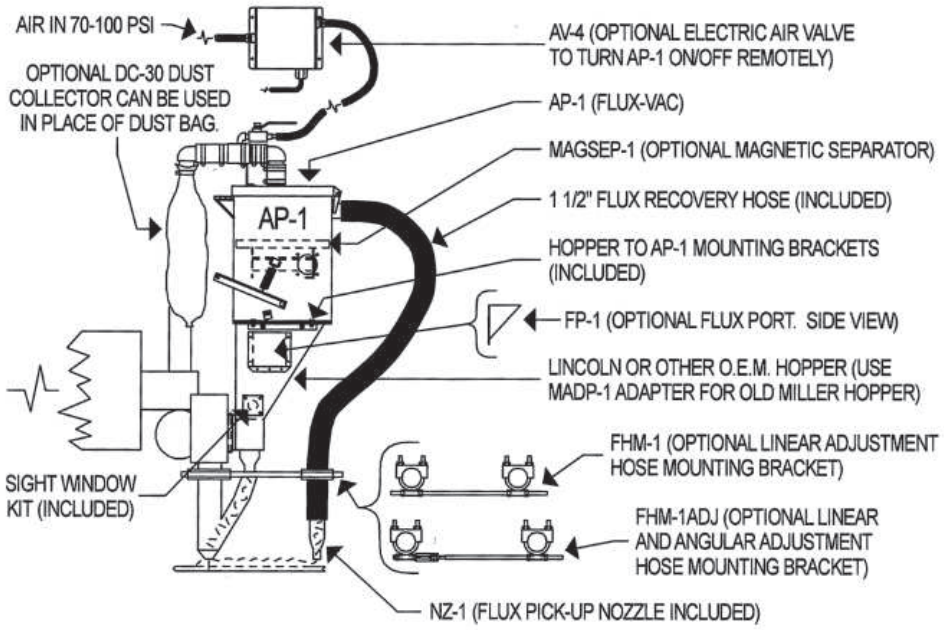

RECOMMENDED SYSTEM ORDER LIST:

1) AP-1 (FLUX-VAC)
   INCLUDED WITH AP-1 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AP-1 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FP-1 (FLUX PORT ENABLES LOADING OF FLUX WITHOUT INTERRUPTING WELDING).

4) OPTIONAL MADP-1 (ADAPTER PLATE USED ONLY IF MOUNTING ON OLD MILLER HOPPER).

5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).


6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).

FIG. 2

AP-1 FLUX-VAC MOUNTED TO OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER. (40 LBS. CAPACITY)

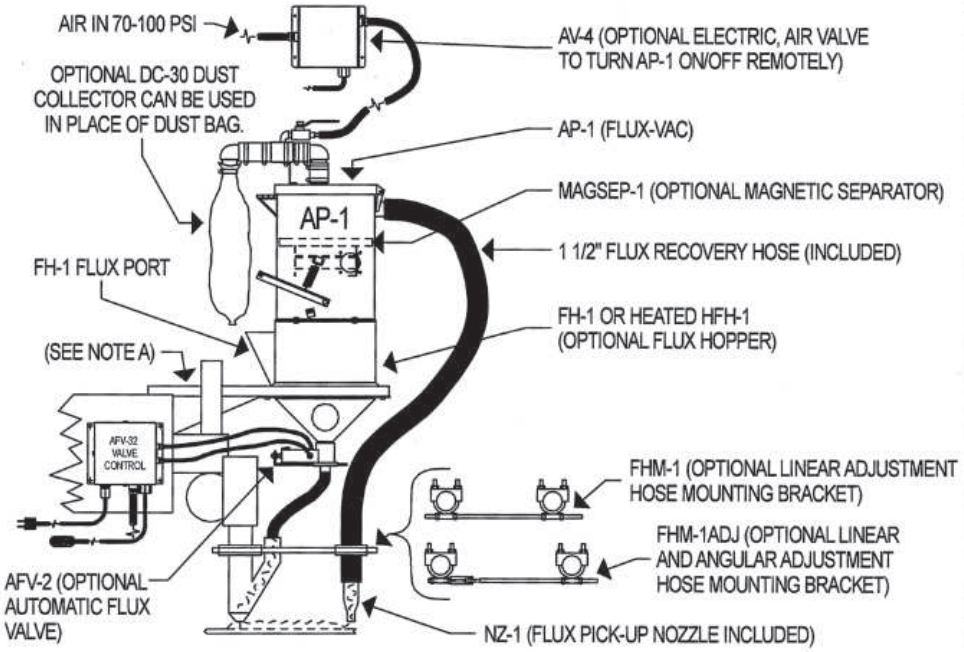

RECOMMENDED SYSTEM ORDER LIST:

1) AP-1 (FLUX-VAC)
   INCLUDED WITH AP-1 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AP-1 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER FOR MORE FLUX CAPACITY. (SEE NOTE A FOR MOUNTING).

4) OPTIONAL AFV-32 (AUTOMATIC FLUX VALVE AND CONTROL).

5) OPTIONAL (MAGSEP-1 MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

NOTE A: MOUNTING FRAME

CUSTOMER PROVIDES MOUNTING FRAME FROM FLUX HOPPER TO WELDING HEAD.

BULLETIN: (PAGE 1) TB-708
FILE: 01~AP-1 TB.CAD
REVISED: AP1-TB.DWG (1-6-1994 TB-MM394)
WELD ENGINEERING CO., INC.
JWW 10-29-2014


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: WWW.WELDENGINEERING.COM
EMAIL: SALES@WELDENGINEERING.COM

FIG. 5

SUPER-AP-1 FLUX-VAC MOUNTED TO LINCOLN OR OTHER O.E.M. AUTOMATIC WELDING EQUIPMENT.

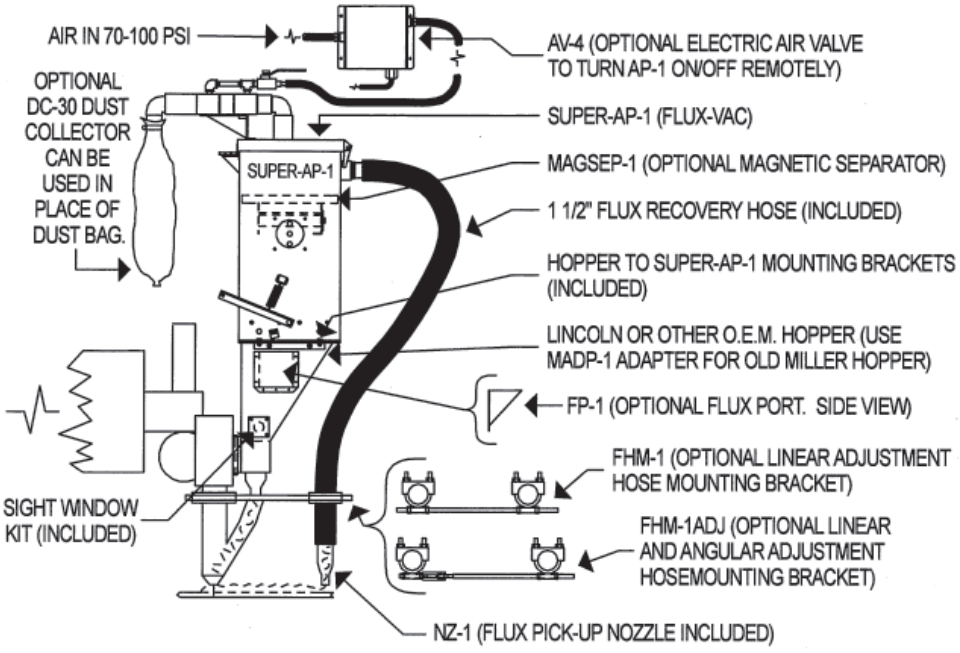

RECOMMENDED SYSTEM ORDER LIST:

1) SUPER-AP-1 (FLUX-VAC)
   INCLUDED WITH SUPER-AP-1 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AP-1 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FP-1 (FLUX PORT ENABLES LOADING OF FLUX WITHOUT INTERRUPTING WELDING).

4) OPTIONAL MADP-1 (ADAPTER PLATE USED ONLY IF MOUNTING ON OLD MILLER HOPPER).

5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).


6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).

FIG. 6

SUPER-AP-1 FLUX-VAC MOUNTED TO OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER. (40 LBS. CAPACITY)

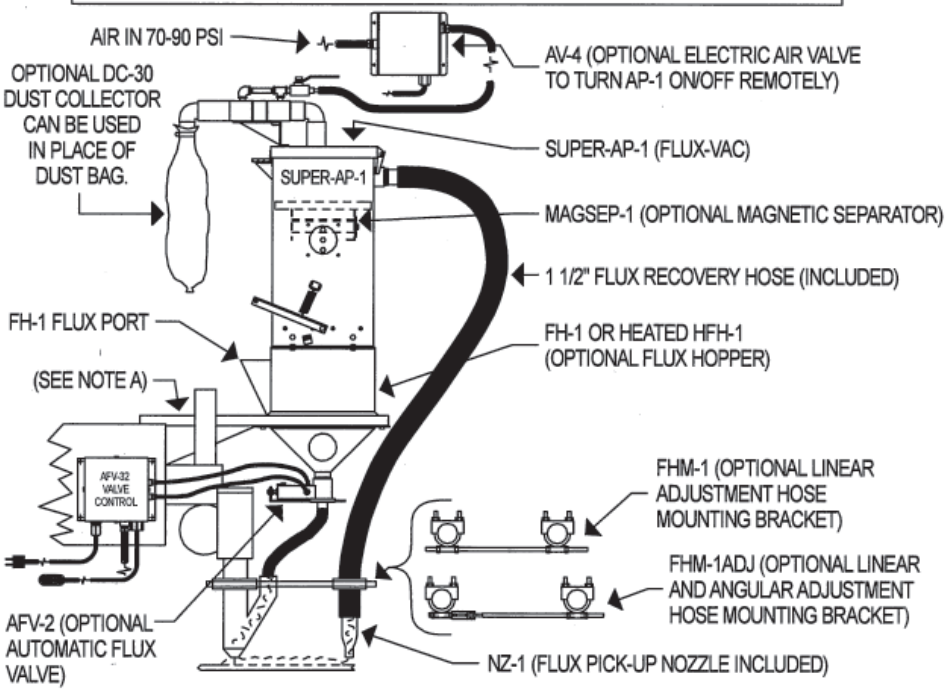

NOTE A: MOUNTING FRAME

CUSTOMER PROVIDES MOUNTING FRAME FROM FLUX HOPPER TO WELDING HEAD.

RECOMMENDED SYSTEM ORDER LIST:

1) SUPER-AP-1 (FLUX-VAC)
   INCLUDED WITH SUPER-AP-1 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AP-1 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER FOR MORE FLUX CAPACITY. SEE NOTE A FOR MOUNTING.

4) OPTIONAL AFV-32 (AUTOMATIC FLUX VALVE AND CONTROL).

5) OPTIONAL (MAGSEP-1 MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)


7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).

BULLETIN: (PAGE 3) TB-708
FILE: SUPER-AP-1-01-22-15
WELD ENGINEERING CO., INC.
TML 02-22-15

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


3. AP-1-E/P AUTOMATIC FLUX TRANSFER MIGHTY-MIGHT *"AIR POWERED"* FLUX VAC.

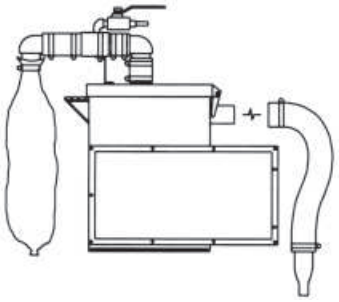

Same as AP-1, except flux is automatically transferred to lower hopper without operator input. Requires same air power input as AP-1, plus 115v/1ph/50-60hz input (220v unit also available).
See page 5 for recommended system order list.

Input power: Shop air (8 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

4. SUPER-AP-1-E/P AUTOMATIC FLUX TRANSFER MIGHTY-MIGHT *"AIR POWERED"* FLUX VAC.

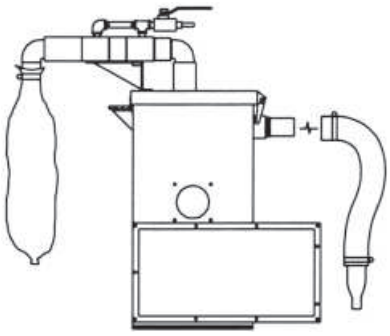

Same as SUPER-AP-1, except flux is automatically transferred to lower hopper without operator input. This unit has twice the vacuum power and twice the flux capacity as the AP-1-E/P. Requires same air power input as SUPER-AP-1, plus 115v/1ph/50-60hz input (220v unit also available).
See page 6 for recommended system order list.

Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: **WWW.WELDENGINEERING.COM**
EMAIL: **SALES@WELDENGINEERING.COM**

FIG. 3:

AP-1-E/P FLUX-VAC MOUNTED TO LINCOLN OR OTHER O.E.M. AUTOMATIC WELDING EQUIPMENT.

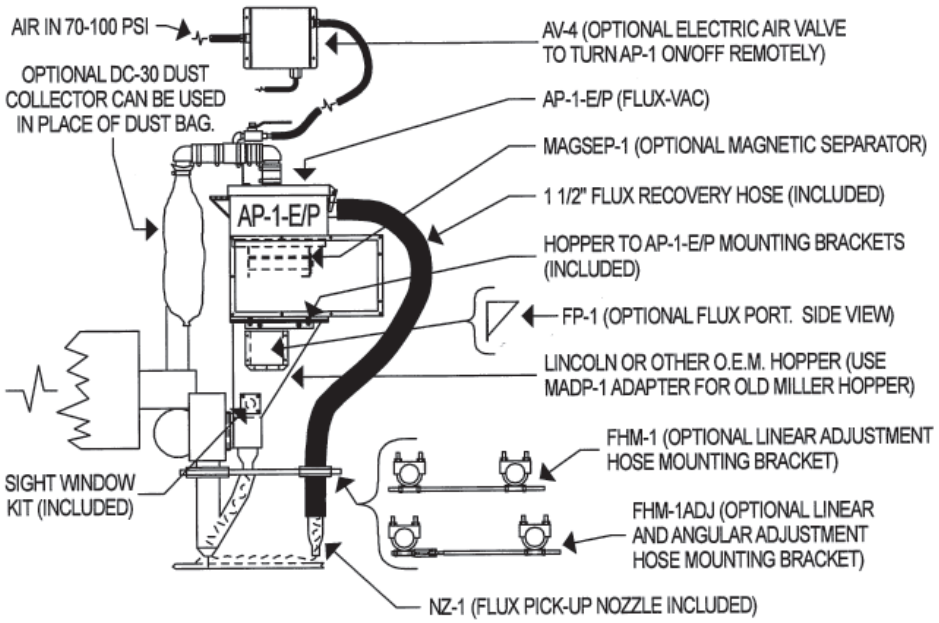

RECOMMENDED SYSTEM ORDER LIST:

1) AP-1-E/P (FLUX-VAC)
INCLUDED WITH AP-1-E/P AT NO EXTRA COST:
A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
B) HOPPER TO AP-1 MOUNTING BRACKETS.
C) NZ-1 (FLUX PICK-UP NOZZLE).
D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
FHM-1 (LINEAR ADJUSTMENT ONLY)
FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FP-1 (FLUX PORT ENABLES LOADING OF FLUX WITHOUT INTERRUPTING WELDING).

4) OPTIONAL MADP-1 (ADAPTER PLATE USED ONLY IF MOUNTING ON OLD MILLER HOPPER).

5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).


6) OPTIONAL FLUX PICK-UP NOZZLES:
NZ-1 CRN (CORNER NOZZLE)
NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).

FIG. 4:

AP-1-E/P FLUX-VAC MOUNTED TO OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER. (40 LBS. CAPACITY)

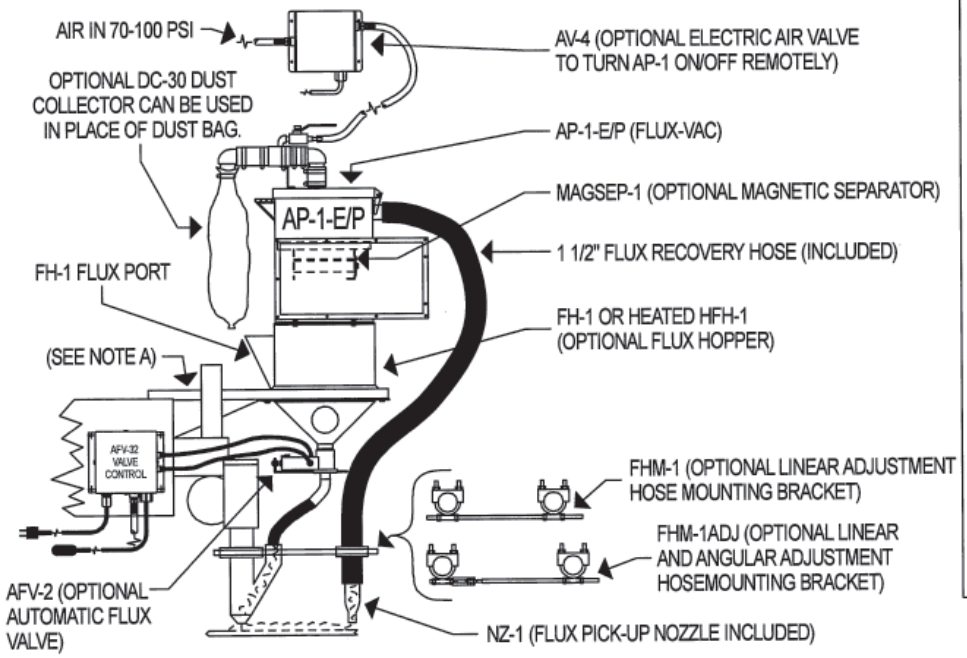

RECOMMENDED SYSTEM ORDER LIST:

1) AP-1-E/P (FLUX-VAC)
INCLUDED WITH AP-1-E/P AT NO EXTRA COST:
A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
B) HOPPER TO AP-1 MOUNTING BRACKETS.
C) NZ-1 (FLUX PICK-UP NOZZLE).
D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
FHM-1 (LINEAR ADJUSTMENT ONLY)
FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER FOR GREATER FLUX CAPACITY. SEE NOTE A FOR MOUNTING.

4) OPTIONAL AFV-32 (AUTOMATIC FLUX VALVE AND CONTROL).

5) OPTIONAL (MAGSEP-1 MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
NZ-1 CRN (CORNER NOZZLE)
NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).

NOTE A: MOUNTING FRAME

CUSTOMER PROVIDES MOUNTING FRAME FROM FLUX HOPPER TO WELDING HEAD.

BULLETIN: (PAGE 2) TB-708
FILE: AP-1-EP-TB-01-21-15
WELD ENGINEERING CO., INC.
TML 01-22-15


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: **WWW.WELDENGINEERING.COM**
EMAIL: **SALES@WELDENGINEERING.COM**

FIG. 7:

SUPER AP-1-E/P FLUX-VAC MOUNTED TO LINCOLN OR OTHER O.E.M. AUTOMATIC WELDING EQUIPMENT.

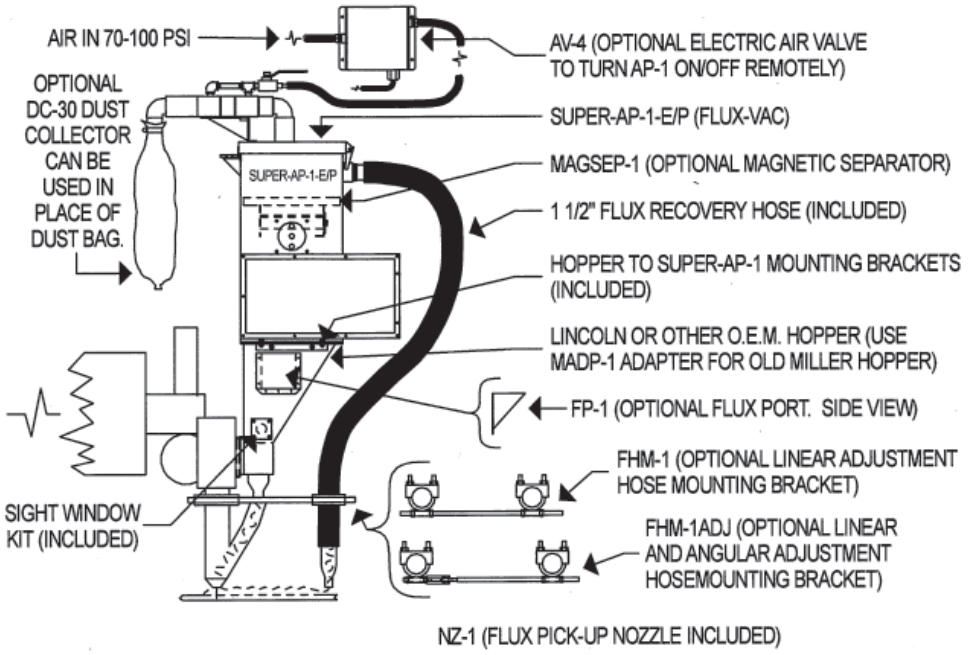

RECOMMENDED SYSTEM ORDER LIST:

1) SUPER-AP-1-E/P (FLUX-VAC). INCLUDED WITH SUPER-AP-1-E/P AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AP-1 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FP-1 (FLUX PORT ENABLES LOADING OF FLUX WITHOUT INTERRUPTING WELDING).

4) OPTIONAL MADP-1 (ADAPTER PLATE USED ONLY IF MOUNTING ON OLD MILLER HOPPER).

5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).


6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).

FIG. 8:

SUPER-AP-1-E/P FLUX-VAC MOUNTED TO OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER. (40 LBS. CAPACITY)

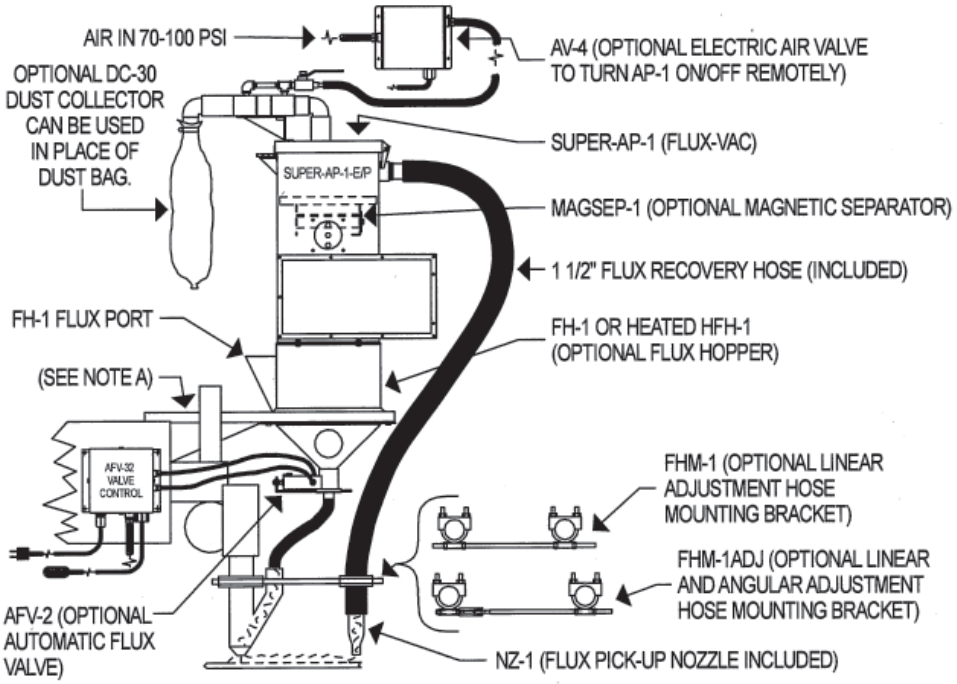

RECOMMENDED SYSTEM ORDER LIST:

1) SUPER-AP-1-E/P (FLUX-VAC). INCLUDED WITH SUPER-AP-1-E/P AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AP-1 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER FOR MORE FLUX CAPACITY. SEE NOTE A FOR MOUNTING.

4) OPTIONAL AFV-32 (AUTOMATIC FLUX VALVE AND CONTROL).

5) OPTIONAL (MAGSEP-1 MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER DUST CAPACITY AND LESS MAINTENANCE).


NOTE A: MOUNTING FRAME

CUSTOMER PROVIDES MOUNTING FRAME FROM FLUX HOPPER TO WELDING HEAD.

FILE: SUPER-AP-1-EP-01-22-15.CAD
WELD ENGINEERING CO., INC.
TML 01-22-15

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


5. XP-3 MIGHTY-MIGHT *"AIR POWERED"* FLUX VAC.

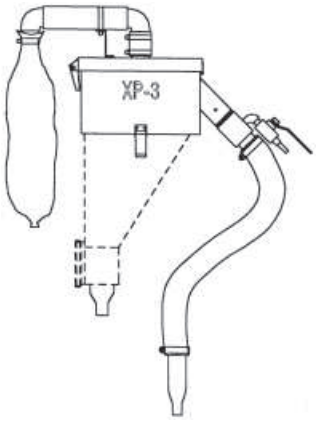

Powerful ***air operated flux vacuum*** mounts on top of Standard Lincoln (Hopper p/n L-3552-F) and new Miller flux hopper. Please consult our factory for other applications in which a Lincoln L-3552-F or Miller hopper is not present. The XP-3 is very compact and lightweight and continuously feeds recovered flux to hopper **without the need of any flux transfer valve. (Since recovered flux passes through compressed air stream in air pump, it is necessary to use clean, dry compressed air supply {no oil, dirt or water}.)** Dust bag and internal filter removes unwanted dust from recovered flux. Comes complete with five (5) feet of 1 1/2" recovery hose, standard NZ-1 flux pick up nozzle, and two hopper sight windows. (FHM-1 and FHM-1ADJ Flux Hose Mounting Brackets are optional, see page 30.)
See page 8 for recommended system order list.

Input power: **Clean and dry compressed air**
(70-100 psi @ 8 cfm, using a minimum 1/4" I.D. air hose).

6. XP-4T MIGHTY-MIGHT *"AIR POWERED"* FLUX VAC.

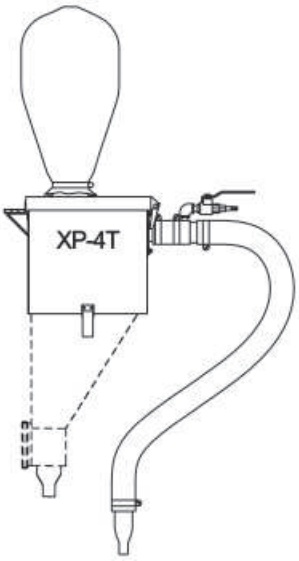

Powerful ***air operated flux vacuum*** mounts on top of Standard Lincoln flux hopper (Hopper p/n L-3552-F). Please consult our factory for other applications in which a Lincoln L-3552-F hopper is not present. Recycles flux dust and *does not require any emptying of the dust bag.* Vertical dust bag allows flux dust to be recycled back into the system. The XP-4T is very compact and lightweight and continuously feeds recovered flux to hopper **without the need of any flux transfer valve. (Since recovered flux passes through compressed air stream in air pump, it is necessary to use clean, dry compressed air supply {no oil, dirt or water}.)** Comes complete with five (5) feet of 1 1/2" recovery hose, standard NZ-1 flux pick up nozzle, and two hopper sight windows. (FHM-1 and FHM-1ADJ Flux Hose Mounting Brackets are optional, see page 30).
See page 9 for recommended system order list.

Input power: **Clean and dry compressed air**
(70-100 psi @ 8 cfm, using a minimum 1/4" I.D. air hose).

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE:
WWW.WELDENGINEERING.COM
EMAIL:
SALES@WELDENGINEERING.COM

FIGURE 9

FIG. 9:

XP-3 FLUX-VAC MOUNTED TO LINCOLN ELECTRIC FLUX HOPPER.

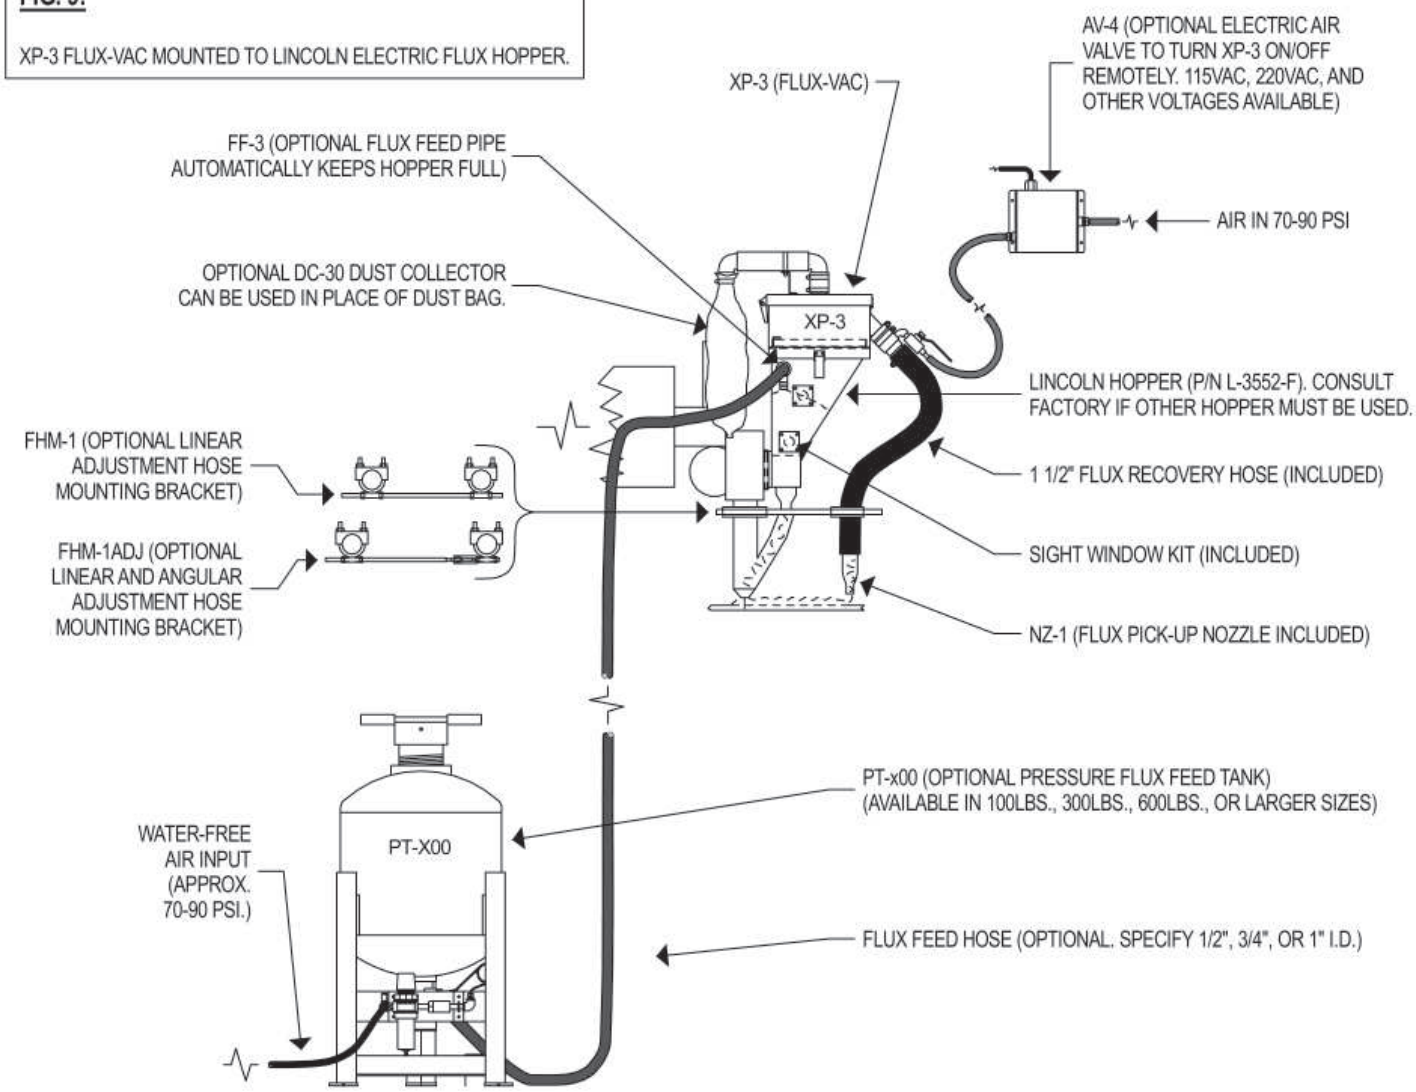

RECOMMENDED SYSTEM ORDER LIST:

1) XP-3 (FLUX-VAC)
   INCLUDED WITH XP-3 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) NZ-1 (FLUX PICK-UP NOZZLE).
   C) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

4) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).

5) OPTIONAL FF-3 (FLUX FEED PIPE AUTOMATICALLY KEEPS HOPPER FULL OF FLUX IF USING PT-xOO OR SIMILAR FEED TANK. SPECIFY I.D. OF 1/2", 3/4", OR 1").

6) OPTIONAL PT-x00 FLUX FEED TANK (AVAILABLE IN 100LBS., 300LBS., 600LBS., OR LARGER SIZES).

7) OPTIONAL FLUX FEED HOSE. (SPECIFY 1/2", 3/4", OR 1" I.D. SIZE).

8) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

BULLETIN: (PAGE 5) TB-708
FILE: 05~ XP-3 TB-DRT 7-29-2008.CAD
REVISED: XP3-TB.CAD (7-1-1998 TB-394)
WELD ENGINEERING CO., INC.
DRT 11-18-2009

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE:
WWW.WELDENGINEERING.COM
EMAIL:
SALES@WELDENGINEERING.COM

FIGURE 10

FIG. 10:

XP-4T FLUX VACUUM MOUNTED TO LINCOLN ELECTRIC FLUX HOPPER.

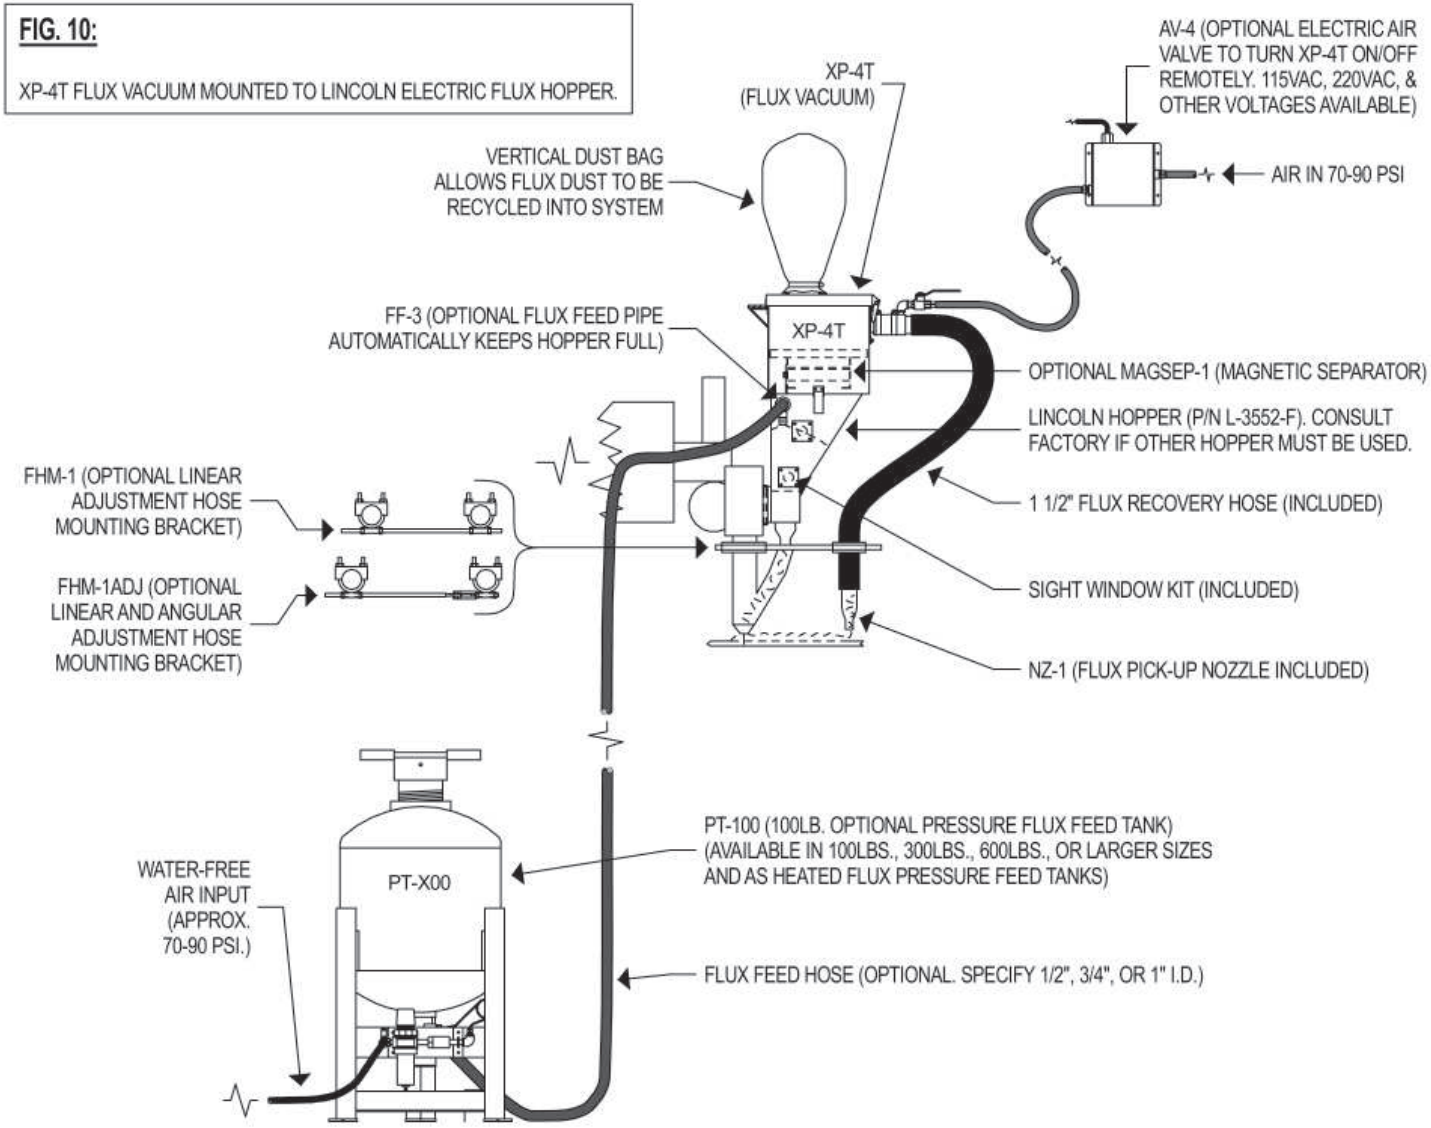

INCLUDED AT NO EXTRA COST:

1) XP-4T (FLUX VACUUM)
2) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
3) NZ-1 (FLUX PICK-UP NOZZLE).
4) 2 HOPPER SIGHT WINDOWS.

OTHER OPTIONAL ACCESSORIES AVAILABLE:


1) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).
2) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)
3) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).
4) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).
5) OPTIONAL FF-3 (FLUX FEED PIPE AUTOMATICALLY KEEPS HOPPER FULL OF FLUX IF USING PT-100 OR SIMILAR FEED TANK. SPECIFY I.D. OF 1/2", 3/4", OR 1").
6) OPTIONAL 100LB. PT-100 OR HEATED HPT-100 FLUX PRESSURE FEED TANK [ALSO AVAILABLE IN 300LB. PT-300 OR HEATED HPT-300, 600LB. PT-600 OR HEATED HPT-600, OR LARGER SIZES].
7) OPTIONAL FLUX FEED HOSE. (SPECIFY 1/2", 3/4", OR 1" I.D. SIZE).

BULLETIN: (PAGE 6) TB-708
FILE: 06~ XP-4T TB-DRT 12-17-2011.CAD
WELD ENGINEERING CO., INC.
DRT 12-19-2011

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


7. SUPER-FH-100-A/P 150 POUND CAPACITY *"AIR POWERED"* FLUX VAC WITH HOPPER/SEPARATOR.

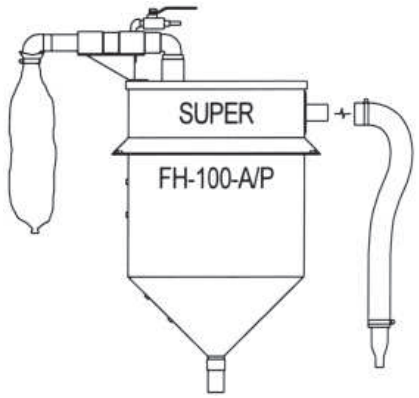

Powerful ***air operated vacuum*** introduces no oil or water to the flux and produces no damage to the recovered flux particles since recovered flux is not in the compressed air stream. The SUPER-FH-100-A/P is a 150 pound capacity gravity feed recovery unit with a slag tray, and two large sight window level indicators. Comes complete with 7 feet of 1 1/2" dispensing hose and 10 feet of 1 1/2" recovery hose, and NZ-1 flux pick-up nozzle.
(See page 12 for recommended system order list.)

Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

8. SUPER-HFH-100-A/P HEATED 150 POUND CAPACITY *"AIR POWERED"* FLUX VAC WITH HOPPER/SEPARATOR.

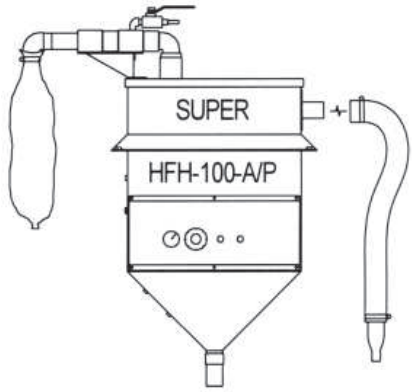

The SUPER-HFH-100-A/P is the same as the SUPER-FH-100-A/P, except heated. It has a Continuous digital thermostat control (ambient to 250°F {121°C}) and large digital display for easy reading.. Please specify voltage (115V/1PH/50-60HZ or 220V/1PH/50-60HZ).
(See page 12 for recommended system order list.)


Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

9. SUPER-FH-100-A/P-E/P 150 POUND CAPACITY *"AIR POWERED"* FLUX VAC WITH HOPPER/SEPARATOR.

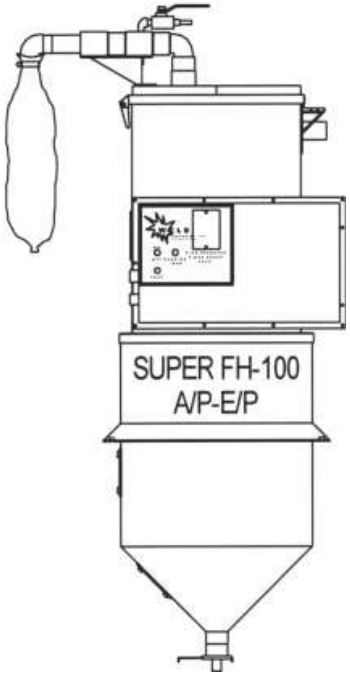


Powerful ***air operated vacuum*** introduces no oil or water to the flux and produces no damage to recovered flux particles since recovered flux is not in compressed air stream. The SUPER-FH-100-A/P-E/P is a 150 pound capacity, automatic flux transfer, continuous feed recovery unit with a slag tray, and two large sight window level indicators. Comes complete with 5 feet of 1 1/2" dispensing hose and 8 feet of 1 1/2" recovery hose, and NZ-1 flux pick-up nozzle.
(Important note: This unit does not require a specific "head height" above welding torch or hopper as does the SUPER-FH-100-A/P.) See page 12 for recommended system order list.

Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

115V/1PH/50-60HZ (Other voltages available).

10. SUPER-HFH-100-A/P-E/P 150 POUND CAPACITY *"AIR POWERED"* FLUX VAC WITH HOPPER/SEPARATOR.

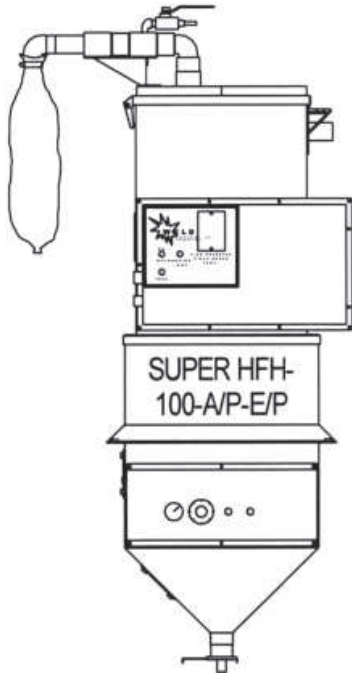

The SUPER-HFH-100-A/P-E/P is the same as the SUPER-FH-100-A/P-E/P except heated. Continuous digital thermostat control (ambient to 250°F {121°C}) and large digital display for easy reading Please specify voltage (115V/1PH/50-60HZ or 220V/1PH/50-60HZ).
See page 12 for recommended system order list.

Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

115V/1PH/50-60HZ (Other voltages available).


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: WWW.WELDENGINEERING.COM
EMAIL: SALES@WELDENGINEERING.COM

FIG. 10:

AIR OPERATED SUPER-FH-100-A/P OR (HEATED) SUPER-HFH-100-A/P FLUX-VAC.

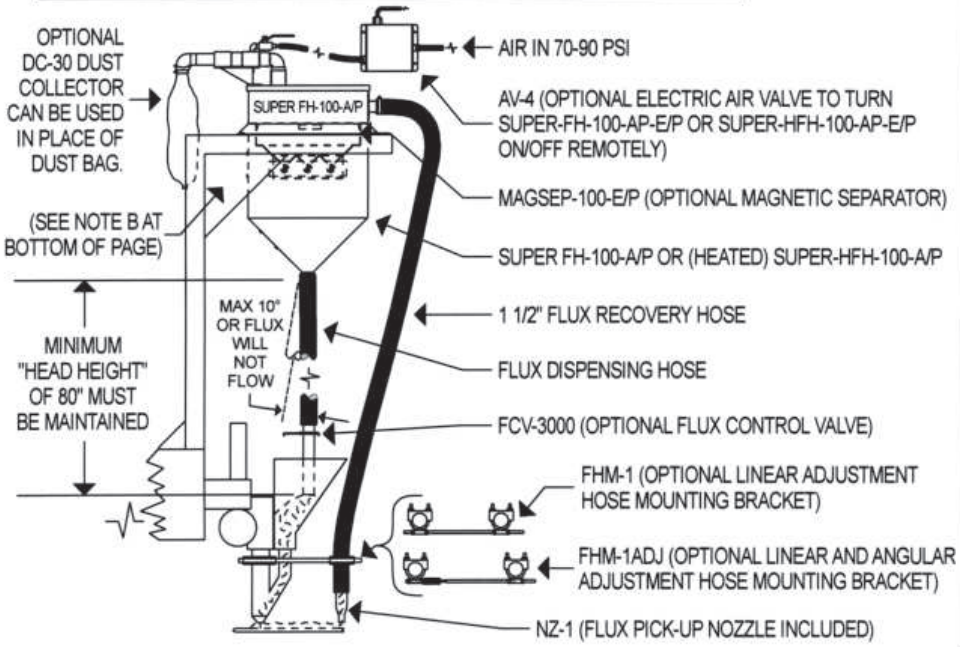


RECOMMENDED SYSTEM ORDER LIST:

1) AIR OPERATED SUPER-FH-100-A/P OR (HEATED) SUPER-HFH-100-A/P (FLUX-VAC) INCLUDED WITH UNIT AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (10FT. LONG).
   B) 1 1/2" FLUX DISPENSING HOSE (7FT. LONG)
   C) NZ-1 (FLUX PICK-UP NOZZLE).
2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).
3) OPTIONAL FCV-3000 (FLUX CONTROL VALVE).
4) OPTIONAL MAGSEP-100 (MAGNETIC SEPARATOR).
5) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)
6) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).
7) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

FIG. 11:

AIR OPERATED SUPER-FH-100-A/P-E/P OR (HEATED) SUPER-HFH-100-A/P-E/P FLUX-VAC.

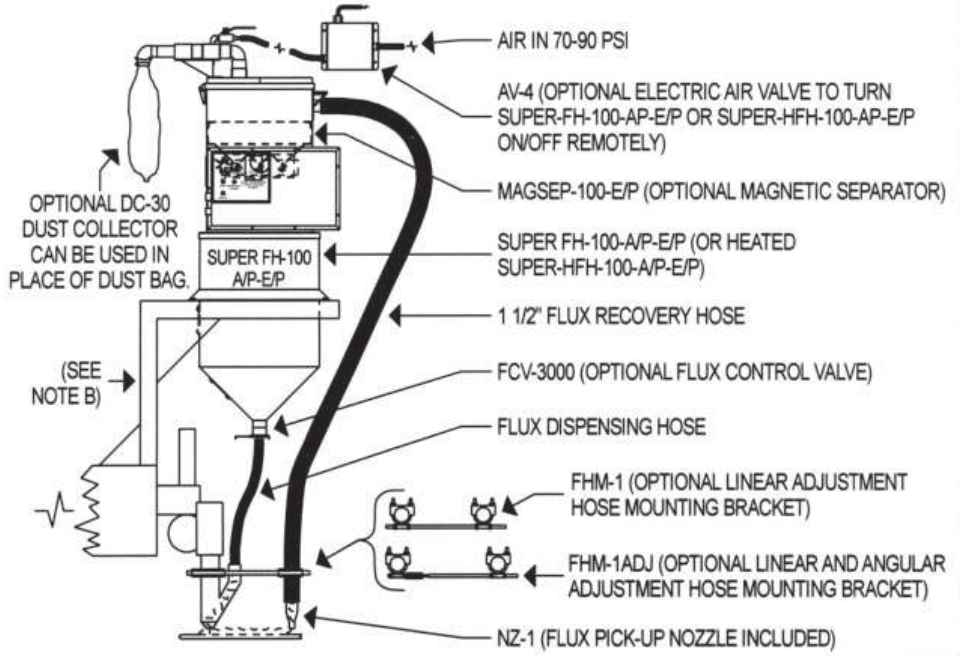

RECOMMENDED SYSTEM ORDER LIST:

1) AIR OPERATED SUPER-FH-100-A/P-E/P OR (HEATED) SUPER-HFH-100-A/P-E/P(FLUX-VAC) INCLUDED WITH UNIT AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (8FT. LONG).
   B) 3/4" FLUX DISPENSING HOSE (5FT. LONG).
   C) NZ-1 (FLUX PICK-UP NOZZLE).
2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).
3) OPTIONAL FCV-3000 (FLUX CONTROL VALVE).
4) OPTIONAL MAGSEP-100-E/P (MAGNETIC SEPARATOR).
5) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT BUTT NOZZLE)
6) OPTIONAL AV-4 (ELECTRIC AIR VALVE. 115VAC, 220VAC, AND OTHER VOLTAGES AVAILABLE).
7) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

NOTE A: "HEAD HEIGHT" ELIMINATED

HOPPER CAN BE PLACED IN ANY CONVENIENT POSITION (NOT SENSITIVE TO "HEAD HEIGHT")

NOTE B: MOUNTING BRACKETS

MOUNTING BRACKETS FOR UNIT ARE PROVIDED BY CUSTOMER.

BULLETIN: (PAGE 6) TB-MM708
FILE: 06~ SUPER-FH-100 TB-DRT 7-31-2008.CAD
REVISED: SUPER-FH-100-TB.CAD (6-25-1996 TB-MM394)
WELD ENGINEERING CO., INC.
DRT 8-4-2008


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

ELECTRIC POWERED FOR AUTOMATIC WELDING HEADS

1. AS-4 MIGHTY-MIGHT ELECTRIC FLUX VAC.

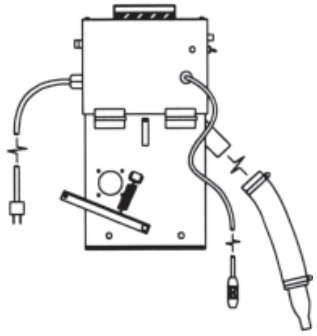


The AS-4 features flashing indicator light when dust bag requires cleaning, flux level sight window in AS-4 and lower hopper. The AS-4 mounts directly to standard Lincoln flux hopper. Use MADP-1* adapter plate (*See page 41 for mounting to Miller hopper). The AS-4 can be adapted to any automatic welding head using optional FH-1 or HFH-1 heated flux hopper (see page 34 and 35). Comes complete with five (5) feet of hose, hopper mounting brackets, NZ-1 nozzle and flux hopper sight glass. (FHM-1 or FHM-1ADJ Flux Hose Mounting Brackets and MAGSEP-1 Magnetic Separator are optional, see pages 30 and 33).
See page 14 for recommended system order list.

Input power: 115v/1ph/50-60hz/9 amps

Input power: 220v/1ph/50-60hz/4.5 amps

2. AS-4-E/P AUTOMATIC FLUX TRANSFER MIGHTY-MIGHT ELECTRIC FLUX VAC.

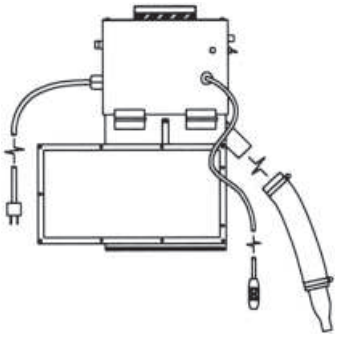

Same as AS-4, except flux is automatically transferred to lower hopper without operator input. In addition to the above electrical input, it requires shop air (70-100 psi with minimum 3/16" I.D. air hose. Air operates flux valve only and does not provide vacuum). **See page 15 for recommended system order list.**

Input power: 115v/1ph/50-60hz/9 amps

Input power: 220v/1ph/50-60hz/4.5 amps

IMPORTANT NOTE
24v control circuit for on/off pendant is available for AS-4, PS-2, LPFR-3 and PFR-3.


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: **WWW.WELDENGINEERING.COM**
EMAIL: **SALES@WELDENGINEERING.COM**

FIG. 13:

AS-4 FLUX-VAC MOUNTED TO LINCOLN OR OTHER O.E.M. AUTOMATIC WELDING EQUIPMENT.

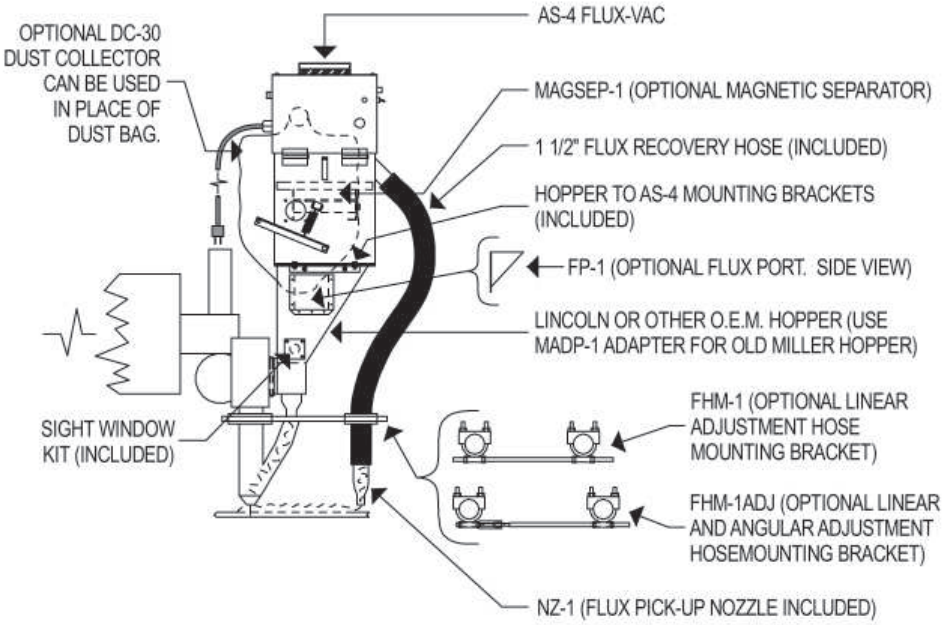

RECOMMENDED SYSTEM ORDER LIST:

1) AS-4 FLUX-VAC
   INCLUDED WITH AS-4 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AS-4 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FP-1 (FLUX PORT ENABLES LOADING OF FLUX WITHOUT INTERRUPTING WELDING).

4) OPTIONAL MADP-1 (ADAPTER PLATE USED ONLY IF MOUNTING ON OLD MILLER HOPPER).


5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

FIG. 14:

AS-4 FLUX-VAC MOUNTED TO OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER. (40 LBS. CAPACITY)

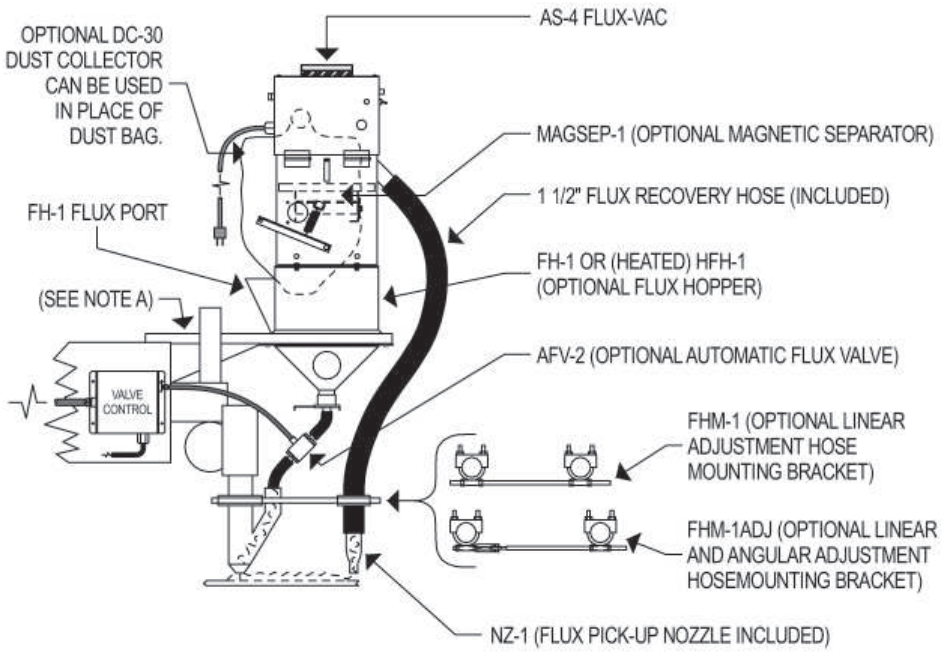

RECOMMENDED SYSTEM ORDER LIST:

1) AS-4 FLUX-VAC
   INCLUDED WITH AS-4 AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AS-4 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FH-1 OR (HEATED) HFH-1 (FLUX HOPPER).

4) OPTIONAL AFV-2 (AUTOMATIC FLUX VALVE AND CONTROL).

5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

NOTE A: MOUNTING FRAME

CUSTOMER PROVIDES MOUNTING FRAME FROM FLUX HOPPER TO WELDING HEAD.

BULLETIN: (PAGE 8) TB-MM708
FILE: 08~ AS-4 TB-DRT 7-31-2008.CAD
REVISED: AS4-TB.CAD (7-1-1998 TB-MM394)
WELD ENGINEERING CO., INC.
DRT 8-1-2008


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 FRUIT STREET
SHREWSBURY, MA 01545 (U.S.A.)
TELEPHONE: (508) 842-2224
FAX: (508) 842-3893
WEBSITE: **WWW.WELDENGINEERING.COM**
EMAIL: **SALES@WELDENGINEERING.COM**

FIG. 15:

AS-4-E/P FLUX-VAC MOUNTED TO LINCOLN OR OTHER O.E.M. AUTOMATIC WELDING EQUIPMENT. (AS-1-E/P AUTOMATICALLY TRANSFERS FLUX TO LOWER HOPPER W/OUT OPERATOR INPUT)

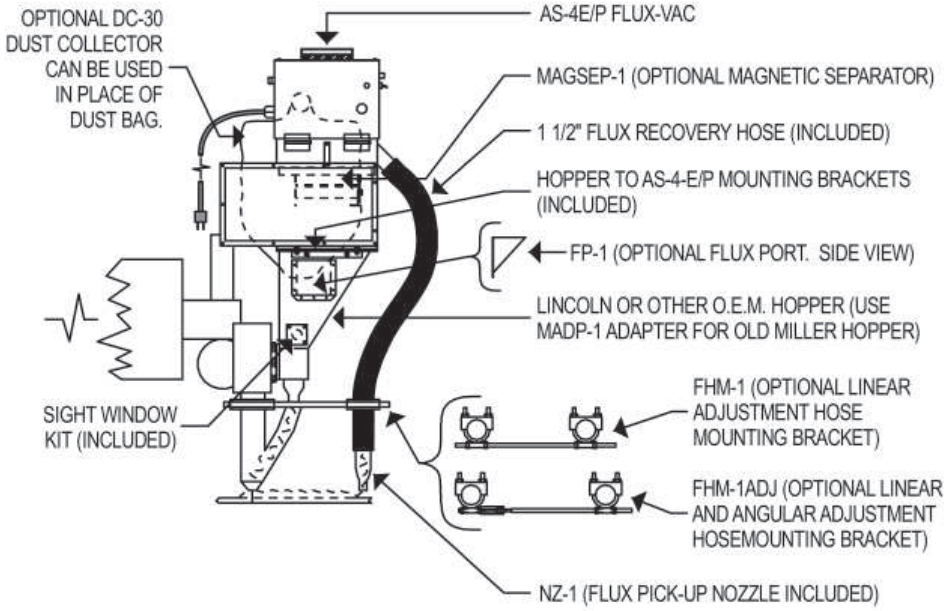

RECOMMENDED SYSTEM ORDER LIST:

1) AS-4-E/P FLUX-VAC
   INCLUDED WITH AS-4-E/P AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AS-4 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FP-1 (FLUX PORT ENABLES LOADING OF FLUX WITHOUT INTERRUPTING WELDING).

4) OPTIONAL MADP-1 (ADAPTER PLATE USED ONLY IF MOUNTING ON OLD MILLER HOPPER).


5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

FIG. 16:

AS-4-E/P FLUX-VAC MOUNTED TO OPTIONAL FH-1 OR HEATED HFH-1 FLUX HOPPER. (40 LBS. CAPACITY)

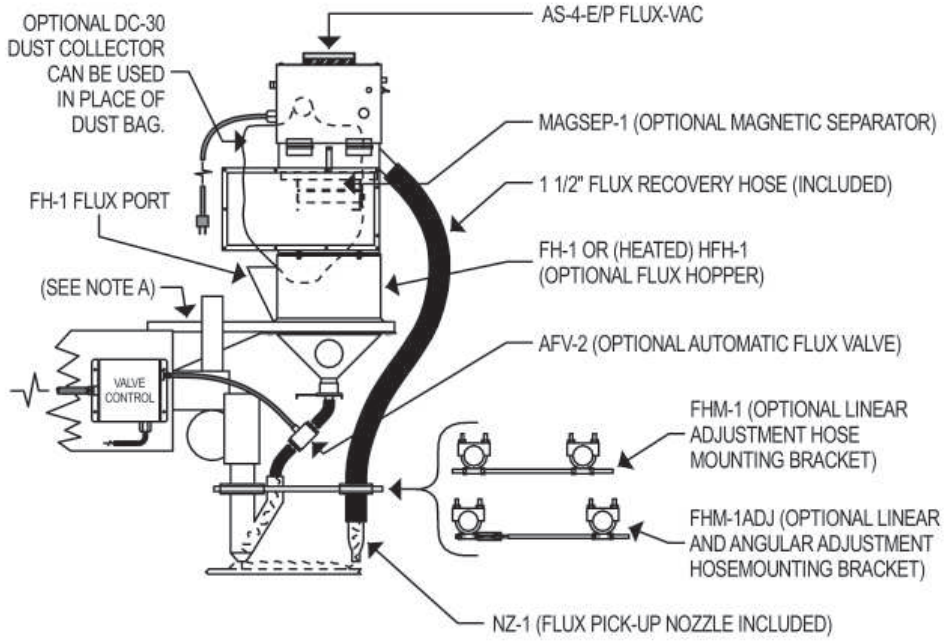

RECOMMENDED SYSTEM ORDER LIST:

1) AS-4-E/P FLUX-VAC
   INCLUDED WITH AS-4-E/P AT NO EXTRA COST:
   A) 1 1/2" FLUX RECOVERY HOSE (5FT. LONG).
   B) HOPPER TO AS-4 MOUNTING BRACKETS.
   C) NZ-1 (FLUX PICK-UP NOZZLE).
   D) 2 HOPPER SIGHT WINDOWS.

2) OPTIONAL HOSE MOUNTING BRACKETS:
   FHM-1 (LINEAR ADJUSTMENT ONLY)
   FHM-1ADJ (LINEAR AND ANGULAR ADJUSTMENT).

3) OPTIONAL FH-1 OR (HEATED) HFH-1 (FLUX HOPPER).

4) OPTIONAL AFV-2 (AUTOMATIC FLUX VALVE AND CONTROL).

5) OPTIONAL MAGSEP-1 (MAGNETIC SEPARATOR).

6) OPTIONAL FLUX PICK-UP NOZZLES:
   NZ-1 CRN (CORNER NOZZLE)
   NZ-1 BUTT (BUTT NOZZLE)

7) OPTIONAL DC-30 (DUST COLLECTOR USED IN PLACE OF DUST BAG FOR GREATER CAPACITY AND LESS MAINTENANCE).

NOTE A: MOUNTING FRAME

CUSTOMER PROVIDES MOUNTING FRAME FROM FLUX HOPPER TO WELDING HEAD.

BULLETIN: (PAGE 9) TB-MM708
FILE: 09~ AS-4-EP TB-DRT 8-1-2008.CAD
REVISED: AS4EP-TB.CAD (7-1-1998 TB-MM394)
WELD ENGINEERING CO., INC.
DRT 8-1-2008


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

PORTABLE FLUX RECOVERY SYSTEMS

1. PS-2 MIGHTY-MIGHT ELECTRIC FLUX VAC.

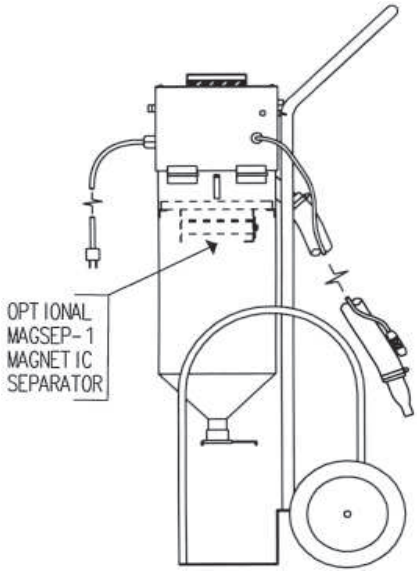


The PS-2 is a portable, **electric** flux recovery system for use anywhere in the shop. Vacuum comes with indicator light which flashes when dust bag needs to be cleaned. Holds approximately 75 pounds of flux and comes complete with 15 feet of hose with nozzle and remote "on/off" pendant. (For longer hose up to 25 Ft. total length, please consult factory for price.)

Input power: 115v/1ph/50-60hz/9amps

Input power: 220v/1ph/50-60hz/4.5 amps

2. PS-2-A/P MIGHTY MIGHT *"AIR POWERED"* FLUX VAC.

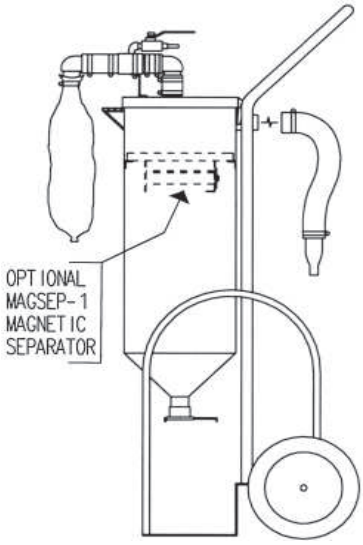

The PS-2-A/P is a ***portable, air powered flux recovery*** system for use anywhere in the shop. Powerful air operated vacuum introduces no oil or water to the flux and produces no damage to recovered flux particles since recovered flux is not in compressed air stream. The PS-2-A/P holds approximately 75 pounds of flux and comes complete with 10 feet of hose with nozzle.


Input power: Shop air (8 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose).

The **HPS-2-A/P** is same as the PS-2-A/P **except it is heated**. It has a digital thermostat control (ambient to 250°F {121°C}) and large digital display for easy reading.

Input power: Shop air (8 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose) and 115 or 220v/1ph/50 or 60hz.

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

3. SUPER-PS-2-A/P *"AIR POWERED"* FLUX VAC.

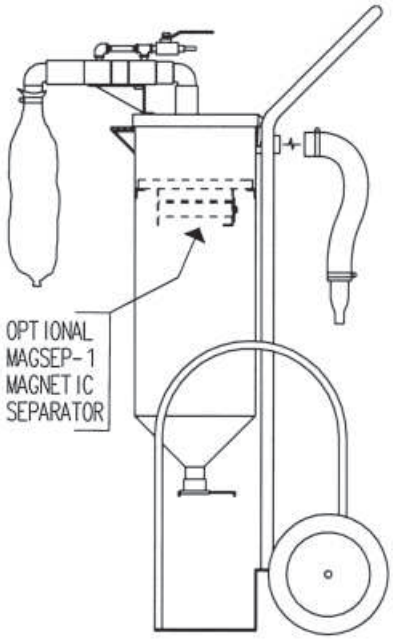

Same as PS-2-A/P, except it has **twice the vacuum power**, and comes complete with 15 ft. of hose and nozzle.

Input power: Shop air (14 cfm @ 70-100 psi using minimum 1/4" I.D. air hose).

The **SUPER-HPS-2-A/P** is the same as the **SUPER-PS-2-A/P** except it is heated. It has a digital thermostat control (ambient to 250°F {121°C}) and large digital display for easy reading.

Input power: Shop air (14 cfm @ 70-100 psi, using minimum 1/4" I.D. air hose) and 115 or 220v/1ph/50 or 60hz.


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

"AIR POWERED" TRACTOR FLUX RECOVERY UNITS


1. APT-2-C *"AIR POWERED"* MIGHTY-MIGHT FLUX RECOVERY SYSTEM FOR LINCOLN CRUISER TRACTOR MOUNTING.

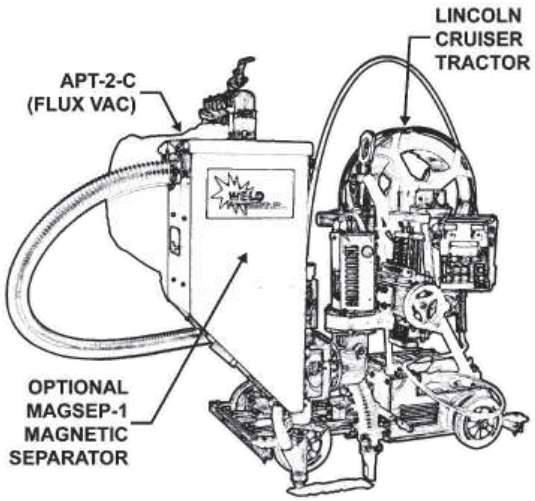

The APT-2-C is a ***lightweight modular air powered*** unit for Lincoln Electric's Cruiser submerged arc welding tractors. Powerful air operated vacuum introduces no oil or water to the flux and produces no damage to recovered flux particles since recovered flux is not in compressed air stream. Recovers flux while welding and automatically separates out dust, fines and slag. Places reusable flux back into tractor flux hopper with dump valve. Comes complete with six (6) feet of hose, mounting bracket, standard FHM-1 flux hose mounting bracket and standard NZ-1 flux pick up nozzle. See pages 30 and 31 for other accessories. **(Consult factory for mounting brackets for tractors other than Lincoln.)**

Input power: Shop air (70-100 psi, 8 cfm using minimum 1/4" I.D. air hose).

2. APT-2 *"AIR POWERED"* MIGHTY-MIGHT FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING.

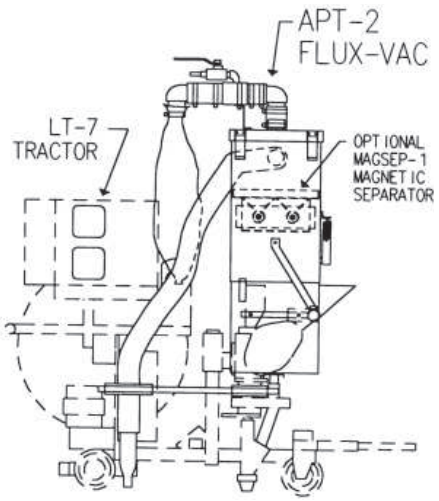

The APT-2 is a ***lightweight modular air powered*** unit for Lincoln, Miller, and other automatic submerged arc welding tractors. Powerful air operated vacuum introduces no oil or water to the flux and produces no damage to recovered flux particles since recovered flux is not in compressed air stream. Recovers flux while welding and automatically separates out dust, fines and slag. Places reusable flux back into tractor flux hopper with dump valve. Comes complete with six (6) feet of hose, mounting bracket, standard FHM-1 flux hose mounting bracket and standard NZ-1 flux pick up nozzle. See pages 30 and 31 for other accessories.
(Consult factory for mounting brackets for tractors other than Lincoln.)


Input power: Shop air (70-100 psi, 8 cfm using minimum 1/4" I.D. air hose).

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


3. XP-3TRAC-C "ULTRA LIGHTWEIGHT" *"AIR POWERED"* MIGHTY-MIGHT FLUX RECOVERY SYSTEM FOR LINCOLN CRUISER TRACTOR MOUNTING.

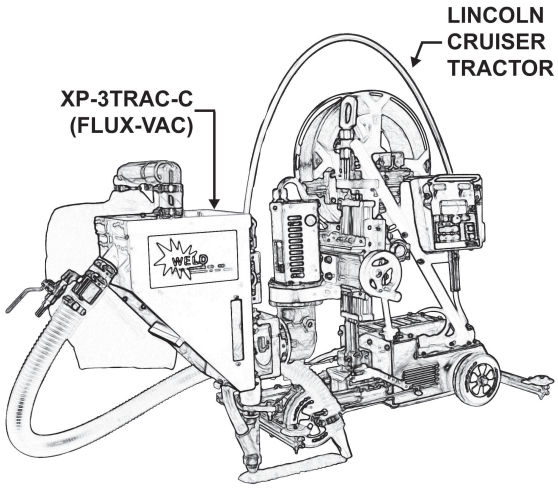

The XP-3TRAC-C is an **"ULTRA LIGHTWEIGHT"** and **VERY COMPACT** ***air powered flux recovery unit*** for Lincoln Electric's Cruiser submerged arc welding tractors. The powerful air operated vacuum continuously feeds recovered flux to the welding nozzle **without the need of any flux transfer valve. (Since recovered flux passes through a compressed *air* stream...unlike the APT-2 or AP-1...it is necessary to use clean, dry compressed *air* supply {no oil, dirt or water}).** This unit recovers flux while welding and automatically separates out dust, fines and slag, and feeds recovered flux to welding nozzle. Comes complete with five (5) feet of recovery hose, mounting bracket for Lincoln Cruiser Tractor, standard FHM-1 flux hose mounting bracket and standard NZ-1 flux pick-up nozzle. See pages 30 and 31 for other accessories. **(Consult factory for mounting brackets for tractors other than Lincoln.)**

Input power: **Clean and dry shop** air (70-100 psi; 8 cfm, using a minimum 1/4" I.D. air hose.)

4. XP-3TRAC "ULTRA LIGHTWEIGHT" *"AIR POWERED"* MIGHTY-MIGHT FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING.

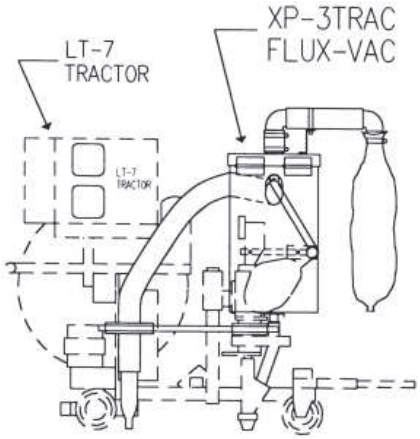

The XP-3TRAC is an **"ULTRA LIGHTWEIGHT"** and **VERY COMPACT** ***air powered flux recovery unit*** for Lincoln, Miller, and other automatic submerged arc welding tractors. The powerful air operated vacuum continuously feeds recovered flux to the welding nozzle **without the need of any flux transfer valve. (Since recovered flux passes through a compressed *air* stream...unlike the APT-2 or AP-1...it is necessary to use clean, dry compressed *air* supply {no oil, dirt or water}).** This unit recovers flux while welding and automatically separates out dust, fines and slag, and feeds recovered flux to welding nozzle. Comes complete with five (5) feet of recovery hose, mounting bracket to Lincoln LT-7 Tractor, standard FHM-1 flux hose mounting bracket and standard NZ-1 flux pick-up nozzle. See pages 30 and 31 for other accessories. **(Consult factory for mounting brackets for tractors other than Lincoln.)**


Input power: **Clean and dry shop** air (70-100 psi; 8 cfm, using a minimum 1/4" I.D. air hose.)

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

1. ALT-2-C MIGHTY-MIGHT ELECTRIC FLUX RECOVERY SYSTEM FOR LINCOLN CRUISER TRACTOR MOUNTING.

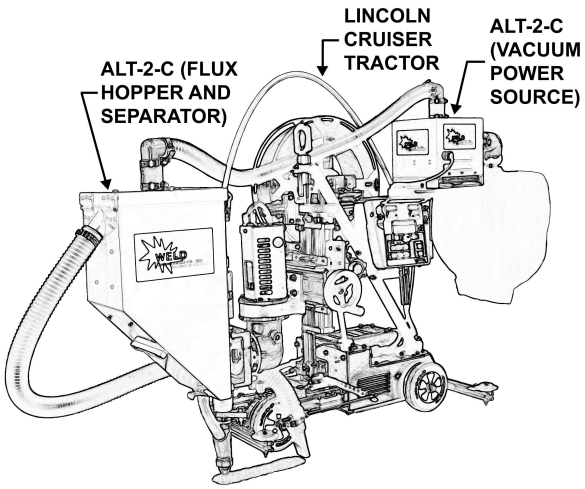


The ALT-2-C **electric** flux recovery system is a lightweight modular unit for Lincoln Electric's Cruiser submerged arc welding tractors. It recovers flux while welding and automatically separates out dust, fines and slag. Places reusable flux back into tractor flux hopper with dump valve. Equipped with indicator light which flashes when dust bag needs to be cleaned and "Flux Port" which enables new flux to be added without interrupting the weld. Comes complete with five (5) feet of recovery hose, four (4) feet of vacuum hose, mounting brackets, standard FHM-1 flux hose mounting bracket, and standard NZ-1 flux pick up nozzle. See pages 30 and 31 for other accessories.
(Consult factory for mounting brackets for tractors other than Lincoln.)

Input power: 115v/1ph/50-60 hz/9 amps

Input power: 220v/1ph 50-60 hz/4.5 amps

2. ALT-2 MIGHTY-MIGHT ELECTRIC FLUX RECOVERY SYSTEM FOR TRACTOR MOUNTING.

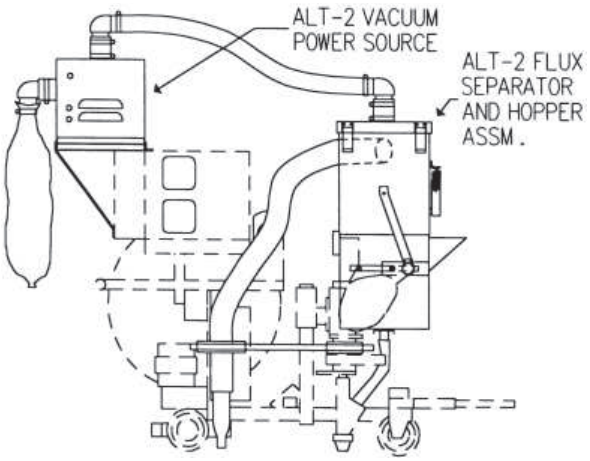

The ALT-2 **electric** flux recovery system is a lightweight modular unit for Lincoln LT-7, Miller, and other automatic submerged arc welding tractors. It recovers flux while welding and automatically separates out dust, fines and slag. Places reusable flux back into tractor flux hopper with dump valve. Equipped with indicator light which flashes when dust bag needs to be cleaned and "Flux Port" which enables new flux to be added without interrupting the weld. Comes complete with five (5) feet of recovery hose, four (4) feet of vacuum hose, mounting brackets for LT-7, standard FHM-1 flux hose mounting bracket, and standard NZ-1 flux pick up nozzle. See pages 30 and 31 for other accessories.
(Consult factory for mounting brackets for tractors other than Lincoln.)

Input power: 115v/1ph/50-60 hz/9 amps

Input power: 220v/1ph 50-60 hz/4.5 amps


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT WELD ENGINEERING CO. DESIGN !

ALL OF WELD ENGINEERING CO.'S FLUX FEED TANKS ARE EQUIPPED WITH OUR EXCLUSIVE "INTERNAL FLUX CONE." THIS ALLOWS ALL THE FLUX TO FEED OUT OF THE TANK. THERE IS NO "DEAD SPACE" IN THE TANK WHICH TRAPS FLUX.

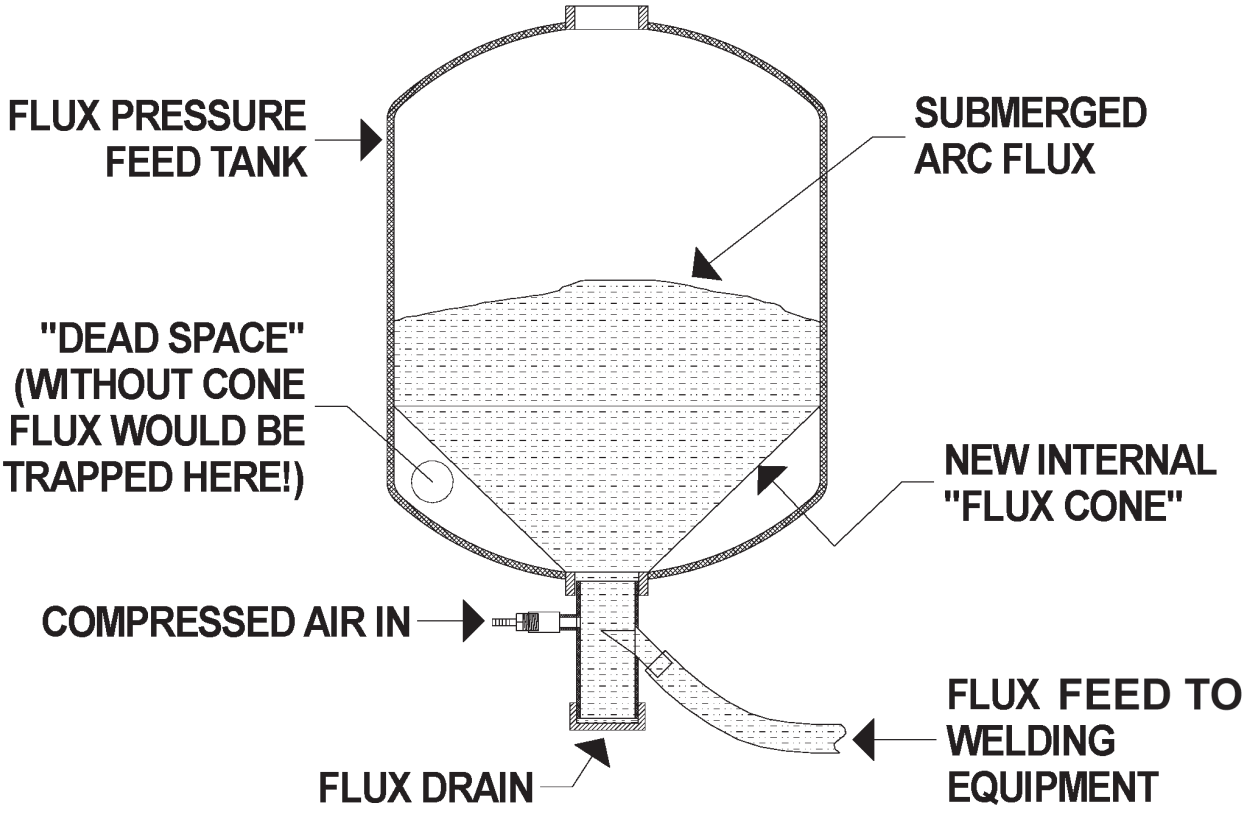

FLUX CONE DGRM 6-15-18.TIF
6-15-18 TML


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

PRESSURE FEED AND RECOVERY SYSTEMS

1. PFR-3 (ELECTRIC POWERED), PFR-3-A/P OR SUPER-PFR-3-A/P (*AIR POWERED*) FLUX RECOVERY SYSTEM.

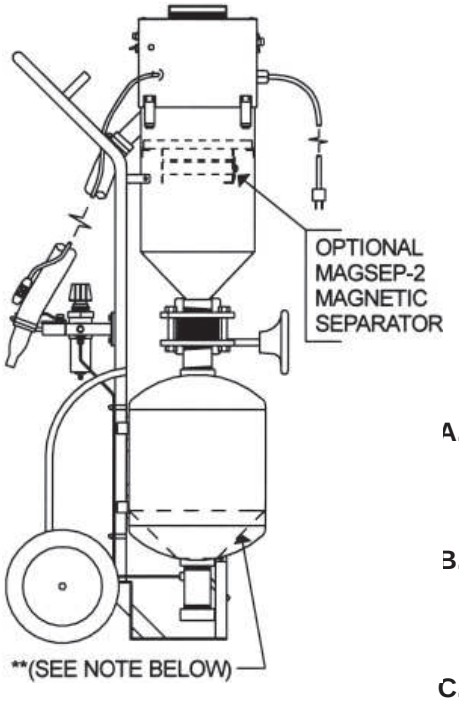

The PFR-3 System pressure-feeds and recovers unfused submerged arc flux in one complete, closed system. The system is completely portable and can be used with any wire feeder/power source combination suitable for submerged arc welding (does not include welding gun). The PFR-3 (**electric**) comes with 15 ft. of recovery hose, the PFR-3-A/P (***air powered***) with 10 ft. of recovery hose and the SUPER-PFR-3-A/P (***air powered***) comes with 15 ft. of recovery hose. All units come with 60 lb. pressure feed tank, NZ-1 pick-up nozzle, and 20 ft. of pressure feed hose (1/2", 3/4", or 1" I.D.) - ready to use! (For different hose lengths please consult factory.) Note: PFR-3 (**electric**) also requires 60-100 psi of compressed air @ approximately 2 - 3 cfm for pressure feeding flux.

A. PFR-3 Electric
Input power: 115v/1ph/50-60hz/9 amps

B. PFR-3 Electric
Input power: 220v/1ph/50-60hz/4.5 amps

C. PFR-3-A/P *Air Powered*
Input power: Shop air (70-100 psi @ approx. 8 cfm, using minimum 1/4" I.D. air hose).

D. SUPER-PFR-3-A/P *Air Powered*
Input power: Shop air (70-100 psi @ approx. 14 cfm, using minimum 1/4" I.D. air hose.)

****Please note, the PFR-3 pressure feed and recovery system is now manufactured with an internal flux cone. This flux cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank, from which flux will not flow out of the tank.**

The PFR-3 is available without undercarriage and larger pressure tank for boom mounting. Please consult factory for exact pricing to meet your specifications.

IMPORTANT NOTE


24v control circuit for on/off pendant is available for AS-4, PS-2, LPFR-3 and PFR-3.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

2. LPFR-3 (ELECTRIC), LPFR-3-A/P OR SUPER-LPFR-3-A/P (*AIR POWERED*) FLUX RECOVERY SYSTEM.

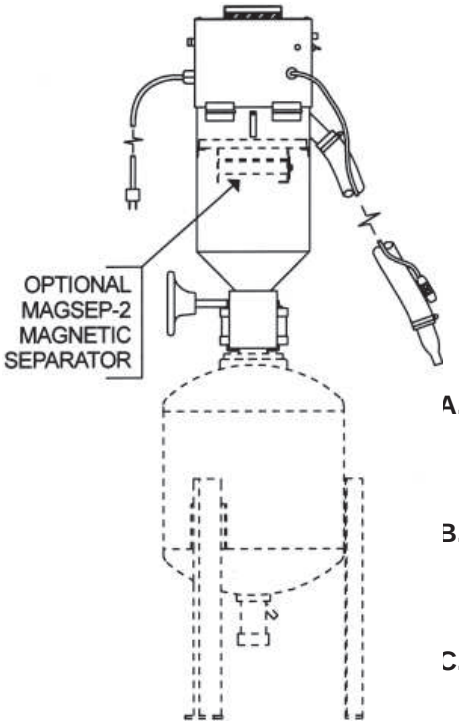

For direct mounting on Lincoln Electric's flux feed tank. The LPFR-3 flux recovery system mounts directly to the pressurized flux feed tank. The LPFR-3 screws on the tank in place of the top pressure cap. It recovers all the unfused flux and transfers flux to pressure tank via a butterfly valve and geared hand-wheel opener. The LPFR-3 (**electric**) comes with 15 ft. of recovery hose, the LPFR-3-A/P (***air powered***) with 10 ft. of recovery hose, and the SUPER-LPFR-3-A/P (***air powered***) comes with 15 ft. of recovery hose. All units come with NZ-1 flux pick-up nozzle... ready to use.
(For different hose lengths, please consult factory.)

A. LPFR-3 Electric
Input power: 115v/1ph/50-60hz/9 amps

B. LPFR-3 Electric
Input power: 220v/1ph/50-60hz/4.5 amps

C. LPFR-3-A/P *Air Powered*
Input power: Shop air (70-100 psi @ approx. 8 cfm, using minimum 1/4" I.D. air hose.)

D. SUPER-LPFR-3-A/P *Air Powered*
Input power: Shop air (70-100 psi @ approx. 14 cfm, using minimum 1/2" I.D. air hose.)

***** Available to fit other manufacturer's pressure feed tanks; please consult the factory.

IMPORTANT NOTE

24v control circuit for on/off pendant is available for AS-4, PS-2, LPFR-3 and PFR-3.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

FLUX PRESSURE FEED TANK SYSTEMS

1. PT-"x"00 FLUX PRESSURE FEED TANK SYSTEM.

The PT-"x"00 is a flux pressure feed tank system for pressure feeding flux to a flux hopper or welding torch. Many tank sizes are available, i.e. 100 pound, 300 pound, 600 pound, or larger. Also specify flux feed nozzle (See TNOZ-"x" on page 38.) for 1/2", 3/4" or 1" I.D. flux feed hose. Compressed air input of 60 psi @ approximately 2 - 3 cfm is also required.

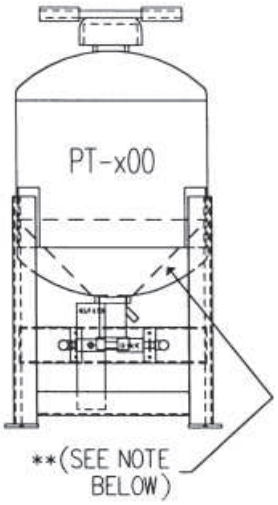

A. PT-3 (60 pound tank)

B. PT-100 (100 pound tank)

C. PT-300 (300 pound tank)


D. PT-600 (600 pound tank)

Please consult factory for larger size tanks.

NOTE: **Electronic low or high flux level sensor** is an option available for all size pressure tanks. When flux level is low (or high, based on your requirements), a loud audible alarm and flashing light on control panel will signal operator. (See page 38 for sensor options).

2. HPT-"x"00 HEATED FLUX PRESSURE FEED TANK SYSTEM.

The HPT-"x"00 is the same as above PT-"x"00, but is heated to 250°F (121°C), adjust able.

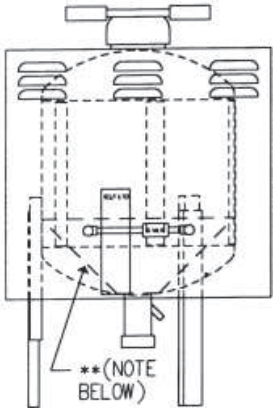

A. HPT-100 (100 pound tank)

B. HPT-300 (300 pound tank)

C. HPT-600 (600 pound tank)

For high temperature electronic high or low level sensor (as described in item no.1 above), see page 39.


NOTE: Specify flux feed hose diameter. 1/2", 3/4" or 1" are standard. Hose does not come with tank. See page 39 for feed hoses. (Please consult factory for larger size heated tanks.)

****Please note, the PT-"x"00 and HPT-"x"00 flux pressure feed tank systems are now manufactured with an internal flux cone. This flux cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank, from which flux will not flow out of the tank.**

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

3. HPT-100/D HEATED PRESSURE FEED SYSTEM WITH AIR DRYER FOR SUBMERGED ARC FLUX.

The HPT-100/D is a heated (32°F/0°C to 400°F/ 204°C) submerged arc flux pressure feeding system with a refrigerated air dryer for automatically pressure feeding flux to a flux hopper or welding torch. The flux capacity is 100 pounds (45.36 g.). Flux is fed through a 1/2", 3/4" or 1" I.D. high temperature hose to the welding hopper or torch. Incoming shop air (60 psi required) first passes through an oil and water trap, then a micron filter, and then through a refrigerated air dryer, before finally pressurizing the flux tank with very clean, dry air. The tank is heated to an adjustable range of 32°F/0°C to 400°F/ 204°C. The HPT-100/D minimizes the effects of hydrogen assisted cracking due to moisture in the flux.

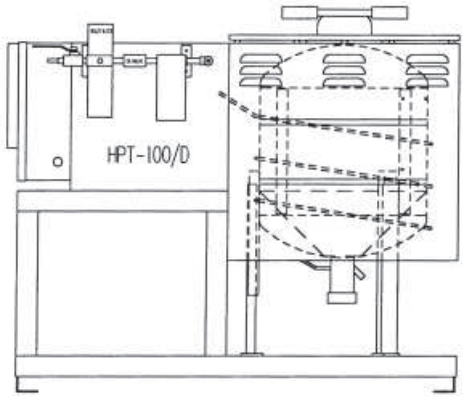

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

SUBMERGED ARC FLUX RE-BAKE OVENS

1. PORTABLE SUBMERGED ARC FLUX OVENS



A. The **HTP-100-850° Super Flux Oven** has approximately 100 pound storage capacity. Total and uniform heating of flux is accomplished with six powerful heating elements (1500 watts total). This oven re-bakes flux at an adjustable temperature range setting of 32°F to 850°F (0°C to 455°C), for a selected amount of time -- 3 minutes to 999 hours. (Factory pre-set fot 3 hrs). After the bake time has elapsed the oven will shift to a storage mode with a temperature range of 0 °F to 850 °F (0 °C to 455 °C).

Oven has large, hard, rubber wheels for complete portability. Internal oven compartment vents any pressure build-up. The storage temperature is maintained until the Re-bake button is pushed again. Large digital temperature gages and push buttons make operation very easy and. The unit comes complete and ready for use.

Input power: 115V/1ph or 220V/1ph (Please specify voltage.)

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

1. PORTABLE SUBMERGED ARC FLUX OVENS (CONTINUED)



B. The **PFO-100 Flux Oven** has approximately 100 pound storage capacity. Total and uniform heating of flux is accomplished with four powerful heating elements (1000 watts total). Temperature range from 32 °F to 550 °F (0 °C to 288 °C) with large digital display for easy reading. Oven has large, hard, rubber wheels for complete portability. Internal oven compartment vents any pressure build-up. The unit comes complete and ready for use.

Input power: 115V/1ph or 220V/1ph (Please specify voltage.)

C. The **PFO-100-AB Flux Oven** (shown) is the same as the PFO-100 above, **plus it is a programmable flux re-bake oven.** This oven re-bakes flux at an adjustable temperature range setting of 32 °F to 550 °F (0 °C to 288 °C), for a selected amount of time -- 3 minutes to 999 hours (factory pre-set to 3 hrs.). After the bake time has elapsed the oven will shift to a storage mode with a temperature range of 32 °F to 550 °F (0 °C to 288 °C). The storage temperature is maintained until the Re-bake button is pushed again. Large digital display and push buttons make operation very easy. The unit comes complete and ready for use.

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

2. STATIONARY SUBMERGED ARC FLUX OVENS



A. The **HTS-700-850° Super Flux Oven** is a programmable flux re-bake oven and has a 700 pound storage capacity. Total and uniform heating of flux is accomplished with 4500 watts of power. **Eighteen (18) powerful Incoloy sheathed heating elements are submerged in the flux (not on the side walls as in many competitive models).**

This oven re-bakes flux at an adjustable temperature range setting of 32°F to 850°F (0°C to 455°C), for a selected amount of time -- 3 minutes to 999 hours (factory pre-set for 3 hrs.). After the bake time has elapsed the oven will shift to a storage mode with a temperature range of 0 °F to 850 °F (0 °C to 455 °C). Oven has large digital display for easy reading.

The HTS-700-850° oven is rugged and stationary for industrial in-plant use. Internal oven compartment vents any pressure build-up. The storage temperature is maintained until the Re-bake button is pushed again. Push buttons make operation very easy. The unit comes complete and ready for use.

Input power: 220v/1ph/60-50hz

Input power: 460v/3ph/60hz

(Other voltages are available.)

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

2. STATIONARY SUBMERGED ARC FLUX OVENS (CONTINUED)



THE FO-700 FLUX OVEN HAS BEEN REPLACED BY THE FO-700 HT HIGH TEMPERATURE FLUX OVEN. IMPORTANT NOTE: THE FO-700 HT FLUX OVEN WILL BE PRICED AT THE SAME PRICE AS THE FO-700. THIS WILL SAVE OUR CUSTOMERS SEVERAL THOUSAND DOLLARS PLUS THE BENEFIT OF THE HIGH TEMPERATURE RANGE OF THE FO-700 HT!

A. The **FO-700 HT** Flux Oven has a 700 pound storage capacity. Total and uniform heating of flux is accomplished with 4500 watts of power. **Eighteen (18) powerful Incoloy sheathed heating elements are submerged in the flux (not on the side walls as in many competitive models).** Temperature range is from 32 °F to 700 °F (0 °C to 371 °C) with digit al display for easy reading. The Oven is rugged for industrial in-plant use. Internal oven compartment vents any pressure buildup. The unit comes complete and ready for use.

Input power: 220v/1ph/60-50hz

Input power: 460v/3ph/60hz

(Other voltages are available. Please advise voltage required for exact pricing.)

B. The **FO-700 HT-AB** is the same as the FO-700 HT above, except it is a programmable flux re-bake oven. This oven re-bakes flux at an adjustable temperature range setting of 32 °F to 700 °F (0 °C to 371 °C), for a selected amount of time -- 3 minutes to 999 hours (factory pre-set at 3 hrs.). After the bake time has elapsed the oven will shift to a storage mode with a temperature range of 32 °F to 700 °F (0 °C to 371 °C). The storage temperature is maintained until the Re-bake button is pushed again. Large push buttons make operation very easy. The unit comes complete and ready for use.

Input power: 220v/1ph/60-50hz

Input power: 460v/3ph/60hz

(Other voltages are available. Please advise voltage required for exact pricing.)

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

ACCESSORIES FOR THE FOLLOWING FLUX RECOVERY AND FLUX HANDLING SYSTEMS:


AP-1
SUPER-AP-1
AP-1-E/P
SUPER-AP-1-E/P
XP-3
XP-4T
SUPER-FH-100-A/P
SUPER-HFH-100-A/P
SUPER-FH-100-A/P-E/P
SUPER-HFH-100-A/P-E/P
AS-4
AS-4-E/P
PS-2
PS-2-A/P
SUPER-PS-2-A/P
APT-2
APT-2-C
XP-3TRAC
XP-3TRAC-C
ALT-2
ALT-2-C
PFR-3
PFR-3-A/P
SUPER-PFR-3-A/P
LPFR-3
LPFR-3-A/P
SUPER-LPFR-3-A/P
PT & HPT-"x"00

1. AV-4 ELECTRIC *AIR* VALVE. (For all ***air powered*** Flux Vacs.)

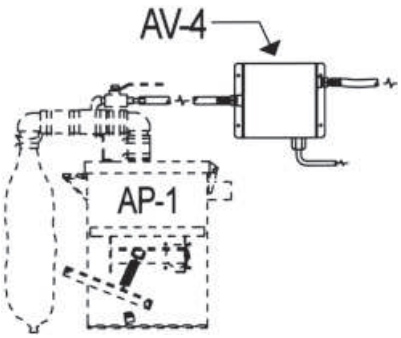


The AV-4 electric air valve is for remotely turning ***air powered*** flux recovery vacuums on and off (AP-1, SUPER-AP-1, AP-1-E/P, SUPER-AP-1-E/P, XP-3, XP-4T, XP-3TRAC, APT-2, PS-2-A/P, SUPER-PS-2-A/P, and FH-100-AP etc.). The AV-4 is installed between the on/off ball valve of the flux vac, and the air supply. When electrical signal is provided to the AV-4, the valve opens, allowing the flux vac to operate. Standard input voltage is 115V. (Also available in other voltages.)
See pages 2, 3, 5, 6, 8, 9 and 12 for typical installations.

2. FLUX HOSE MOUNTING BRACKETS.

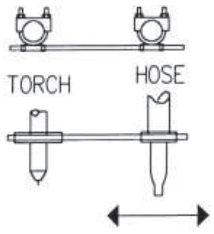

A. The **FHM-1** provides easy positioning of hose over flux. (Linear adjustment only.) For use with all Mighty-Might and Mighty-Mac Recovery Systems.

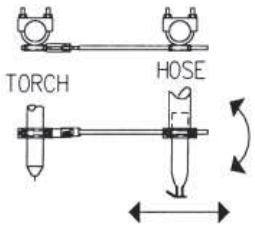


B. The **FHM-1ADJ** provides easy positioning of hose over flux. (Linear and angular adjustment.) For use with all Mighty-Might and Mighty-Mac Recovery Systems.

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

C. RFHM-7 REAR HOSE MOUNTING BRACKET. (For all tractor flux recovery units.)

The RFHM-7 rear hose mounting bracket is for use with the Lincoln LT-7 tractor and when welding is done between tractor wheels, or when tractor is riding in 45° trough (i.e., Web to flange welds). RFHM-7 enables universal positioning of flux pick-up hose at rear of tractor. (For use with the ALT-2, APT-2, and XP-3TRAC.)

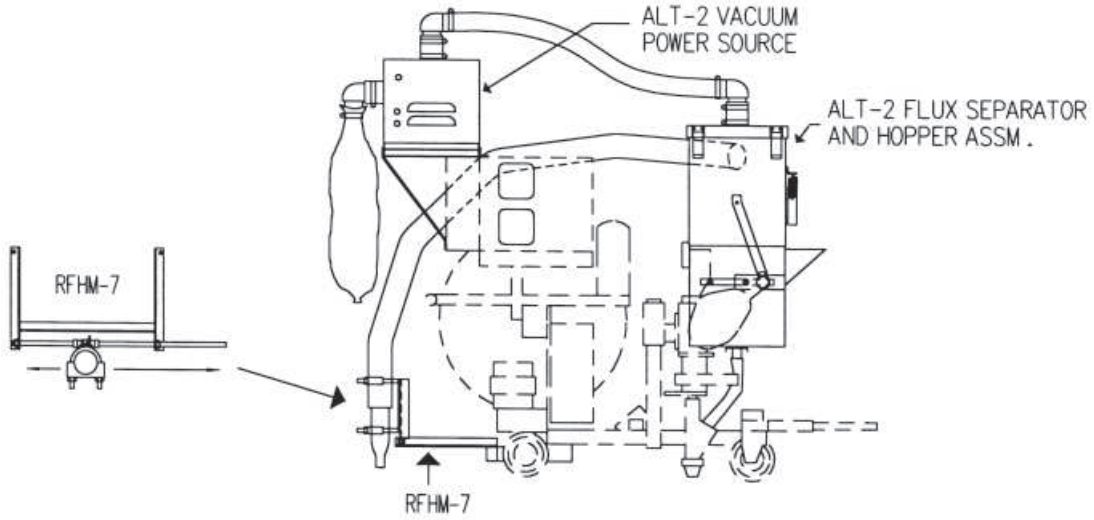

3. FLUX PICK-UP NOZZLES. (For all flux recovery equipment.)



A. **NZ-1;** Standard Flux Pick-up Nozzle, 2" wide.



B. **NZ-1-4;** 4" Wide Flux Pick-up Nozzle.
(NEW PRODUCT!)




C. **NZ-1CRN;** Corner Weld Flux Pick-up Nozzle (sold as a pair, one right nozzle, one left nozzle).



D. **NZ-1BUTT;** Butt Weld Flux Pick-up Nozzle.

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

4. DC-30 DUST COLLECTOR.

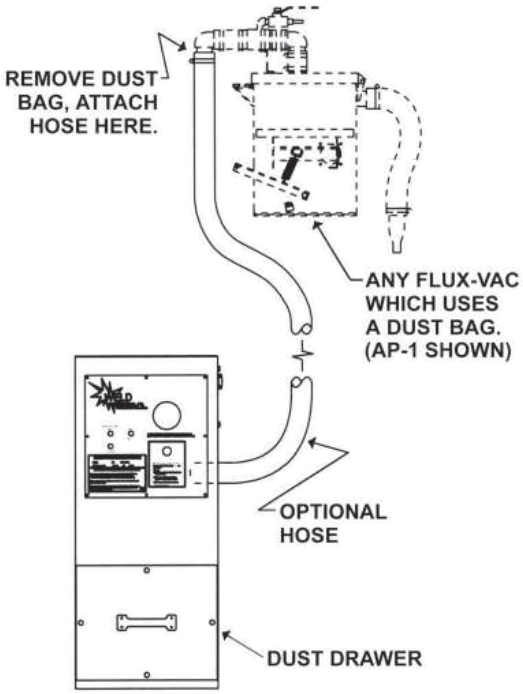

The **DC-30 dust collector** is for use with all stationary flux vacs, which use a dust bag as the standard dust collection method (i.e. AS-4, AP-1, SUPER-AP-1, SUPER-FH-100-A/P, XP-3, etc.). The advantages of the **DC-30** relative to the dust bag are **larger dust holding capacity** (approximately 30 pounds), **elimination of dust bag from welding area, easy filter cleaning (the filter is cleaned by pressing a button which will back pulse the filter with compressed air), larger more efficient filter area, dust drawer for easy removal and dumping of dust and greater filter life with less maintenance.** (Does not come with dust hose. Please select length from dust collector hose below.)

5. DUST COLLECTOR HOSE (2") FOR USE WITH ALL UNITS. (Must be purchased in 5 ft. increments).

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


6. MAGNETIC SEPARATORS.

MAGSEP-1, MAGSEP-2, MAGSEP-100 and MAGSEP-100-E/P Magnetic Separators install in place of the standard slag tray. Its advanced design provides a slag separation tray and powerful magnets to remove magnetic particles from recovered flux. Magnetic particles are easily disposed of by removing the magnetic separator from the flux recovery vacuum, operator then slides magnet assembly out of magnetic collection tubes and magnetic particles fall away to be discarded. (Not available for XP-3, XP-3TRAC and ALT-2.)

MAGSEP-1 (For AP-1, SUPER-AP-1, SUPER-AP-1-E/P, AP-1-E/P, AS-4, AS-4-E/P, PS-2, PS-2-A/P, SUPER-PS-2-A/P, APT-2, MS-1, AND MS-1-E/P)




FRONT VIEW




SIDE VIEW

MAGSEP-2 (For PFR-3, PFR-3-A/P, SUPER-PFR-3-A/P, LPFR-3, LPFR-3-A/P, SUPER-LPFR-3-A/P, HAMX-50 and HPFR- HAMX-3000-H100-H100)

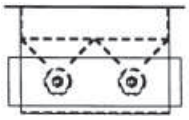


FRONT VIEW




SIDE VIEW

MAGSEP-100 (For FH-100, HFH-100, FH-300, HFH-300, FH-400, HFH-400, FH-600, HFH-600, FH-1000, HFH-1000, GHAMX-150, LPHR-3000, HLPFR-3000, PFR-3000, HPFR-3000, SUPER-FH-100-A/P and SUPER-HFH-100-A/P)




MAGSEP-100-E/P (For SUPER-FH-100-A/P-E/P, SUPER-HFH-100-A/P-E/P, FH-100-E/P, HFH-100-E/P)




34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

The PAS-1 easily converts the AP-1, SUPER-AP-1 and AS-4 into a portable flux recovery system.


7. PAS-1 PORTABLE FLUX HOPPER.

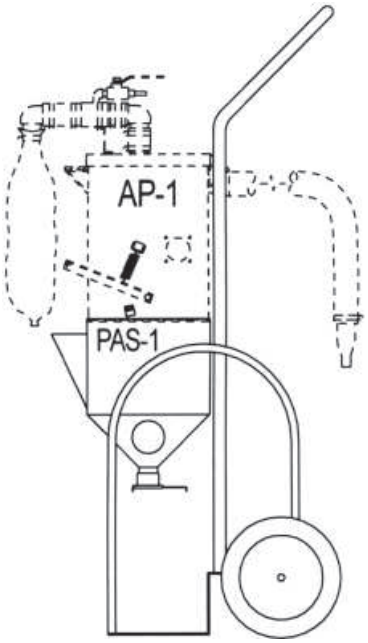

PAS-1/AP-1 comes complete with 10 feet of 1-1/2" hose and flux pick-up nozzle.

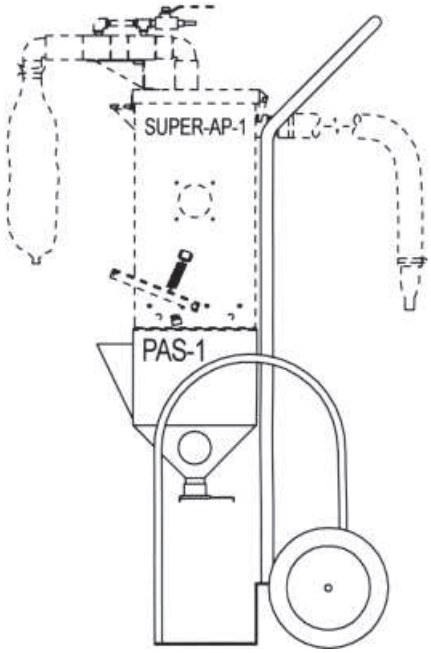


PAS-1/SUPER-AP-1 comes complete with with 15 feet of 1-1/2" hose and flux pick-up nozzle.

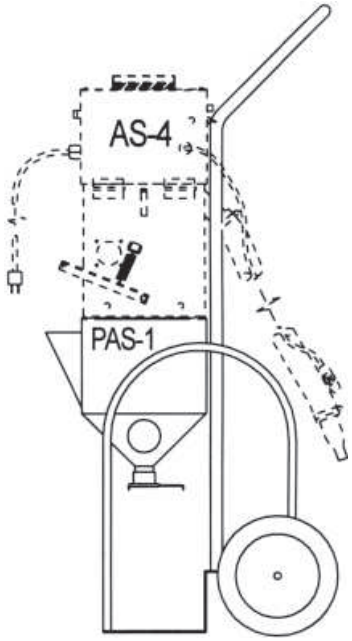

PAS-1/AS-4 comes complete with 15 feet of 1-1/2" hose and flux pick-up nozzle.

8. FH-1 FLUX HOPPER.

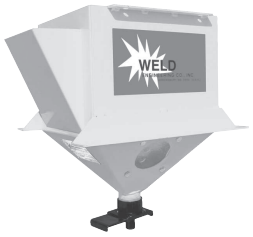

The FH-1 flux hopper is for use with the AS-4, AS-4-E/P, AP-1, SUPER-AP-1, AP-1-E/P,SUPER-AP-1-E/P, MS-1, and MS-1-E/P where greater flux capacity is required. Side loading port of hopper enables operator to add flux to hopper during welding without interrupting the weld, thus providing an unlimited supply of flux. Hopper holds approximately 35 to 40 pounds of flux. **Note: Customer must provide own mounting bracket. Does not mount directly to welding head because of increased size and flux weight capacity.**

FH-1-60 flux hopper is the same as above except it holds 60 lbs of flux.

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


9. HFH-1 HEATED FLUX HOPPER.



The HFH-1 heated flux hopper is the same as the FH-1 Hopper except it is heated. It has a Digital Temperature control with large temperature display (ambient to 250°F {121°C}) (Interfaces with same recovery equipment as FH-1 Hopper.) Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz.

HFH-1-60 flux hopper is the same as above except it holds 60 lbs of flux.

FH-3 FLUX HOPPER.

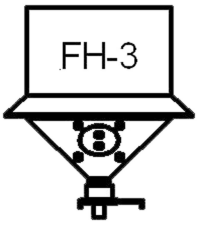

The FH-3 flux hopper is for use with the XP-3 and XP-4T where greater flux capacity is required. Hopper holds approximately 35 to 40 pounds of flux.
Note: Customer must provide own mounting bracket. Does not mount directly to welding head because of increased size and flux weight capacity.

FH-3-60 flux hopper is the same as above except it holds 60 lbs of flux.

HFH-3 FLUX HOPPER.




The HFH-3 heated flux hopper is the same as the FH-3 Hopper except it is heated. It has a continuous thermostat control (ambient to 250°F {121°C}) and temperature gauge for those applications where flux must be heated. (Interfaces with same recovery equipment as FH-1 Hopper.)Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz.

HFH-3-60 flux hopper is the same as above except it holds 60 lbs of flux.


34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

10. FP-1 FLUX PORT.

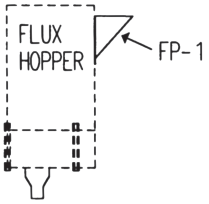

The FP-1 flux port is for the Lincoln hopper or any flat walled hopper. Allows additional flux to be added to hopper without interrupting the weld. Includes aluminum port and pop-rivets. (Not for use with the XP-3 or XP-3TRAC.)

11. AFV-2 AUTOMATIC FLUX VALVE.

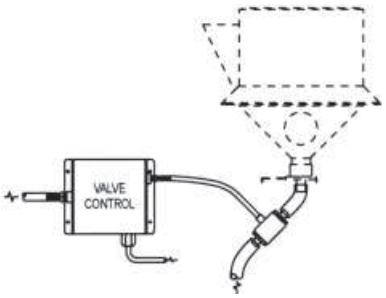

The AFV-2 is an in-line flux pinch valve for 3/4" I.D. flux feed hose. Automatically opens or closes flux flow in 3/4" I.D. hose, when 115v electrical signal is supplied. Use with FH-1, HFH-1, FH-100-E/P, HFH-100-E/P, SUPER-FH-100-A/P-E/P and SUPER-HFH-100-A/P-E/P, or any gravity feed hopper. (Typical use would be to automatically start flux flow when arc-start button is pushed and to stop flow when weld is finished.) System includes flux pinch valve, air on/off solenoid, pressure regulator and five (5) feet of 1/4" I.D. air hose.

Input power: 115v/1ph/50-60hz and standard shop air (other voltages available).


AFV-2-1 1/2 is the same as above except it is for 1 1/2" I.D. flux feed hose.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

12. AFV-32 AUTOMATIC FLUX VALVE.

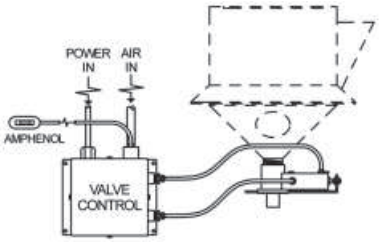


The AFV-32 is an automated slide valve attachment for 1" I.D. flux feed hose. Automatically opens or closes flux flow in 1" I.D. hose, when 115v electrical signal is supplied. Use with FH-1, HFH-1, FH-100-E/P, HFH-100-E/P, SUPER-FH-100-A/P-E/P and SUPER-HFH-100-A/P-E/P, or any gravity feed hopper. (Typical use would be to automatically start flux flow when arc-start button is pushed and to stop flow when weld is finished.) System includes automated slide valve, air on/off solenoid, pressure regulator and two five (5) foot lengths of 1/4" I.D. air hose.

Input power: 115v/1ph/50-60hz and standard shop air (other voltages available).

AFV-32-1 1/2 is the same as above except it is for 1 1/2" I.D. flux feed hose.

13. FF-3 FLUX FEED PIPE.

The FF-3 flux feed pipe enables flux to be fed from a pressure feed tank (PT-"x"00 or other pressure tank is required) to the flux hopper. Flux flow to hopper will automatically stop when flux level inside hopper is higher than inlet pipe. Specify flux feed hose size (1/2", 3/4" or 1" I.D. size available).

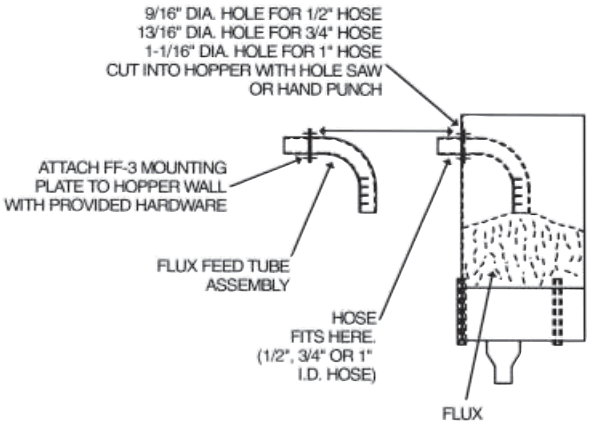


FF-3-1/2" for 1/2" I.D. hose

FF-3-3/4" for 3/4" I.D. hose

FF-3- 1" for 1" I.D. hose


34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

14. PFR-LD3 LID.

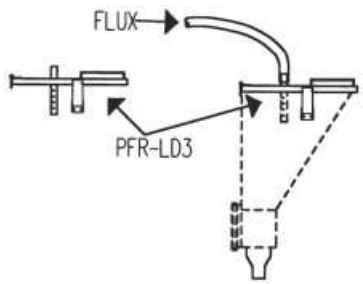

The PFR-LD3 Lid is for attachment to most manufacturers standard OEM (Please specify model of hopper when ordering). This lid will enable one to pressure feed flux to the hopper from a pressure feed tank (PT-'X' 00, HPT-'X' 00, PFR3, LPFR-3, PFR-3000, HPFR-3000, HPFR-HAMX-3000 etc.). Customer has choice of using 1/2", 3/4", or 1" I.D. hose.

15. TNOZ-"x" PRESSURE TANK FLUX FEED NOZZLES.

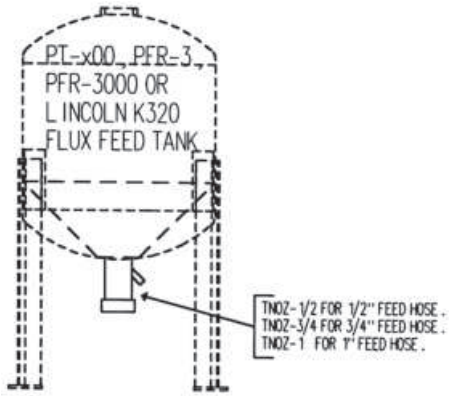

1. TNOZ-1/2" - Pressure tank flux feed nozzle for 1/2" I.D. hose. Nozzle fits 2" NPT female pipe fitting which is standard on PFR-3, PT-"x"00, HPT-"x"00, PFR-3000, and Lincoln K320 tanks.
(Please consult factory for non-standard sizes.)

2. TNOZ-3/4" - Same as above, except for 3/4" I.D. flux feed hose.


3. TNOZ-1" - Same as above, except for 1" I.D. flux feed hose.

4. TNOZ-DUAL-1/2" - Same as above, except for 1/2" I.D. flux feed hose.

5. TNOZ-DUAL - 3/4" - Same as above, except for 3/4" I.D. flux feed hose.

6. TNOZ-DUAL-1" - Same as above, except for 1" I.D. flux feed hose.

16. TANK OR HOPPER HIGH OR LOW LEVEL SENSOR

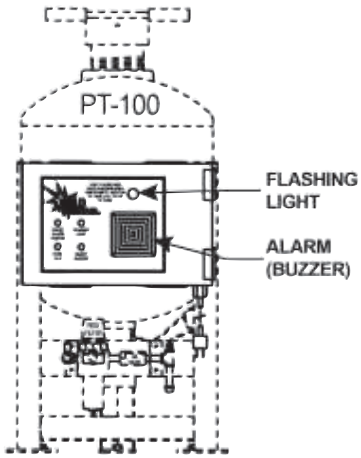

1. High or low flux level warning lights and audible alarm for flux level for all **UNHEATED** tanks and large hoppers (FH-100, 300 etc. and PT-100, PT-300 and larger tanks).

A. SEN LFLS-115V Low flux level sensor (115V)

B. SEN LFLS-220V Low flux level sensor (220V)

C. SEN HFLS-115V High flux level sensor (115V)


D. SEN HFLS-220V High flux level sensor (220V)

E. SEN L-HFLS-115V High and low flux level sensor (115V)

F. SEN L-HFLS-220V High and low flux level sensor (220V)

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

16. continued:

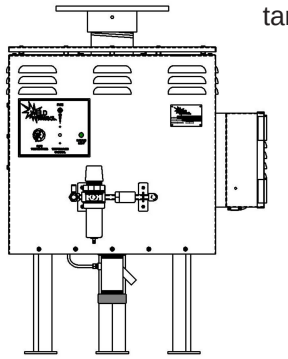

2. High or low flux level warning lights and audible alarm for flux level for all **HEATED** tanks and large hoppers (FH-100, FH-100-E/P hoppers and PT-100, PT-300 tanks).

A. SEN HT-LFLS-115V High Temp. Low flux level sensor(115V)

B. SEN HT-LFLS-220V High Temp. Low flux level sensor (220V)


C. SEN HT-HFLS-115V High Temp. High flux level sensor (115V)

D. SEN HT-HFLS-220VHigh Temp. High flux level sensor (220V)

E. SEN HT-LHFLS-115V High Temp. High and Low flux level sensor (115V)

F. SEN HT-LHFLS-220V High Temp. High and Low flux level sensor (220V)

17. FFC-1 FLUX FILLING CONE.

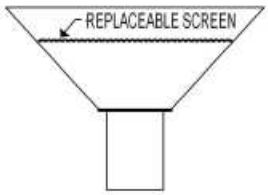

The flux filling cone is for easily adding flux to the PT-"x"00 and HPT-"x"00 flux pressure feed tank systems.

18. FV-1 IN-LINE FLUX VALVE.



The FV-1 in-line flux valve, is for hand held sub-arc guns, and PFR-LD3 lid. Trouble free valve fits inside diameter (1/2", 3/4" and 1") flux hose. Installs in minutes and is ready to use.

FV-1-1/2" (For 1/2" I.D. Hose)

FV-1-3/4" (For 3/4" I.D. Hose)


FV-1- 1" (For 1" I.D. Hose)

19. PRESSURE FEED HOSE.

1/2" .....
3/4" .....
1" .....
3/4" High Temperature Hose (Max. 400ºF {204ºC}) **.....**
1" High Temperature Hose (Max. 400ºF {204ºC}) **.....**

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

20. LAFV-32 AIR POWERED SLIDE VALVE FOR LINCOLN ELECTRIC K219 FLUX HOPPER.

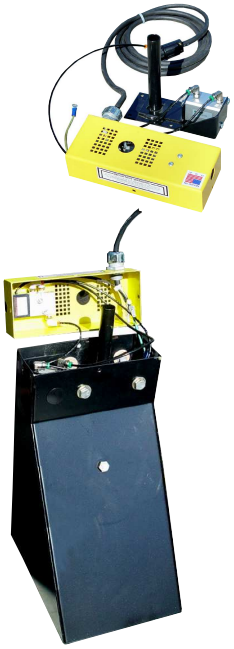

The LAFV-32 is an air powered slide valve for use with the Lincoln Electric K219 flux hopper. This valve replaces the existing flux hopper valve. The control cord plugs into the same receptical as the OEM valve uses. The LAFV-32 will give you a complete valve closure and will prevent the problems associated with leaking OEM electric solenoid flux valves, especially when using Pressure feed systems (PFR-3000, HPFR-3000 AND HPFR-HAMX-3000 to feed the flux or flux recovery units XP-3 AND XP-4T).This valve is operated using the Lincoln Electric controls.

I**nput Power:** Uses The Lincoln control voltage.
Air: 70 to 100 psi air pressure. The air flow is very low since air is only used to actuate a small air piston.

21. MAFV-32 AIR POWERED SLIDE VALVE FOR MILLER ELECTRIC FLUX HOPPER.



The MAFV-32 is an air powered slide valve for use with the Miller Electric OEM flux hopper. This valve replaces the existing flux hopper valve. The control cord plugs into the same receptical as the OEM valve uses. The MAFV-32 will give you a complete valve closure and will prevent the problems associated with leaking OEM electric solenoid flux valves, especially when using Pressure feed systems (PFR-3000, HPFR-3000 and HPFR-HAMX-3000 to pressure feed the flux or flux recovery units XP-3 and XP-4T).This valve is operated using the Miller Electric controls.

I**nput Power:** Uses The Miller control voltage.
Air: 70 to 100 psi air pressure. The air flow is very low since air is only used to actuate a small air piston.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

22. 1-1/2" STANDARD DUTY RECOVERY HOSE (For AP-1, SUPER-AP-1, AP-1-E/P, SUPER-AP-1-E/P, XP-3, XP-4T, SUPER-FH-100-A/P, SUPER-HFH-100-A/P, SUPER-FH-100-A/P-E/P, SUPER-HFH-100-A/P-E/P, AS-4, AS-4-E/P, PS-2, PS-2-A/P, SUPER-PS-2-A/P, APT-2, XP-3TRAC, ALT-2, PFR-3-A/P, SUPER-PFR-3-A/P, LPFR-3-A/P, SUPER-LPFR-3-A/P).


5 feet .....
10 feet .....
15 feet .....
20 feet .....
25 feet .....

23. 1-1/2" HEAVY DUTY HIGH ABRASION RECOVERY HOSE (FOR INCREASED HOSE LIFE FOR ABOVE EQUIPMENT).

5 feet .....
10 feet .....
15 feet .....
20 feet .....
25 feet .....

24. MADP-1 ADAPTER PLATE.
The MADP-1 is for mounting the AS-4, AS-4-E/P, AP-1, SUPER-AP-1, AP-1-E/P, SUPER-AP-1-E/P, MS-1, and MS-1-E/P to older Miller FH308B Hopper (New Miller Hopper does not require MADP-1).

25. FD-1 FLUX DAM FOR BUILDING UP SMALL DIAMETER ROLLS.
The FD-1 Flux Dam "dams" flux on cylindrical welding applications, to enable proper flux coverage and keeps flux from cascading off the cylinder.

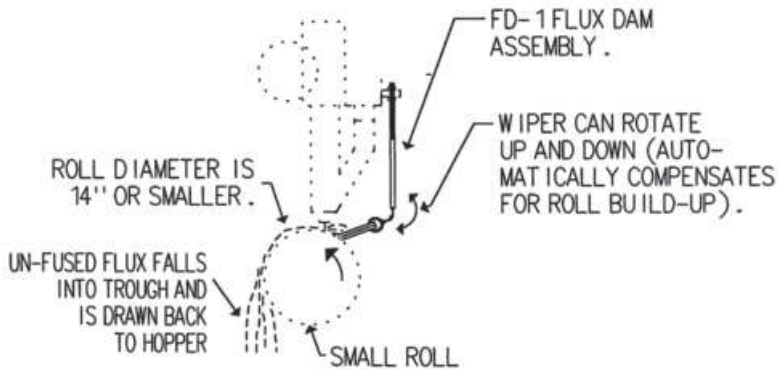

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

26. HEAVY DUTY KIT FOR AIR POWERED FLUX VACS.

A. **AP-1-HD-KIT** is for single air pump flux vacs. Includes stainless steel air jet, heavy duty elbows and a special dust bag air diffuser hose for inside of dust bag.

B. **AP-2-HD-KIT** is for super flux vacs with dual air pumps. Same as above except it includes two (2) stainless steel air jets.


C. **HB-1** Heavy duty dust bag diffuser hose for inside of dust bag.

27. POWER WAND

The Power Wand, adjustable flux loading nozzle, increases air flow to carry newly opened flux from the bag or container into the hopper fast and effectively.

A) **PW-1500** for 1-1/2" Recovery Hose.

B) **PW-2000** for 2" Recovery Hose.



PW-1500 OR PW-2000

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

RECOMMENDED CONSUMABLE PARTS FOR "MIGHTY-MIGHT" FLUX RECOVERY SYSTEMS

1. **AP-1**
SUPER-AP-1
AP-1-E/P
SUPER-AP-1-E/P
APT-2, APT-2-C
PS-2-A/P
SUPER-PS-2-A/P
PFR-3-A/P
SUPER-PFR-3-A/P
LPFR-3-A/P
SUPER-LPFR-3-A/P

A. 1 each Small Rubber Impingement Plates

B. 1 each Dust Bag Assembly

C. 1 each Exhaust Elbows (1 pair)

D. Air Pump - for Standard Air Powered units.

E. Twin Air Pump - for **Super** Air Powered units.

F. Air Jet (two required for SUPER's)

*** ***

2. **SUPER-FH-100-A/P**
SUPER-HFH-100-A/P
SUPER FH-100-A/P-E/P
SUPER-HFH-100-E/P

A. 1 each Large Rubber Impingement Plates

B. 1 each Dust Bag Assembly

C. 1 each Exhaust Elbows (1 pair)

D. Twin Air Pumps

E. Air Jets (two required)

*** ***

3. **AS-4**
PS-2
ALT-2
ALT-2-C
PFR-3
LPFR-3

A. 1 each Fine Flux Filter

B. 1 each Dust Bag Assembly

C. 1 each Motor Filter

D. Vacuum Motor 115V

E. Vacuum Motor 220V

*** ***

4. **XP-3**
XP-3TRAC

XP-3TRAC-C

A. 1 each XP-3 Flux Filter

AA. 1 each XP-3 Flux Filter Heavy Duty

B. 1 each Dust Bag Assembly

C. Air Pump (stainless steel)

D. Air Jet (stainless steel)

*** ***

5. **XP-4T**

A. 1 each XP-4T Dust Bag Assembly

B. 1 each Small Rubber Impingement Plate

C. Air Pump (stainless steel)

D. Air Jet (stainless steel)

ALL EQUIPMENT - F.O.B. - OUR FACTORY
Prices subject to change without notice and are those in effect at time of order.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"


34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

INDUSTRIAL PRODUCT SELECTION FOR "MIGHTY-MAC" (HEAVY DUTY) FLUX RECOVERY EQUIPMENT

HEAVY CONTINUOUS DUTY VACUUMS

1A. MM-1500X ("MIGHTY-MAC 1500X")

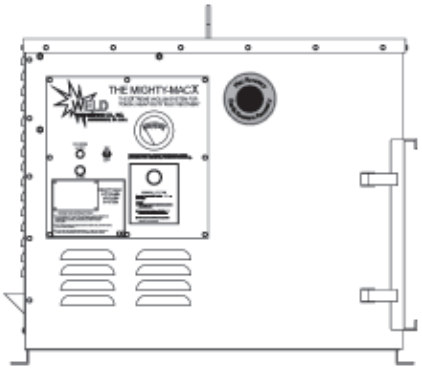


The New MM-1500X (Mighty-Mac 1500X) Heavy Duty Vacuum and Dust Collector offers great new features. E**X**tremely rugged and durable, e**X**tremely easy to maintain because large drawer pulls out to empty flux dust and access filter for easy replacement. This drawer and all internal covers are simple to remove by means of four (4) wing nuts. E**X**tremely safe; micron filters remove particles below one (1) micron. The air you breath will be much cleaner. The MM-1500X also provides **auto sensing** dust cleaning logic so filters are always automatically pulse cleaned as they become dirty (with no operator intervention). Motor: 2 hp, TEFC directly coupled to blower.

Input power: 230v/60hz/3ph
Input power: 230v/50hz/1ph

input power: 460v/60hz/3ph
Input power: 220v/50hz/3ph
Input power: 380-415V/50hz/3ph
Input power: 575v/60hz/3ph

1B. MM-1500X/P ("MIGHTY-MAC 1500X/P")

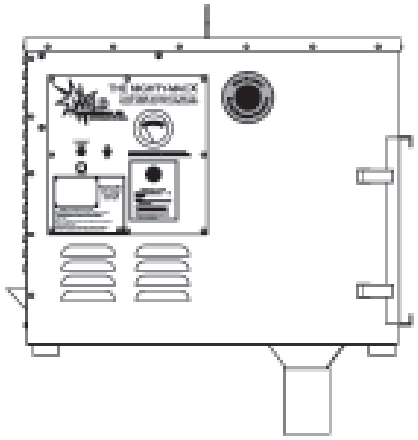

MM-1500X/P (Mighty-Mac 1500X/P) Heavy Duty Vacuum unit only. Same as 2A above, except that instead of a dust drawer, dust filter chamber has a hopper bottom. This enables continuous dumping of dust to a much larger dust container below the Mighty-Mac (i.e FD-55 Dust Drum). Ideal for very continuous recovery applications where regular emptying of dust drawer is inconvenient..

TO ABOVE 1A PRICES ADD

NOTE: Teflon coated polyester filter for extra heavy duty applications. Factory installed. One required.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


2A. MM-3000X ("MIGHTY-MAC 3000X")

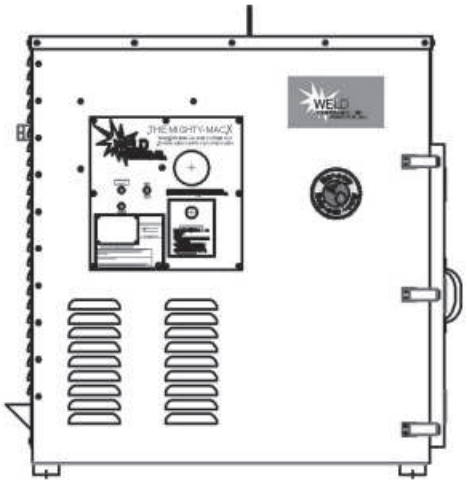

The new MM-3000X ("Mighty-Mac 3000X) heavy duty vacuum and dust collector offers great new features. E**X**tremely rugged and durable. E**X**tremely easy to maintain because large door to filters open with the flick of latches, and all internal covers are simply removed. E**X**tremely safe; micron filters remove particles below one (1) micron. The air you breath will be much cleaner. The MM-3000X also provides auto sensing dust cleaning logic so filters are always **automatically** pulse cleaned as they become dirty (with no operator intervention)! Motor: 4 hp, TEFC directly coupled to blower.

Input power: 230v/60hz/3ph
nput power: 460v/60hz/3ph
Input power: 220v/50hz/3ph
Input power: 380-415V/50hz/3ph
Input power: 575v/60hz/3ph

2B. MM-3000X/P ("MIGHTY-MAC 3000X/P")

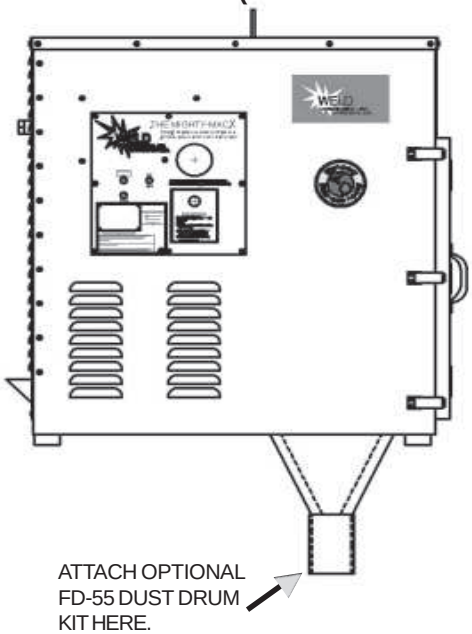

MM-3000X/P ("Mighty-Mac 3000X/P") Heavy-duty vacuum unit only. Same as 2A above, except that instead of a dust drawer, dust filter chamber has a hopper bottom. This enables continuous dumping of dust to a much larger dust container below Mighty-Mac (i.e. FD-55 dust drum). Ideal for very continuous recovery applications where regular emptying of dust drawer is inconvenient. (See Bulletin TB-MM708 for descriptive diagrams).

TO ABOVE 2A PRICES ADD

Note: TEFLON COATED POLYESTER FILTERS. (Available for use with the MM-3000X, MM-3000X/P, MM-5000X, MM-5000X/P, and are standard in the MM-5000X-MILL.) Specify these filters for extra heavy duty or dusty flux applications. Filters last much longer and resist dust clogging. Two required.

FACTORY INSTALLED, ADD TO 2A MIGHTY-MAC VACUUM UNIT COST

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


3A. MM-5000X ("MIGHTY-MAC 5000X")

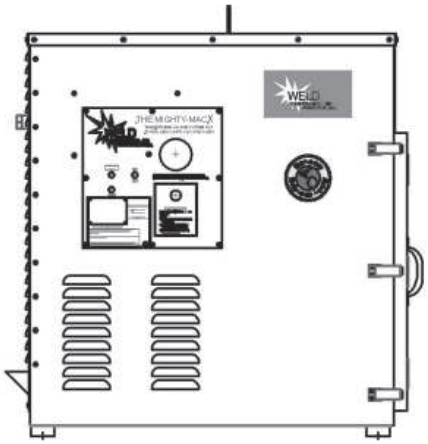

The new MM-5000X ("Mighty-Mac 5000X) heavy duty vacuum and dust collector offers great new features. E**X**tremely rugged and durable. E**X**tremely easy to maintain because large door to filters open with the flick of latches, and all internal covers are simply removed. E**X**tremely safe; micron filters remove particles below one (1) micron. The air you breath will be much cleaner. The MM-5000X also provides auto sensing dust cleaning logic so filters are always **automatically** pulse cleaned as they become dirty (with no operator intervention)! Motor: 5.5 hp, TEFC directly coupled to blower.

Input power: 230v/60hz/3ph
nput power: 460v/60hz/3ph
Input power: 220v/50hz/3ph
Input power: 380-415V/50hz/3ph
Input power: 575v/60hz/3ph

3B. MM-5000X/P ("MIGHTY-MAC 5000X/P")

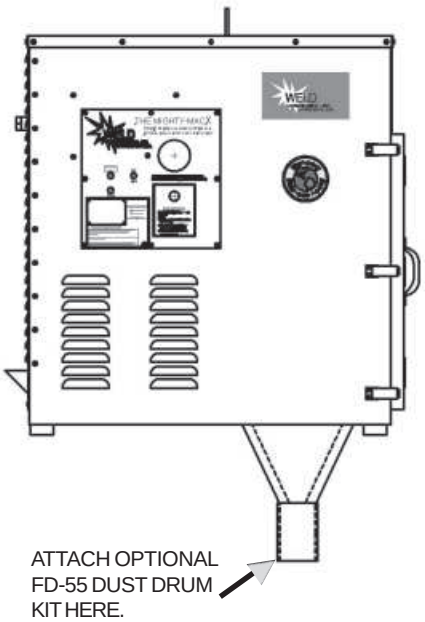

"Mighty-Mac 5000X/P" (MM-5000X/P) Heavy-duty vacuum unit only. Same as 3A above, except that instead of a dust drawer, dust filter chamber has a hopper bottom. This enables continuous dumping of dust to a much larger dust container below Mighty-Mac (i.e. FD-55 dust drum). Ideal for very continuous recovery applications where regular emptying of dust drawer is inconvenient. (See Bulletin TB-MM708 for descriptive diagrams).

TO ABOVE 3A PRICES ADD

Note: TEFLON COATED POLYESTER FILTERS. (Available for use with the MM-3000X, MM-3000X/P, MM-5000X, MM-5000X/P and are standard in the MM-5000X-MILL.) Specify these filters for extra heavy duty or dusty flux applications. Filters last much longer and resist dust clogging. Two required.

FACTORY INSTALLED, ADD TO 3A MIGHTY-MAC VACUUM UNIT COST

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"


34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

4. MM-5000X-MILL ("MIGHTY-MAC 5000X-MILL")

"Mighty-Mac 5000X-MILL" (MM-5000X-MILL) very heavy duty vacuum unit. Typical applications are pipe mills or any very heavy duty flux recovery requirement where automatic cleaning of large amounts of flux dust with low maintenance is important. The new MM-5000X-MILL ("Mighty-Mac 5000X-MILL) heavy duty vacuum unit offers great new features. E**X**tremely rugged and durable. E**X**tremely easy to maintain because large door to filters open with the flick of latches, and all internal covers are simply removed. E**X**tremely safe; micron filters remove particles below one (1) micron. The air you breath will be much cleaner. The MM-5000X-MILL also provides auto sensing dust cleaning logic so filters are always **automatically** pulse cleaned as they become dirty (with no operator intervention)! Four (4) special high capacity Teflon coated polyester filters are used instead of two regular filters in standard MM-5000X unit. Each filter is individually and sequentially pulsed when dirty. "Hopper" bottom on dust chamber is standard. Unit also includes a 50 ft. remote on/off cord with amphenol for remote interface with welding system control panel and extra cooling for motor and control area. Motor: 5.5 hp, TEFC directly coupled to blower.

Input power: 230v/60hz/3ph
Input power: 460v/60hz/3ph
Input power: 220v/50hz/3ph
Input power: 380-415v/50hz/3ph
Input power: 575v/60hz/3ph

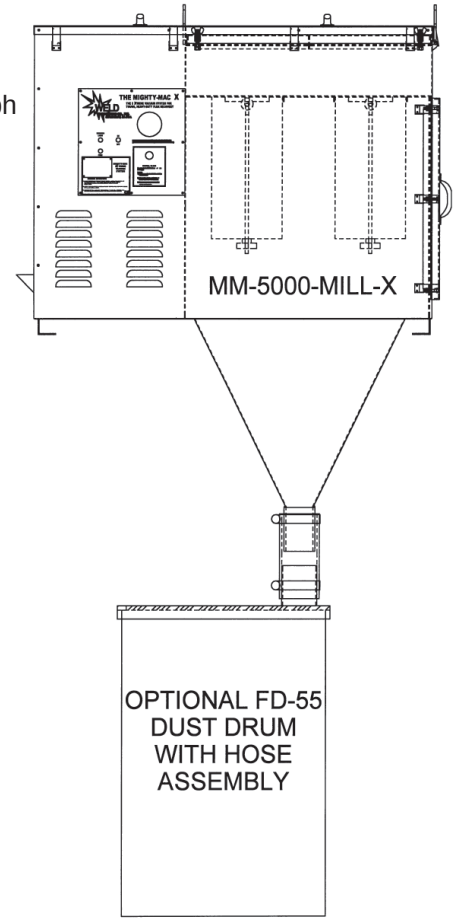

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

Complete Pipe Mill Flux Recovery and Processing Systems

OUTSIDE DIAMETER (OD) OF PIPE FLUX RECOVERY

Weld Engineering Co., Inc. has designed and produced "State of the Art" flux recovery and processing systems for any size Pipe Mill, single to mutiple Series Arc, outside diameter and inside diameter for spiral and longitudinal welding. Our new systems will remove all flux recovery dust from the air. They offer totally automatic operation, and are designed to recover in excess of 4,000,000 pounds of flux per year with very little maintenance. Our systems provide the cleanest, safest and lowest maintenance of any system available in the world, at a very reasonable price. Please call us for engineering and sales assistance.

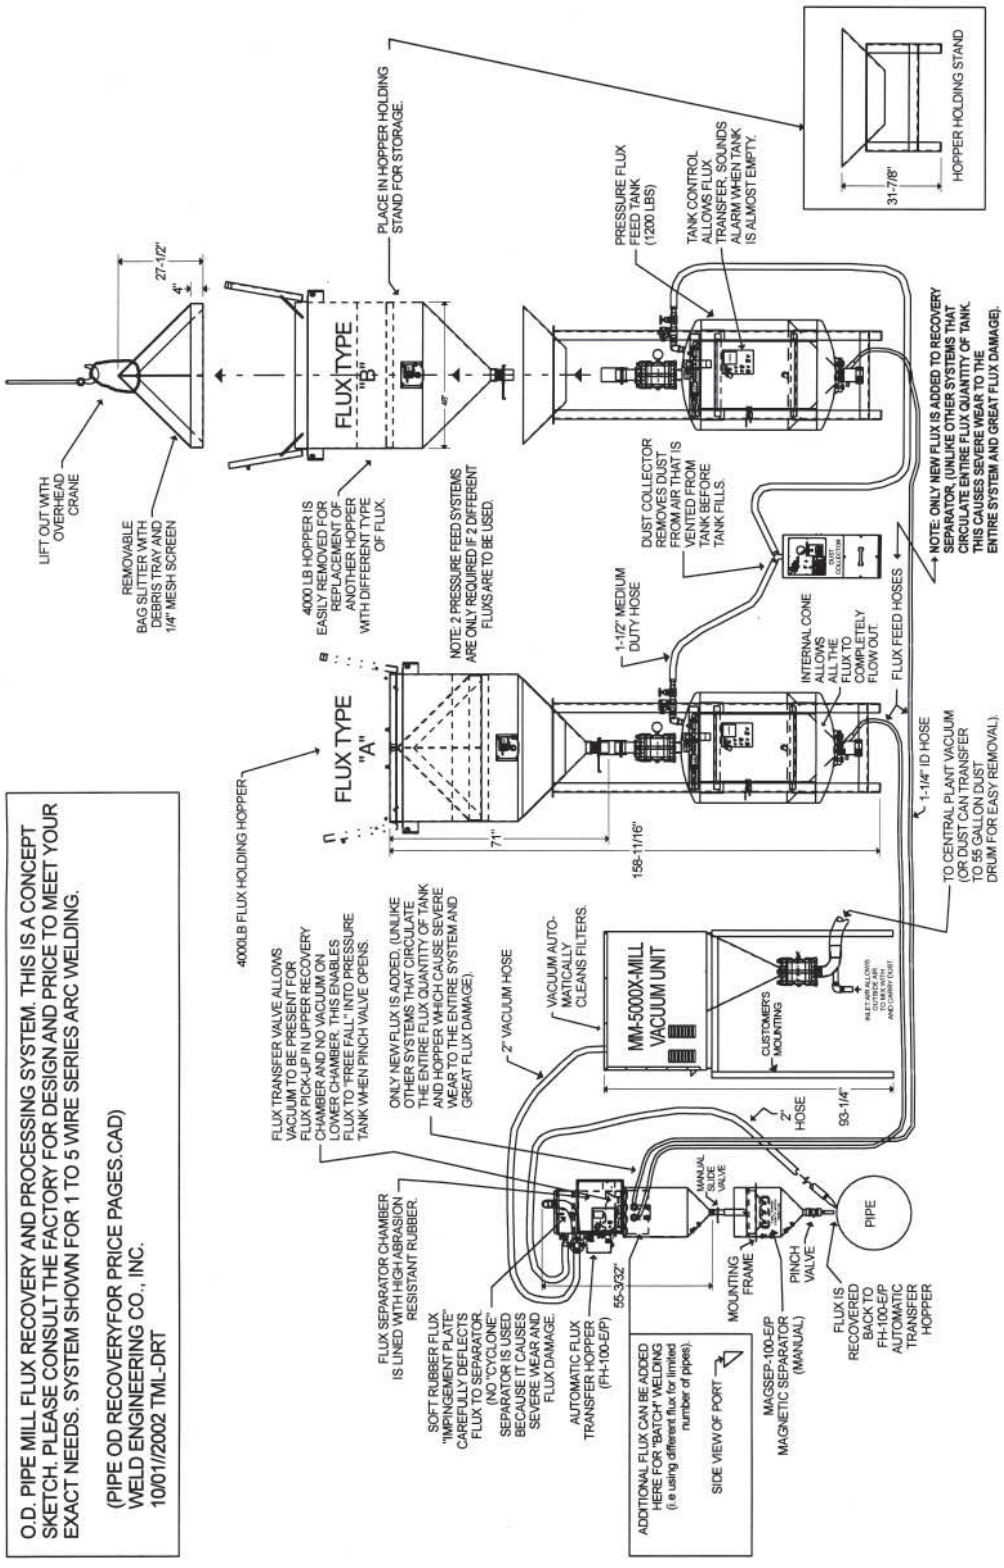

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


Complete Pipe Mill Flux Recovery and Processing Systems

INSIDE DIAMETER (ID) OF PIPE FLUX RECOVERY

Weld Engineering Co., Inc. has designed and produced "State of the Art" flux recovery and processing systems for any size Pipe Mill, single to mutiple Series Arc, outside diameter and inside diameter for spiral and longitudinal welding. Our new systems will remove all flux recovery dust from the air. They offer totally automatic operation, and are designed to recover in excess of 4,000,000 pounds of flux per year with very little maintenance. Our systems provide the cleanest, safest and lowest maintenance of any system available in the world, at a very reasonable price. Please call us for engineering and sales assistance.

I.D. PIPE MILL FLUX RECOVERY AND PROCESSING SYSTEM. THIS IS A CONCEPT SKETCH. PLEASE CONSULT THE FACTORY FOR DESIGN AND PRICE TO MEET YOUR EXACT NEEDS. SYSTEM SHOWN FOR 1 TO 5 WIRE SERIES ARC WELDING.

(PIPE ID RECOVERY FOR PRICE PAGES.CAD)
WELD ENGINEERING CO., INC.
10/01/2008 TML-DRT

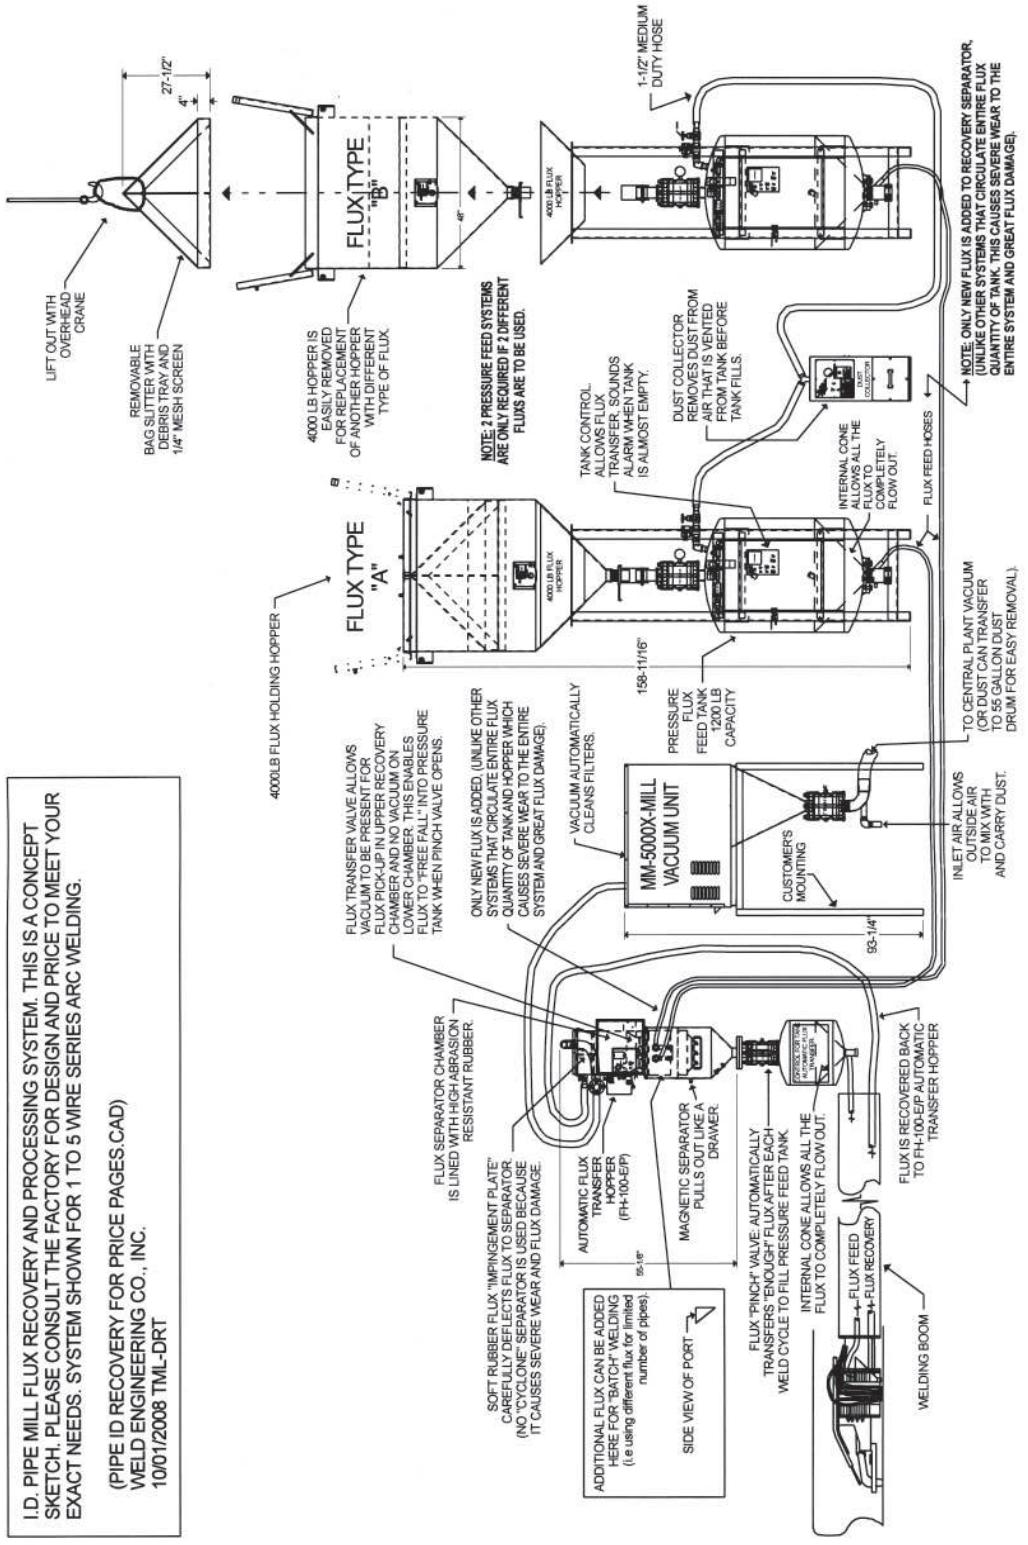

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


LOW COST HEAVY CONTINUOUS DUTY PORTABLE FLUX RECOVERY EQUIPMENT


THE PS-1500, PS-3000, PS-5000, AND PS-7500 HAVE SEMI-AUTOMATIC FILTER CLEANING (PUSH BUTTON TO CLEAN THE FILTER. DUST FALLS INTO A DRAWER FOR EASY REMOVAL.), 200 LBS FLUX HOPPER/ SEPARATOR AND CONTINUOUS DUTY VACUUM BLOWER/MOTOR UNIT ALL MOUNTED ON A PORTABLE UNDERCARRIAGE.

1. PS-1500 (2 HP FLUX RECOVERY SYSTEM)
- Input power: 220v/1ph/60hz
- Input power: 220-460v/3ph/60hz
- Input power: 380-415v/3ph/50hz
- Input power: 575v/3ph/60hz
- Extra Heavy Duty Teflon Filter

2. PS-3000 (4 HP FLUX RECOVERY SYSTEM)
- Input power: 220-460v/3ph/60hz
- Input power: 380-415v/3ph/50hz
- Input power: 575v/3ph/60hz
- Extra Heavy Duty Teflon Filter

3. PS-5000 (5.5 HP FLUX RECOVERY SYSTEM)
- Input power: 220-460v/3ph/60hz
- Input power: 380-415v/3ph/50hz
- Input power: 575v/3ph/60hz
- Extra Heavy Duty Teflon Filter

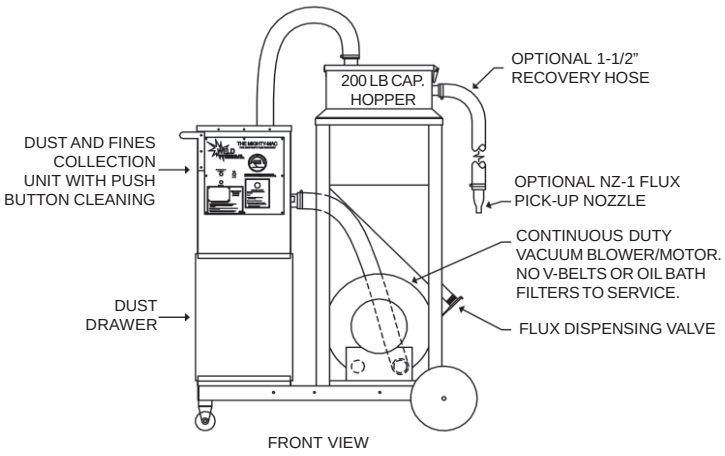

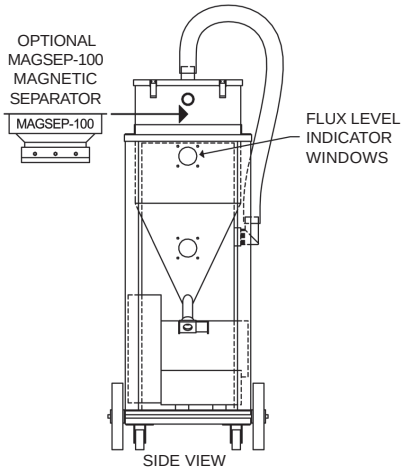

MAGSEP-100 Magnetic Separator for PS-1500, PS-3000 and PS-5000 flux recovery units available. See page 61, Item C.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


NEW PRODUCT!


7.5 HP PORTABLE FLUX RECOVERY SYSTEM

THE PS-7500 HAS SEMI-AUTOMATIC FILTER CLEANING (PUSH BUTTON TO CLEAN THE FILTER. DUST FALLS INTO A DRAWER FOR EASY REMOVAL.), 200 LB FLUX HOPPER/SEPARATOR AND CONTINUOUS DUTY VACUUM BLOWER/MOTOR UNIT ALL MOUNTED ON A PORTABLE UNDERCARRIAGE.

4. PS-7500 (PORTABLE 7.5 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz

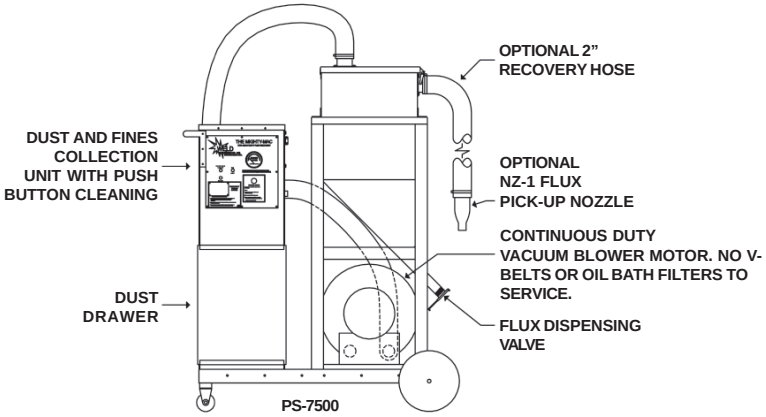

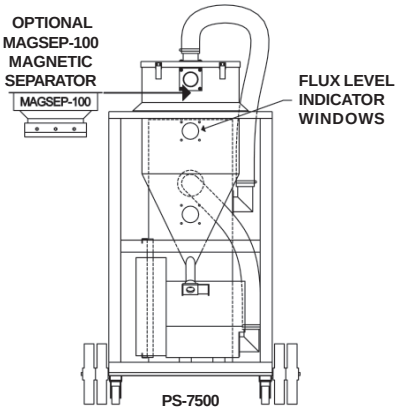

ADDITIONAL ACCESSORIES FOR PS-7500:

2-1/2" Vacuum Hose (sold in 5 ft increments).
2" Flux Recovery Hose (sold in 5 ft increments).
NZ-2" Flux Pick-Up Nozzle.
Teflon Filter for Extra Heavy Duty Recovery

MAGSEP-100 Magnetic Separator for PS-1500, PS-3000, PS-5000 and PS-7500 flux recovery units available.
See page 61, Item C.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

LOW COST HEAVY CONTINUOUS DUTY HEATED PORTABLE FLUX RECOVERY EQUIPMENT

THE HPS-1500, HPS-3000, HPS-5000, AND HPS-7500 HAVE SEMI-AUTOMATIC FILTER CLEANING (PUSH A BUTTON TO CLEAN THE FILTER. DUST FALLS INTO A DRAWER FOR EASY REMOVAL.), 200 LB HEATED FLUX HOPPER/SEPARATOR **(THE HOPPER IS HEATED TO AN ADJUSTABLE 32°F/0°C to 250°F/121°C)** AND CONTINUOUS DUTY VACUUM BLOWER/MOTOR UNIT ARE ALL MOUNTED ON A PORTABLE UNDERCARRIAGE.

1. HPS-1500 (2 HP FLUX RECOVERY SYSTEM)


Input power: 220v/1ph/60hz
Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Extra Heavy Duty Teflon Filter


2. HPS-3000 (4 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Extra Heavy Duty Teflon Filter

3. HPS-5000 (5.5 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Extra Heavy Duty Teflon Filter

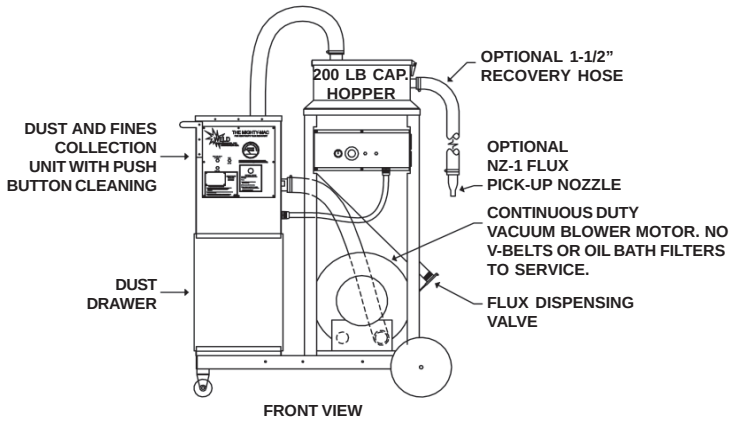

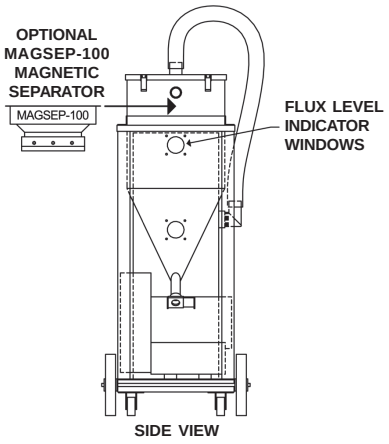

MAGSEP-100 Magnetic Separator for HPS-1500, HPS-3000 and HPS-5000 flux recovery units available.
See page 61, Item C.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


NEW PRODUCT!


7.5 HP PORTABLE HEATED FLUX RECOVERY SYSTEM

THE HPS-7500 HAS SEMI-AUTOMATIC FILTER CLEANING (PUSH A BUTTON TO CLEAN THE FILTER. DUST FALLS INTO A DRAWER FOR EASY REMOVAL.), 200 LB HEATED FLUX HOPPER/SEPARATOR **(THE HOPPER IS HEATED TO AN ADJUSTABLE 32°F/0°C to 250°F/121°C)** AND CONTINUOUS DUTY VACUUM BLOWER/MOTOR UNIT ARE ALL MOUNTED ON A PORTABLE UNDERCARRIAGE.

4. HPS-7500 (PORTABLE HEATED 7.5 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz

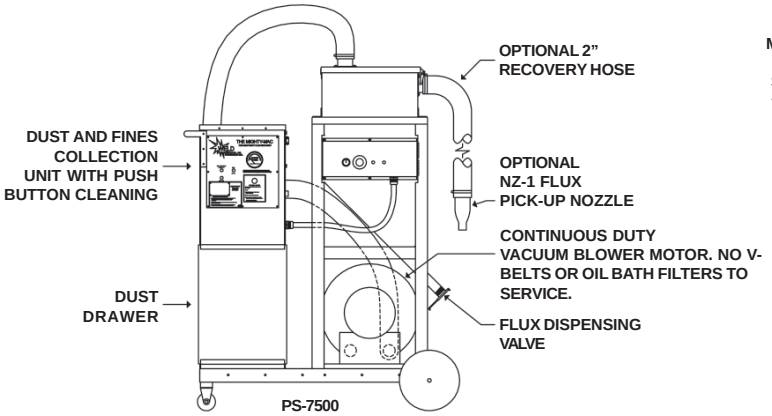

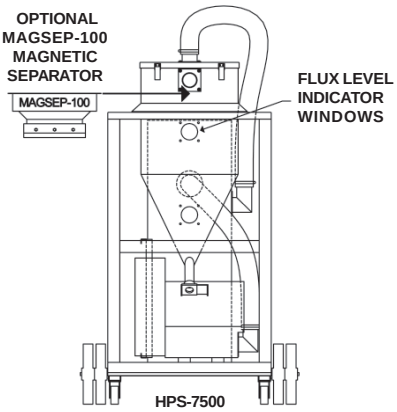

ADDITIONAL ACCESSORIES HPS-7500:

2-1/2" Vacuum Hose (sold in 5 ft increments).
2" Flux Recovery Hose (sold in 5 ft increments).
NZ-2" Flux Pick-Up Nozzle.2-1/2" Vacuum
Teflon Filter for Extra Heavy Duty Recovery

MAGSEP-100 Magnetic Separator for HPS-1500, HPS-3000, HPS-5000 and HPS-7500 flux recovery units available.
See page 61, Item C.

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

LOW COST HEAVY CONTINUOUS DUTY STATIONARY FLUX RECOVERY EQUIPMENT

THE SPS-1500, SPS-3000, SPS-5000, AND SPS-7500 HAVE SEMI-AUTOMATIC FILTER CLEANING (PUSH A BUTTON TO CLEAN THE FILTER. DUST FALLS INTO A DRAWER FOR EASY REMOVAL.), **YOUR CHOICE OF EITHER THE FH-100 (150 LBS CAPACITY) FLUX HOPPER/SEPARATOR OR THE MS-1 SEPARATOR.** THE CONTINUOUS DUTY VACUUM BLOWER/MOTOR UNIT AND SEMI-AUTOMATIC DUST COLLECTION UNIT ARE MOUNTED ON A STURDY UNDERCARRIAGE.

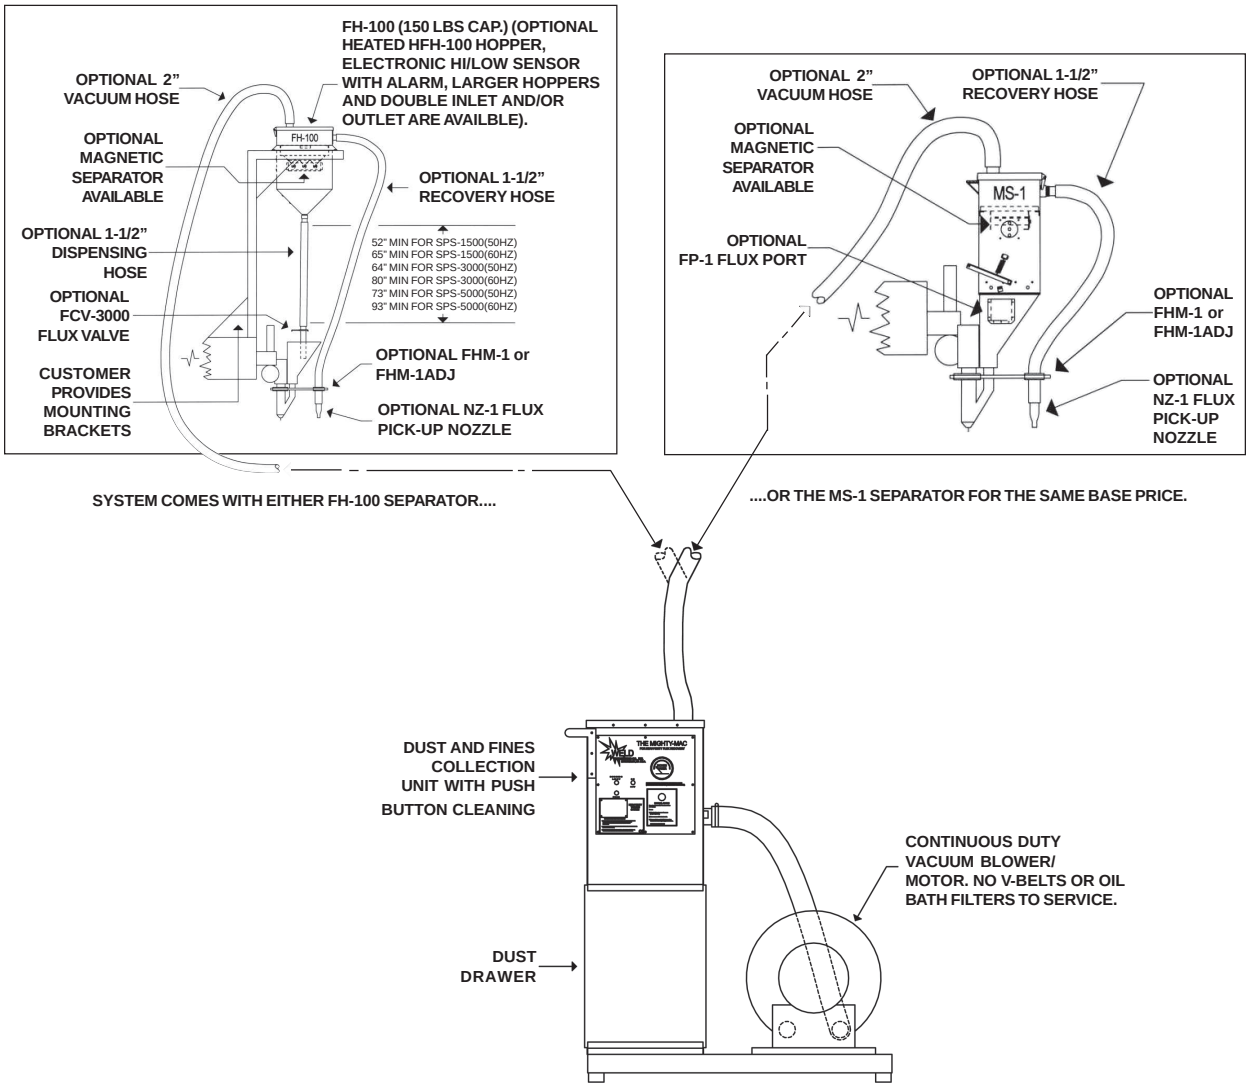

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

1. SPS-1500 (2 HP FLUX RECOVERY SYSTEM)

Input power: 115-220v/1ph/60hz
Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Teflon Filter for Extra Heavy Duty Recovery

2. SPS-3000 (4 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Teflon Filter for Extra Heavy Duty Recovery

3. SPS-5000 (5.5 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Teflon Filter for Extra Heavy Duty Recovery

4. SPS-7500 (STATIONARY 7.5 HP FLUX RECOVERY SYSTEM)

Input power: 220-460v/3ph/60hz
Input power: 380-415v/3ph/50hz
Input power: 575v/3ph/60hz
Teflon Filter for Extra Heavy Duty Recovery

ADDITIONAL ACCESSORIES SPS-7500:

2-1/2" Vacuum Hose (sold in 5 ft increments).
2" Flux Recovery Hose (sold in 5 ft increments).
NZ-2" Flux Pick-Up Nozzle.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

NEW PRODUCT!


MV-5 LOW COST, HEAVY DUTY RECOVERY SYSTEM

The NEW **MV-5 (Complete with the FHMV5-100 HOPPER) is a low cost, heavy duty flux recovery system** which is ideal for Girth Welding (3 O'clock storage tank welding).

Input power: 115v/1ph/60hz / 7.5amp input, 3/4 HP vacuum motor.

***SMALL HEAVY DUTY ELECTRIC FLUX VACUUM.**
***COMES WITH FHMV5-100 FLUX HOPPER (100 LB CAPACITY).**
***PERFECT FOR GIRTH WELDERS.**
***VERY QUIET. NO HIGH PITCH SOUND.**
***115 VAC PLUGS INTO MOST WELDERS.**
***DUST FALLS INTO REMOVABLE DUST PAN.**
***VERY LOW MAINTENANCE.**
***REQUIRES NO COMPRESSED AIR.**

FHMV5-100 100LB CAPACITY HOPPER. COMES WITH MV-5 SYSTEM

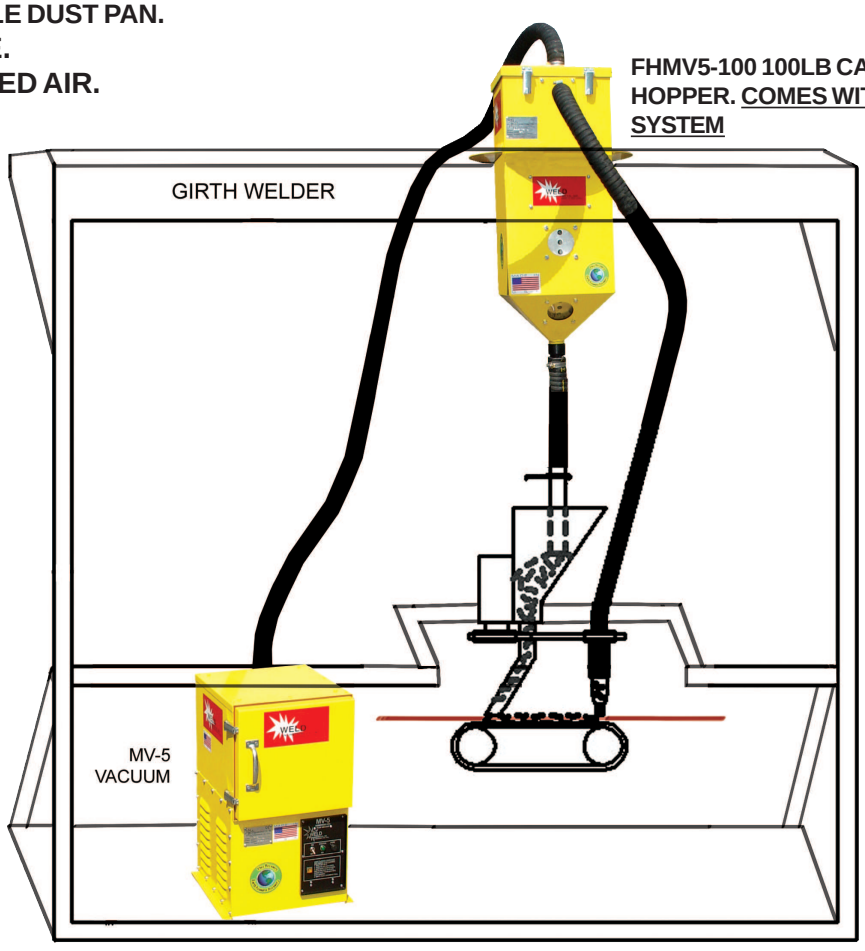

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

ACCESSORIES FOR MIGHTY-MAC AND SPS VACUUMS

1. FD-55 DUST DRUM.




The FD-55 is a dust drum with sealed lid and 3-1/2" hose fitting for dust collection (i.e. includes LID-55 and DHK-55 dust hose kit. See item no. 2 and 3 below). It has a 55 gallon capacity and is used with the MM-1500X/P, MM-3000X/P, MM-5000X/P, and MM-5000X-MILL vacuum.

2. LID-55 DUST DRUM LID.



The LID-55 dust drum lid fits standard **heavy duty** 55 gallon drum. Includes lid to drum ring clamp. (Also recommend ordering DHK-55 hose Kit below.)

3. DHK-55 DUST HOSE KIT.



The DHK-55 Dust hose kit includes 5 feet of 3 1/2" dust hose and two hose clamps for attachment to LID-55. (Included with FD-55; not included with LID-55.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

4. FH-100 FLUX HOPPER/SEPARATION CHAMBER.

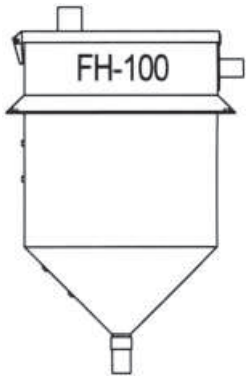


The FH-100 Flux Hopper/Separation Chamber has approximately a 150 lb. capacity with a slag tray, two large sight window level indicators, and a filter which prevents slag from being drawn into the vacuum unit. (See pg. 61, item C {MAGSEP-100} for optional magnetic separator.) (See Technical Bulletin TB-MM708 figure nos. 2, 9, 10, 11, 12, 13, 14, 15, 17, and 18.)

A. FH-300 Flux Hopper/Separation Chamber is same as above except the FH-300 has a 300 lb. capacity.

B. FH-600 Flux Hopper/Separation Chamber is same as above except the FH-600 has a 600 lb. capacity.

C. FH-1000 Flux Hopper/Separation Chamber is same as above except the FH-1000 has a 1000 lb. capacity.

5. HFH-100 HEATED FLUX HOPPER/SEPARATION CHAMBER.

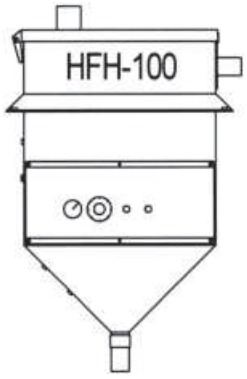

The HFH-100 Heated Flux Hopper/Separation Chamber is same as item no.4, except heated. Continuous control to 250°F (121°C.) Please specify volt age, 115v/1ph/50-60hz or 220v/1ph/50-60hz. (See pg. 61, item C {MAGSEP-100} for optional magnetic separator.) (See Technical Bulletin TB-MM708 figure nos. 2, 9, 10, 11, 12, 13, 14, 15, 17, and 18.)

A. HFH-300 Heated Flux Hopper/Separation Chamber is the same as above except the HFH-300 has a 300 lb. capacity.

B. HFH-600 Heated Flux Hopper/Separation Chamber is same as above except the HFH-600 has a 600 lb. capacity.

C. HFH-1000 Heated Flux Hopper/Separation Chamber is same as above except the HFH-1000 has a 1000 lb. capacity.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

6. FH-100-E/P AND HFH-100-E/P AUTOMATIC FLUX HOPPER/SEPARATION CHAMBER.

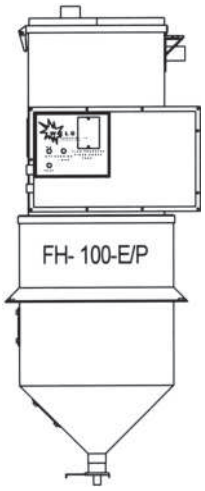

A. FH-100-E/P is a fully automatic submerged arc flux hopper/separator. It has approximately a 150 lb. flux capacity with auto flux transfer to a lower chamber within the FH-100-E/P. This enables the FH-100-E/P not to be sensitive to "Head Height" as the standard FH-100 is, and allows placing the unit in any convenient position over the welding torch. (See Technical Bulletin TB-MM708, figure nos. 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19 and 20)
(See pg. 62, item D {MAGSEP-100-E/P} for optional magnetic separation.)

B. FH-300-E/P Automatic Flux Hopper/Separation Chamber is the same as above except the FH-300-E/P has a 300 lb. capacity.

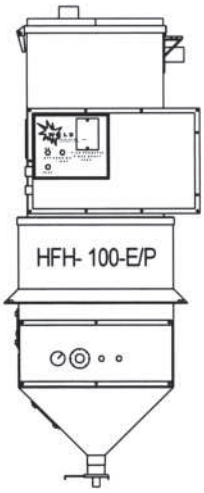

C. HFH-100-E/P Heated Automatic Flux Hopper/Separation Chamber same as above, except heated. Continuous control to 250°F (121°C). Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz.
(See pg. 62, item D {MAGSEP-100-E/P} for optional magnetic separation.)

D. HFH-300-E/P Heated Automatic Flux Hopper/Separation Chamber. Same as above HFH-100-E/P, except it has a 300 Lb. capacity. Continuous control to 250°F(121°C). Please specify volt age, 115v/1ph/ 50-60hz or 20v/1ph/50-60hz.
(See pg. 62, item D {MAGSEP-100-E/P} for optional magnetic separation.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

7. FH-100-E/P-PIPEMILL AUTOMATIC FLUX HOPPER/SEPARATION CHAMBER

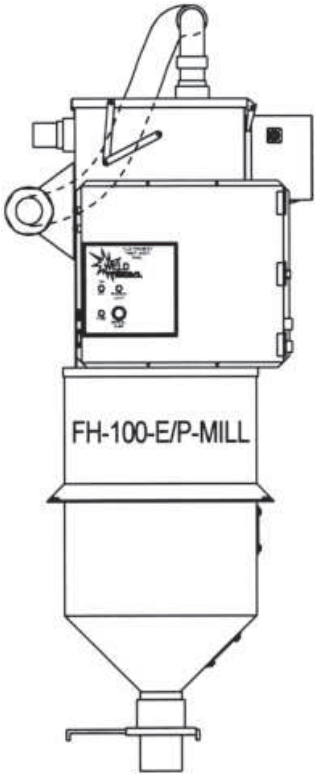

A. FH-100-E/P-PIPEMILL is a fully automatic submerged arc flux hopper/separator. It is made extremely rugged with rubber lined walls for abrasion resistance and specially designed flux transfer valve and automatic vacuum line shutoff valve for rapid flux transfer. It has approximately a 150 lb. flux capacity with auto flux transfer to a lower chamber within the FH-100-E/P-PIPEMILL. This enables the FH-100-E/P-PIPEMILL not to be sensitive to "Head Height" as the standard FH-100 is, and allows placing the unit in any convenient position over the welding torch. (Call factory for diagrams showing applications in "Pipe Mill" or other very heavy duty application.) (See pg. 62, item D {MAGSEP-100-E/P} for optional magnetic separation.) (Please see Techical Bulletin TB-MM708 Figure 35 and 36.)

B. HFH-100-E/P-PIPEMILL Heated Automatic Flux Hopper/Separation Chamber. Same as above except heated. Continuous control to 250°F(121°C).Please specify volt age, 115v/1ph/50-60hz or 220v/1ph/50-60hz. (See pg. 62, item D {MAGSEP-100-E/P} for optional magnetic separation.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


ADD ON CHANGES FOR HOPPERS 4, 5, 6 & 7

A.) For two (2) flux recovery hose inlets (standard is one {1}), there is a small additional cost added to FH-100, FH-300, FH-600, FH-1000, HFH-100, HFH-300, HFH-600, HFH-1000, FH-100-E/P, FH-300-E/P, HFH-100-E/P or HFH-300-E/P prices. (Not recommended for FH-100-E/P-PIPEMILL and HFH-100-E/P-PIPEMILL.)

B.) For two (2) flux dispensing outlets (standard is one {1}), there is a small additional cost added to FH-100, FH-300, FH-600, FH-1000, HFH-100, HFH-300, HFH-600, HFH-1000, FH-100-E/P, FH-300-E/P, HFH-100-E/P or HFH-300-E/P prices. (Not recommended for FH-100-E/P-PIPEMILL and HFH-100-E/P-PIPEMILL.)

C.) MAGSEP-100 MAGNETIC SEPARATOR.

MAGSEP-100 Magnetic Separator for FH-100, FH-300, FH-600, FH-1000, HFH-100, HFH-300, HFH-600, HFH-1000, LPFR-3000, PFR-3000, HLPFR-3000, HPFR-3000, and PS-1500 through HPS-7500 flux recovery units. The MAGSEP-100 installs in place of the standard slag tray. Its advanced design provides a slag separation tray and powerful magnets to remove magnetic particles from recovered flux. Magnetic particles are easily disposed of by removing MAGSEP-100 from the flux recovery separator, operator then slides magnet assembly out of magnetic collection tubes and magnetic particles fall away to be discarded.

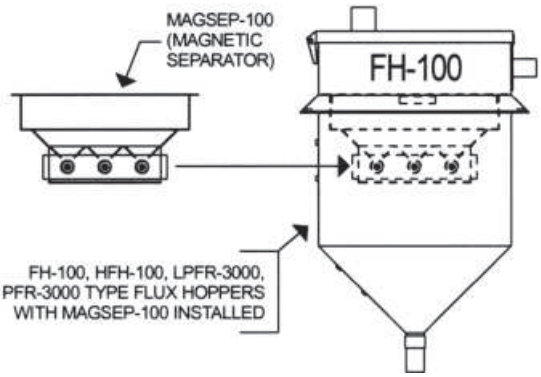

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

D.) MAGSEP-100-E/P MAGNETIC SEPARATOR.

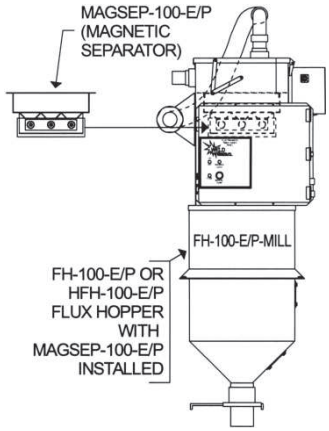

MAGSEP-100-E/P Magnetic Separator for FH-100-E/P, FH-300-E/P, HFH-100-E/P, HFH-300-E/P, SUPER-FH-100-A/P-E/P and SUPER-HFH-100-A/P-E/P, installs in place of the standard slag tray. Its advanced design provides a slag separation tray and powerful magnets to remove magnetic particles from recovered flux. Magnetic particles are easily disposed of by removing MAGSEP-100-E/P from the flux recovery separator, operator then slides magnet assembly out of magnetic collection tubes and magnetic particles fall away to be discarded.


E.) ELECTRONIC HIGH OR LOW FLUX LEVEL SENSOR FOR FH-100, FH-300, FH-600, FH-1000, HFH-100, HFH-300, HFH-600, HFH-1000, FH-100-E/P, FH-300-E/P, HFH-100-E/P AND HFH-300-E/P.

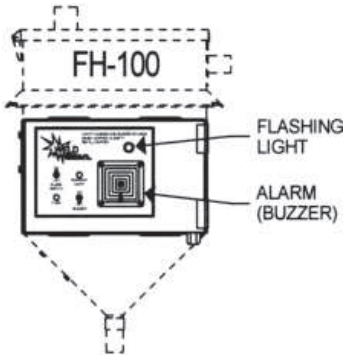

High or low flux level warning lights or audible alarm for flux level. (Consult factory if high and low flux level sensing is required.)

A. Please see pg. 38 for prices and details.
B. Please see pg. 39 for prices and details.

8. MS-1 SEPARATOR

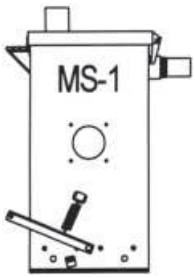

The MS-1 Separator is for flux recovery directly back to the welding head hopper. Mounts directly on to Lincoln, L-Tec and most other hoppers, or use optional FH-1, 35 to 40 pound capacity hopper. **Two MS-1 separators can be used with one MM-3000X or MM-5000X. If only one MS-1 is used, the VFT-3000 vacuum control valve must also be used** (see price on page 84). **Use one MS-1 with the MM-1500.** (See Technical Bulletin TB-MM708 figure nos. 1, 3, 4, 5, 6, and 7 in TB-MM708. Also see pg. 64, item no.12 {MAGSEP-1} for optional magnetic separator.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


9. MS-1-E/P SEPARATOR.

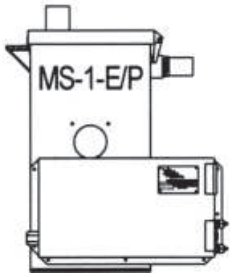

The MS-1-E/P Separator is the same as Item 8, except flux is automatically transferred to the lower welding head hopper. 115v or 220V input and shop air (70-100 psi with minimum 3/16" I.D. air hose required. The air operates flux valve only, does not provide vacuum). (See pg. 64, item no. 12 {MAGSEP-1} for optional magnetic separator.) See Technical Bulletin TB-MM708 figure nos. 1, 3, 4, 5, 6, and 8.)

Input power: 115v/1ph/50-60hz
Input power: 220v/1ph/50-60hz

10. HAMX-50.

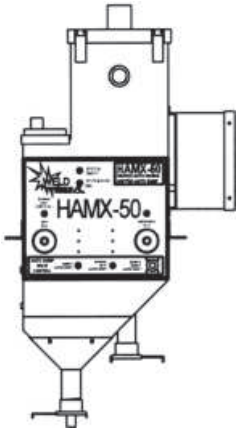

HAMX-50 recovers unfused flux and automatically mixes a pre-set ratio of new flux to recovered and dispenses this mixture to the welding torch while welding. The HAMX-50 holds 25 pounds of new flux and 25 pounds of recovered flux in separate heated chambers (32°F/0°C to 250°F/121°C). It replaces existing OEM flux hopper. (User must provide own mounting brackets for attachment of HAMX-50 to welding system.) Larger capacity systems are available, please consult factory with your requirements. Hoses, pick up nozzle and magnetic separator are not included. See pg. 64, item no. 12 {MAGSEP-2} for optional magnetic separator and figure nos. 24 and 25 of TB-MM708. (Note: Compressed air @ 70-100 psi with minimum 3/16" I.D. hose must be attached to the HAMX-50.
(This provides power for operation of flux transfer valve.)

Input power: 115v/1ph/50-60hz
Input power: 220v/1ph/50-60hz

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


11. GHAMX-150 HEATED GRAVITY FEED MIXING HOPPER

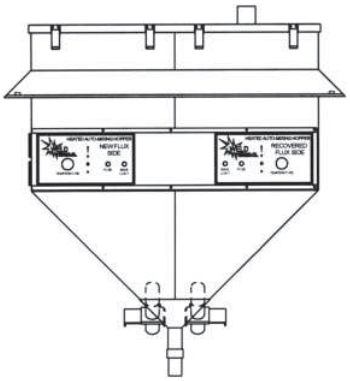

GHAMX-150 Separator automatically mixes a pre-set ratio of new flux to recovered flux and dispenses this mixture to the welding torch while welding. The GHAMX-150 holds 150 pounds of **new flux** and 150 pounds of **recovered flux** in separate heated chambers {32°F (0°C) to 250°F (121°C)}. User must provide own mounting brackets for attachment of GHAMX-150 to welding system. Hoses, pick up nozzle and magnetic separator are ordered separately. See pg. 79 item no. 14 (MAGSEP-100) for optional magnetic separator and figure no. 26 of TB-MM708 for complete system requirements.


Input power: 115v/1ph/50-60hz
Input power: 220v/1ph/50-60hz

12. MAGSEP-1 OR MAGSEP-2 MAGNETIC SEPARATOR.

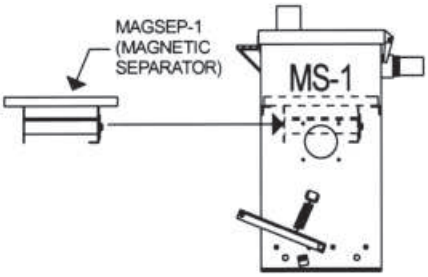

MS-1 & MS-1-E/P, and MAGSEP-2 for HAMX-50 flux recovery vacuums. The MAGSEP-1 and MAGSEP-2 installs in place of the standard slag tray. Its advanced design provides a slag separation tray and powerful magnets to remove magnetic particles from recovered flux. Magnetic particles are easily disposed of by removing MAGSEP-1 or MAGSEP-2 from the flux recovery vacuum, operator then slides magnet assembly out of magnetic collection tubes and magnetic particles fall away to be discarded.

13. FH-1 FLUX HOPPER.

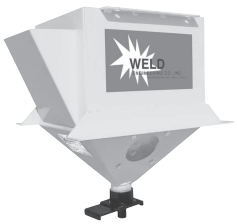

The FH-1 flux hopper is for use with AS-4, AS-4-E/P, AP-1, AP-1-E/P, SUPER-AP-1, SUPER-AP-1-E/P, MS-1 and MS-1-E/P where greater flux capacity is required. Side Loading Port of hopper enables operator to add flux to hopper during welding, without interrupting the weld; thus providing an unlimited supply of flux. Hopper holds approximately 35 to 40 pounds of flux. **Note: Customer must provide own mounting bracket. Does not mount directly to welding head because of increased size and flux weight capacity.**

FH-1-60 flux hopper is the same as above except it holds 60 lbs of flux.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


14. HFH-1 HEATED FLUX HOPPERS.



The HFH-1 heated flux hopper is the same as the FH-1 Hopper (see page 64), except it is heated. It has a continuous digital temperature control (34°F {1 °C } to 250°F{121°C}) with digital readout for those applications where flux must be heated. (Interfaces with same recovery equipment as FH-1 Hopper). Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz.


A. HFH-1-60 heated flux hopper is the same as above except it holds 60 lbs of flux.

15. HFH-3-PF HEATED FLUX HOPPER.

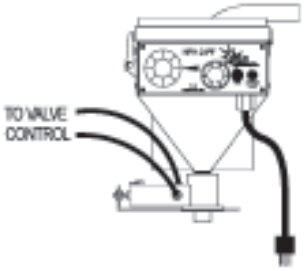

Compact, heated flux hopper for feeding to smaller I.D. welds. Mounts directly to Lincoln and Miller welding equipment, in place of standard hopper. Will also mount to other manufacturer's equipment. Holds approximately 7 lbs of flux. Heats flux up to 250°F (121°C) with easy to use thermostat control. Pressure feed system constantly feeds new flux to hopper. Comes complete with auto-pneumatic flux valve with external control. Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz.

16. HFH-4-PF heated flux hopper is the same as above except it holds 17 lbs of flux.

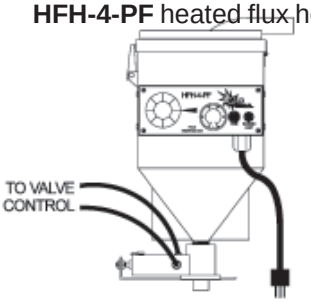

Compact, heated flux hopper for feeding to smaller I.D. welds. Mounts directly to Lincoln and Miller welding equipment, in place of standard hopper. Will also mount to other manufacturer's equipment. Holds approximately 17 lbs of flux. Heats flux up to 250°F (121°C) with easy to use thermostat control. Pressure feed system constantly feeds new flux to hopper. Comes complete with auto-pneumatic flux valve with external control. Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz.

***FOR FH-3 AND HFH-3 HOPPERS SEE PAGE 35**

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

17. FP-1 FLUX PORT.

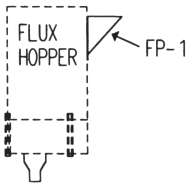

The FP-1 flux port is for the Lincoln hopper or any flat walled hopper. Allows additional flux to be added to hopper without interrupting the weld. Includes aluminum port and pop-rivets.


18. AFV-2 AUTOMATIC FLUX VALVE.

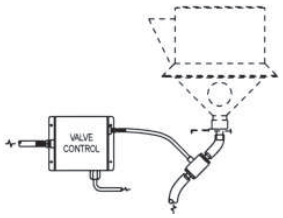

The AFV-2 is an in-line flux pinch valve for 3/4" I.D. flux feed hose. Automatically opens or closes flux flow in 3/4" I.D. hose, when 115v electrical signal is supplied. Use with FH-1, HFH-1, or any gravity feed hopper. (Typical use would be to automatically start flux flow when arc-start button is pushed and stop flux flow when weld is finished.) System includes flux pinch valve, air on/off solenoid, pressure regulator and five (5) feet of 1/4" I.D. air hose.

Input power: 115v/1ph/50-60hz and standard shop air (available in other voltages).


19. AFV-2-FH-100 AUTOMATIC FLUX VALVE.

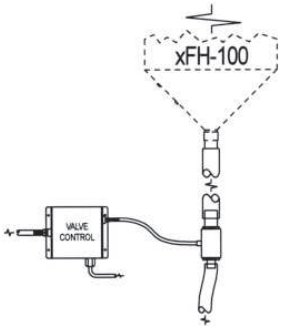

Same as Item 18, except used with FH-100 or HFH-100. One end accepts 1 1/2" I.D. flux dispensing hose from FH-100; other end accepts 3/4" I.D. hose to feed welding torch.

Input power: 115v/1ph/50-60hz and standard shop air (available in other voltages).

20. AFV-32 AUTOMATIC FLUX VALVE.

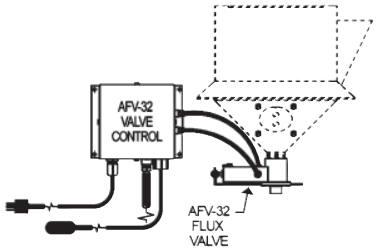

The AFV-32 is an automated slide valve attachment for 1" I.D. flux feed hose. Automatically opens or closes flux flow in 1" I.D. hose, when 115v electrical signal is supplied (other voltages available). Use with FH-1, HFH-1, FH-100-E/P, HFH-100-E/P, SUPER-FH-100-A/P-E/P and SUPER-HFH-100-A/P-E/P, or any gravity feed hopper. (Typical use would be to automatically start flux flow when arc-start button is pushed and to stop flow when weld is finished.) System includes automated slide valve, air on/off solenoid, pressure regulator and two five (5) foot lengths of 1/4" I.D. air hose.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

21. LAFV-32 AIR POWERED SLIDE VALVE FOR LINCOLN ELECTRIC K219 FLUX HOPPER.

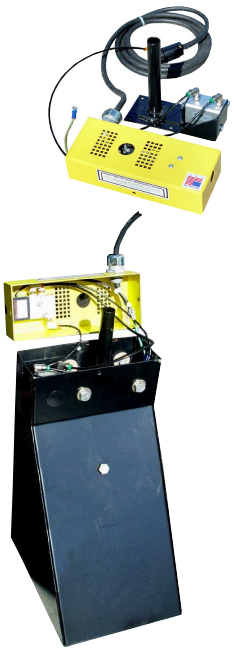

The LAFV-32 is an air powered slide valve for use with the Lincoln Electric K219 flux hopper. This valve replaces the existing flux hopper valve. The control cord plugs into the same receptical as the OEM valve uses. The LAFV-32 will give you a complete valve closure and will prevent the problems associated with leaking OEM electric solenoid flux valves, especially when using Pressure feed systems (PFR-3000, HPFR-3000 AND HPFR-HAMX-3000 to feed the flux or flux recovery units XP-3 AND XP-4T).This valve is operated using the Lincoln Electric controls.

I**nput Power:** Uses The Lincoln control voltage.
Air: 70 to 100 psi air pressure. The air flow is very low since air is only used to actuate a small air piston.

22. MAFV-32 AIR POWERED SLIDE VALVE FOR Miller Electric FLUX HOPPER.



The MAFV-32 is an air powered slide valve for use with the Miller Electric OEM flux hopper. This valve replaces the existing flux hopper valve. The control cord plugs into the same receptical as the OEM valve uses. The MAFV-32 will give you a complete valve closure and will prevent the problems associated with leaking OEM electric solenoid flux valves, especially when using Pressure feed systems (PFR-3000, HPFR-3000 and HPFR-HAMX-3000 to pressure feed the flux or flux recovery units XP-3 and XP-4T).This valve is operated using the Miller Electric controls.

I**nput Power:** Uses The Miller control voltage.
Air: 70 to 100 psi air pressure. The air flow is very low since air is only used to actuate a small air piston.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT WELD ENGINEERING CO. DESIGN !

ALL OF WELD ENGINEERING CO.'S FLUX FEED TANKS ARE EQUIPPED WITH OUR EXCLUSIVE "INTERNAL FLUX CONE." THIS ALLOWS ALL THE FLUX TO FEED OUT OF THE TANK. THERE IS NO "DEAD SPACE" IN THE TANK WHICH TRAPS FLUX.

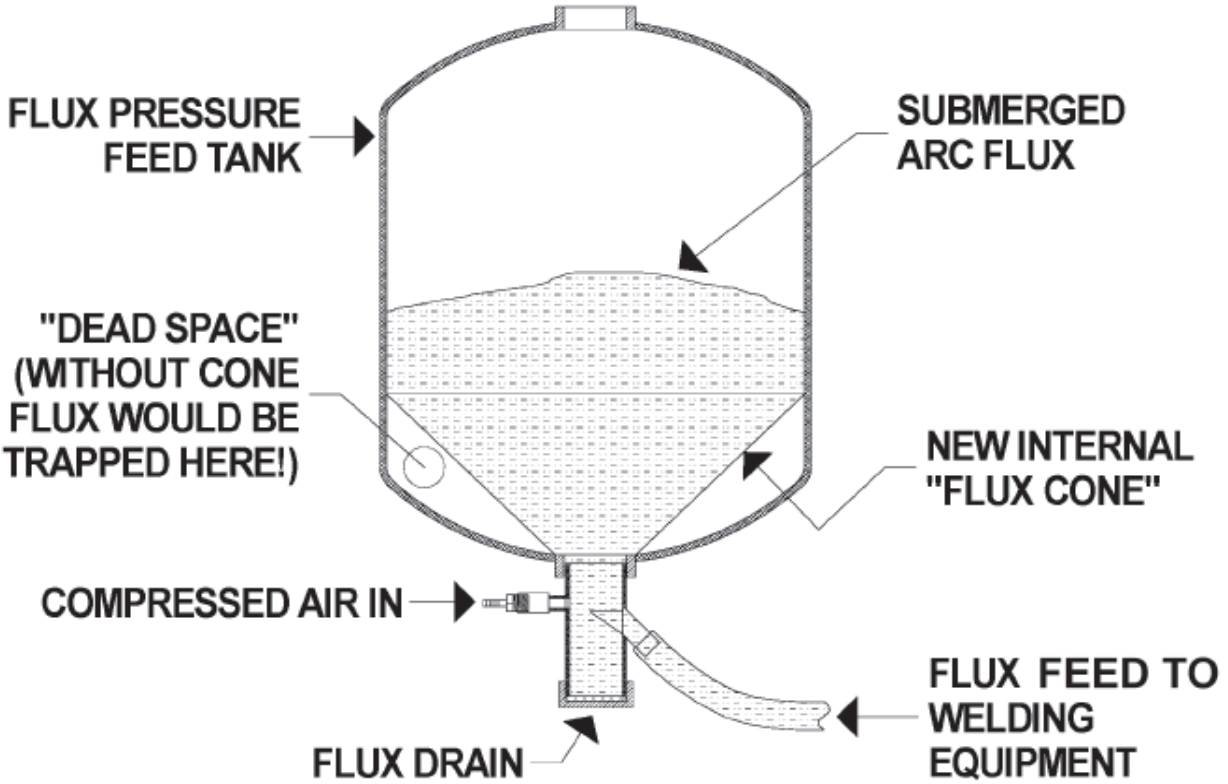

FLUX CONE DGRM.TIF
2-29-18 TML

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

FLUX PRESSURE FEED TANK SYSTEMS

1. PT-"x"00 FLUX PRESSURE FEED TANK SYSTEM.

The PT-"x"00 is a flux pressure feed tank system for pressure feeding flux to a flux hopper or welding torch. Many tank sizes are available, i.e. 100 pound, 300 pound, 600 pound, or larger. Also flux feed nozzle for 1/2", 3/4" or 1" I.D. flux feed hose is available. (See T-NOZ-"x" on page 82.) (Compressed air input of 60-100 psi @ approximately 1 cfm is required.) (i.e. 100 pound tank with 3/4" I.D. flux feed hose has a part number PT-100-3/4). **Please consult factory with exact requirements for pricing.**

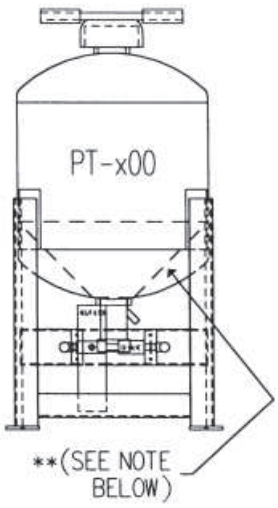

A. PT-3 (60 pound tank)

B. PT-100 (100 pound tank)

C. PT-300 (300 pound tank)

D. PT-600 (600 pound tank)


Please consult factory for larger size tanks.

NOTE: Specify flux feed hose diameter. 1/2",3/4" or 1" are standard. Hose does not come with tank. See page 83 for feed hoses.

For Electronic low or high flux level sensor an option is available for all size pressure tanks. When flux level is low (or high, based on your requirements), a loud audible alarm and flashing light on control panel will signal operator. (See page 38 for sensor options).

2. HPT-"x"00 HEATED FLUX PRESSURE FEED TANK SYSTEM.

The HPT-"x"00 is the same as above PT-"x"00, but is heated to 250°F (121°C), adjust able.

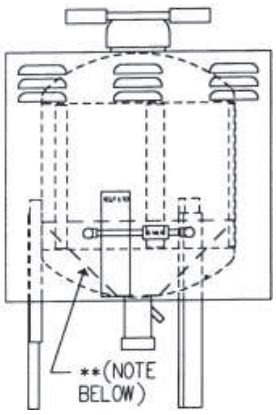

A. HPT-100 (100 pound tank)

B. HPT-300 (300 pound tank)

C. HPT-600 (600 pound tank)

Please consult factory for larger size tanks.

NOTE: Specify flux feed hose diameter. 1/2", 3/4" or 1" are standard. Hose does not come with tank. See page 83 for feed hoses.

For high temperature electronic high or low level sensor (as described in item no.1 above), see page 39.


****Please note, the PT-"x"00 and HPT-"x"00 flux pressure feed tank systems are now manufactured with an internal flux cone. This flux cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank, from which flux will not flow out of the tank.**

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

3. HPT-100/D HEATED PRESSURE FEED SYSTEM WITH AIR DRYER FOR SUBMERGED ARC FLUX.

The HPT-100/D is a heated (32°F/0°C to 400°F/ 204°C) submerged arc flux pressure feeding system with a refrigerated air dryer for automatically pressure feeding flux to a flux hopper or welding torch. The flux capacity is 100 pounds (45.36 g.). Flux is fed through a 1/2", 3/4" or 1" I.D. high temperature hose to the welding hopper or torch. Incoming shop air (60 psi required) first passes through an oil and water trap, then a micron filter, and then through a refrigerated air dryer, before finally pressurizing the flux tank with very clean, dry air. The tank is heated to an adjustable range of 32°F/0°C to 400°F/ 204°C. The HPT-100/D minimizes the effects of hydrogen assisted cracking due to moisture in the flux.

.

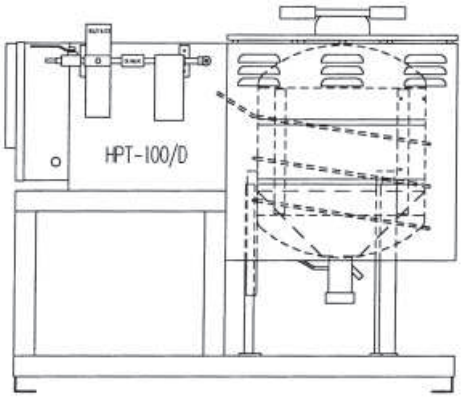

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

4. FTV-3000 AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!

THE NEW FTV-3000 FLUX VALVE AUTOMATICALLY TRANSFERS RECOVERED SUB-MERGED ARC FLUX FROM THE RECOVERY HOPPER TO THE LOWER PRESSURE FEED TANK OF OUR POPULAR PFR-3000 (OR HPFR-3000) PRESSURE FEED AND RECOVERY SYSTEM FOR SUBMERGED ARC WELDING. EASY TO INSTALL ON OLD, OR ORDER WITH NEW PFR-3000'S AND HPFR-3000'S. TO TRANSFER FLUX FROM HOPPER TO FEED TANK, SIMPLY PUSH A BUTTON ON CONTROL OR REMOTE PENDANT. THE FTV-3000 IS A GREAT "COST REDUCTION" FOR ALL PFR-3000'S OR HPFR-3000'S ALREADY IN THE FIELD OR NEW SYSTEMS.



*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

5. AV-3000-NS AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!

THE AV-3000-NS IS AN AUTOMATIC FLUX TRANSFER VALVE WHICH ALLOWS THE OPERATOR TO TRANSFER FLUX FROM THE UPPER FLUX RECOVERY HOPPER TO THE LOWER PRESSURE FEED FLUX TANK WITH THE PUSH OF A BUTTON OR IT CAN AUTOMATICALLY TRANSFER WHEN TANK IS LOW (MUST ORDER SPECIAL PRESSURE FEED TANK). THE AV-3000-NS INCLUDES AN ELECTRONIC HIGH AND LOW LEVEL SENSOR AND ALARM, WHICH ALERTS OPERATOR WHEN FLUX IS NOT AT AN OPTIMAL LEVEL.

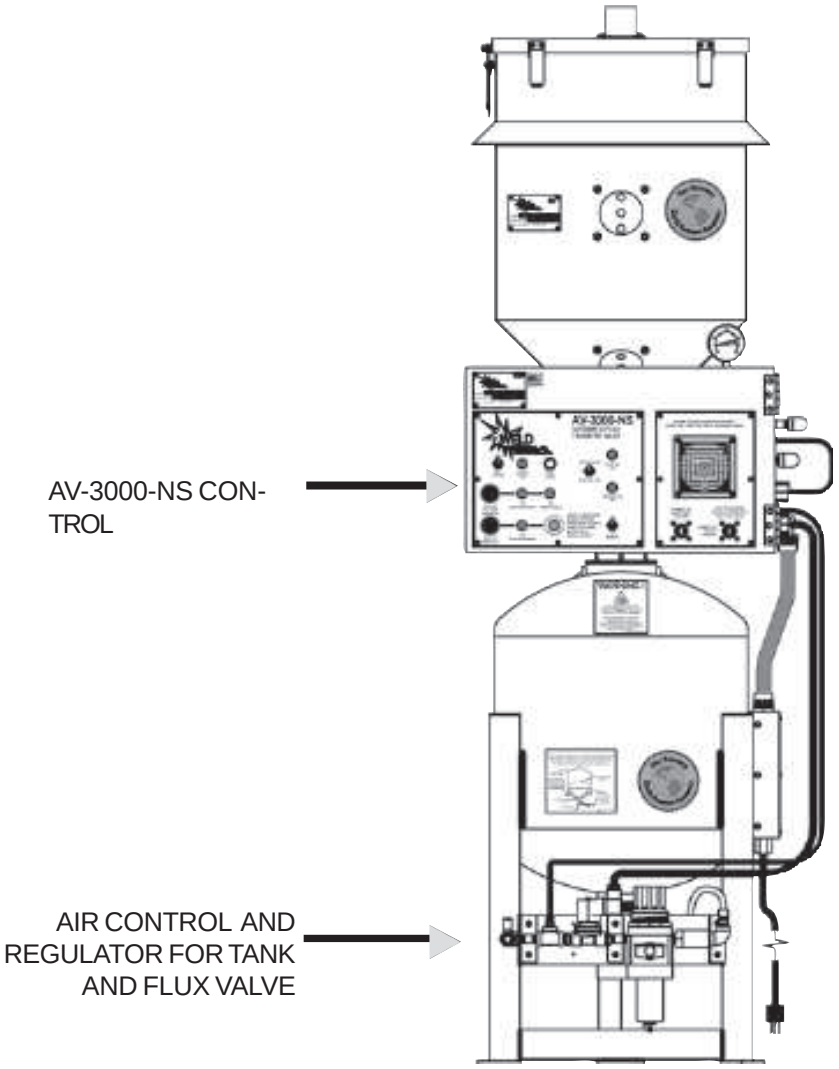

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

6. LPFR-3000 FLUX RECOVERY SYSTEM.

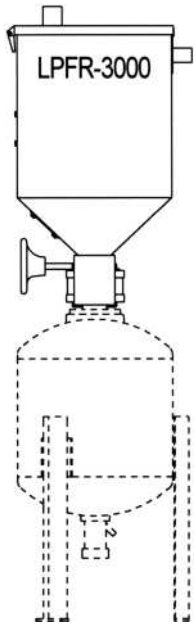

The LPFR-3000 flux recovery system (less the pressure tank) mounts directly to the pressurized flux feed tank. The LPFR-3000 screws on the tank in place of the top pressure cap; recovers all unfused flux and transfers flux to pressure tank via a butterfly valve and geared hand-wheel opener. Approximately 150 pound capacity. (Requires a "Mighty-Mac" vacuum to provide vacuum power.) Available for PT-"x"00, HPT-"x"00, Lincoln K320, and Miller pressure tanks. Please consult factory for other pressure tanks. (See pg. 79, item 14 {MAGSEP-100} for optional magnetic separator and TB-MM708 figure nos. 21, 22 and 23 for complete system requirements.)

7. HEATED HLPFR-3000 FLUX RECOVERY SYSTEM.

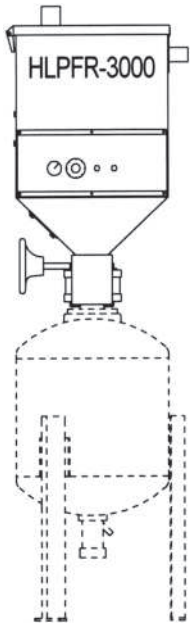

The HLPFR-3000 flux recovery system is the same as Item 6, except heated. Continuous control to 250°F (121°C). Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz. (See pg. 79, item 14 {MAGSEP-100} for optional magnetic separator and TB-MM708 figure nos. 21, 22 and 23 for complete system requirements.)

OPTIONAL FTV-3000 AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!

Please see page 71 for details.115V/1PH/60-50HZ
(Other voltages available upon request.)
(Consult factory for pricing details.)

Input power: 115v/1ph/50-60hz and standard shop air (other voltages available).

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

8. PFR-3000 PRESSURE FEED AND RECOVER SYSTEM.

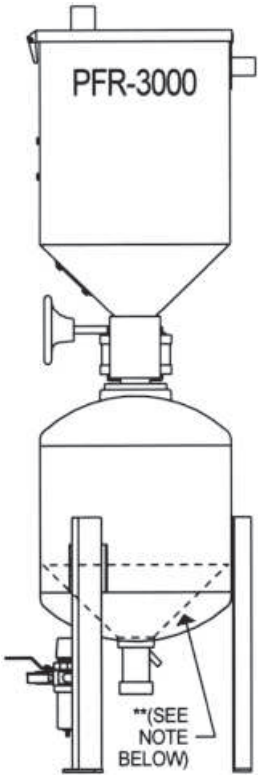

The PFR-3000 pressure feed and recover system recovers flux back to the flux separation hopper; recovered flux is then pressure-fed to torch or welding equipment hopper. (Requires a "Mighty-Mac" vacuum to provide vacuum power and compressed air input of 60-100 psi @ approximately 1 cfm.) (See pg. 79, item 14 {MAGSEP-100} for optional magnetic separator and TB-MM708 figure nos. 21, 22 and 23 for complete system requirements.) Different hopper and pressure feed tank capacities are listed below.

A. PFR-3000-200/100 - 150 Lb. Capacity Hopper/Separator
100 Lb. Capacity Pressure Tank

B. PFR-3000-300/300 - 300 Lb. Capacity Hopper/Separator
300 Lb. Capacity Pressure Feed Tank

C. PFR-3000-600/400 - 400 Lb. Capacity Hopper/Separator
600 Lb. Capacity Pressure Feed Tank

D. PFR-3000-1200/1000 -1000 Lb. Capacity Hopper/Separator
1200 Lb. Capacity Pressure Feed Tank

E. PFR-3000-1500/2000 - 2000 Lb. Capacity Hopper/Separator
2000 Lb. Capacity Pressure Feed Tank

ELECTRONIC FLUX LEVEL SENSOR:
Optional electronic high or low flux level sensor is available to sense flux level of pressure tank or flux hopper. When flux level is low (or high; based on your requirements), a loud audible alarm and flashing light on control panel will signal operator (See page 38 - 39 for sensor options and pricing.)

OPTIONAL FTV-3000 and AV-3000-NS AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!

Please see page 71 and 72 for details.115V/1PH/60-50HZ (Other voltages available upon request. Call for pricing details.)

****Please note, the PFR-3000 flux pressure feed and recovery system is now manufactured with an internal flux cone. This cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank from which flux will not flow out of the tank.**

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

9. HEATED HPFR-3000 FLUX RECOVERY SYSTEM.



The HPFR-3000 flux recovery system is the same as item 8, except that the upper flux hopper is heated (tank is not heated). Continuous control to 250°F (121°C). (Input of 60 psi of compressed air @ approximately 2 cfm is required.) Please specify voltage, 115v/1ph/50-60hz or 220v/1ph/50-60hz. (See pg. 79, item 14 {MAGSEP-100} for optional magnetic separator and TB-MM708 figure nos. 21, 22 and 23 for complete system requirements.)

A. HPFR-3000-H200/100 - 150 Lb. Capacity Heated Hopper/Separator 100 Lb. Capacity Pressure Feed Tank

B. HPFR-3000-H300/300 - 300 Lb. Capacity Heated Hopper/Separator 300 Lb. Capacity Pressure Feed Tank

C. HPFR-3000-H400/600 - 400 Lb. Capacity Heated Hopper/Separator 600 Lb. Capacity Pressure Feed Tank

D. HPFR-3000-H1000/1200 -1000 Lb. Capacity Heated Hopper/Separator 1200 Lb. Capacity Pressure Feed Tank

E. HPFR-3000-H1500/2000 - 1500 Lb. Capacity Heated Hopper/Separator 2000 Lb. Capacity Pressure Feed Tank
(Note: **Available in 220v/3ph/50-60hz or 380-415v/3ph/50-60hz only**.)

ELECTRONIC FLUX LEVEL SENSOR:

Optional high temperature electronic high or low flux level sensor is available to sense flux level of pressure tank or flux hopper. When flux level is low (or high; based on your requirements), a loud audible alarm and flashing light on control panel will signal operator. (See page 38 - 39 for sensor options and pricing.)

OPTIONAL FTV-3000 and AV-3000-NS AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!

Please see page 71 and 72 for details.115V/1PH/60-50HZ (Other voltages available upon request. Call for pricing details.)

****Please note, the HPFR-3000 flux pressure feed and recovery system is manufactured with an internal flux cone. This cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank from which flux will not flow out of the tank.**

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

10. HPFR-3000H HEATED PRESSURE FEED AND HEATED RECOVERY SYSTEM.

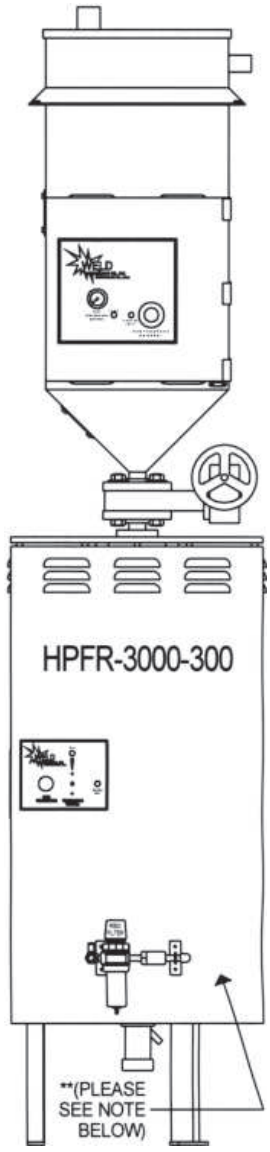

Same as item no. 9, except **both** the upper hopper and pressure tank are heated. (See pg. 79, item 14 {MAGSEP-100} for optional magnetic separator and TB-MM708 figure nos. 21, 22 and 23 for complete system requirements.) Different hopper and pressure feed tank capacities are listed below:

A. HPFR-3000-H200/H100 - 150 Lb. Capacity Heated Hopper/Separator 100 Lb. Capacity Heated Pressure Feed Tank

B. HPFR-3000-H300/H300 - 300 Lb. Capacity Heated Hopper/Separator 300 Lb. Capacity Heated Pressure Feed Tank

C. HPFR-3000-H400/H600 - 400 Lb. Capacity Heated Hopper/Separator 600 Lb. Capacity Heated Pressure Feed Tank

D. HPFR-3000-H1000/H1200 - 1000 Lb. Capacity Heated Hopper/Separator 1200 Lb. Capacity Heated Pressure Feed Tank

E. HPFR-3000-H1500/H2000 - 1500 Lb. Capacity Heated Hopper/Separator 2000 Lb. Capacity Heated Pressure Feed Tank

ELECTRONIC FLUX LEVEL SENSOR:
Optional electronic high or low flux level sensor is available to sense flux level of pressure tank or flux hopper. When flux level is low (or high; based on your requirements), a loud audible alarm and flashing light on control panel will signal operator. (See page 38 - 39 for sensor options and pricing.)

OPTIONAL FTV-3000 AND AV-3000-NS AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!
Please see page 71 and 72 for details.115V/1PH/60-50HZ
(Other voltages available upon request. Consult factory for pricing details.)

****Please note, the HPFR-3000H flux pressure feed and recovery system is now manufactured with an internal flux cone. This cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank from which flux will not flow out of the tank.**

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

11. PFR-HAMX-3000 HEATED FLUX HOPPER/SEPARATOR AND PRESSURE FEED SYSTEM.

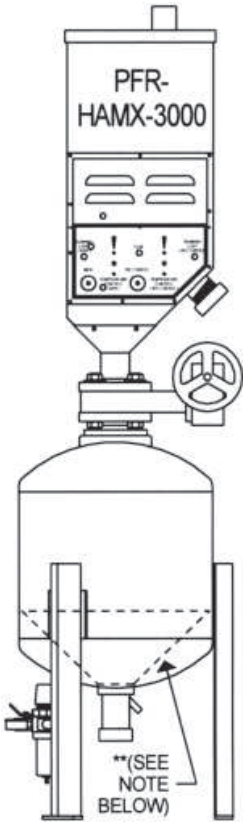

The PFR-HAMX-3000-H100-100 is a heated (control up to 250°F {121°C}) flux hopper/separator and pressure feed system.The top hopper/separator has **two 50 pound capacity sections**, one for recovered flux and one for new flux. Flux from each of these two sections mix together at a preset ratio as the flux is transferred into the **100 lb pressure tank**. Each section features a high and low level sight window to monitor the amount of flux in the unit. The PFR-HAMX-3000 is very useful for sub-arc welding when code requires a specific percentage of new flux to be mixed with recovered flux. (See pg. 64, item 12 {MAGSEP-2} for optional magnetic separator.) (Please consult factory for larger tank/hopper combinations.)

Input power: 115v/1ph/50-60hz
Input power: 220v/1ph/50-60hz

ELECTRONIC FLUX LEVEL SENSOR:
Optional electronic high or low flux level sensor is available to sense flux level of pressure tank or flux hopper. When flux level is low (or high; based on your requirements), a loud audible alarm and flashing light on control panel will signal operator. (See pages 38 - 39 for sensor options and pricing.)

OPTIONAL FTV-3000 and AV-3000-NS AUTOMATIC FLUX TRANSFER VALVE.....NEW PRODUCT!
Please see page 71 and 72 for details. 115V/1PH/60-50HZ
(Other voltages available upon request. Consult factory for pricing.)

****Please note, the PFR-HAMX-3000 flux pressure feed and recovery system is now manufactured with an internal flux cone. This cone allows complete draining of all flux out of the tank. There is no stagnant area in the tank from which flux will not flow out of the tank.**

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


12. HPFR-HAMX-3000-H100/H100



The HPFR-HAMX-3000-H100/H100 is a heated {32°F (0°C) to 250°F (121°C)}. flux hopper/separator and pressure feed system. The top hopper/separator has two 50 pound capacity sections, one for **recovered flux** and one for **new flux**. Flux from each of these two sections mix together at a preset ratio as the flux is transferred into the heated 100 pound capacity pressure tank. Each section of the flux hopper/separator features a high and low level sight window to monitor the amount of flux in the unit. T**he HPFR-HAMX-3000-H100/H100 is very useful for sub-arc welding when code requires a specific percentage of new flux to be mixed with recovered flux.**
(See pg. 64, item 12 {MAGSEP-2} for optional magnetic separator and TB-MM708 figure no. 27 and 29 for complete system requirements.)

Input power: 220v/1ph/50-60hz
Input power: 460v/3ph/60hz

13. HPFR-HAMX-3000-H300/H300

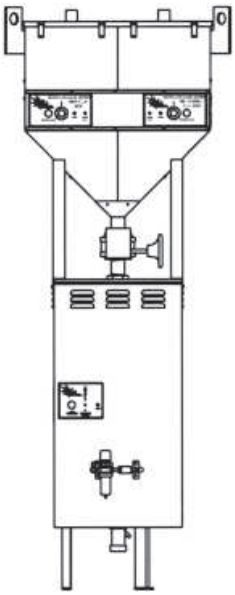

The HPFR-HAMX-3000-H300/H300 is a heated {32°F (0°C) to 250°F (121°C)} flux hopper/separator and pressure feed system. The top hopper/separator has two 150 pound capacity sections, one for **recovered flux** and one for **new flux**. Flux from each of these two sections mix together at a preset ratio as the flux is transferred into the heated 300 pound capacity pressure tank. Each of the flux hopper/separator section features a high and low level sight window to monitor the amount of flux in the unit. The HPFR-HAMX-3000-H300/H300 is very useful for sub-arc welding when code requires a specific percentage of new flux to be mixed with recovered flux. (See pg. 79, item 14 {MAGSEP-100} for optional magnetic separator and TB-MM708 figure nos. 28, 31, 32 and 33 for complete system requirements.) (Please consult factory for larger tank/ hopper combinations.)

Input power: 220v/1ph/50-60hz
Input power: 460v/3ph/60hz

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

14. MAGSEP-100 MAGNETIC SEPARATOR.

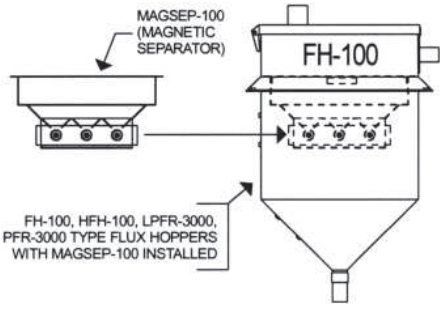


MAGSEP-100 Magnetic Separator for FH-100, HFH-100, LPFR-3000, PFR-3000, HLPFR-3000 and HPFR-3000 flux recovery separators. The MAGSEP-100 installs in place of the standard slag tray. Its advanced design provides a slag separation tray and powerful magnets to remove magnetic particles from recovered flux. Magnetic particles are easily disposed of by removing MAGSEP-100 from the flux recovery machine, operator then slides magnet assembly out of magnetic collection tubes and magnetic particles fall away to be discarded.

15. MAGSEP-100-E/P MAGNETIC SEPARATOR.

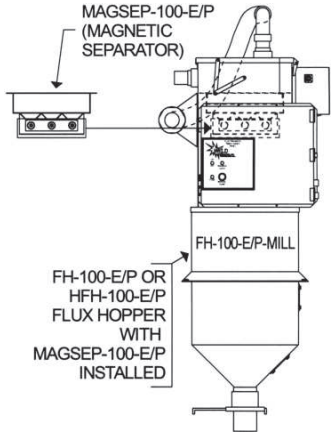

MAGSEP-100-E/P Magnetic Separator for FH-100-E/P, HFH-100-E/P, SUPER-FH-100-A/P-E/P and SUPER-HFH-100-A/P-E/P, installs in place of the standard slag tray. Its advanced design provides a slag separation tray and powerful magnets to remove magnetic particles from recovered flux. Magnetic particles are easily disposed of by removing MAGSEP-100-E/P from the flux recovery separator, operator then slides magnet assembly out of magnetic collection tubes and magnetic particles fall away to be discarded.

16. FT-100 - 100 POUND CAPACITY FLUX TROUGH

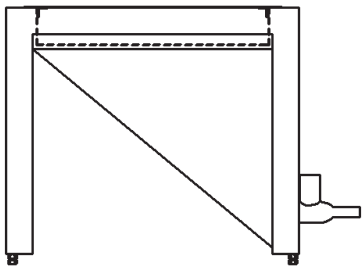

The FT-100 - 100 pound capacity flux trough is used under small parts where flux spills off and needs to be recovered. It is also used for loading flux into hopper/separators which are not easily accessible. (See Technical Bulletin TB-MM708 figure nos. 7, 8, 13, 14 and 15.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

17. FF-3 FLUX FEED PIPE.


The FF-3 flux feed pipe enables flux to be fed from a pressure feed tank (PT-"x"00 or other pressure tank is required) to the flux hopper. Flux flow to hopper will automatically stop when flux level inside hopper is higher than inlet pipe. Specify flux feed hose size (1/2", 3/4" or 1" I.D. size available.)

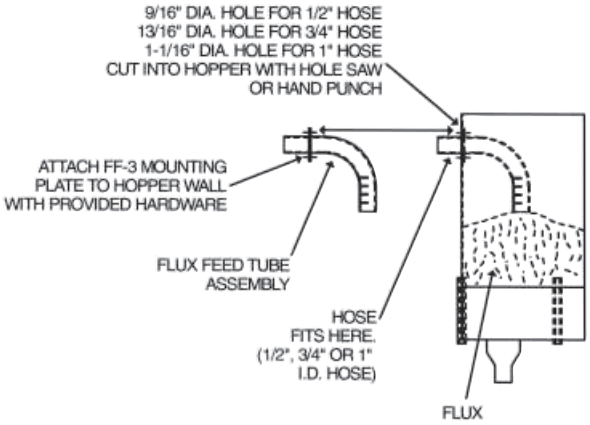

FF-3-1/2" for 1/2" I.D. hose
FF-3-3/4" for 3/4" I.D. hose
FF-3- 1" for 1" I.D. hose

18. PFR-LD3 LID.

The PFR-LD3 Lid is for attachment to most manufacturer's standard flux hoppers (please specify model of hopper used when ordering), to pressure feed flux to the hopper from a flux feed pressure tank ("x"PT-"x"00, LPFR-3000 and PFR-3000 systems). Customer has choice of 1/2", 3/4" or 1" I.D. hose fitting.

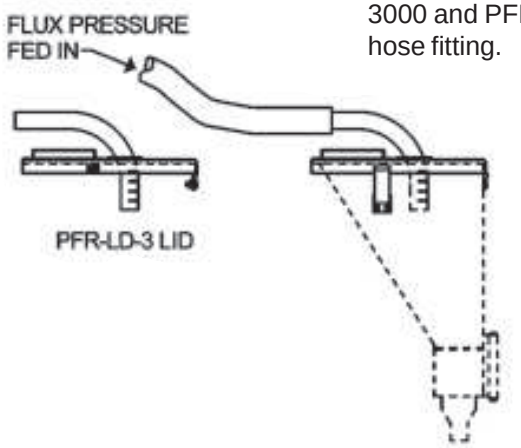

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

19. LAFV-32 AIR POWERED SLIDE VALVE FOR LINCOLN ELECTRIC K219 FLUX HOPPER.

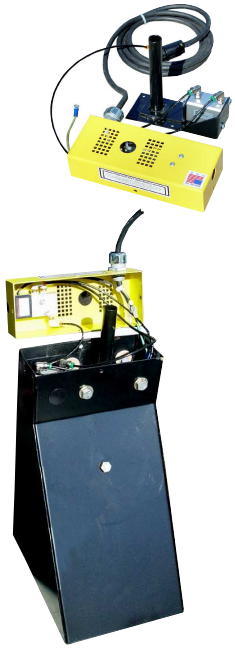

The LAFV-32 is an air powered slide valve for use with the Lincoln Electric K219 flux hopper. This valve replaces the existing flux hopper valve. The control cord plugs into the same receptical as the OEM valve uses. The LAFV-32 will give you a complete valve closure and will prevent the problems associated with leaking OEM electric solenoid flux valves, especially when using Pressure feed systems (PFR-3000, HPFR-3000 AND HPFR-HAMX-3000 to feed the flux or flux recovery units XP-3 AND XP-4T).This valve is operated using the Lincoln Electric controls.

I**nput Power:** Uses The Lincoln control voltage.
Air: 70 to 100 psi air pressure. The air flow is very low since air is only used to actuate a small air piston.

20. MAFV-32 AIR POWERED SLIDE VALVE FOR Miller Electric FLUX HOPPER.



The MAFV-32 is an air powered slide valve for use with the Miller Electric OEM flux hopper. This valve replaces the existing flux hopper valve. The control cord plugs into the same receptical as the OEM valve uses. The MAFV-32 will give you a complete valve closure and will prevent the problems associated with leaking OEM electric solenoid flux valves, especially when using Pressure feed systems (PFR-3000, HPFR-3000 and HPFR-HAMX-3000 to pressure feed the flux or flux recovery units XP-3 and XP-4T).This valve is operated using the Miller Electric controls.

I**nput Power:** Uses The Miller control voltage.
Air: 70 to 100 psi air pressure. The air flow is very low since air is only used to actuate a small air piston.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

21. TNOZ-"x" PRESSURE TANK FLUX FEED NOZZLES.

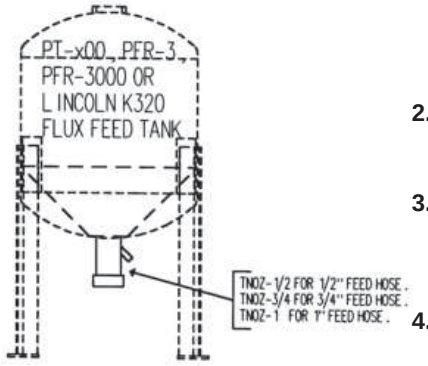


1. **TNOZ-1/2" - Pressure tank flux feed nozzle for 1/2" I.D. hose. Nozzle fits 2" NPT female pipe fitting which is standard on PFR-3, "x"PFR-3000, "x"PT-"x"00 and Lincoln K320 tanks. (Please consult factory for non-standard sizes.)**
2. **TNOZ-3/4" - Same as above,except for 3/4" I.D. flux feed hose.**
3. **TNOZ-1" - Same as above, except for 1" I.D. flux feed hose.**
4. **TNOZ-DUAL-1/2" - Same as above, except for 1/2" I.D. flux feed hose.**
5. **TNOZ-DUAL - 3/4" - Same as above, except for 3/4" I.D. flux feed hose.**
6. **TNOZ-DUAL-1" - Same as above, except for 1" I.D. flux feed hose.**

22. TANK HIGH/LOW SENSOR.

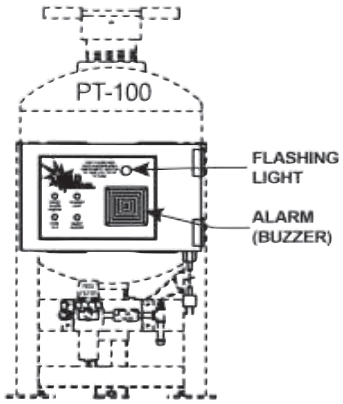

High or low flux level warning lights or audible alarm for flux level.
See page 38 - 39 for sensor options.

23. FFC-1 FLUX FILLING CONE.

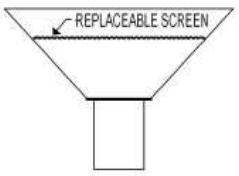

The flux filling cone is for easily adding flux to the PT-"x"00 and HPT-"x"00 flux pressure feed tank systems.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

24. FV-1 IN-LINE FLUX VALVE.



The FV-1 in-line flux valve is for hand-held sub-arc guns and PFR-LD3 lid. Trouble free valve fits inside diameter flux hose. Installs in minutes and is ready to use.

FV-1-1/2" (For 1/2" I.D. Hose)

FV-1-3/4" (For 3/4" I.D. Hose)

FV-1-1" (For 1" I.D. Hose)

25. PRESSURE FEED HOSE.

A. 1/2".....
B. 3/4".....
C. 1" .....
D. 3/4" High Temperature Hose (Max. 450ºF {232ºC}).....
E. 1" High Temperature Hose (Max. 450ºF {232ºC}).....

26. TWO INCH (2") VACUUM HOSE.

(Hose between Mighty-Mac vacuum unit and hopper/separator.)

A. 10 feet .....
B. 15 feet .....
C. 20 feet .....
D. 25 feet .....

Longer hose available in increments of five (5) feet.

27. 1-1/2" HEAVY DUTY HIGH ABRASION FLUX RECOVERY HOSE.

From hopper/separator to point of flux pick-up. This is our special **"YELLOW" ultra-high abrasion hose** designed for very rugged recovery applications.

A. 5 feet .....
B. 10 feet .....
C. 15 feet .....
D. 20 feet .....
E. 25 feet .....

Longer hose available in increments of five (5) feet.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)


28. 1-1/2" STANDARD DUTY FLUX DISPENSING/RECOVERY HOSE.

From hopper/separator to welding equipment hopper or welding torch.


A. 5 feet.....
B. 10 feet.....

Longer hose available in increments of five (5) feet at $8.60/ft.

29. MOUNTING BRACKETS.

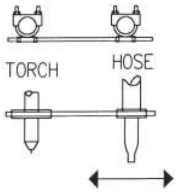


A. The **FHM-1** provides easy positioning of hose over flux. (Linear adjustment only.) For use with all Mighty-Might and Mighty-Mac Recovery Systems.

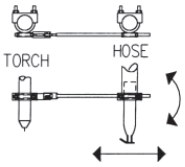

B. The **FHM-1ADJ** provides easy positioning of hose over flux. (Linear and angular adjustment.) For use with all Mighty-Might and Mighty-Mac Recovery Systems.

30. FCV-3000.



The **FCV-3000** flux control valve with 8" nozzle is used on end of flux dispensing hose (1-1/2") to control flux flow rate to welding equipment hopper or torch.

31. F/A-3000.



The F/A-3000 flux recovery line shut-off valve for 1-1/2" hose (i.e., Shut off one recovery line; open another.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***


WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018


IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

32. V/L-3000.



V/L-3000 vacuum line shut-off valve (2")

33. VFT-3000.

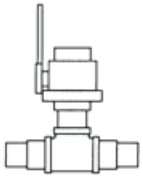

The VFT-3000 vacuum line control valve (2") allows operator to adjust vacuum draw on separator. The VFT-3000 enables the use of one MS-1 separator with the MM-3000X or MM-5000X, or reduces "head height" between the FH-100 or HFH-100 separator and the lower welding equipment hopper.

34. BAC-3000.



The BAC-3000 air control for flux trough (bin) pick-up, mixes air with flux when recovery hose is connected directly to a flux collecting trough, or bin, beneath the part which is welded. This is for the 1 1/2" hose.

35. Y-3000.



The Y-3000 "Y" fitting for 1-1/2" or 2" I.D. hose is used to branch flux recovery or vacuum hose to two positions. Specify hose I.D. when ordering. (Note: MM-3000X, MM-5000X and MM-5000X-MILL have two (2) vacuum inlets.)

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979


"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

36. FD-1 FLUX DAM FOR BUILDING UP SMALL DIAMETER ROLLS.

The FD-1 Flux Dam "dams" flux on cylindrical welding applications, to enable proper flux coverage and keeps flux from cascading off the cylinder.

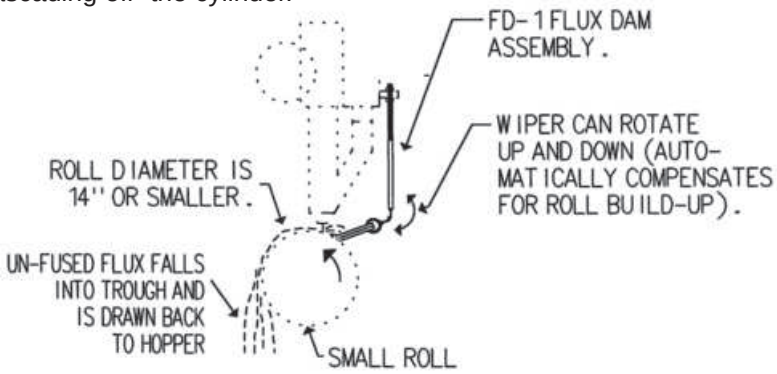

37. FLUX PICK-UP NOZZLES.



A. NZ-1; Standard Flux Pick-up Nozzle.



B. NZ-1-4; 4" Wide Flux Pick-up Nozzle.
(NEW PRODUCT!)



C. NZ-1CRN; Corner Weld Flux Pick-up Nozzle.
(Sold as a pair, one left nozzle, one right nozzle.)



D. NZ-1BUTT; Butt Weld Flux Pick-up Nozzle.



E. NZ-2; 2" Hose Dia. Flux Pick-up Nozzle.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"


34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

38. PIPE MILL ID OR OD PICK UP NOZZLES - PIPE SIZES FROM 24" TO 42" OD. (Two inch recovery hose required).




A. NZ-2-STR-24-45-ID Straight, ID pick up nozzles (24" to 42" PIPE DIA.)

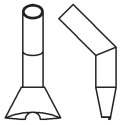

B. NZ-2-ANGLE 24-45-ID angle pick up nozzles (24" to 42" PIPE DIA.)



C. NZ-2-STR-24-45-OD Straight OD pick up nozzles (24" to 42" PIPE DIA.)

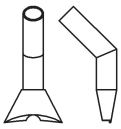

D. NZ-2-ANGLE 24-45-OD angle pick up nozzles (24" to 42" PIPE DIA.)


(Larger sizes are available, please contact factory for information and pricing.)

39. SPECIAL DESIGN NOZZLES AVAILABLE FOR SPECIFIC NEEDS. CONSULT FACTORY FOR DETAILS.

40. POWER WAND

The Power Wand, adjustable loading nozzle, increases air flow to carry newly opened **flux from the bag or container into the hopper fast and effectively.**

A) **PW-1500** for 1-1/2" Recovery Hose.
B) **PW-2000** for 2" Recovery Hose



PW-1500 OR PW-2000

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

ATTENTION: SPARE PARTS MANAGER!

RECOMMENDED CONSUMABLE PARTS FOR:

MM-1500X, 3000X AND 5000X VACUUM SYSTEMS WITH SEPARATOR

SPS-1500, SPS-3000, SPS-5000 AND SPS-7500 RECOVERY SYSTEMS WITH SEPARATOR

PS-1500, PS-3000, PS-5000 AND PS-7500 RECOVERY SYSTEMS WITH SEPARATOR

1. MM-1500X:

A.) 1 each **Standard** Cartridge Dust Filter (One filter required per machine)
or
1 each One **Teflon** Dust Filter for Extra heavy duty use.

2. MM-3000X , MM-5000X, SPS-1500, SPS-3000, SPS-5000, SPS-7500 AND PS-1500, PS-3000, PS-5000 AND PS-7500:

A.) 2 each Cartridge Dust Filter required for **MM-3000X & MM-5000X**

B.) 1 each Cartridge Dust Filter required for **SPS-1500, SPS-3000, SPS-5000, SPS-7500 AND PS-1500, PS-3000, PS-5000 AND PS-7500:**

Or: TEFLON COATED POLYESTER FILTERS Use as an alternative to Standard filters. Specify these filters for **Extra Heavy Duty and Dusty flux applications**. Filters last much longer and resist dust clogging. **MM-3000X , MM-5000X REQUIRE 2 FILTERS, SPS-1500, SPS-3000, SPS-5000, SPS-7500 AND PS-1500, PS-3000, PS-5000 AND PS-7500 REQUIRE 1 FILTER:**

C.) TEFLON Cartridge Dust Filter

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***

WELD ENGINEERING CO., INC.
EXCELLENCE SINCE 1979

"MANUFACTURERS OF THE MOST COMPLETE LINE OF FLUX HANDLING EQUIPMENT IN THE WORLD"

34 Fruit St.
Shrewsbury, MA 01545 (U.S.A.)
Telephone: (508) 842-2224
Fax: (508) 842-3893
Website:
www.weldengineering.com
Email:
Sales@weldengineering.com
March 1, 2018

IMPORTANT NOTE: For diagrams of flux recovery system configurations, see the "Heavy Duty" section of your catalog and look in the Technical Bulletin "TB-MM708," or call us for engineering assistance. (Ask us to send you the "TB-MM708" if it is not available to you.)

RECOMMENDED CONSUMABLE PARTS CONTINUED.

3. FH-100/HFH-100 SEPARATOR/HOPPER.

A.) Large Flux Impingement Plate
B.) Inlet nozzle

4. MS-1 and MS-1-E/P SEPARATOR.

A.) Small Flux Impingement Plate
B.) Inlet nozzle

5. FLUX PICK-UP NOZZLES. (See Page 86 and 87 for all FLUX PICK-UP NOZZLES).

6. HOSE. (Please see pages 83 and 84 for all hose prices).

ALL EQUIPMENT - F.O.B. - OUR FACTORY

Prices subject to change without notice,
and are those in effect at time of order.

*** SEE BULLETIN "TB-MM708" IN THE "HEAVY DUTY" SECTION OF CATALOG FOR SYSTEM DIAGRAMS***