


Repaired VCO R2: all 99 loaded channel checks pass

Each bar: measured frequencies at 0.2 V and 1.0 V fine control; shaded region: +/-2 MHz guard.

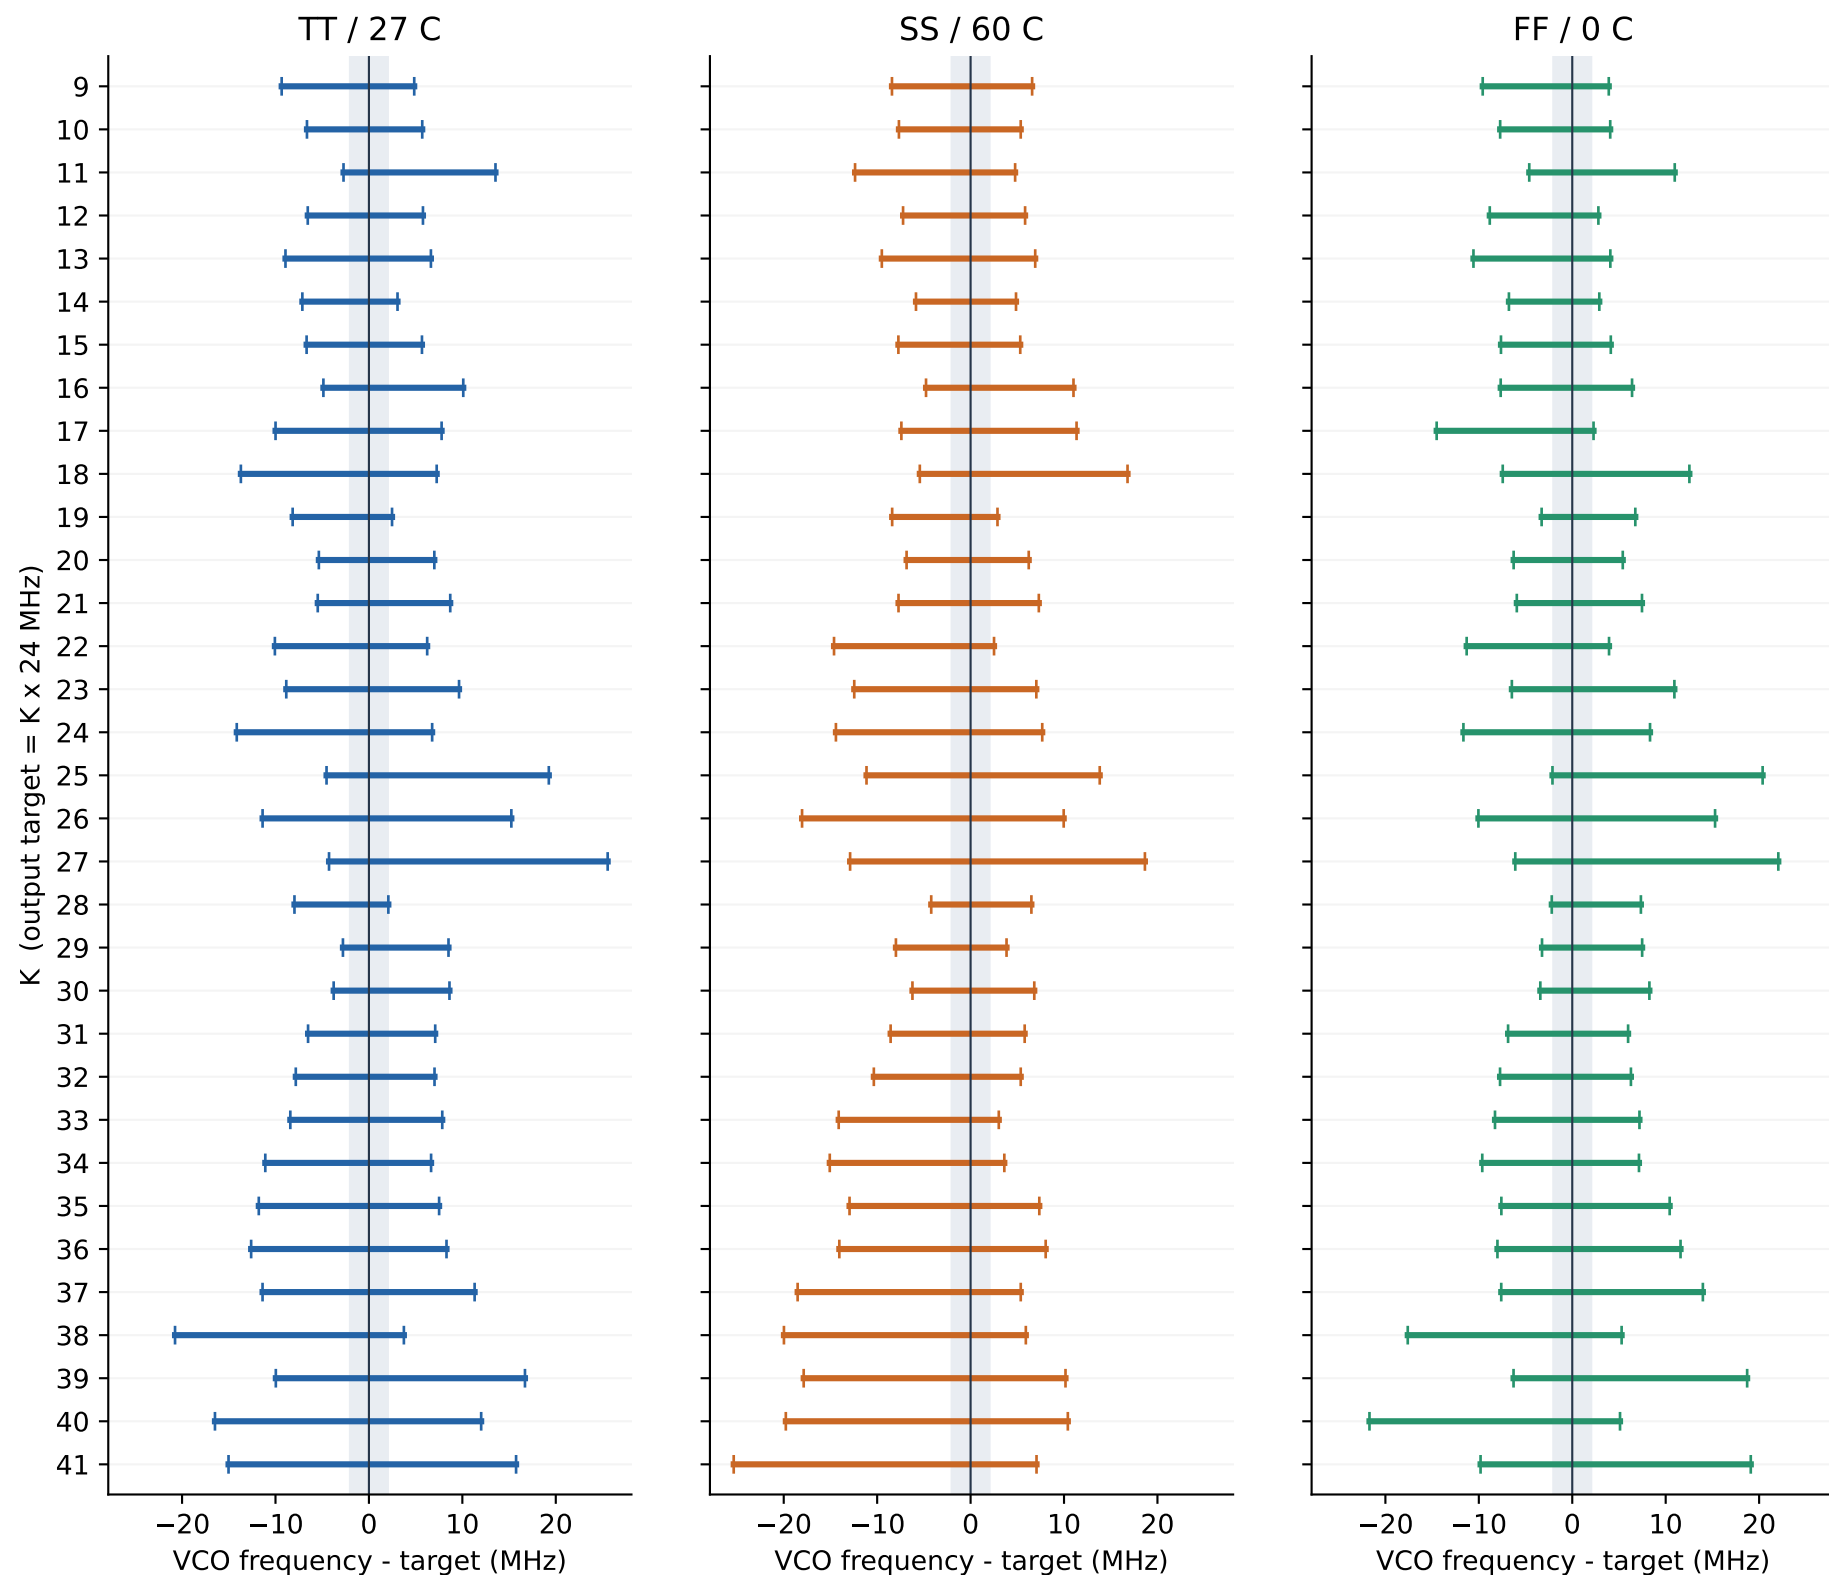

1.2 V; assumed inductor Q = 5 at 3.3 GHz; actual divider + sampler/CP/reference circuitry.
Endpoint coverage and valid division are verified; these are not closed-loop PLL lock results.