



Ultra-compact model with front brake and integrated safety brake.

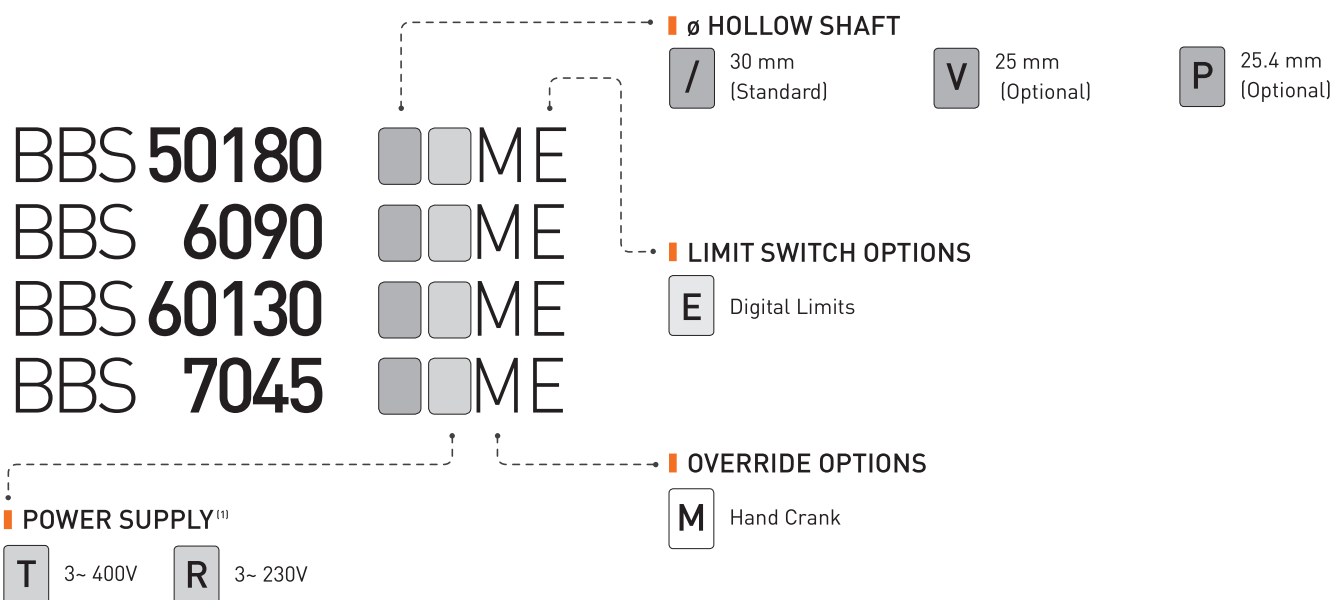

⁽¹⁾ It is possible for the installer to independently convert the connection of the gearmotor power supply from star (400V) to triangle (230V) and vice versa.

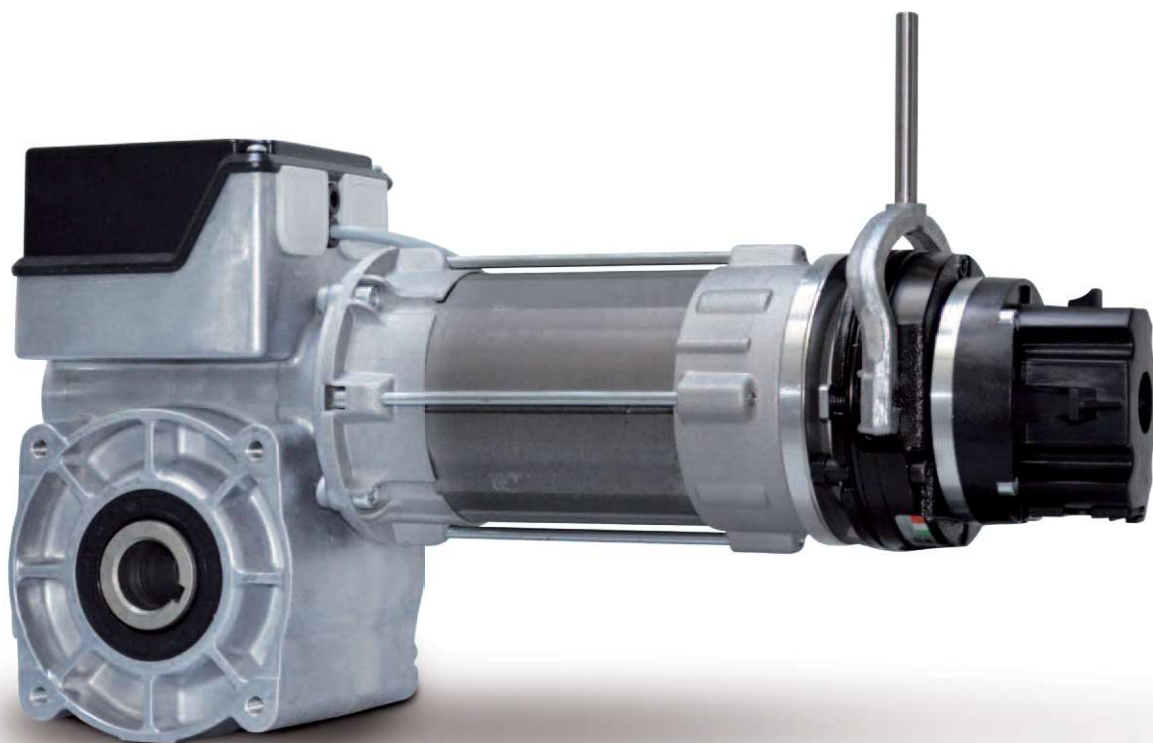

All models are provided with an electromagnetic brake which stops suddenly the inertia of the motor.


				Ø HOLLOW SHAFT		
				/	V	P
				30 mm (Standard)	25 mm (Optional)	25.4 mm (Optional)
				LIMIT SWITCH OPTIONS		
				M	E	
				Mechanical Limits	Digital Limits	
				OVERRIDE OPTIONS		
				M		
				Hand Crank		

POWER SUPPLY⁽¹⁾

T	R
3~ 400V	3~ 230V

⁽¹⁾ It is possible for the installer to independently convert the connection of the gearmotor power supply from star (400V) to triangle (230V) and vice versa.

TÜV SÜD Certificate:
TorFV 24/197

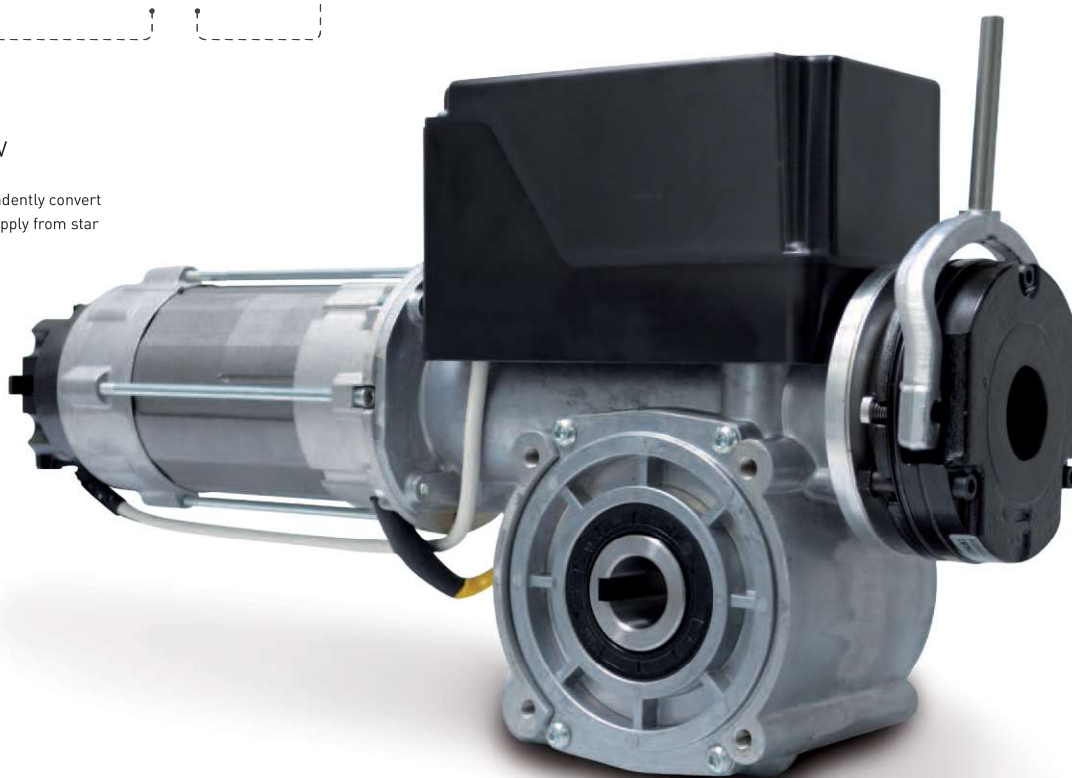




|| OVERRIDE OPTION




Hand crank

|| LIMIT SWITCH OPTIONS

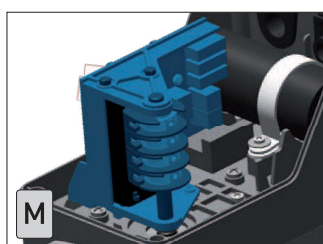

Mechanical limits


- 2 Green cams for operating limits.
- 2 Red cams for safety limits.
- 2 Yellow cams for auxiliary controls

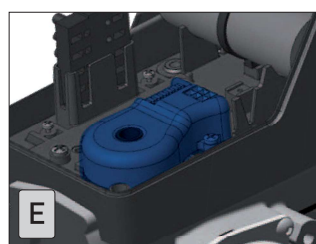

Digital limits


Absolute encoder
No readjustment after power failure
(necessary if a control unit with inverter is used)

|| INSTALLATION TYPE

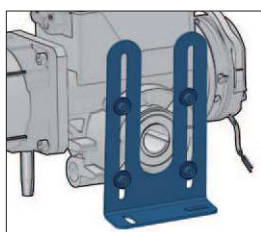


Flange bracket

ANSZXM

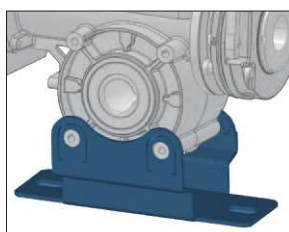

Basement

AS0MBP

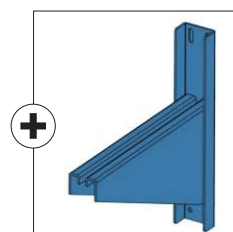

Bracket

AS0M

|| ADDITIONAL DETAILS

European directives

RAPIDO is made in accordance with product standards EN 13241-1 Doors- and EN 12453 Safety for power operated doors.

Duty rating

There is a relation between the weight of the door and the number of movements per hour so the motor duty rating varies according to the door weight.

Overload safety factor

Motor overload safety factor = 4 x the nominal motor amperage because the starting current of the RAPIDO can reach these levels for short periods.

Output speed

The maximum admissible speed depends on the construction and the door type.
The admissible closing speed shall be tuned so to let the operating forces comply with the EN 12453.

Manual operation

Rapido is supplied with hand crank for manual operation when power cuts off.



TECHNICAL DETAILS

	BRD40130RM		BBS50180RM BRD50180RM		BBS6090RM BRD6090RM	
Torque (Nm)	40		50		60	
Output Speed (rpm)	130		180		90	
Mechanical power (kW)	0.6		1.0		0.6	
Power Supply (V~) ⁽¹⁾	3~ 400	3~ 230	3~ 400	3~ 230	3~ 400	3~ 230
Absorption (A)	2.69	4.85	2.69	4.44	2.21	4.08
Frequency (Hz)	50		50		50	
Max Cycles Per Hour	45		45		45	
Limit Switch max turns ⁽²⁾	18		18		18	
Working temperature ⁽³⁾	-20°C/+60°C		-20°C/+60°C		-20°C/+60°C	
Protection Rate	IP54		IP54		IP54	
GAPOSA control unit recommended	QC600 ⁽⁴⁾		QC600S ⁽⁴⁾		QC600 ⁽⁴⁾	

	BBS60130RM BRD60130RM		BBS7045RM BRD7045RM		BRD9090RM	
Torque (Nm)	60		70		90	
Output Speed (rpm)	130		45		90	
Mechanical power (kW)	1.0		0.6		1.0	
Power Supply (V~) ⁽¹⁾	3~ 400	3~ 230	3~ 400	3~ 230	3~ 400	3~ 230
Absorption (A)	2.29	4.1	2.02	3.6	2.5	4.6
Frequency (Hz)	50		50		50	
Max Cycles Per Hour	45		30		45	
Limit Switch max turns ⁽²⁾	18		18		18	
Working temperature ⁽³⁾	-20°C/+60°C		-20°C/+60°C		-20°C/+60°C	
Protection Rate	IP54		IP54		IP54	
GAPOSA control unit recommended	QC600 ⁽⁴⁾		QC600 ⁽⁴⁾		QC600S ⁽⁴⁾	

	BRD12045RM		BRD120140TM		BRD18090TM	
Torque (Nm)	120		120		180	
Output Speed (rpm)	45		140		90	
Mechanical power (kW)	0.92		2.0		2.2	
Power Supply (V~) ⁽¹⁾	3~ 400	3~ 230	3~ 400	3~ 230	3~ 400	3~ 230
Absorption (A)	2.3	4.4	3.77	6.7	4.5	7.6
Frequency (Hz)	50		50		50	
Max Cycles Per Hour	30		45		45	
Limit Switch max turns ⁽²⁾	18		18		18	
Working temperature ⁽³⁾	-20°C/+60°C		-20°C/+60°C		-20°C/+60°C	
Protection Rate	IP54		IP54		IP54	
GAPOSA control unit recommended	QC600S ⁽⁴⁾		QC600S ⁽⁴⁾		QC600W	

⁽¹⁾ Highlighted the default electrical connection diagram.

⁽²⁾ A higher limit switch range is available upon request

⁽³⁾ Nominal values are fully respected within a temperature range -10°C/+40°C. In case of harsh temperatures there might be a performance drop on the declared values.

⁽⁴⁾ The power supply connection of the gear motor must be in a delta shape [3-230V].






RAPIDO bbs

DIMENSIONS
(mm)


Ø HOLLOW SHAFT

STANDARD	ver. V	ver. P

BBS50180RM



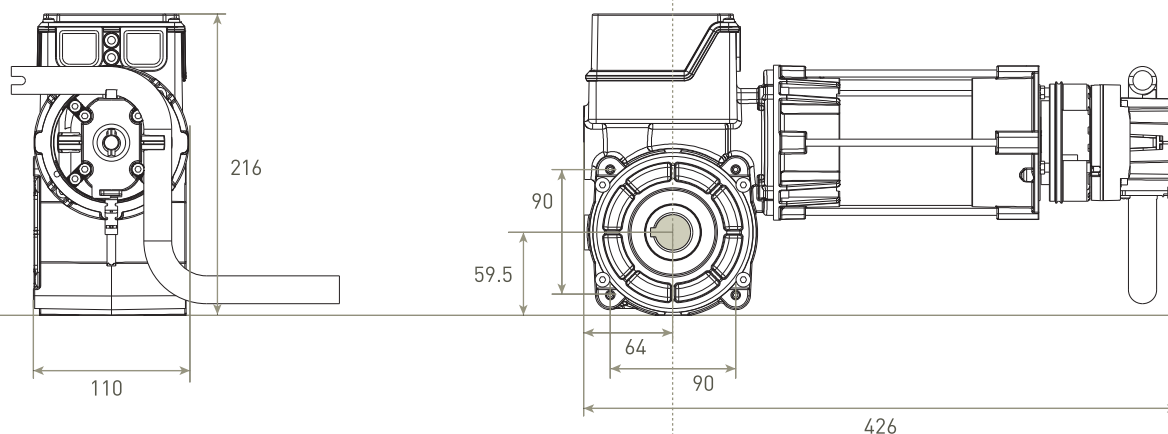


BBS6090RM


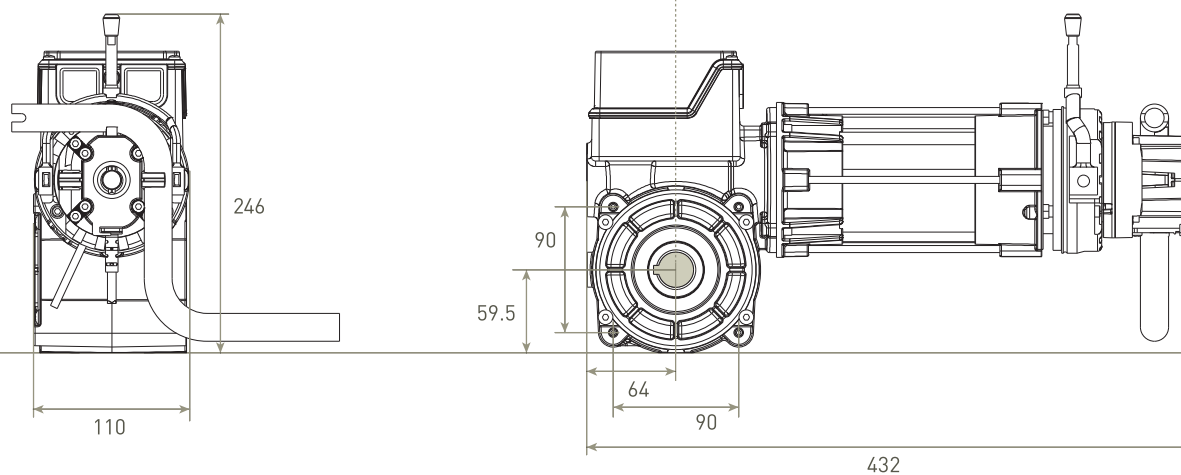




■ $\varnothing$ HOLLOW SHAFT

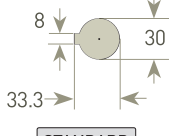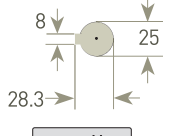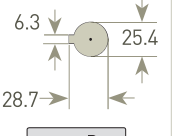 STANDARD	 ver. V	 ver. P
--	---	---

BBS**60130**RM

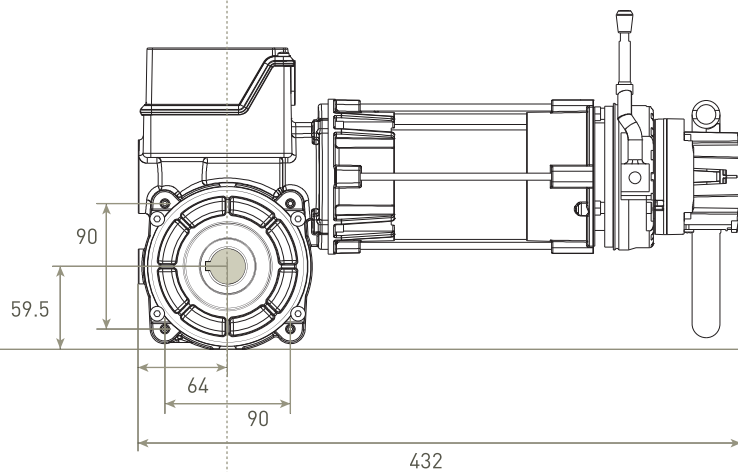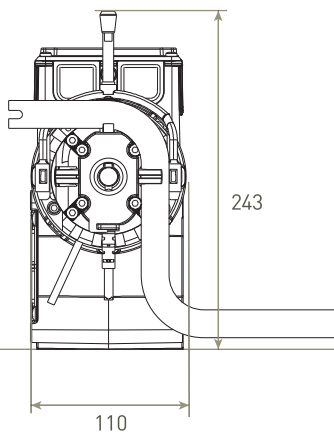

BBS**7045**RM

