


Dual Programmable Air - Installation

 haascnc.com/service/troubleshooting-and-how-to/how-to/dual-programmable-air---installation---ad0637.html

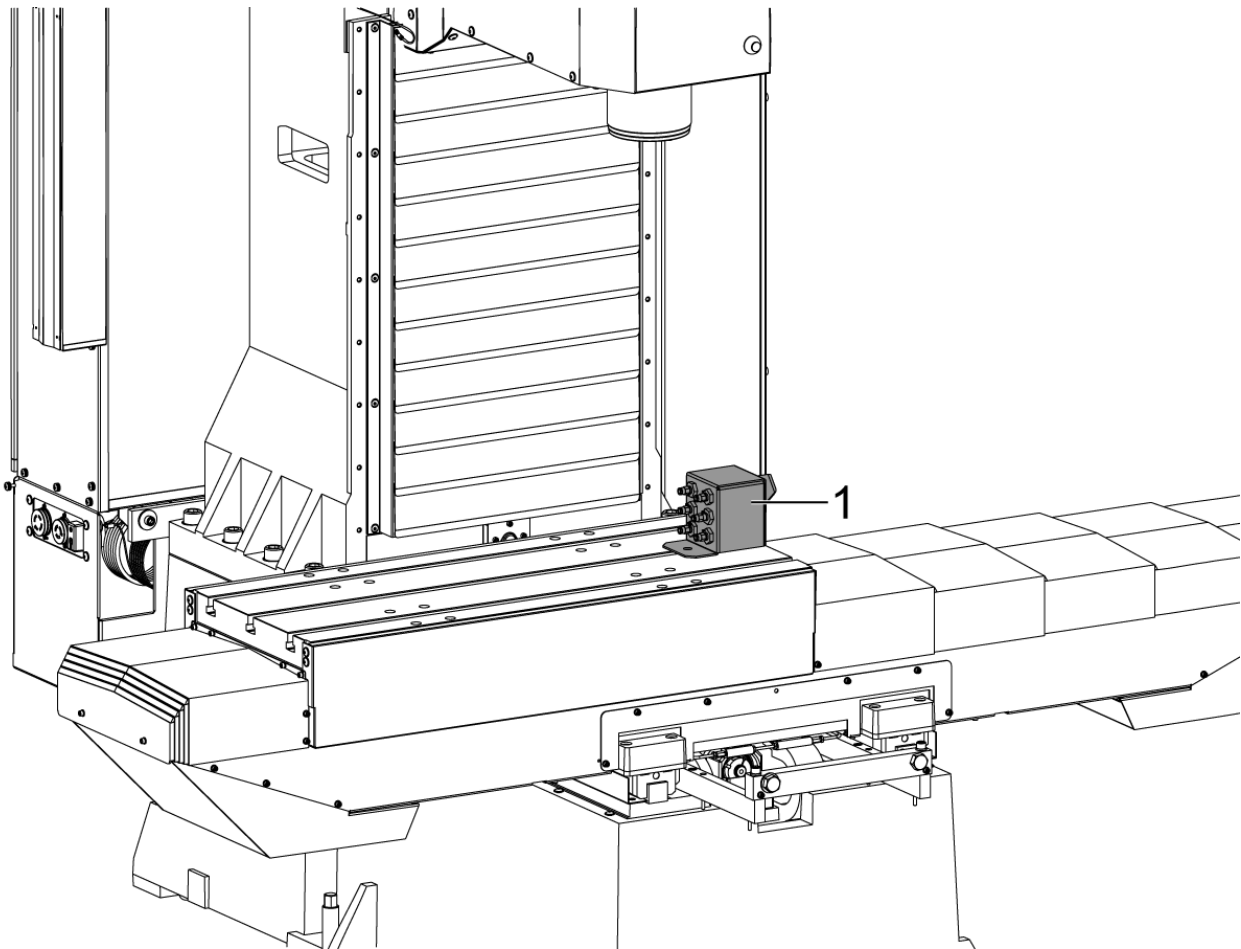

This procedure will show you how to install the Programmable Air Option [1] on the following machines and their variants:

- VF-1/2/3/4/5/6/7/8/9
- VM-2/3
- DM-1/2
- DT-1/2
- MM
- CM-1

Machine Requirements

- NGC Software Requirements: **100.20.000.1200** or later.
- Minimum Main IO firmware Version: **4.0** or higher.
- **93-1000878** - PROGRAMMABLE AIR DUAL FIELD INSTALL KIT
- **93-1000910** - PROGRAMMABLE AIR DUAL FIELD INSTALL KIT

Important: The Dual Programmable Air option is **NOT** compatible with the Single Programmable Air option **or** the E-vise option.

Important: The Dual Programmable Air option is **NOT COMPATIBLE** with machines with the **TAB** option built before **June 2019**.

IMPORTANT: Depending on the machine's built by date, separate brackets may need to be ordered to make the machine compatible. The brackets that are sold separately are **25-12138**, **25-14177** & **25-12749**. Refer to the below table to determine what brackets are needed for each machine:

Machine	Date	Part Number
VF-1/2	Built before 7/22/2022	25-12138 & 25-14177
	Built after 7/22/2022	25-15873 & 25-15875
VF-1/2YT	Built before 7/21/2022	25-12138 & 25-14177
	Built after 7/21/2022	25-15873 & 25-15875
VF-3/4	Built before 7/30/2022	25-12749 & 25-14177
	Built after 7/30/2022	25-15873 & 25-15875

VF-3YT/40	Built before 8/16/2022	25-12749 & 25-14177
	Built after 8/16/2022	25-15873 & 25-15875
VF-3YT/50	Built before 12/1/2022	25-12749 & 25-14177
	Built after 12/1/2022	25-15873 & 25-15875
VF-5/40/XT	Built before 9/20/22	25-12749 & 25-14177
	Built after 9/20/22	25-15873 & 25-15875
VF-5/50/XT	Built before 10/16/22	25-12749 & 25-14177
	Built after 10/16/22	25-15873 & 25-15875
VF-6/40/50	Built before 5/1/2022	25-12138 & 25-14177
	Built after 5/1/2022	25-15873 & 25-15875
VF-7/40/50	Built before 5/1/2022	25-12138 & 25-14177
	Built after 5/1/2022	25-15873 & 25-15875
VF-8/40/50	Built before 2/28/2022	25-12138 & 25-14177
	Built after 2/28/2022	25-15873 & 25-15875
VF-9/40/50	Built before 2/28/2022	25-12138 & 25-14177
	Built after 2/28/2022	25-15873 & 25-15875
VR-8/9	Built before 2/28/2022	25-12138 & 25-14177
	Built after 2/28/2022	25-15873 & 25-15875
VM-2/3	Built before 5/1/2022	25-12138 & 25-14177
	Built after 5/1/2022	25-15873 & 25-15875
DT/DM-1/2	Built before 1/28/2022	25-12138 & 25-14177
	Built after 1/28/2022	25-15873 & 25-15875

TM-0	Built before 9/1/2022	25-12138 & 25-14177
	Built after 9/1/2022	25-15873 & 25-15875
TM-1	Built before 1/28/2022	25-12138 & 25-14177
	Built after 1/28/2022	25-15873 & 25-15875
TM-2	Built before 9/10/2022	25-12138 & 25-14177
	Built after 9/10/2022	25-15873 & 25-15875
CM-1	Built before 8/25/2022	25-12138 & 25-14177
	Built after 8/25/2022	25-15873 & 25-15875