Table marks for the new tracks T01 to T16 (tape once, keep all day)

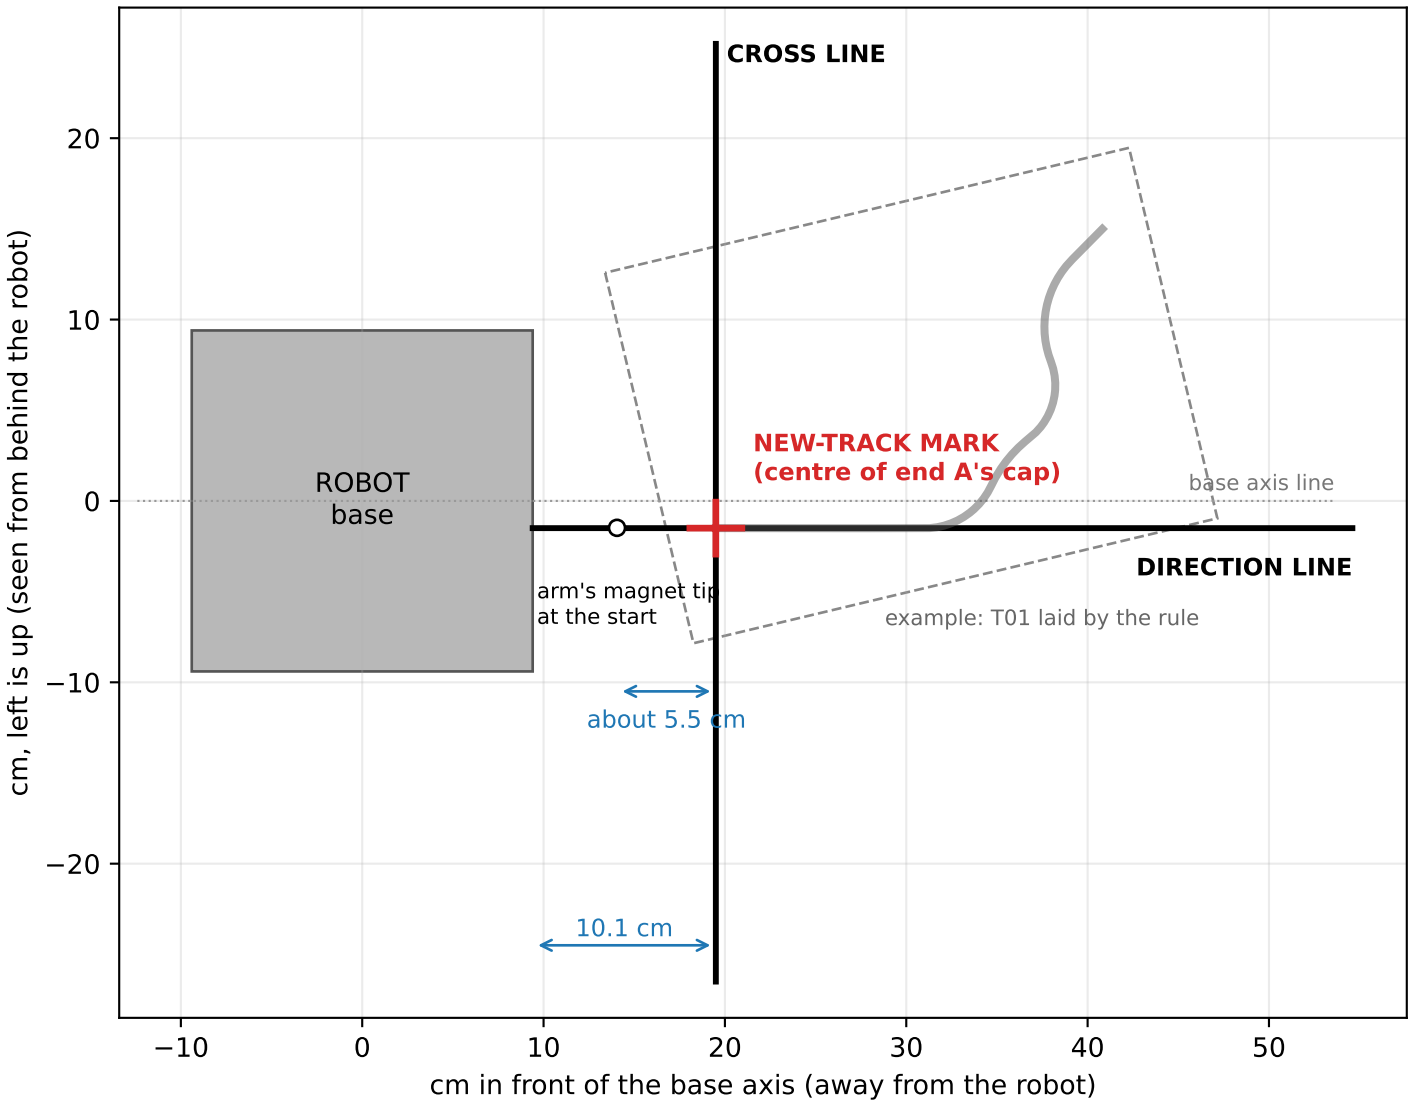

1. DIRECTION LINE: a straight tape line on the table, pointing straight away from the robot, 1.5 cm to the RIGHT of the middle of the base's front edge (seen from behind the robot), from the base's front edge to about 55 cm out.

2. CROSS LINE: a straight tape line square to the direction line, crossing it 19.5 cm in front of the base axis, which is 10.1 cm in front of the base's front edge (calc: the base drawn as a 18.8 cm square around its axis; Niryo's sheet gives a footprint of 18.2 x 18.8 cm, so measure your base's front edge once). At least 26 cm to each side.

3. Where the two lines cross is the NEW-TRACK MARK. Use LIGHT masking tape with a thin pen line, not dark tape: the camera sees the table beside the paper, and a dark stripe could become a cue the model learns (judgement, 13.11.26, not tested). It is not the course sheets' START MARK: lay the course sheets as before.

4. Check, only with the robot running and Emranul's go: when the arm comes down at the start of an episode, its magnet tip stands on the direction line about 5.5 cm before the mark (calc from config.py: 14.05, -1.48 cm; measured in the 148 start-mark recordings: 14.0, -1.5 cm). Do not touch the arm while its motors are on.

5. Every new sheet: the centre of end A's round cap (end A as the set-up picture shows it) over the mark, the first straight piece of the line along the direction line (the tape shows at the paper's near and far edges, the cross line at both sides), the sheet not turned. Check one or two corner distances of the set-up picture with a ruler, then tape the corners down.

Sizes, calc from the lay-out check (tracks.json): the paper's near edge 11.4 cm or more in front of the base axis, its far edge at most 49.6 cm; it reaches at most 22.2 cm to the left and 23.5 cm to the right of the base axis line. Keep the table clear that far.