


# type stepping motor

### 24BYJ48/28BYJ48/30BYJ46

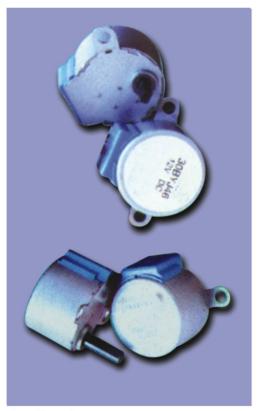

Applicatim: mainly used for air-conditioners...

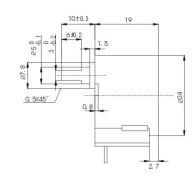

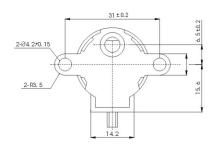

24BYJ48

28BYJ48

# 24BYJ48 Motor Specification

No.of phases	4	Voltage	12VDC	
Current	40mA	Resistance	300Ω	
Step angle	5.625	Reduction Ratio	1:64	
No-load pull-out frequency	1000pps	No-load pull-in frequency	500pps	
Pull-intorque	≥29.4 mN . m			
Wiring indications	A (orange) , B (yellow) , C (blue) D (grey) , E (red,min-point)			

### 28BYJ48 Motor Specification

No.f phases	4	Voltage	12VDC	
Current	40mA	Resistance	300Ω	
Step angle	5.625	Reduction Ratio	1:64	
No-load pull-out frequency	1000pps	No-load pull-in frequency	500pps	
Pull-intorque	≥29.4 mN . m			
Wiring indications	A (orange) , B (yellow) , C (blue) D (grey) , E (red,min-point)			

# 30BYJ46 Motor Specification

No.f phases	4	Voltage	12VDC
Current	40mA	Resistance	300Ω
Step angle	5.625	Reduction Ratio	1:85.25
No-load pull-out frequency	800pps	No-load pull-in frequency	500pps
Pull-intorque	≥34.3 mN . m		
Wiring indications	A (orange), B (black), C (white) D (yellow), E (red,mid-point)		

