Pressure sensors SPAB, with display




Pressure sensors SPAB, with display

Key features, product range overview

FESTO

At a glance

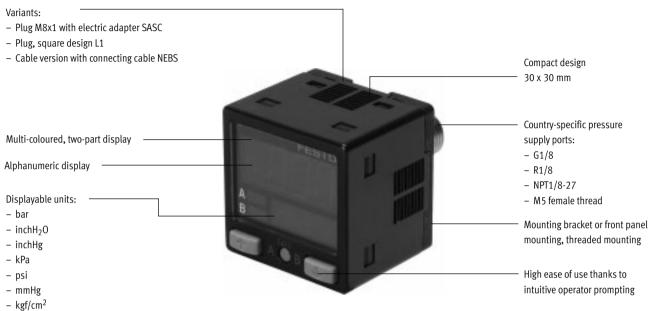

Product description

- MPa

The pressure sensor SPAB can be used in many industries thanks to its wide range of connection and configuration options and its compact size.

Switching point settings are emphasised via switching status indication and switching of the display value colour.

Main applications

- Pressure/vacuum sensing
- Light assembly
- Wherever there is a need for space-saving pressure measurement with visualisation and limited robustness
- Easy identification of the system status by means of clear, colour-based switching status detection

Key features

- Pressure measuring range –1 ... +1 or 0 ... 10 bar
- Relative pressure measurement
- Pressure supply port G1/8, R1/8, NPT1/8-27 or M5 female thread
- Electrical connection cable, plug M8x1 or plug, square design
- Switching output PNP, NPN
- Analogue output 1 ... 5 V or 4 ... 20 mA, switchable

- Two-part, multi-coloured display
- Copy function (settings can be transferred from one device to another)
- Simple commissioning thanks to intuitive operation
- Compact design 30x30 mm

Pressure sensors SPAB, with display Keyfeatures, product range overview

FESTO

Mounting options

Front panel mounting



Manifold sub-bases via mounting bracket






Threaded mounting with adapter M8



Product range overview										
Measurement method	Measured variable	Pressure measuring range	Switching function	Pneumatic connection		Electrical output				
		[bar]		Male thread	Female thread	Digital	Analogue			
Piezoresistive	1x relative	-1 +1 or	Freely	G1/8,	M5	1x PNP	1 5 V / 4 20 mA			
pressure sensor	pressure	0 10	programmable	R1/8 or		2x PNP	-			
with display				NPT1/8-27		1x NPN	1 5 V / 4 20 mA			
						2x NPN	_			

Pressure sensors SPAB, with display Peripherals overview



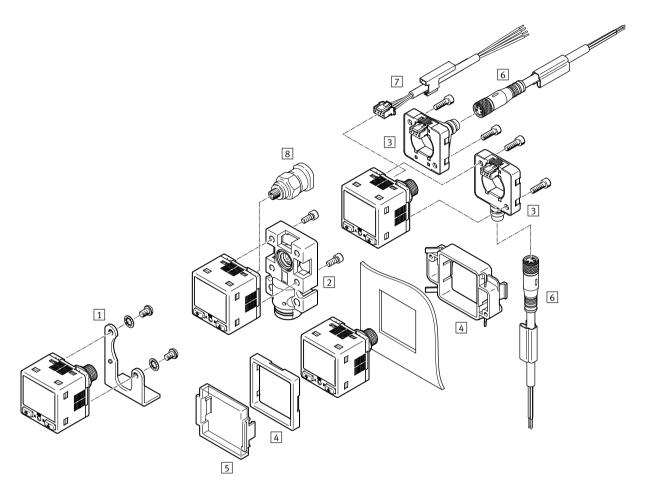

Accessories	→ Page/ Internet
	Internet
Mounting bracket SAMHA	10
2 Adapter plate SASF for pressure sensor SPABF	13
3 Electric adapter SASCA	11
4 Front panel installation kit SAMHF	10


Accessories	→ Page/
	Internet
5 Protective cover SACC	10
6 Connecting cable NEBU-M8	14
7 Connecting cable NEBS-L1G4	14
8 Push-in fitting QSM-M5	14

Pressure sensors SPAB, with display

FESTO

5

Type codes

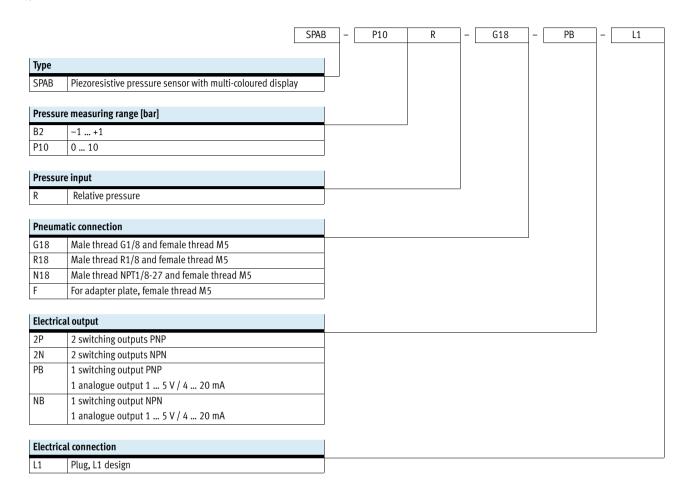


Pressure sensors SPAB, with display


Technical data

FESTO

Function E.g. switching output 2x PNP

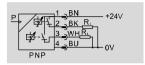

E.g. switching output NPN, analogue output

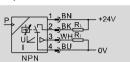





- 【 - Temperature range -10 ... +50 °C



General technical data						
SPAB	-B2	-P10				
General information						
Certification	c UL us - Recognized (OL)					
	RCM trademark	RCM trademark				
CE mark (see declaration of conformity)	To EU EMC Directive ¹⁾					
Note on materials	Contains PWIS (paint wetting impairment substances)					
	RoHS-compliant					
Input signal/measuring element						
Measured variable	Relative pressure					
Measurement method	Piezoresistive pressure sensor with display					
Pressure measuring range [bar]	-1 +1	0 10				
Overload capacity [bar]	5	15				
Operating medium	Compressed air in accordance with ISO 8573-1:2010 [7:	4:4]				
Note on operating/pilot medium	Operation with lubricated medium not possible					
Ambient temperature [°C]	-10 +50					

¹⁾ For information about the applicability of the component see the manufacturer's EC declaration of conformity at: www.festo.com/sp → Certificates.

If the component is subject to restrictions on usage in residential, office or commercial environments or small businesses, further measures to reduce the emitted interference may be necessary.

Electrical data									
SPAB		-B2				-P10			
Electrical output		2P	2N	PB	NB	2P	2N	PB	NB
Switching output ¹⁾									
Switching output		2x PNP	2x NPN	PNP	NPN	2x PNP	2x NPN	PNP	NPN
Switching function		Freely progr	ammable						
Switching element function		Switchable							
Accuracy of FS display	[%]	1				2			
Reproducibility of switching value	[%]	0.1				0.2			
Max. output current	[mA]	100							
Analogue output ¹⁾									
Analogue output	[V]	-		1 5		-		1 5	
	[mA]	-		4 20		-		4 20	
Accuracy of analogue output zero	[%]	-		5		-		5	
point ±FS									
Accuracy of analogue output margin	[%]	-		5		-		5	
±FS									
Reproducibility of analogue value	[%]	-		0.2		-		0.2	
		1		II.		1		l .	
Output, additional data									
Protection against short circuit		Yes							

^{1) %} FS = % of the measuring range final value (full scale)

Pressure sensors SPAB, with display Technical data

Electrical data									
SPAB		-B2				-P10			
Electrical output		2P	2N	PB	NB	2P	2N	PB	NB
Operating voltage range DC	[V]	12 24							
Reverse polarity protection		For all el	For all electrical connections						
Electrical connection		Plug, 4-p	Plug, 4-pin, square design						

Pin allocation SPABL1			
Plug, 4-pin			
Square design	Pin	Wire colour	Allocation
	1	Brown	Operating voltage 12 24 V DC
1234	2	Black	Switching output A
++++	3	White	Switching output B / analogue output, external
	4	Blue	0 V DC

Mechanical components								
SPAB		-G18	-R18	-N18	-F			
Type of mounting		Screw-in			On adapter plate			
		Via accessories			_			
Pneumatic connection		Female thread M5	Female thread M5					
		Male thread G1/8	Male thread R1/8	Male thread NPT1/8-27	-			
Product weight	[g]	45		·	30			
Housing materials		PBT, reinforced						

Display/operation						
SPAB		-B2		-P10		
Display type		Illuminated LCD, multi-coloured				
Displayable units		bar		bar		
		inchH ₂ O		-		
		inchHg		-		
		kPa		kPa		
		psi		psi		
		mmHg		-		
		kgf/cm ²		kgf/cm ²		
		-		MPa		
Switching status display		Yellow LCD				
Setting options		Teach-in				
		Via display and keys				
Tamper protection		PIN code				
Threshold value setting range	[%]	0 100				
Hysteresis setting range	[%]	0 90				

Immissions/emissions	
Protection class	IP40
Corrosion resistance class CRC ¹⁾	2

¹⁾ Corrosion resistance class CRC 2 to Festo standard FN 940070 Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pressure sensors SPAB, with display Technical data





Туре	B1	D1	D2	H1	H2	H3	L1	L2	L3	L4	L5	=©
SPABG18L1	30	G1/8	-	30	-	-	15	7	~25	-	1	14
SPABR18L1	30	R1/8	-	30	-	-	14	9.5	~25	-	1	12
SPABN18L1	30	NPT1/8	-	30	-	-	14	9.5	~25	-	1	12
SPABFL1	30	M5	-	30	-	-	4.4	-	~25	-	ı	-

Pressure sensors SPAB, with display Technical data

Ordering data				
Pressure measuring range	Electrical output		Part No.	Туре
[bar]	Digital	Analogue		
Male thread G1/8 and female t	hread M5			
-1 +1	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000051	SPAB-B2R-G18-PB-L1
	2 switching outputs PNP	-	8000045	SPAB-B2R-G18-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000054	SPAB-B2R-G18-NB-L1
	2 switching outputs NPN	-	8000048	SPAB-B2R-G18-2N-L1
0 10	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000063	SPAB-P10R-G18-PB-L1
	2 switching outputs PNP	-	8000057	SPAB-P10R-G18-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000066	SPAB-P10R-G18-NB-L1
	2 switching outputs NPN	-	8000060	SPAB-P10R-G18-2N-L1
	<u> </u>	·		
Male thread R1/8 and female t				
-1 +1	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000052	SPAB-B2R-R18-PB-L1
	2 switching outputs PNP	-	8000046	SPAB-B2R-R18-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000055	SPAB-B2R-R18-NB-L1
	2 switching outputs NPN	-	8000049	SPAB-B2R-R18-2N-L1
) 10	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000064	SPAB-P10R-R18-PB-L1
	2 switching outputs PNP	-	8000058	SPAB-P10R-R18-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000067	SPAB-P10R-R18-NB-L1
	2 switching outputs NPN	-	8000061	SPAB-P10R-R18-2N-L1
	<u>'</u>			
Male thread NPT1/8-27 and fe				
-1 +1	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000053	SPAB-B2R-N18-PB-L1
	2 switching outputs PNP	-	8000047	SPAB-B2R-N18-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000056	SPAB-B2R-N18-NB-L1
	2 switching outputs NPN	-	8000050	SPAB-B2R-N18-2N-L1
0 10	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000065	SPAB-P10R-N18-PB-L1
	2 switching outputs PNP	-	8000059	SPAB-P10R-N18-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000068	SPAB-P10R-N18-NB-L1
	2 switching outputs NPN	-	8000062	SPAB-P10R-N18-2N-L1
		·		
For adapter plate, female threa				
-1 +1	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000071	SPAB-B2R-F-PB-L1
	2 switching outputs PNP	-	8000069	SPAB-B2R-F-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000072	SPAB-B2R-F-NB-L1
	2 switching outputs NPN	-	8000070	SPAB-B2R-F-2N-L1
0 10	1 switching output PNP	1 analogue output 1 5 V / 4 20 mA	8000075	SPAB-P10R-F-PB-L1
	2 switching outputs PNP	-	8000073	SPAB-P10R-F-2P-L1
	1 switching output NPN	1 analogue output 1 5 V / 4 20 mA	8000076	SPAB-P10R-F-NB-L1
	2 switching outputs NPN	-	8000074	SPAB-P10R-F-2N-L1

Pressure sensors SPAB, with display Accessories

FESTO


Mounting bracket SAMH

Material:

Galvanised chromated steel

Note on materials: RoHS-compliant



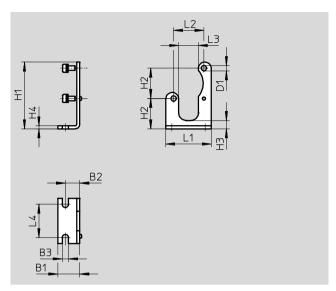


Dimensio	Dimensions and ordering data												
B1	B2	В3	D1	H1	H2	Н3	H4	L1	L2	L3	L4	Part No.	Туре
			Ø										
14.5	9.5	4.2	3.5	~44	20	5.5	2	30	20	13	22	552376	SAMH-P4-A

Front panel installation kit SAMH

Materials: PC, POM

Note on materials: RoHS-compliant



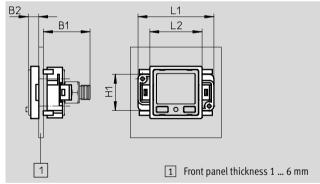

Ordering data						
B1	B2	H1	L1	L2	Part No.	Туре
~31	7	24	50	34.5	552377	SAMH-P4-F


Protective cover SACC

Material:

PC

Note on materials: RoHS-compliant



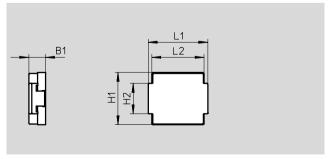

Dimensions and ordering data									
B1	H1	H2	L1	L2	Part No.	Туре			
~28	34.5	20	39.3	34.5	552378	SACC-P4-G			

Pressure sensors SPAB, with display

FESTO


Accessories

Electric adapter SASC

Material: Housing: PA-reinforced Plug housing: Nickel plated brass

Note on materials: RoHS-compliant



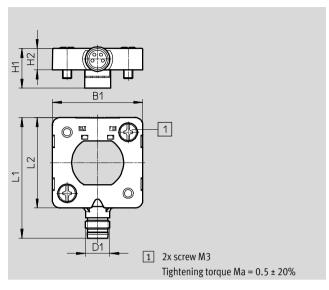

Dimensions and	Dimensions and ordering data									
B1	D1	H1	H2	L1	L2	CRC ¹⁾	Part No.	Туре		
	Ø									
29.6	M8x1	13	7	39.5	29.6	2	8000326	SASC-P4-A-M8-A		

¹⁾ Corrosion resistance class CRC 2 to Festo standard FN 940070

Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pin allocation	Pin allocation							
Plug, 4-pin, M8x1								
Round design Pin Allocation								
1	1	Operating voltage 12 24 V DC						
(+ +) 2	2	Switching output B / analogue output, external						
(++)4	4	Switching output A						
3	3	0 V DC						

Pressure sensors SPAB, with display Accessories

FESTO


Electric adapter SASC

Material:

Housing: PA-reinforced Plug housing: Nickel plated brass

Note on materials: RoHS-compliant



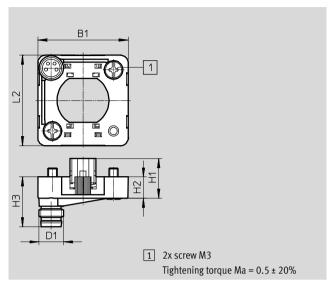

Dimensions and	Dimensions and ordering data									
B1	D1	H1	H2	Н3	L2	CRC ¹⁾	Part No.	Туре		
	Ø									
29.6	M8x1	13	7	16.3	29.6	2	8000327	SASC-P4-A-M8-S		

¹⁾ Corrosion resistance class CRC 2 to Festo standard FN 940070
Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pin allocation	Pin allocation							
Plug, 4-pin, M8x1								
Round design	Pin	Allocation						
1	1	Operating voltage 12 24 V DC						
(++) 2	2	Switching output B / analogue output, external						
↓ + / 4	3	0 V DC						
3	4	Switching output A						

Pressure sensors SPAB, with display

Accessories

FESTO

Adapter plate SASF


for pressure sensor SPAB-...-F

Materials: PBT-reinforced High-alloy stainless steel HNBR

Note on materials: Contains PWIS (paint wetting impairment substances) RoHS-compliant





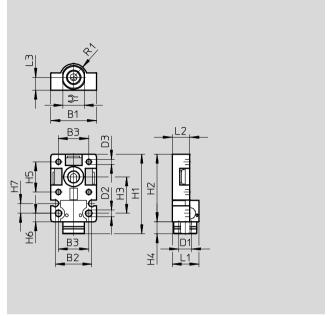

- Note

To differentiate the adapter plates R1/8, G1/8 and NPT1/8, they are identified as follows at the

pneumatic connection:

R1/8 No lineNPT1/8 One line

- G1/8 Two lines

Dimensions ar	Dimensions and ordering data									
B1	B2	В3	D1	D2	D3	H1	H2	H3	H4	H5
				Ø	Ø					
			R1/8							
30	24	20	G1/8	4.3	3.4	52.5	44.5	24	8	20
			NPT1/8							
30	24	20	M5	4.3	3.4	-	44.5	24	-	20

Н6	H7	L1	L2	L3	R1	=©	CRC ¹⁾	Part No.	Туре
5.5	6.5	17.5	11.5	8.5	9	14		570801 570802	SASF-P4-P-R18 SASF-P4-P-G18
						2	570803	SASF-P4-P-N18	
5.5	6.5	17.5	11.5	8.5	9	-		570804	SASF-P4-P-M5

Corrosion resistance class CRC 2 to Festo standard FN 940070
 Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pressure sensors SPAB, with display Accessories



Ordering da	Ordering data – Connecting cables Technical data → Internet: nebu									
	Designation	Number of wires	Cable length [m]	Part No.	Туре					
	Socket,	4	2.5	572576	NEBS-L1G4-K-2.5-LE4					
9 To 100	rectangular design L1		5	572577	NEBS-L1G4-K-5-LE4					
	Straight socket, M8x1	4	2.5	541342	NEBU-M8G4-K-2.5-LE4					
6			5	541343	NEBU-M8G4-K-5-LE4					
	Angled socket, M8x1	4	2.5	541344	NEBU-M8W4-K-2.5-LE4					
			5	541345	NEBU-M8W4-K-5-LE4					

Ordering da	Ordering data – Push-in fittings Technical data → Internet: o									
	Pneumatic connection	For tubing O.D. [mm]	Part No.	Туре						
	M5	6	153304 153306	QSM-M5-4 QSM-M5-6						