Estimate: 240079 Institute of Music for Children

Estimate Unit Costs

Line	Description	Quantity	Unit Cost	Total
1	**01 General Requirements**			
2	**01.5400 Construction Aids**			
3	Scaffolding For Exterior [Budget]	1.00 EA	50,000.00	50,000.00
4			**Construction Aids Total**	**$50,000.00**
5			**General Requirements Total**	**$50,000.00**
6	**02 Existing Conditions**			
7	**02.1000 Demolition**			
8	Remove Floor Mounted Radiator	3.00 EA	500.00	1,500.00
9	Demo Stone Steps	1.00 EA	3,500.00	3,500.00
10	Demo Metal Railings	33.28 LF	20.00	665.60
11	Remove Refrigerator	2.00 EA	150.00	300.00
12	Demo Existing Work Stations	2.00 EA	300.00	600.00
13	Demo Existing Wall Mounted Device And All Associated Infrastructure	1.00 EA	400.00	400.00
14	Demo Bulkhead	34.32 SF	40.00	1,372.80
15	Demo Brick Wall	79.30 SF	35.00	2,775.50
16	Demo Brick Retaining Wall	26.21 LF	200.00	5,242.00
17	Remove Rubber Stair Treads	15.00 EA	120.00	1,800.00
18	Demo Ductwork	119.82 LF	20.00	2,396.40
19	Demo Exhaust Duct	36.14 LF	20.00	722.80
20	Remove Existing Radiator	4.00 EA	500.00	2,000.00
21	Remove Interior Partitions	173.27 LF	24.00	4,158.48
22	Remove Millwork	32.76 LF	40.00	1,310.40
23	Remove Millwork And Salvage	21.97 LF	40.00	878.80
24	Remove Floor Tile	430.69 SF	5.00	2,153.45
25	Remove Wall Tile & Backing (Plan View)	54.80 SF	12.00	657.60
26	Remove Flooring	3,033.49 SF	4.00	12,133.96
27	Remove ACT Ceilings, Lights & Diffusers	2,859.31 SF	1.75	5,003.79
28	Remove GWB Ceilings	300.34 SF	2.00	600.68
29	Remove Plumbing Fixtures	26.00 EA	125.00	3,250.00
30	Remove Doors & Frames	8.00 EA	100.00	800.00
31	Remove Damaged Speaker	1.00 EA	500.00	500.00
32	Remove Toilet Partitions	4.00 EA	200.00	800.00
33	Remove Window	1.00 EA	500.00	500.00
34			**Demolition Total**	**$56,022.26**
35	**02.2500 Asbestos Remediation**			
36	Asbestos Abatement [Pipes In Corridor 301]	1.00 EA	2,500.00	2,500.00
37	Asbestos Abatement On Stairwell	2.00 EA	20,000.00	40,000.00
38	Abate VAT/Mastic [Classroom 204, VAT/Mastic]	532.00 SF	20.00	10,640.00
39	Abate VAT/Mastic[Classroom 203, VAT/Mastic]	2,700.00 SF	15.00	40,500.00
40	Abate Linoleum Glue [Phonoteck Room 105]	264.00 SF	20.00	5,280.00
41	Abate Carpet Glue [Office 304, Office 306, And Office 307]	1,160.00 SF	15.00	17,400.00

Line	Description	Quantity	Unit Cost	Total
42	Abate TSI In Walls [MER, Pipe Insulation]	680.00 SF	10.00	6,800.00
43	Asbestos 3rd Party Monitoring	1.00 LS	3,000.00	3,000.00
44	Asbestos 3rd Party Monitoring	1.00 LS	6,000.00	6,000.00
45			**Asbestos Remediation Total**	**$132,120.00**
46			**Existing Conditions Total**	**$188,142.26**
47	**03 Concrete**			
48	**03.1000 Concrete**			
49	Form & Pour Concrete Footings	6.55 CY	1,750.00	11,462.50
50	Form & Pour Concrete Foundation Wall(s)	15.08 CY	1,750.00	26,390.00
51	Patch Concrete Slab	418.44 SF	20.00	8,368.80
52	Hand-Dig Fill from Trench & Remove from Jobsite	209.22 LF	25.00	5,230.50
53	F/I Gravel Subbase in Trench	418.44 SF	9.00	3,765.96
54	Form & Pour Exterior Concrete Stairs (Per Risers). F/I All Applicable Rebar Per Plans & Specifications.	9.00 EA	1,750.00	15,750.00
55			**Concrete Total**	**$70,967.76**
56	**03.1500 Concrete Cutting**			
57	Portion Of Wall Above Window May Need To Be Removed For Allignment	1.00 EA	1,000.00	1,000.00
58	Sawcut Existing Slab (2' Wide) For Underground Utilities. Flip & Haul Concrete Off Site.	209.22 LF	100.00	20,922.00
59	Sawcut Block Door Opening 10" Demolition	16.95 LF	250.00	4,237.50
60			**Concrete Cutting Total**	**$26,159.50**
61			**Concrete Total**	**$97,127.26**
62	**04 Masonry**			
63	**04.5710 Brick**			
64	Repoint Misc. Brick And Limestone Cladding Where Visible Along Entire Exterior Of Building [Budgetary]	9,866.10 SF	5.00	49,330.50
65	Clean Brick Where Visible Efflorescence Staining [Allowance]	1.00 EA	10,000.00	10,000.00
66			**Brick Total**	**$59,330.50**
67			**Masonry Total**	**$59,330.50**
68	**05 Metal**			
69	**05.0100 Misc. Steel**			
70	Replace Corroded Steel Lintels Where Needed [Budgetary]	1.00 EA	0.00	0.00
71	F/I 1-1/2" Stainless Steel Rail	78.38 LF	200.00	15,676.00
72	F/I 1-1/2" Stainless Pipe Handrail	181.23 LF	150.00	27,184.50
73			**Misc. Steel Total**	**$42,860.50**
74	**05.1000 Ornamental Metals**			
75	3/8" Aluminum Plate 2'10" High Max	130.10 LF	150.00	19,515.00
76			**Ornamental Metals Total**	**$19,515.00**
77			**Metal Total**	**$62,375.50**
78	**06 Wood , Plastic and Composites**			
79	**06.2000 Finish Carpentry**			
80	F/I Adjustable Shelving	3.04 LF	350.00	1,064.00

Line	Description	Quantity	Unit Cost	Total
81	Repair Door, Door Hinges And Replace Any Damaged Or Missing Door Handles And Hardware [Budget]	10.00 EA	125.00	1,250.00
82			**Finish Carpentry Total**	**$2,314.00**
83	**06.2200 Millwork**			
84	F/I Millwork Doors (Pair) at Existing Closets	2.00 EA	4,200.00	8,400.00
85	F/I Control Booth	10.11 LF	500.00	5,055.00
86	F/I Closet Interiors	20.54 LF	250.00	5,135.00
87			**Millwork Total**	**$18,590.00**
88			**Wood , Plastic and Composites Total**	**$20,904.00**
89	**07 Thermal and Moisture Protection**			
90	**07.1000 Waterproofing**			
91	F/I Foundation Waterproofing [Tremproof 250GC or Equal]	917.84 SF	5.00	4,589.20
92			**Waterproofing Total**	**$4,589.20**
93	**07.3000 Roofing**			
94	Remove Section Of Slate Tiles On Roof	466.07 SF	25.00	11,651.75
95	Demo Existing Parapet Flashing	231.12 LF	15.00	3,466.80
96	Demo Parapet Coping	240.65 LF	15.00	3,609.75
97	1' Strip Of Plywood For Coverboard At Parapet Walls	311.04 LF	8.00	2,488.32
98	F/I Wood Nailer At Parapet Walls	311.04 LF	4.00	1,244.16
99	Provide New Continuous Metal Lead Caping On Roof Peak	82.86 LF	50.00	4,143.00
100	Budget For Replacing Damaged, Missing, Or Poorly Matched Slate Tiles On Roof	1.00 EA	10,000.00	10,000.00
101	Blocking At Top Of Parapet	237.79 LF	15.00	3,566.85
102	Replace Miscellaneous Metal Flashing At Steeple	1.00 EA	2,500.00	2,500.00
103	Remove Roofing	2,462.77 SF	7.00	17,239.39
104	F/I Ridge Cap Flashing	83.02 LF	55.00	4,566.10
105	F/I 1-Ply TPO Roof Membrane	2,455.55 SF	22.00	54,022.10
106	F/I 1-Ply TPO Roof Membrane at Parapet Walls	311.04 SF	26.00	8,087.04
107	Flash Roof Curb (Up To 18"x18")	1.00 EA	3,000.00	3,000.00
108	Flash Roof Drain (Existing)	4.00 EA	1,500.00	6,000.00
109	F/I Copper Standing Seam Roofing	672.25 SF	75.00	50,418.75
110	Double Caulk Pocket 3 Piece Counterflashing	311.04 LF	45.00	13,996.80
111	F/I .050 Aluminum Coping	237.79 LF	75.00	17,834.25
112			**Roofing Total**	**$217,835.06**
113	**07.6600 Gutters & Leaders**			
114	Cleanout Gutters And Downspouts	1.00 EA	2,500.00	2,500.00
115	Repair And Replace Gutter And Leaders As Needed [Budgetary]	1.00 EA	2,500.00	2,500.00
116			**Gutters & Leaders Total**	**$5,000.00**
117	**07.9510 Siding**			
118	Replace Miscellaneous Exterior Wood "Components" [Budget]	1.00 EA	10,000.00	10,000.00
119			**Siding Total**	**$10,000.00**
120			**Thermal and Moisture Protection Total**	**$237,424.26**

Line	Description	Quantity	Unit Cost	Total
121	**08 Openings**			
122	**08.1100 Doors, Frames & HW**			
123	HM Frame (Single)	8.00 EA	400.00	3,200.00
124	F/O HM Door	8.00 EA	450.00	3,600.00
125	F/O Door Hardware	7.00 EA	1,075.00	7,525.00
126	F/O Door Hardware	1.00 EA	1,200.00	1,200.00
127			**Doors, Frames & HW Total**	**$15,525.00**
128	**08.8200 Arch. Metal & Glass**			
129	Carefully Remove Damaged Existing Window Lights And Discard. Replace With New [Budget]	1.00 EA	5,000.00	5,000.00
130	Repair Existing Glazing At Window Panes Where Needed	743.00 EA	22.00	16,346.00
131	F/I Entry Storefront Frame, Sidelite & Transom w/HM Insulated Door & Panic Hardware HW	1.00 EA	5,200.00	5,200.00
132			**Arch. Metal & Glass Total**	**$26,546.00**
133			**Openings Total**	**$42,071.00**
134	**09 Finishes**			
135	**09.2300 Drywall & Carpentry**			
136	Remove And Salvage Existing Wall Mounted Mirror	2.00 EA	100.00	200.00
137	Relocate Curtain Track To Clear Electrical Panels And Conduits	17.25 LF	600.00	10,350.00
138	Patch And Paint Ceiling Where Lighting Fixtures Were Removed	15.55 SF	50.00	777.50
139	1" Shaft Wall Liner	464.00 SF	12.00	5,568.00
140	F/I New Seals At All Existing Exterior Doors	7.00 EA	350.00	2,450.00
141	Install Interior Signage	1.00 EA	1,500.00	1,500.00
142	Patch GWB Ceilings Where Lights Were Removed	9.00 EA	100.00	900.00
143	F/I 5/8" GWB Walls	3,883.12 SF	5.00	19,415.60
144	Patch Existing GWB Walls	213.77 SF	5.00	1,068.85
145	F/I Blanket Insulation	883.20 SF	5.00	4,416.00
146	F/I Blanket Insulation	2,350.74 SF	3.00	7,052.22
147	F/I 5/8" GWB Soffit Fascia	556.38 SF	10.00	5,563.80
148	F/I 5/8" GWB Soffit Fascia	692.06 SF	8.00	5,536.48
149	I/O Bath Accessories	7.00 BATH	850.00	5,950.00
150	I/O Interior Door, Frame & HW	8.00 EA	375.00	3,000.00
151	F/I 4" C-H Metal Stud Framing	463.26 SF	9.00	4,169.34
152	F/I 3-5/8" Metal Stud Framing	1,887.48 SF	7.75	14,627.98
153	F/I 3-5/8" Metal Stud Soffit Framing	883.20 SF	11.00	9,715.20
154			**Drywall & Carpentry Total**	**$102,260.97**
155	**09.2500 Acoustical Ceilings**			
156	Replace Maximum 50% Of 2x2 ACT Ceiling Tiles	437.65 SF	5.00	2,188.25
157	F/I ACT-2 Ceilings [Certainteed Aquarock 2x2 Narrow Reveal White]	512.56 SF	25.00	12,814.00
158	F/I ACT-1 Ceilings [Certainteed Ecophon Focus A 2x2 Narrow Reveal White]	98.58 SF	32.00	3,154.56
159	F/I ACT-3 Ceilings [Not Labeled or Specified]	717.06 SF	24.00	17,209.44

Line	Description	Quantity	Unit Cost	Total
160			**Acoustical Ceilings Total**	**$35,366.25**
161	**09.3013 Tile & Stone**			
162	Tile->Marble Transitions	33.04 LF	25.00	826.00
163	Provide Shop Drawings for Patterned Wall Tile Areas	1.00 EA	1,500.00	1,500.00
164	Tile Shop Drawings	1.00 EA	1,500.00	1,500.00
165	Clean And Refinish Floor Tile	64.83 SF	20.00	1,296.60
166	F/I TL-1 Tile Floors [Nasco Story Cloud 12x14 Matte]	498.75 SF	45.00	22,443.75
167	F/I TL-4 Floor Tile [	45.39 SF	47.00	2,133.35
168	F/I TL-1 Wall Tile [Nasco Story Cloud 12x24 Matte (Pattern)]	164.24 SF	45.00	7,390.80
169	TL-2 Wall Tile [Crossville Tile Cursive Custom Pattern TBD]	846.18 SF	45.00	38,078.10
170	TL-3 Wall Tile [Fire Clay Tile Cursive Custom Pattern TBD]	243.56 SF	45.00	10,960.20
171	Schluter Jolly Strip	21.59 LF	9.00	194.31
172	Waterproofing for Wall Tile. Perform Water Test (Per Specifications)	1,089.74 SF	8.00	8,717.92
173	Waterproofing for Wall Tile. Perform Water Test (Per Specifications)	498.75 SF	8.00	3,990.00
174			**Tile & Stone Total**	**$99,031.03**
175	**09.6000 Flooring**			
176	F/I MAR-1 Welded Seams [Formo Marmoleum Marble]	66.79 LF	9.00	601.11
177	F/I MAR-1 Floors [Formo Marmoleum Marble]	98.55 SF	16.00	1,576.80
178	F/I RB-1 4" Vinyl Base	126.39 LF	6.00	758.34
179	F/I RT Stair Nosings [RF7B-N30] Per RFI Responses #2	17.00 EA	500.00	8,500.00
180	F/I CPT-4 Walkoff Mat [Interface Step Repeeat Collection]	58.21 SY	65.00	3,783.65
181	F/I MAR-1 Floors [Formo Marmoleum Marble]	440.29 SF	16.00	7,044.64
182	F/I CPT-2 Carpet Tile [Aerial Collection Interface Per RFI Response #1]	117.19 SY	100.00	11,719.00
183	F/I CPT-3 -> CPT-4 Transitions	7.22 LF	55.00	397.10
184			**Flooring Total**	**$34,380.64**
185	**09.6400 Wood Flooring**			
186	Refinish Wood Stair Treads And Risers	6.00 EA	385.00	2,310.00
187	Allowance to Replace Damaged Wood Flooring	1.00 EA	5,000.00	5,000.00
188	Sand, Stain & Poly Existing Wood Flooring	2,114.44 SF	7.25	15,329.69
189			**Wood Flooring Total**	**$22,639.69**
190	**09.9100 Painting**			
191	Scrape, Sand, And Paint Existing Built In Storage	2.00 EA	1,200.00	2,400.00
192	Patch And Repair Window Sill Damage	3.00 EA	600.00	1,800.00
193	Paint Existing Radiator To Match Adjacent Wall	5.00 EA	600.00	3,000.00
194	Paint Lighting Poles	64.99 LF	10.00	649.90
195	Paint Existing Conduits	36.58 LF	10.00	365.80
196	Paint Eletrical Panel	3.00 EA	50.00	150.00
197	Scrape, Sand, And Paint Existing Millwork Shelving	26.74 LF	50.00	1,337.00
198	Paint Existing Radiators	18.45 LF	600.00	11,070.00
199	Scrape, Sand And Paint Existing Cornice (Including Lifts)	249.92 LF	70.00	17,494.40

Line	Description	Quantity	Unit Cost	Total
200	Existing Door To Be Stripped From Existing Paint, Sanded, Prepared For New Paint, And Painted	2.00 EA	1,200.00	2,400.00
201	Scrape, Sand, And Prep Existing Wood Frames To Receive New Panes	48.00 EA	500.00	24,000.00
202	Paint Existing Wood Windows	47.00 EA	500.00	23,500.00
203	Paint Exterior Wood Components	1.00 EA	20,000.00	20,000.00
204	Caulk As Necessary [Budgetary]	1.00 EA	5,000.00	5,000.00
205	Grind And Repaint Exposed Steel Window Lintels Where Visible	46.00 EA	300.00	13,800.00
206	Scrape, Sand And Paint Existing Window Casing	6.00 EA	600.00	3,600.00
207	Scrape, Patch, And Paint Window	1.00 EA	600.00	600.00
208	Paint Existing Heating Unit	1.00 EA	300.00	300.00
209	Paint GWB Walls	2,135.97 SF	2.50	5,339.93
210	Paint Existing GWB Walls	6,475.12 SF	2.50	16,187.80
211	Paint Existing GWB Walls @ 11'	880.44 SF	2.00	1,760.88
212	Paint Base Molding	265.64 LF	5.00	1,328.20
213	Paint Existing Base Molding	243.51 LF	3.50	852.29
214	Paint GWB Ceilings	681.21 SF	2.00	1,362.42
215	Paint GWB Ceilings	544.73 SF	2.75	1,498.01
216	Paint/Stain New Doors & Frames	8.00 EA	300.00	2,400.00
217	Paint GWB Walls	6,168.29 SF	2.50	15,420.74
218	Paint Existing HM Door & Frame	5.00 EA	300.00	1,500.00
219	Paint Existing HM Door & Frame	3.00 EA	275.00	825.00
220	Paint Existing HM Door & Frame	10.00 EA	225.00	2,250.00
221	Paint Existing GWB Ceilings	2,038.09 SF	2.00	4,076.18
222	Paint Existing GWB Ceilings	660.79 SF	2.75	1,817.17
223	Paint Stage Front	25.98 LF	73.50	1,909.53
224	Paint GWB Soffit Fascia	115.24 SF	3.00	345.72
225			**Painting Total**	**$190,340.97**
226			**Finishes Total**	**$484,019.55**
227	**10 Specialties**			
228	**10.1400 Signage**			
229	F/O S1.03 Exit Signage	6.00 EA	60.00	360.00
230	F/O S1.1 Room Designation Signage	20.00 EA	60.00	1,200.00
231	F/O S1.0 Restroom Signage	4.00 EA	60.00	240.00
232			**Signage Total**	**$1,800.00**
233	**10.2226 Operable Partitions**			
234	Replace Curtains At Stage With Inherently Non Combustible Curtains	84.37 LF	150.00	12,655.50
235			**Operable Partitions Total**	**$12,655.50**
236	**10.2239 Folding Panel Partitions**			
237	F/I Retractable Wall Partition in Existing Opening	16.19 LF	250.00	4,047.50
238			**Folding Panel Partitions Total**	**$4,047.50**
239	**10.2800 Bath Accessories**			

Line	Description	Quantity	Unit Cost	Total
240	F/O TA-07 Toilet Seat Cover Dispenser [Bobrick B-4221]	9.00 EA	125.00	1,125.00
241	F/O TA-05.3 Grab Bar 18" [Bobrick B-9806x18]	3.00 EA	325.00	975.00
242	F/O TA-05.1 Grab Bar 36" [Bobrick B-9806x36]	5.00 EA	375.00	1,875.00
243	F/O TA-05.2 Grab Bar 42" [Bobrick B-9806x42]	11.00 EA	350.00	3,850.00
244	F/O TA-01 Toilet Tissue (Paper) Dispenser [Bobrick B-4288 Contura Series]	9.00 EA	150.00	1,350.00
245	F/O T-09 Toilet Tissue (Paper) Dispenser [Georgia Pacific 56790A]	2.00 EA	175.00	350.00
246	F/O TA-03 Paper Towel Dispenser/Waste Receptacle [Bobrick B-3979]	4.00 EA	1,000.00	4,000.00
247	F/O TA-10 Paper Towel Dispenser [Tork-Essity-NA 771728]	1.00 EA	100.00	100.00
248	F/O TA-04 Soap Dispenser [Bobrick B-2111]	8.00 EA	50.00	400.00
249	F/O Mirror [No Spec]	3.00 EA	150.00	450.00
250	F/O TA-02 Sanitary Napkin Disposal [Bobrick B-270 Contura Series]	11.00 EA	50.00	550.00
251			**Bath Accessories Total**	**$15,025.00**
252	**10.2900 Toilet Partitions**			
253	TA-06 Full Height Toilet Partitions	5.00 EA	5,000.00	25,000.00
254			**Toilet Partitions Total**	**$25,000.00**
255			**Specialties Total**	**$58,528.00**
256	**12 Furnishing**			
257	**12.2000 Window Treatments**			
258	F/I Mecho Shade Window Treatments	56.68 SF	95.00	5,384.60
259			**Window Treatments Total**	**$5,384.60**
260			**Furnishing Total**	**$5,384.60**
261	**22 Plumbing**			
262	**22.0000 Plumbing**			
263	F/I Rough Plumbing (H/C Water, Waste & Vent Piping)	1.00 LS	30,000.00	30,000.00
264	Disconnect Existing Plumbing Fixtures	26.00 EA	200.00	5,200.00
265	F/I Toilet	4.00 EA	4,200.00	16,800.00
266	F/I Bath Lav (Sink) & Faucet	4.00 EA	4,400.00	17,600.00
267	F/I Circulator Pump	1.00 EA	3,800.00	3,800.00
268	F/I Submersible Pump In Manhole	1.00 EA	7,000.00	7,000.00
269	F/I Mop Sink	2.00 EA	3,800.00	7,600.00
270	F/I Hot Water Heater [Bradford White LE22OU3]	1.00 EA	5,600.00	5,600.00
271			**Plumbing Total**	**$93,600.00**
272			**Plumbing Total**	**$93,600.00**
273	**23 Heating, Ventilating and Air-Conditioning**			
274	**23.0000 HVAC**			
275	Disconnect Existing Radiators And Discard	4.00 EA	500.00	2,000.00
276	F/I New Space Heater	5.00 EA	1,500.00	7,500.00
277	Disconnect Floor Mounted Radiator And Piping	2.00 EA	500.00	1,000.00
278	F/I 6" Round Ductwork Insulated (Per LB)	375.43 LB	36.00	13,515.48
279	F/I Exhaust Plenum	76.45 LB	36.00	2,752.20

Line	Description	Quantity	Unit Cost	Total
280	F/I Ductwork Insulated (Per LB)	138.41 LB	32.00	4,429.12
281	F/I Exhaust Fan	4.00 EA	1,500.00	6,000.00
282	80 CFM Exhaust Fan	4.00 EA	350.00	1,400.00
283			**HVAC Total**	**$38,596.80**
284			**Heating, Ventilating and Air-Conditioning Total**	**$38,596.80**
285	**26 Electrical**			
286	**26.0000 Electric**			
287	Remove Existing Lighting Fixtures	4.00 EA	200.00	800.00
288	Remove Existing Light Fixture	1.00 EA	200.00	200.00
289	Home Run + Standard Breaker	5.00 EA	500.00	2,500.00
290	GFI Receptacle (Residential)	5.00 EA	350.00	1,750.00
291	Duplex Receptacle (Commercial)	4.00 EA	325.00	1,300.00
292	Duplex Receptacle (Commercial)	19.00 EA	300.00	5,700.00
293	Quad Receptacle (Commercial)	8.00 EA	450.00	3,600.00
294	Wire FC-1	1.00 EA	950.00	950.00
295	Wire FCCU-1	1.00 EA	2,200.00	2,200.00
296	Wire ERV	1.00 EA	2,200.00	2,200.00
297	Wire Exhaust Fans	4.00 EA	1,200.00	4,800.00
298	Wire New Electric Heater EH-1	4.00 EA	1,600.00	6,400.00
299	Wire Hot Water Heater [HWH] (120V)	1.00 EA	850.00	850.00
300	Wire Space Heater	7.00 EA	1,500.00	10,500.00
301	Install Lighting Fixture (Commercial)	65.00 EA	300.00	19,500.00
302	Install Linear Lighting Fixture	59.20 LF	75.00	4,440.00
303	Single-Pole Switch (Commercial)	4.00 EA	225.00	900.00
304	Wall-Mounted Occupancy Sensor (OC)	13.00 EA	350.00	4,550.00
305	Electrical Disconnects Prior to Demo	1.00 EA	1,200.00	1,200.00
306	Junction Box (Commercial)	12.00 EA	500.00	6,000.00
307			**Electric Total**	**$80,340.00**
308	**26.5000 Lighting Fixtures**			
309	Lighting Fixture Budget	58.00 EA	500.00	29,000.00
310	Lighting Fixture Budget (Recessed)	7.00 EA	200.00	1,400.00
311	LED Linear Light Budget	59.20 LF	60.00	3,552.00
312			**Lighting Fixtures Total**	**$33,952.00**
313			**Electrical Total**	**$114,292.00**
314	**28 Safety And Security**			
315	**28.4600 Fire Alarm**			
316	F/I New Speaker/Strobe Combination	7.00 EA	750.00	5,250.00
317	F/I Strobe	1.00 EA	700.00	700.00
318	Fire Alarm Programming	1.00 EA	5,000.00	5,000.00
319	Fire Alarm Shop Drawings	1.00 EA	2,500.00	2,500.00
320			**Fire Alarm Total**	**$13,450.00**

Line	Description	Quantity	Unit Cost	Total
321			**Safety And Security Total**	**$13,450.00**
322	**31 Sitework**			
323	**31.0000 Sitework**			
324	Excavate For Drainage	78.19 LF	75.00	5,864.25
325	Gravel For Drainage Trench	20.00 CY	50.00	1,000.00
326	Remove Existing Drainage Inlets	2.00 EA	800.00	1,600.00
327	Vinyl Sheet Piles	130.10 LF	150.00	19,515.00
328	Excavate Sidewalk	854.15 SF	4.00	3,416.60
329	Excavate For Foundation Water Proofing	116.26 LF	75.00	8,719.50
330	Excavate Retaining Walls	163.76 LF	50.00	8,188.00
331	Backfill Retaining Walls	77.98 LF	36.00	2,807.28
332	Prepare Sidewalk Subgrade and Compact	854.15 SF	2.50	2,135.38
333	Backfill Sidewalk Compact	854.15 SF	2.50	2,135.38
334	F/I Crushed Stone	14.24 CY	195.00	2,776.80
335			**Sitework Total**	**$58,158.19**
336	**31.1100 Drainage & Stormwater**			
337	8" Sch 40 PVC	29.78 LF	60.00	1,786.80
338	48" Diam. Drain Manhole	1.00 EA	3,600.00	3,600.00
339	Trench Drains Set in Concrete (Per LF)	11.01 LF	300.00	3,303.00
340	4" PVC Sch 40 Drainage Pipe	45.12 LF	40.00	1,804.80
341	Drainage Chambers	1.00 EA	1,600.00	1,600.00
342			**Drainage & Stormwater Total**	**$12,094.60**
343	**31.2200 Grading**			
344	Rough Grading with Stockpiled Soil	2,053.75 SF	3.00	6,161.25
345			**Grading Total**	**$6,161.25**
346			**Sitework Total**	**$76,414.04**
347	**32 Exterior Improvements**			
348	**32.9300 Landscaping**			
349	Seeding	2,053.75 SF	0.80	1,643.00
350			**Landscaping Total**	**$1,643.00**
351			**Exterior Improvements Total**	**$1,643.00**
352	**97 Notes/Exclusions/RFIs/Etc.**			
353	**97.0000 Notes/RFIs/Exclusions/Allowances:**			
354	Exclusion: Assess And Replace Operable Window/Door Hardware	1.00 EA	0.00	0.00
355	Exclusion: Rout And Seal Sky-Facing Mortar Joints/Misc. Cracking Where Visible Along Entire Exterior Of Church	1.00 EA	0.00	0.00
356	Exclusion: Replace Corroded Steel Lintels Where Needed [Budgetary]	1.00 EA	0.00	0.00
357	Exclusion: Asphalt Repairs	1.00 EA	0.00	0.00
358			**Notes/RFIs/Exclusions/Allowances: Total**	**$0.00**
359			**Notes/Exclusions/RFIs/Etc. Total**	**$0.00**
360	**Sub-Total (Base Cost)**			**$1,643,302.77**

Estimate Summary

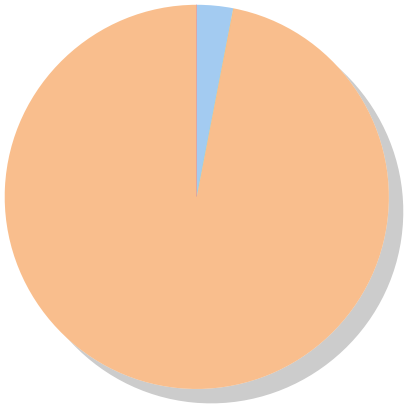

Material [$49,976]
Labor [$0]
SubContractor [$1,593,327]
Equipment [$0]
Other [$0]

Description		Total
Sub-Total (Base Cost)		$1,643,302.77
Sub-Total ()		$1,643,302.77
General Conditions	12.0000%	197,196.33
Overhead & Profit	10.0000%	184,049.91
Insurance	3.0000%	60,736.47
Total Estimate		$2,085,285.48