Robot Procedure 2016_015

Apr 14th

2016

Preparation for Patch software loading and data collection procedure

[Patch Software loading to R30iA Controller]

Purpose:

Patch Software installation to overcome below troubles in R30iA:
Problem1: Problems TP program reset to Line Zero after Input Power Recycle
Problem2: TP screen freezing in R30iA at Tip Dressing cycle

This document shows a procedure to install patch software into following version controller.

Target version : V7.70P/8,9,10,14,18,19,21,23,25,37,41,43,45
V7.50P/6,9,14,17,22,23,24,25
V7.30P/24,35

Tools Required:
Compact Flash Card – 2 Nos.
CF1 – Used for Collecting Image backup from each robot.
CF2 – With Patch Software data pre-loaded.

Note:
Please write CF1 & CF2 on respective compact flash cards for easy identification.

Preparation:
One time activity
Extract patch software content to compact flash card (CF2):
1. Unzip the mc.zip into memory card.
   Confirm that following files are extract to the root directory of the memory card.
   - v730p
   - v750p
   - v770p
   - a.cm
   - lg_p485.ls

2. Collect Robot Image Backup for each Robot separately using Compact flash card (CF1):
   Please save image backup files before installation. (For safety)
   After collecting image backup, please save the content to your PC with Robot identification number (Old_XXXXXXXX)

Procedure to Load Patch Software:

a. Insert patch software memory card into memory card socket of controller.

b. Select file menu.
   - [MENUS]
   - FILE

c. Select MC: as memory device and show list of all files.
   - F5[UTIL]
   - 1 Set Device
   - Select "Mem Card (MC:)".
   - F2 [DIR]
   - Select "*.*" and put ENTER

d. Select A.CM and put ENTER key.

e. Question • Execute A.CM? is displayed. Then press F4• YES

f. Caution after software update

When following message is displayed, installation is succeeded. **Go ahead to "g".**
VERSION V7.X0P/XX
Patch was loaded successfully.

When any of following message appears please take necessary action

- **If "VERSION ERROR" message is displayed, installation is cancelled.**
  - **Because version is not Target version.**
- **If you see a message "Program already exists",**
  - **V730P24F.TP exists in the controller.**
  - **Please save V730P24F.TP on a memory card.**
  - **Please run A.CM again.**
  - **After the patch is loaded successfully, load V730P24F.TP from the memory card.**

g. Turn OFF/ON the power.
h. That's all for installation.
i. If any system alarm or system hangs during Power Off and On
(Or)
You want to restore state before patch installation, please restore image backup collected for this Robot from CF1 card.

✓ **Robot Data Collection**

Please collect the below information before and after patch software update:

1. Robot Controller: R30iA
2. Robot Controller Sl. No.: EXXXXXXX
3. Robot Model: R2000iX/XXXX
4. Robot Sl. No,: RXXXXXXX
5. Old image backup file name: OLD_XXXXXXXX
6. Robot Software information before and after, collect from below screen (Sl. No 1, 5 & 11)
   Menu →(0) Next →(4) Status →(4) Version ID→F2 (Software) below screen displayed:

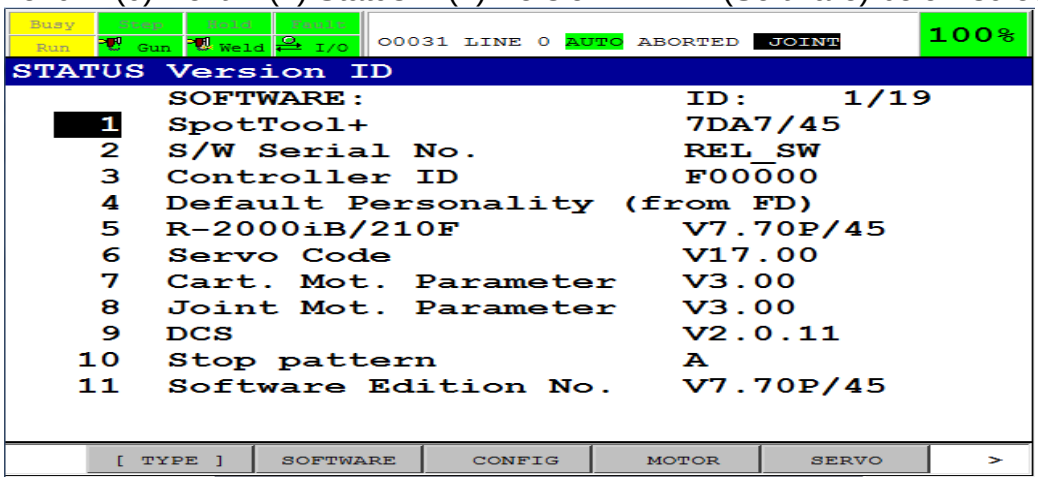

7. Save the above mentioned information (S.N 1~6) to the excel sheet provided.

END OF ACTIVITY