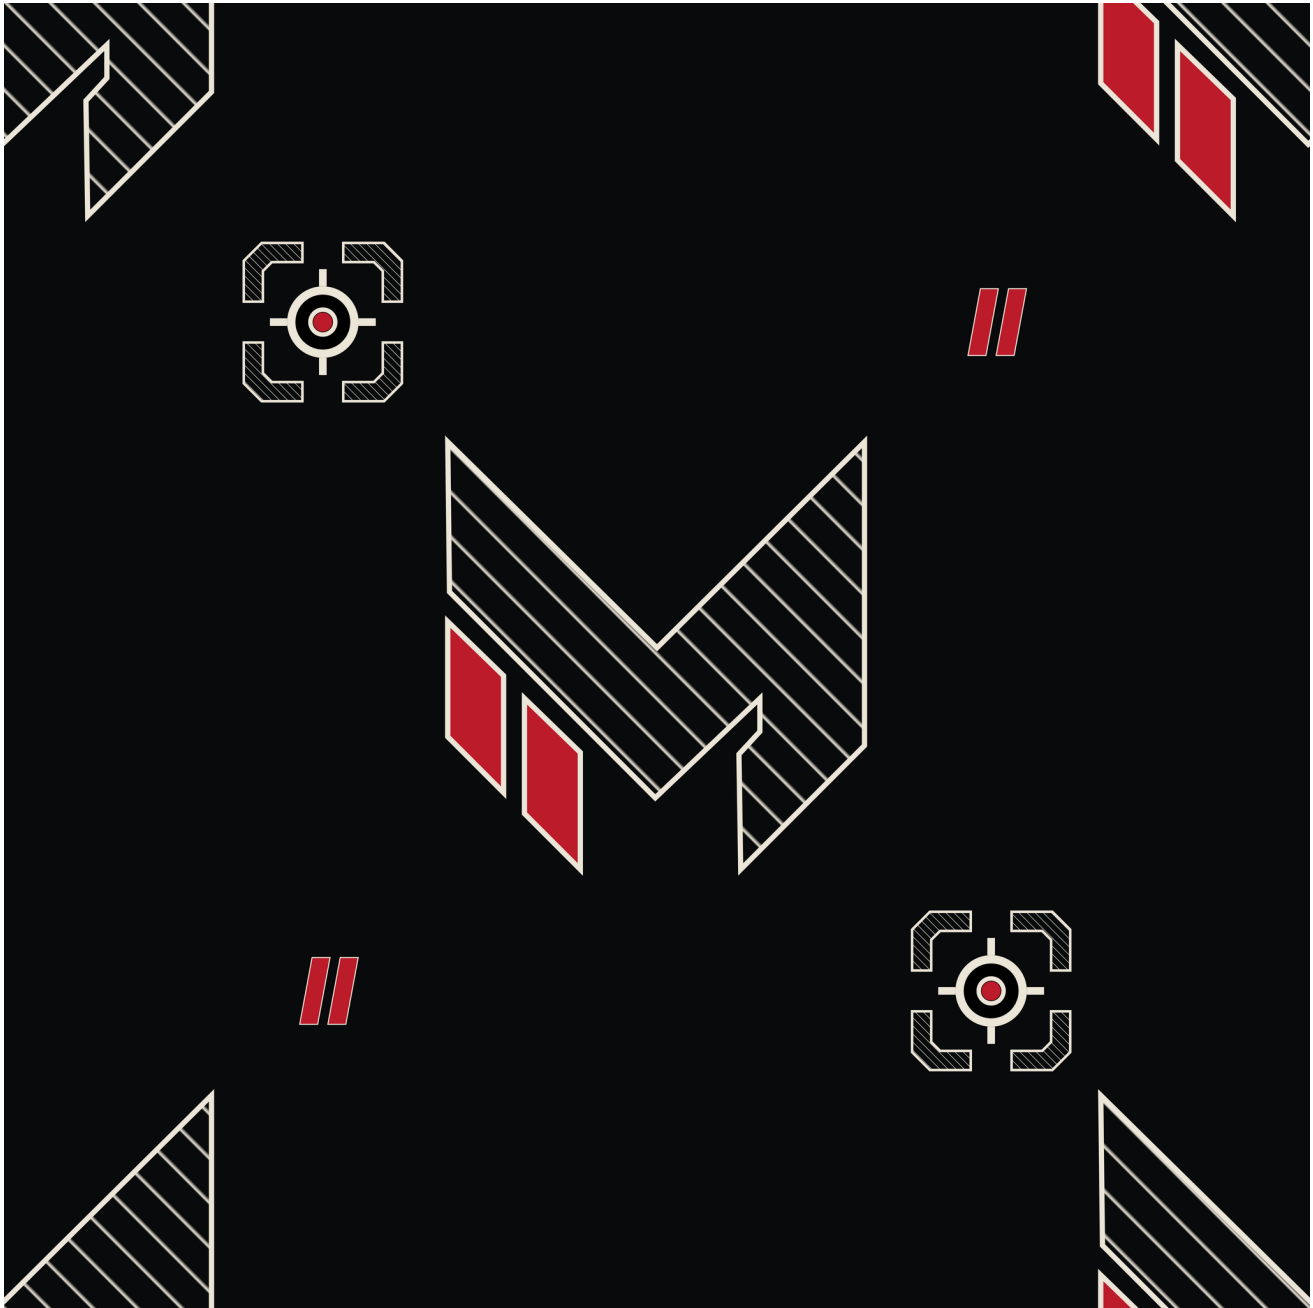

McCluster Dual Sight

Manufacturing Master and Production Guide



LOCKED SYSTEM: exact M emblem = the House; red // = peace and wartime; Dual Sight = camera focus and recording light in peace, weapon optic and red-dot target in war.

Production defaults

Item	Specification
Repeat	8.000 x 8.000 in / 203.2 x 203.2 mm, square straight repeat
Print raster	600 ppi master: 4800 x 4800 px
Color count	3 visual colors; black may be substrate rather than ink
Minimum vinyl repeat	150 mm recommended; use cut-safe solid files, not the hatched print master
Embroidery	Two-thread sequence: red fill first, ivory linework second
Scaling	Vector/print may scale freely. Machine embroidery should not scale beyond +/-10 percent.

Color values

Color	HEX	RGB	Approx. CMYK	Production note
Black	#080A0C	8 / 10 / 12	33 / 17 / 0 / 95	Prefer black garment/substrate when possible
Ivory	#ECE6D8	236 / 230 / 216	0 / 3 / 8 / 7	Match by physical ink/thread swatch
Red	#BC1B2A	188 / 27 / 42	0 / 86 / 78 / 26	Match by physical ink/thread swatch

CMYK values are conversion starting points, not a substitute for the printer's press profile. Approve a strike-off under production lighting.

File map

Folder	Use	Primary formats
01_MASTER_VECTOR	Editable seamless source and Illustrator-compatible exchange	SVG, SVGZ, PDF, EPS, EMF
02_PRINT_TEXTILE_DTF	Fabric, sublimation, DTG, DTF, wallpaper, packaging	PNG, TIFF, CMYK TIFF/PDF, JPG, WebP, ORA, GIF, BMP
03_SCREEN_PRINT_SEPARATIONS	Spot plates, underbase, film positives	SVG, PDF, EPS, 1-bit TIFF
04_VINYL_HTV_PLOTTER	Cricut, Silhouette, sign vinyl, heat-transfer vinyl	SVG, PDF, EPS, DXF, HPGL/PLT; mirrored HTV set
05_EMBROIDERY_MACHINE_FILES	Industrial and home embroidery machines	DST, PES, JEF, EXP, VP3, XXX, U01, TBF, PEC
06_LASER_CNC_ENGRAVING	Laser, routing, engraving, plotting	SVG, DXF, PDF, EPS, PLT
07_COLOR_SWATCHES	Design and vendor color setup	ASE, GPL, JSON, CSS

Use the hatched master for print. Use CUT-SAFE SOLID files for vinyl, laser, routing, and small-format production. Those paths are welded and contain no live strokes.

Embroidery production

Design	Sewn bounds	Stitches	Colors	Machine formats
repeat-cell-100mm	63.3 x 63.3 mm	1,216	2	DST, PES, JEF, EXP, VP3, XXX, U01, TBF, PEC
repeat-cell-180mm	113.9 x 113.9 mm	2,584	2	DST, PES, JEF, EXP, VP3, XXX, U01, TBF, PEC
m-emblem-90mm	87.8 x 90.0 mm	2,839	2	DST, PES, JEF, EXP, VP3, XXX, U01, TBF, PEC
dual-sight-50mm	50.0 x 50.0 mm	1,330	2	DST, PES, JEF, EXP, VP3, XXX, U01, TBF, PEC
two-states-35mm	30.5 x 35.0 mm	1,034	2	DST, PES, JEF, EXP, VP3, XXX, U01, TBF, PEC

- Black is substrate and is not stitched.
- Sew order is red fill first, ivory linework second.
- The repeat-cell files omit clipped edge motifs so they can sew as self-contained placements. A multi-head mill should use the master vector to program continuous all-over registration.
- A test sew-out is mandatory. Stabilizer, needle, thread, garment stretch, pull compensation, density, and underlay must be approved on the actual material.
- Do not resize a machine file beyond +/-10 percent. Use another supplied size or re-digitize from the SVG master.

Vinyl, screen print, laser, and transfer

Vinyl / HTV	Import SVG first; DXF is the fallback. Keep layers aligned. Cut ivory underlay first and red top second. Use the MIRRORED files only for heat-transfer material.
Weeding	The solid cut file removes decorative hatch cuts. Do not use the print SVG for small vinyl. Keep the repeat at 150 mm or larger unless the cutter and material pass a test.
Screen print	Black is normally the garment. Use the supplied ivory and red spot separations plus the underbase plate when printing on dark material. Registration and choke/spread remain press-specific.
DTF / DTG	Use transparent 600 ppi PNG/TIFF. Do not mirror for DTG. Mirror only when the RIP or transfer workflow requires it.
Sublimation	Use the mirrored transfer file and confirm the fabric profile. Sublimation does not print white; ivory requires a white/light substrate or a different transfer method.
Laser / CNC	DXF units are millimeters. Confirm kerf, tool diameter, operation order, and whether internal contours cut before external contours. No machine-specific G-code is supplied.

Vendor approval checklist

- ☐ Confirm finished repeat dimensions and application before production.
- ☐ Confirm substrate color and whether black is garment, ink, vinyl, thread, or material.
- ☐ Approve red and ivory by physical swatch under production lighting.
- ☐ Approve one print strike-off, one cut/weeding test, or one embroidery sew-out as applicable.
- ☐ Verify repeat registration across at least four adjacent tiles before bulk manufacturing.