



Service Bulletin

Customer Service Department

TELEPHONE: 419-661-9000 FAX: 419-661-9639

INTERNET: <http://www.glasstech.com>

Reference #054

Dungs Valve Proving System Verification

The original Glasstech electrical drawings for your furnace may not indicate the correct wiring for the “TIGHTNESS CHECK OK” and “TIGHTNESS CHECK ALARM” outputs from the main gas train Dungs Valve Proving System, as well as the contacts associated with the “TIGHTNESS CHECK ALARM” contacts. We would ask you verify this wiring as soon as possible.

Please verify the following terminations.

The valve proving system is part of the main gas train, the “TIGHTNESS CHECK ALARM” relay is found in the combustion panel, the second row of contactors on the top middle of the panel.

TIGHTNESS CHECK OK Output – Wire number 1Z425 should be terminated on **Terminal 13** of the Dungs Valve Proving System.


TIGHTNESS CHECK ALARM Output – Wire number 1Z429 should be terminated on **Terminal 14** of the Dungs Valve Proving System.

TIGHTNESS CHECK ALARM Contacts – The following contacts for the TIGHTNESS CHECK ALARM relay (listed as CR429) should be checked:


- Wire numbers 1Z418B and 1Z418C should be terminated on a normally closed set of contacts.
- Wire numbers 1Z433A and 1Z433B should be terminated on a normally closed set of contacts.
- Wire numbers 1ZX1 and 1Z739 should be terminated on a normally open set of contacts.

The following indicates the affected wiring found on Glasstech drawing number XXX-460-W001-D sheet 4 of 40. (where xxx represents the furnace number)


Valve Proving System Terminations:

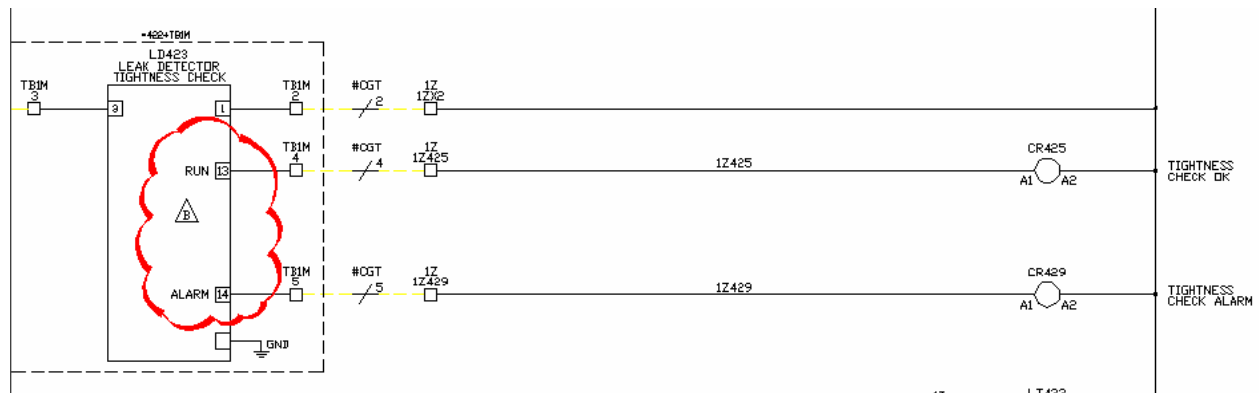

Tightness Check Alarm Contacts (CR429) Terminations:

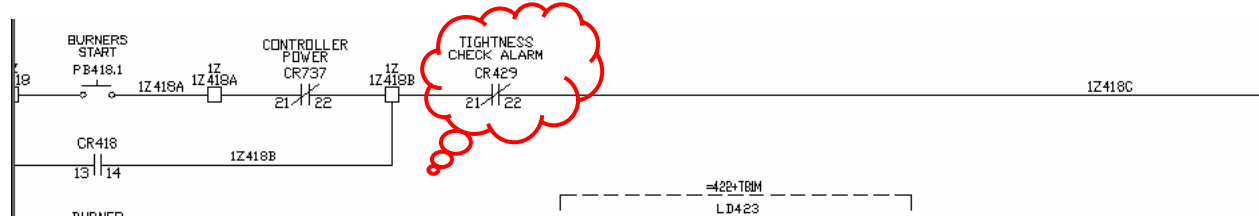

Tightness Check Alarm Contacts (CR429) Terminations:

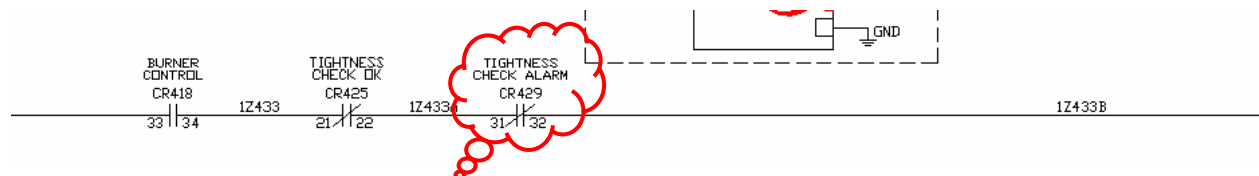

The following indicates the affected wiring found on Glasstech drawing number XXX-460-W001-D sheet 7 of 40. (where xxx represents the furnace number)

Tightness Check Alarm Contacts (CR429) Terminations:

