SCHERGER (RAAF) ELEV 145

AVFAX CODE 4507

QLD UTC +10 YBSG
123726S 1420514E VAR 5 DEG E MIL
AD OPR RAAF, Airbase Operations Centre - RAAF Base Townsville, QLD, 4814.
Email: tvl.aboc@defence.gov.au. PH 07 4752 1888.

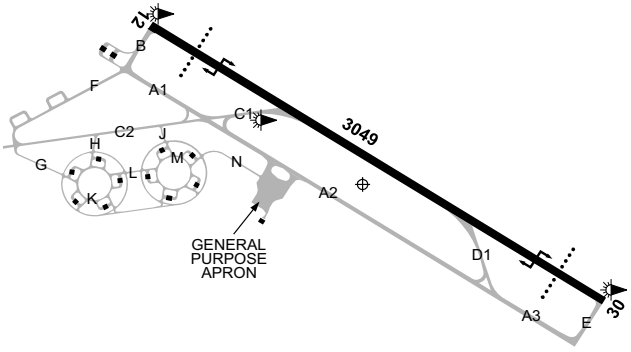

REMARKS

1. All ACFT require H24 PN to RAAF Base Townsville ABOC. PN and support REQ to be made through PH 07 4752 1888 or 0418 405 948 or via email.
2. INTL RAAF FLT are not to plan to enter Australia THRU Scherger WO approval of Department of Customs and Australian Quarantine and Inspection Service (AQIS), EXC in an EMERG.

HANDLING SERVICES AND FACILITIES

AVBL via NOTAM.

RESCUE AND FIREFIGHTING SERVICES

AVBL via NOTAM.

APRONS AND TAXIWAYS

1. TWY C2, G, H, J, K, L, M, N PCR 250/F/C/W/T.
2. TWY F PCR 300/F/C/W/T.
3. TWY F restricted to MAX wingspan 41M.
4. TWY G, H, J, N restricted to Code A ACFT only.
5. RWY and TWY shoulders non-compliant for Code D and Code E ACFT. Reduced WID and edge clearance for Code D ACFT on TWY C1 and D1. TWY edge drops greater than 25mm in areas on TWY A1, A2, A3, C1 and D1.
6. TWY markings non-compliant. C17A ACFT and larger to TAX at 5KT at TWY INT.
7. TWY A1, A2 and A3 AVBL as EMERG RWY.
8. RWY HLDG PSN markings and lighting on TWY B, C1 and D1 non-compliant.
9. Non-STD TWY naming conventions.
10. Nil mandatory instruction movement area guidance signs AVBL at TWY B, C1, D1 and E. INT DEP FM TWY C1 and D1 not assessed for compliance to design RQMNTS DRG initial certification. INT DEP FM TWY C1 and TWY D1 at pilot's discretion.

AERODROME OBSTACLES

IWI at both thresholds penetrate OLS. Not frangible. IWI INTST unknown.

METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS PH 07 3564 3737 - Report faults to 07 4082 3070.

Information may be continued on the next page: PTO

PHYSICAL CHARACTERISTICS

12/30 117 100a PCR 500/F/C/W/T WID 45 RWS 150
Arrestor system not permanently installed. Units requiring hookcable are to provide system and crew.

AERODROME AND APPROACH LIGHTING

RWY 12/30	MIRL	PAL+AA 120.6		SDBY PWR AVBL
RWY 12/30	PAPI	PAL+AA 120.6	3.0 DEG48FT	SDBY PWR AVBL
RWY 12/30	RTIL	PAL+AA 120.6		SDBY PWR AVBL

1. DIST to run markers lit.
2. PWR supplied by generator on base. SDBY PWR AVBL 15-20 SEC delay.
3. RWY edge LGT and PAPI not AVBL EXC with 24HR PN to RAAF Base Townsville ABOC via email.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 122.1 Circuit Area
TWR, SMC and ATIS availability and HR of service promulgated by NOTAM.

RADIO NAVIGATION AND LANDING AIDS

TAC SGR 123710.9S 1420520.0E (1)
(1) PTBL FAC ACT as required by MIL authorities. Channel assignment and ACT by NOTAM.

LOCAL TRAFFIC REGULATIONS

180 DEG turns on RWY not permitted for ACFT with outer main gear wheel span greater than 9M.

FLIGHT PROCEDURES

REMOTELY PILOTED AIRCRAFT SYSTEM (RPAS)

All RPAS requests and enquiries are to be sent to adf.airspace@defence.gov.au with at least 5 business days PN. OPS are subject to MIL OPS and may be restricted or cancelled at any time.

CTAF 126.7

Except when Scherger CTR and Restricted areas active.

ADDITIONAL INFORMATION

1. Animal hazard exists.
2. Two-way COM BTN ACFT on the ground at Weipa and Scherger on CTAF may be prevented by terrain shielding.
3. No AFRU exists at Scherger. ACFT to coordinate alternate means to check COM. Note that Scherger and Weipa use the same CTAF FREQ and use Weipa AFRU.

CHARTS RELATED TO THE AERODROME

1. WAC 3112.
2. MIL Aerodrome Obstruction Chart Type A: NOV 2024.
3. Also refer to AIP Departure and Approach Procedures.

SCONE ELEV 745

AVFAX CODE 2023

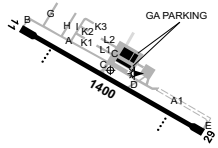

NSW UTC +10 YSCO
320214S 1504956E VAR 12 DEG E CERT
AD OPR Upper Hunter Shire Council, PO Box 208, Scone, NSW, 2337.
PH 02 6540 1100: AH AD Manager 0439 428 134. Fax 02 6545 2671.

REMARKS

1. AD Charges: Refer to http://upperhunter.nsw.gov.au/ for current fees and charges. Bookings for ACFT PRKG is compulsory over 5,700KG.
2. Gate access code from landside to main apron is: C then the YSCO CTAF.

HANDLING SERVICES AND FACILITIES

Aero Refuellers - AVGAS and JET A1 H24 self-service bowsers. Accept Aero Refuellers cards, V and MC. PH: 0413 003 808.