ADDITIONAL INFORMATION
1. Railway tracks are close to the threshold of RWY 15 and 19.
2. Kangaroo hazard may exist.

CHARTS RELATED TO THE AERODROME
WAC 3469.

CROKER ISLAND — ELEV 51

AVFAX CODE 8022

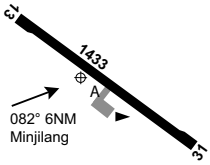

NT UTC +9:30 YCKI
110955S 1322902E VAR 2 DEG E CERT
AD OPR Minjilang Community Inc, Croker Island, NT, 0822.
Email: contracts@westarnhem.nt.gov.au. PH 08 8970 3500 BH.
ARO EMERG Satellite PH 0147 182 356 H24. Mobile 0419 947 865 H24.

PASSENGER FACILITIES
Telephone facilities not AVBL.

PHYSICAL CHARACTERISTICS

13/31	133	47a	Unrated. Sealed	WID 23	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 13/31	PTBL(1)	BY PRIOR ARRANGEMENT

(1) EMERG only.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	118.15 8000FT

CTAF 126.7

ADDITIONAL INFORMATION
Possibility of animals on movement area.

CHARTS RELATED TO THE AERODROME
WAC 3098.

CROOKWELL — ELEV 2953

FULL NOTAM SERVICE NOT AVBL

NSW UTC +10 YCRL
343000S 1492700E VAR 12 DEG E UNCR
AD OPR Advanced Aero Components Pty Ltd, 245 Old Hume Hwy, Mittagong, NSW, 2575.
Email: advancedaerocomponents@gmail.com. Mobile 0436 000 560.
Website: www.crookwellaerodrome.com.au: www.advancedaerocomponents.com.

REMARKS
1. AD charges - Refer to website.
2. Day OPS only.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	121.2 to East - on ground 121.2
FIA	MELBOURNE CENTRE	124.1

CTAF 126.7

ADDITIONAL INFORMATION
1. Turbulence due to Gullen range to West.
2. Down drafts over west end Gullen range in westerly winds.
3. West end Gullen Range may be higher than climb path.
4. Traffic on Kialla Road oriented North/South adjacent to E end of strip.
5. Radio contact may not be possible on ground.

CHARTS RELATED TO THE AERODROME
WAC 3456, 3457.