AERODROME OBSTACLES

1. Communications TWR (lit) 1,463FT AMSL PSN 334944.67S 1484149.90E.
2. Tree 1,083FT AMSL BRG 150 DEG MAG 1,985M FM ARP. Infringes visual segment RWY 33 APCH.

METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS PH 02 9353 6417 - Report faults to BoM.
3. AWIS FREQ 133.625 (requires one-second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

03/21	029	38c	Unrated. Grassed red clay.	WID 30	RWS 80
15/33	150	53a	PCR 100/F/C/0.60 MPa/U	WID 30	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 15/33 LIRL AFRU+PAL 126.7
RWY edge light spacing: 15/33: 90M.

OTHER LIGHTING

TWY LGT: Blue edge (TWY A only).

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 135.25 On ground

RADIO NAVIGATION AND LANDING AIDS

NDB CWR 299 335041.6S 1483911.7E Range 110 (HN 70)

LOCAL TRAFFIC REGULATIONS

1. RWY 15/33 confine OPS to sealed RWY SFC.
2. RWS not ABVL for TKOF or LDG.

FLIGHT PROCEDURES

Right hand CCTS required when OPR on RWY 15.

CTAF - AFRU 126.7

CHARTS RELATED TO THE AERODROME

1. WAC 3456, 3457.
2. Also refer to AIP Departure and Approach Procedures.

CRANBOURN

ELEV 300
FULL NOTAM SERVICE NOT AVBL

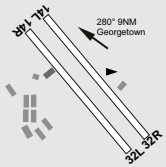

TAS UTC +10 YCRN
410941S 1470053E VAR 14 DEG E UNCR
AD OPR BG & M Hill & Partner, 1283 Dalrymple Road, Mount Direction, TAS, 7252. PH 03 6394 8119: 0488 169 231.

REMARKS

1. PPR.
2. Local peculiarities apply - Contact AD OPR for details.

PHYSICAL CHARACTERISTICS

14L/32R	22c	Unrated. Grass. RWY LEN 680M. Slope down to SE.	WID 17	
14R/32L	22c	Unrated. Grass with gravel. RWY LEN 680M. Slope down to SE. Crests at 370M FM S end and 120M FM N end.	WID 31	

ATS AND AERODROME COMMUNICATION FACILITIES

FIA LAUNY CENTRE (1) 123.8
(1) Outside LT TWR and APP HR ML CENTRE.

FLIGHT PROCEDURES

1. No simultaneous RWY OPS.
2. In nil wind conditions 32L/32R are to be used.
3. Circuits are to be flown to the west of the field with right hand circuits for RWY 14L/14R due to heavily forested areas to the east. Base leg for RWY 32L/32R are to be flown over a path indicated by white tyres mounted on fences 1.1KM south of RWY THR. No flying over houses in the circuit. For further information CTC AD OPR PH: 03 6394 8119.

CTAF 126.7

ADDITIONAL INFORMATION

1. Rabbits may dig on RWY surface.
2. Soft wet surface at mid length of RWY after heavy rain.

CHARTS RELATED TO THE AERODROME

WAC 3556.

CRESSY

ELEV 420

FULL NOTAM SERVICE NOT AVBL

VIC		UTC +10	YCRE
380224S	1433911E	VAR 11 DEG E	UNCR

AD OPR CSS Investments, 175 Aerodrome Road, Cressy, VIC, 3320.
Email: cressyaerodrome@iinet.net.au. PH 0481 327 587.

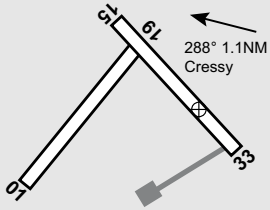

REMARKS

PPR.

HANDLING SERVICES AND FACILITIES

No fuel AVBL.

PASSENGER FACILITIES

WC/RF/HC/AC.

AERODROME OBSTACLES

1. Powerlines on the approach to RWY 33.
2. Unlit TWY 355 DEG MAG 0.8NM FM ARP.

PHYSICAL CHARACTERISTICS

01/19	36c	Unrated. Grass. RWY LEN 1,100M	WID 50
15/33	30c	Unrated. Grass. RWY LEN 900M	WID 50

AERODROME AND APPROACH LIGHTING

RWY 01/19 PTBL(1) BY PRIOR ARRANGEMENT

(1) 30MIN PN.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	126.8

FLIGHT PROCEDURES

1. Right hand circuits when operating on RWY 01 and 33.
2. Pilots are encouraged to avoid overflying Cressy township and properties to the S.
3. Aircraft approaching from NW or W to track via Lake Rosine and when approaching from S track via the eastern shore of Lake Weering.

CTAF 126.7

Information may be continued on the next page: PTO