ADDITIONAL INFORMATION

1. Bird hazard exists.
2. No RFFS provided.
3. Expect moderate turbulence on late final approach when surface wind velocity above 15KT - especially from easterly direction.
4. Hazardous conditions may exist for ACFT when departing on RWY 18 with a E/SE cross-wind ABV 10KT. Due to close proximity of small hill NE of RWS, ACFT are shielded until APRX 800M FM SOT RWY 18.

CHARTS RELATED TO THE AERODROME

1. WAC 3103.
2. Aerodrome Obstruction Chart Type A: July 2025.
3. Also refer to AIP Departure and Approach Procedures (DAP West).

CLARE VALLEY

ELEV 1120

FULL NOTAM SERVICE NOT AVBL

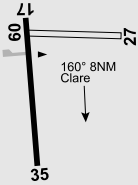

SA			UTC +9:30	YCVA
334230S		1383500E	VAR 8 DEG E	UNCR

AD OPR Clare Valley Flying Group Inc, PO Box 1502, Clare, SA, 5453.
Email: cvfg@clarevalleyaerodrome.com.au. PH Chairman - 0418 891 205.
Mobile Secretary - 0407 829 584. Website: www.clarevalleyaerodrome.com.au.

REMARKS

Donations for use appreciated.

HANDLING SERVICES AND FACILITIES

AVGAS AVBL H24. Use Compac Pay mobile APP. Organisation code for site: 389KP4
PH: 0412 602 447.

PASSENGER FACILITIES

LG/WC/TX/RF. Courtesy car AVBL at AD. Further information and bookings AVBL online: www.clarevalleydownwind.com.au.

PHYSICAL CHARACTERISTICS

09/27	20c	Unrated. Grass. RWY LEN 600M.	WID 30	
17/35	41a	Unrated. Sealed. RWY LEN 1,250M.	WID 18	RWS 22

AERODROME AND APPROACH LIGHTING

RWY 17/35 LIRL PAL 120.05

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 118.95

CTAF 126.7

NOISE ABATEMENT PROCEDURES

1. All ACFT to avoid overflying Bungaree Station 1.3NM SW THR RWY 35 BLW 2,300FT AMSL.
2. ACFT to track close downwind when using RWY 35 to avoid Bungaree Station.
3. TRNG ACFT inbound from S to track via overhead Clare township not below 2,600FT AMSL.

ADDITIONAL INFORMATION

Kangaroo and deer hazard may exist.

CHARTS RELATED TO THE AERODROME

WAC 3458, 3459.