
LAKE CARGELLIGO

ELEV 598

AVFAX CODE 2216

NSW UTC +10 YLCG
331642S 1462209E VAR 11 DEG E CERT
AD OPR Lachlan Shire Council, PO Box 216, Condobolin, NSW, 2877. PH 02 6895 4444.
ARO AH 0428 954 400.

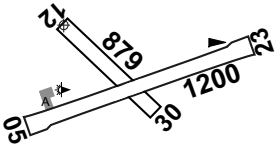

PHYSICAL CHARACTERISTICS

05/23	052	39c	5700 kg/0.45 MPa White Gravel	WID 30	RWS 90
12/30	120	29c	Unrated. Grassed red clay	WID 23	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 05/23 LIRL(1) PAL+AA 119.65
(1) PAL+AA requires three three-second pulses to activate. PTT WI 24 SEC.
RWY 05/23 LIRL spacing: 90M.

OTHER LIGHTING

TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 134.65 2,500FT

CTAF 126.7

ADDITIONAL INFORMATION

Model ACFT OPS HJ 1.5NM S of ARP up to 400FT AGL.


CHARTS RELATED TO THE AERODROME

WAC 3457.

LAKE EVELLA

ELEV 278

AVFAX CODE 8039



NT UTC +9:30 YLEV
122956S 1354821E VAR 3 DEG E CERT
AD OPR Gapuwiyak Community Inc, PMB 18, Nhulunbuy, NT, 0821. ARO 0407 864 404.

REMARKS

Overnight PRKG not AVBL, for EMERG PRKG CTC ARO.

PASSENGER FACILITIES

PT (150M FM AD).

AERODROME OBSTACLES

Tree 350FT AMSL BRG 086 DEG MAG 446M FM ARP. Infringes TNS by 9FT.

PHYSICAL CHARACTERISTICS

08/26	082	35a	Unrated. Sealed	WID 18	RWS 80

AERODROME AND APPROACH LIGHTING

RWY 08/26 PTBL(1)
(1) EMERG only.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 123.4 Circuit Area

LOCAL TRAFFIC REGULATIONS

1. ACFT to carry out 180DEG turns at RWY ends only.
2. ACFT to carry out MAX RAD turns on sealed surfaces.

Information may be continued on the next page: PTO

CTAF 127.15

ADDITIONAL INFORMATION

Animal hazard exists on the AD.


CHARTS RELATED TO THE AERODROME

WAC 3110.

LAKE KEEPIT

ELEV 1150

FULL NOTAM SERVICE NOT AVBL

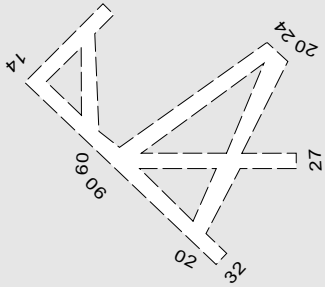

NSW		UTC +10	YKEP
305324S	1503136E	VAR 11 DEG E	UNCR

AD OPR Lake Keepit Soaring Club, 234 Keepit Dam Rd, Keepit, NSW, 2340. Email: manager@keepitsoaring.com. PH 02 6769 7514. Website: www.keepitsoaring.com.

PASSENGER FACILITIES

Drinkable water/TX 02 6742 0069/AC

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	127.1

CTAF 132.25

ADDITIONAL INFORMATION

1. To maintain communications with other ACFT, please call 132.25 - callsign “Keepit Base”.
2. Kangaroo hazard exists.
3. Gliding OPS - Winch Launching.

CHARTS RELATED TO THE AERODROME

WAC 3357.

LAKE MACQUARIE AIRPORT

AVFAX CODE 2090

ELEV 5

FULL NOTAM SERVICE NOT AVBL



NSW		UTC +10	YLMQ
330358S	1513853E	VAR 13 DEG E	UNCR

AD OPR Lake Macquarie Airport Pty Ltd, PO Box 988, Warners Bay, NSW, 2282. Email: contact@lakemacquarieairport.com.au. ARO 0408 449 198 or 0458 301 366. Website: www.lakemacquarieairport.com.au.

REMARKS

1. PPR in writing to ARO.
2. Rescue HEL Service EMERG OPS take precedence. Response time 10MIN.
3. Airfield status subject to change without notice.
4. AD Charges and landing fee apply.

PHYSICAL CHARACTERISTICS

07/25 27c Unrated. Central 11 sealed. WID 18 RWS 90
Length 880M.
Displaced thresholds for landing due to possible obstructions - PPR.

OTHER LIGHTING

Runway lighting not available.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	125.7 On ground

LOCAL TRAFFIC REGULATIONS

Carriage and use of radio is required by AD OPR.