## FLIGHT PROCEDURES

1. Right hand CCTS RQ when OPR on RWY 18 or RWY 13.
2. Training flights conducting practice instrument approach should add 1,000FT to all the ALT prescribed in the approach to reduce noise nuisance and interference with circuit traffic. Such flights should BCST their intentions, including ALT limit of OPS when turning inbound. IMC flights should remain as high as practicable when encountering VMC and join the circuit in the standard manner.

**CTAF - AFRU** 127.75

## ADDITIONAL INFORMATION

1. Bird hazard exists.
2. Possible high ab initio training 0700-2300 Local.
3. Model ACFT OPR HJ WI 1,000M RAD of Burrumbeet Racecourse PSN 372944S 1434014E BRG 269 MAG 5.85NM FM ARP SFC to 3,000FT AMSL.

## CHARTS RELATED TO THE AERODROME

1. WAC 3469.
2. Also refer to AIP Departure and Approach Procedures.

---

## BALLERA — ELEV 385

## AVFAX CODE 4135

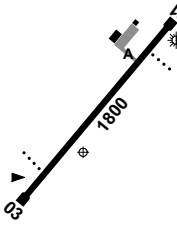


QLD UTC +10 YLLE
272430S 1414830E VAR 8 DEG E CERT
AD OPR Santos Ltd, PO Box 2319, Adelaide, SA, 5001. PH 08 8116 5213. ARO 07 4646 8103.

### REMARKS

1. Restricted OPS. PPR for all OPS.
2. All OPS: advise AD OPR at least 20MIN prior to ETA on 126.4. CS 'Ballera Base'.
3. AD Charges: Non-company aircraft.
4. Bay 2 for all jet refuelling.

## HANDLING SERVICES AND FACILITIES

Private terminal facilities. JET A1 private facility.
Refuelling PH: 08 8678 4107 AVBL H24.

## AERODROME OBSTACLES

1. Chimneys:
   a. 573FT AMSL BRG 343 DEG MAG 1,740 FM ARP, infringes horizontal SFC by 49FT.
   b. 568FT AMSL BRG 344 DEG MAG 1,646M FM ARP, infringes horizontal SFC by 45FT.
2. COM TWR 694FT AMSL BRG 357 DEG MAG 1,766FT FM ARP, infringes horizontal SFC 25FT.

## METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT C, METAR/SPECI.
2. AWIS PH 07 3564 3702 - Report faults to BoM.
3. AWIS FREQ 128.65 - Report faults to Santos Limited.

## PHYSICAL CHARACTERISTICS

03/21 032 59a PCR 90/F/D/X/T Sealed. WID 30 RWS 150

## AERODROME AND APPROACH LIGHTING

| | | | | |
|---|---|---|---|---|
| RWY 03/21 | LIRL | PAL+AA 120.05 | | SDBY PWR AVBL |
| RWY 03/21 | PAPI(1) | PAL+AA 120.05 | 3.0 DEG48FT | SDBY PWR AVBL |
| RWY 03/21 | PTBL(2) | | | BY PRIOR ARRANGEMENT |

(1) Left side.
(2) EMERG only. 60MIN PN.

1. Secondary PWR MAN activated - 45 MIN PN.
2. RWY 03/21 edge light spacing: 60M.

## OTHER LIGHTING

TWY LGT: Blue edge.

### ATS AND AERODROME COMMUNICATION FACILITIES

| | | |
|---|---|---|
| FIA | BRISBANE CENTRE | 118.8 Circuit area |

### LOCAL TRAFFIC REGULATIONS

1. ACFT ABV 5,700KG must use RWY turning nodes for 180 DEG turns.
2. Requirement for all ACFT to taxi to turning nodes and execute MAX radius turns. November to March inclusive.

### FLIGHT PROCEDURES

1. No circling to the W of AD.
2. Right hand circuits RWY 03.

**CTAF - AFRU** 126.7

### ADDITIONAL INFORMATION

1. CAUTION: High pressure gas discharge 1,600M N of AD (D611).
2. Increased wildlife activity will be communicated via NOTAM as required. Pilots are encouraged as part of flight planning to REQ current information from AD safety personnel on 07 4646 8103.

### CHARTS RELATED TO THE AERODROME

1. WAC 3342.
2. Also refer to AIP Departure and Approach Procedures.

## BALLIDU

**ELEV 950**

**FULL NOTAM SERVICE NOT AVBL**

| | | | |
|---|---|---|---|
| WA | | UTC +8 | YBIU |
| 303536S | 1164648E | VAR 1 DEG W | UNCR |

AD OPR Shire of Wongan Ballidu, PO Box 84, Wongan Hills, WA, 6603.
Email: shire@wongan.wa.gov.au. Council PH 08 9671 1011: AD Phone 08 9674 1264.
Fax 08 9671 1230.

### ATS AND AERODROME COMMUNICATION FACILITIES

| | | |
|---|---|---|
| FIA | MELBOURNE CENTRE | 124.8 Circuit area |

**CTAF** 126.7

### CHARTS RELATED TO THE AERODROME

WAC 3351.

## BALLINA/BYRON GATEWAY

**ELEV 7**

### AVFAX CODE 2005

| | | | |
|---|---|---|---|
| NSW | | UTC +10 | YBNA |
| 285002S | 1533345E | VAR 12 DEG E | CERT |

AD OPR Ballina Shire Council, PO Box 450, Ballina, NSW, 2478. PH Airport 02 6681 1858 BH.
ARO H24 0414 482 584. Council PH 02 6686 4444 BH.

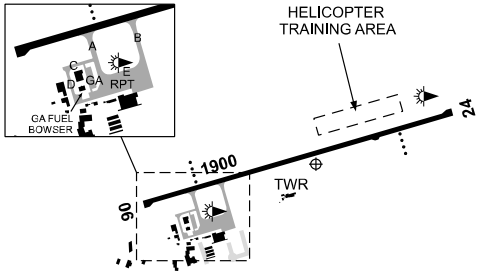


Information may be continued on the next page: PTO