MERIMBULA

ELEV 8

AVFAX CODE 2124

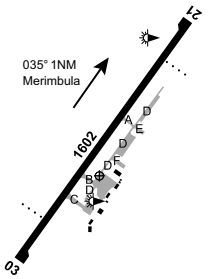

NSW UTC +10 YMER
365431S 1495405E VAR 14 DEG E CERT
AD OPR Bega Valley Shire Council, PO Box 492, Bega, NSW, 2550. PH 02 6495 4211. ARO 0439 947 270: 0439 955 458. Website: www.begavalley.nsw.gov.au.

REMARKS

1. AD Charges - refer to website (Fees and Charges).
2. This AD is a Security Controlled Airport.
3. PPR from AD OPR for all ACFT ABV 5,700KG due parking restrictions.

HANDLING SERVICES AND FACILITIES

Air BP: H24. Phone 0439 947 270 or 0439 955 458, AVGAS Carnet Card Swipe Bowser. JET A1 by tanker, 60 MIN PN. AH call-out fee applies.
Ground handling agent - Merimbula Airport Handling, Phone 0439 955 458.

PASSENGER FACILITIES

LG/ME/AC/RF/PT/TX/HC/WC

AERODROME OBSTACLES

1. Lit TWR:
   a. 722FT AMSL PSN: 365210.24S 1495348.70E.
   b. 728FT AMSL PSN: 365201.60S 1495412.30E.
   c. 440FT AMSL PSN: 365251.58S 1495303.15E.
   d. 538FT AMSL PSN: 365506.64S 1495202.28E.
2. Hazard beacons (terrain):
   a. 345FT AMSL PSN: 365241.72S 1495502.09E.
   b. 205FT AMSL PSN: 365316.95S 1495534.00E.
   c. 334FT AMSL PSN: 365327.40S 1495354.59E.
   d. 434FT AMSL PSN: 365714.17S 1495338.44E.
   e. 310FT AMSL PSN: 365528.51S 1495244.09E.
   f. 204FT AMSL PSN: 365533.95S 1495332.51E.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT C, METAR/SPECI.
2. AWIS Phone 02 9353 6434 - Report faults to BoM.
3. AWIS FREQ 133.65 (Requires one second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

03/21	020	53a	PCR 200/F/D/1.05 MPa/T	WID 30	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 03/21	LIRL	PAL+AA 119.6	
RWY 03	PAPI(1)	PAL+AA 119.6	3.3 DEG45.8FT
RWY 21	PAPI(1)	PAL+AA 119.6	3.0 DEG41.5FT

(1) Left side.
RWY edge light spacing: 03/21: 60M.

OTHER LIGHTING

TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	120.75 On Ground

RADIO NAVIGATION AND LANDING AIDS

DME	MER	117.7/124X	365452.3S	1495357.4E		(1)
NDB	MER	395	365451.3S	1495358.0E	Range 20 (HN 20) OW 50 (OW HN50)	

(1) Antenna ELEV 82FT.

Information may be continued on the next page: PTO

LOCAL TRAFFIC REGULATIONS
1. ACFT ABV 5,700KG must only make 180DEG turns on the RWY THR.
2. RPT PRKG Bays not AVBL to other ACFT except with prior permission.

FLIGHT PROCEDURES
Right hand circuits RQ when OPR on RWY 03.

CTAF - AFRU 126.7

ADDITIONAL INFORMATION
1. Bird and animal hazard exists.
2. Grass APN immediately around primary windsock closed due SWS.

CHARTS RELATED TO THE AERODROME
1. WAC 3470.
2. Also refer to AIP Departure and Approach Procedures.

MERREDIN

ELEV 1300

FULL NOTAM SERVICE NOT AVBL

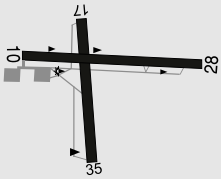

WA		UTC +8	YMDN
313124S	1181912E	VAR 1 DEG W	UNCR

AD OPR China Southern WA Flying College, PO Box 389, Merredin, WA, 6415. PH 08 9041 9200. Fax 08 9041 5636.

REMARKS
1. AD Charges: All ACFT.
2. Privately Owned. PPR. Approvals can be obtained from China Southern West Australian Flying College OPS. For approvals and AD INFO HJ contact 08 9041 9200 or HN duty officer 0429 902 314.

HANDLING SERVICES AND FACILITIES
AVGAS PN

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	123.4 Circuit Area
UNICOM	MERREDIN UNICOM	120.1 (1)

(1) CS "Merredin Ground".

LOCAL TRAFFIC REGULATIONS
1. Backtracking on RWY NOT permitted.
2. Itinerant aircraft parking adjacent to fuel compound.
3. Eastern pre-runway line-up area is unavailable to Code 2 ACFT.

FLIGHT PROCEDURES
1. All circuit entries shall be made on crosswind (4 legs of the circuit to be flown).
2. Before joining the circuit, all ACFT are to overfly the airfield at 3,000FT.

CTAF 120.1

ADDITIONAL INFORMATION
1. High volume ab initio training TFC H24.
2. Kangaroo hazard exists.

CHARTS RELATED TO THE AERODROME
WAC 3351, 3462.