
MILES

ELEV 1002

AVFAX CODE 4015

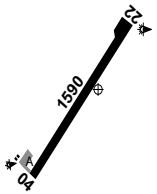

QLD UTC +10 YMLS
264822S 1501011E VAR 10 DEG E CERT
AD OPR Western Downs Regional Council, PO Box 551, Dalby, QLD, 4405. Email: milesairport.aro@baaviation.com.au. ARO 0447 880 253.

REMARKS

1. Restricted OPS - PPR FM AD OPR all non scheduled OPS.
2. AD charges apply due to limited PRKG PPR 48HR PN FM AD OPR for all ACFT.
3. Avdata fees apply.
4. Landside gate access code: 08XY.

PASSENGER FACILITIES

WC/LG.

AERODROME OBSTACLES

1. Lit COM tower, 343DEG 1.1NM FM ARP 1,244FT AMSL infringes inner HZS.
2. Marked and lit power poles:
   a. 1,175FT AMSL APRX BRG 058 DEG MAG 2.2NM FM ARP. Infringes inner HZS.
   b. 1,162FT AMSL APRX BRG 063 DEG MAG 2.1NM FM ARP. Infringes inner HZS.

PHYSICAL CHARACTERISTICS

04/22 040 52a PCR 164/F/C/Y/T WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 04/22 LIRL AFRU+PAL 126.35 SDBY PWR AVBL

OTHER LIGHTING

1. SDBY PWR switchover time: 11 SEC.
2. TWY LGT: Blue edge on A.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 123.95 Circuit Area

LOCAL TRAFFIC REGULATIONS

1. Carriage and use of radio is required by AD OPR.
2. All ACFT ABV 5,700KG must roll through and execute MAX radius turns at THR 22 turning node.

CTAF - AFRU 126.35

ADDITIONAL INFORMATION

Bird and animal hazards exist.


CHARTS RELATED TO THE AERODROME

1. WAC 3340.
2. Refer to AIP Departure and Approach Procedures.

MILINGIMBI

ELEV 53

AVFAX CODE 8017

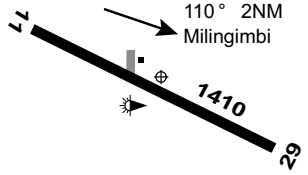

NT UTC +9:30 YMGB
120540S 1345337E VAR 3 DEG E CERT
AD OPR Milingimbi Community Inc, via Darwin, NT, 0822. ARO 8987 9905. ARO AH 0491 281 712. Council PH 08 8987 9905.

REMARKS

1. Overnight PRKG not AVBL, for emergency PRKG CTC ARO.
2. AD closed HN EXC to EMERG OPS.

PASSENGER FACILITIES

Telephone facilities not AVBL.

AERODROME OBSTACLES

Trees:

a. BRG 279 MAG 655M FM ARP infringes TNS BY 10FT.
b. BRG 255 MAG 250M FM ARP infringes TNS BY 9FT.
c. BRG 260 MAG 277M FM ARP infringes TNS BY 9FT.
d. BRG 138 MAG 354M FM ARP infringes TNS BY 9FT.

Note: TNS infringed southside.

METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS PH 08 7922 2511 - Report faults to BoM.
3. AWIS FREQ 128.05 (requires one-second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

11/29 113 46a Unrated. WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 11/29 LIRL(1) BY PRIOR ARRANGEMENT

(1) MAN ACT. 1HR PN. EMERG only.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 123.4 Circuit Area

CTAF 127.5

ADDITIONAL INFORMATION

Animal hazard (dogs) exists.


CHARTS RELATED TO THE AERODROME

1. WAC 3109.
2. Also refer to AIP Departure and Approach Procedures.

MILL IRON

ELEV 150

FULL NOTAM SERVICE NOT AVBL

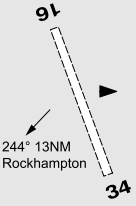

QLD UTC +10 YMIO

231926S 1504145E VAR 9 DEG E UNCR

AD OPR Roger Toole, 142 Keppel Sands Road, Tungamull, QLD, 4702.
Email: milliron@bigpond.com. PH 0407 582 829.

REMARKS

1. Private AD - PPR contact AD OPR.
2. High voltage power lines underground at RWY 16 THR.

PHYSICAL CHARACTERISTICS

16/34 18 Unrated. Unsealed. Compacted grass.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 119.55

CTAF 132.2

ADDITIONAL INFORMATION

RWY fully fenced from stock.

CHARTS RELATED TO THE AERODROME

WAC 3235.

Information may be continued on the next page: PTO