MANGROVE MOUNTAIN GLIDING

ELEV 1020

FULL NOTAM SERVICE NOT AVBL

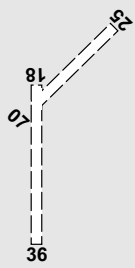

NSW UTC +10 YMVM
331706S 1511246E VAR 13 DEG E UNCR
AD OPR Central Coast Soaring Club, 156 Bloodtree Rd, Mangrove Mountain, NSW, 2250. PH 0402 907 038 (Club Phone) or 0414 256 602 (CFI).
Website: www.ccsoaring.com.au.

REMARKS

PPR for all ACFT (EXC powered EMERG service ACFT) - CTC AD OPR.

AERODROME OBSTACLES

Tall trees on approach to all RWY ends.

PHYSICAL CHARACTERISTICS

07/25	10c	Unrated. Grass. Downslope to the W.
18/36	39c	Unrated. Undulating grass.

RWY 18/36 very soft and unusable after rain.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	SYDNEY CENTRE	124.55

LOCAL TRAFFIC REGULATIONS

Practice glide approaches by powered ACFT are discouraged due to risk of conflict with winch operations and noise abatement.

FLIGHT PROCEDURES

1. Avoid overfly below 3,500FT AMSL due to potential conflict with winch launching gliders.
2. ACFT transiting the circuit area should BCST and MNT CTAF when in the vicinity of Mangrove Mountain.

CTAF 132.1

ADDITIONAL INFORMATION

1. Gliding OPS HJ launched by winch, cable up to 4,000FT in length.
2. Intensive glider OPS including aerobatics within 10NM up to 8000FT AMSL.
3. Wind shear in moderate winds from any direction.
4. Transiting aircraft should maintain a lookout when transiting the area due to the possibility of conflict with gliders in thermals anywhere in the vicinity.

CHARTS RELATED TO THE AERODROME

WAC 3456.

MANINGRIDA

ELEV 123

AVFAX CODE 8025

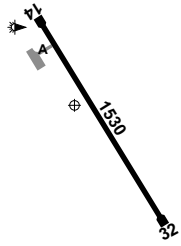

NT UTC +9:30 YMGD
120322S 1341403E VAR 3 DEG E CERT
AD OPR Maningrida Council Inc, Maningrida, NT, 0822.
Email: contracts@westarnhem.nt.gov.au. PH 08 8979 6600 BH. ARO EMERG Satellite PH 0147 150 346 H24. Mobile 0417 053 306 H24.

HANDLING SERVICES AND FACILITIES

BAC Fuel: PH 08 8979 6511 or 0436 669 384. JET A1 and AVGAS. AH $30 call-out fee.

PASSENGER FACILITIES

WC/LG/Telstra mobile phone coverage.

Information may be continued on the next page: PTO

AERODROME OBSTACLES

1. Unlit anemometer 131FT AMSL BRG 187 DEG MAG 85M FM ARP.
2. Trees:
   a. 194FT AMSL BRG 135 DEG MAG 1,120M FM ARP. Infringes TNS.
   b. 183FT AMSL BRG 133 DEG MAG 951M FM ARP. Infringes TNS.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT C, METAR/SPECI.
2. AWIS PH 08 7922 2509 - Report faults to BoM.

PHYSICAL CHARACTERISTICS

14/32 146 50a PCR 50/F/A/Y/U Sealed. WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 14/32 LIRL AFRU+PAL 127.5

OTHER LIGHTING

TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 123.4 On Ground

RADIO NAVIGATION AND LANDING AIDS

NDB MGD 401 120345.9S 1341354.0E Range 45 (HN 45) (1)
(1) 025/0.4, Range 35 to W - Operated by AD OPR - Pilot Monitored

CTAF - AFRU 127.5

ADDITIONAL INFORMATION

Bird and animal hazard exists.

CHARTS RELATED TO THE AERODROME

1. WAC 3109.
2. Also refer to AIP Departure and Approach Procedures.

MANJIMUP

ELEV 942

AVFAX CODE 6306

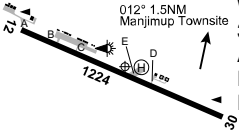

WA UTC +8 YMJM
341555S 1160825E VAR 3 DEG W CERT
AD OPR Shire of Manjimup, PO Box 1, Manjimup, WA, 6258.
Email: info@manjimup.wa.gov.au. PH 08 9771 7777. ARO 0428 711 269.
PH AH 08 6454 4600. Fax 08 9771 7771.

HANDLING SERVICES AND FACILITIES

Air BP: H24. AVGAS card bowser. Air BP Carnet card or cash/cheque only. Phone 0428 711 269.

PASSENGER FACILITIES

WC/TX/ME - S. Hawily LAME. Phone 08 9771 1166 H24.

APRONS AND TAXIWAYS

TWY A: slope 4% down to NW.

AERODROME OBSTACLES

1. Antenna:
   a. 1,113FT AMSL PSN 341515.5S 1160835.3E. Infringes inner HZS by 32FT.
   b. 1,113FT AMSL PSN 341515.9S 1160838.4E. Infringes inner HZS by 32FT.
2. Phone TWR:
   a. 1,152FT AMSL PSN 341512.1S 1160847.2E. Infringes inner HZS by 71FT.
   b. 1,147FT AMSL PSN 341517.3S 1160852.6E. Infringes inner HZS by 66FT.
3. Trees:
   a. 1,087FT AMSL PSN 341527.5S 1160801.1E. Infringes inner HZS by 6FT.
   b. 1,036FT AMSL PSN 341539.0S 1160754.5E. Infringes TNS by 14FT.
   c. 1,030FT AMSL PSN 341540.7S 1160754.2E. Infringes TNS by 35FT.
   d. 989FT AMSL PSN 341540.9S 1160753.7E. Infringes TNS by 10FT.