MURRIN MURRIN

ELEV 1535

AVFAX CODE 6107

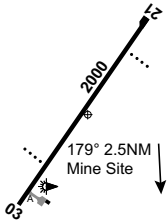

WA UTC +8 YMMI
284219S 1215326E VAR 1 DEG E CERT

AD OPR Minara Resources Pty Ltd, Murrin Murrin Operations, PO Box Z5523, Perth, WA, 6831. Email: siteservices.supt.coord@glencore.com.au. PH 08 9088 5957 (BH). ARO 0408 941 791. Mobile 0408 657 461 (AH).

REMARKS

Restricted Operations. PPR from AD Manager/AROs.

HANDLING SERVICES AND FACILITIES

Nil fuel AVBL.

PASSENGER FACILITIES

LG/WC/PT

AERODROME OBSTACLES

1. Illuminated WDI 209M N of RWY 03 start of TORA 100M E of RWY CL infringes transitional SFC by 10FT.
2. Transient E190 ACFT tail 1,567FT AMSL BRG 209 DEG MAG 885M FM ARP. Infringes TNS by 11FT.

PHYSICAL CHARACTERISTICS

03/21 034 66a PCR 220/F/A/1.10 MPa/T Sealed. WID 30 RWS 150

AERODROME AND APPROACH LIGHTING

RWY 03/21 LIRL SDBY PWR AVBL
RWY 03/21 PAPI(1) 3.0 DEG50FT SDBY PWR AVBL

(1) Left side.

1. RWY edge light spacing: 03/21: nominal 90M.
2. Lighting manually activated. 30MIN PN.

OTHER LIGHTING

1. Standby PWR derived from generator. Switchover time: 10 SEC.
2. TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 118.4 Circuit Area

LOCAL TRAFFIC REGULATIONS

1. ACFT ABV 5,7000KG to use MAX RAD MNM speed turns at RWY ends only.
2. Due to ACFT turn limitations on apron, simultaneous bay occupation may not be AVBL. ARO will advise parking instruction via company frequency on inbound contact.

CTAF - AFRU 126.8

AFRU signal not AVBL on ground Laverton, Murrin Murrin or Sunrise Dam. AFRU located at Leonora.

ADDITIONAL INFORMATION

Mine site 2.5NM, BRG 179DEG M.

CHARTS RELATED TO THE AERODROME

1. WAC 3352.
2. Also refer to AIP Departure and Approach Procedures.