7. Due to the grades on RWY 16/34, the opposite ends of the RWY are not visible when TKOF. Mandatory CTAF BCST required before OPR on RWY.
   a. From the TWY holding point, ACFT at THR RWY 16 may not be visible.
   b. ACFT at THR 16 and 34 may not be visible to one another.
   c. CTAF BCST FM ACFT at the TWY holding point may not be received by ACFT at THR RWY 16.
8. TWY E limited to Royal Flying Doctor Service (RFDS) and LifeFlight ACFT.

FLIGHT PROCEDURES

Right hand circuits RQ when OPR on RWY 34.

CTAF - AFRU 126.5

NOISE ABATEMENT PROCEDURES

Noise Abatement Procedures (NAP) apply. Refer AIP DAP.

ADDITIONAL INFORMATION

1. Blasting will be conducted at various sites WI 6NM RAD of Mount Isa AD. SFC - 2,500FT.
2. A wildlife hazard exists year round at this AD.
   a. Bird activity is significantly increased after rainfall events.
   b. Whistling kite, magpie lark, bustard and nankeen kestrel present all year round.
   c. Black kites occur year round and occur in very high numbers during insect swarms, NOTAM will be issued in these events.
   d. Australian pratincole present in greater numbers OCT to APR but may occur seasonally year round.

   For current information refer to NOTAM.
3. Flying foxes are a seasonal risk at dawn and dusk on the APCH to the RWY (on and off airfield). Peak risk period is AUG through until FEB although potential risk exists year round.
4. Multiple gas turbine facilities emit high velocity plume rise at locations APRX 7NM S of AD.
5. Weather balloon launch APRX 2315 FM 1.5KM S ARP. Launches may occur at other times.

CHARTS RELATED TO THE AERODROME

1. WAC 3233.
2. Also refer to AIP Departure & Approach Procedures.

MOUNT KEITH — ELEV 1792

AVFAX CODE 6605

WA		UTC +8	YMNE
271711S	1203317E	VAR 1 DEG E	CERT

AD OPR BHP Nickel West Pty Ltd (Mount Keith), PO Box 238, Welshpool Delivery Centre, WA, 6986. Email: mountkeithaerodrome@bhp.com. PH AD MGR 0450 031 931. Email: joseph.buchanan@bhp.com. ARO 08 9037 8748: 0499 821 780 (H24).

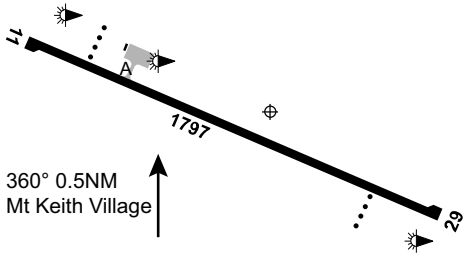

REMARKS

1. PPR for all OPS. Email ARO.
2. AD charges: ALL ACFT.

HANDLING SERVICES AND FACILITIES

No fuel AVBL.

PASSENGER FACILITIES

LG/RF/WC

AERODROME OBSTACLES

1. Unlit terrain:
   a. 2,024FT AMSL PSN 271517.85S 1203225.94E. Infringes HZS by 85FT.
   b. 1,998FT AMSL PSN 271449.7S 12033.22.67E. Infringes COS by 33FT.
2. Unlit earth bund:
   a. 1,781FT AMSL PSN 271711.33S 1203316.81E. Infringes transitional SFC by 1FT.
   b. 1,795FT AMSL PSN 271702.37S 1203242.07E. Infringes transitional SFC by 3FT.
3. Unlit fence 1,788FT AMSL PSN 271711.31S 1203317.65E. Infringes transitional SFC by 3FT.
4. Unlit mast 2,200FT AMSL PSN 271425.16S 1203325.61E. Infringes COS by 121FT.

METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS FREQ 133.15 - Report faults to BHP ARO Phone: 0499 821 780.

PHYSICAL CHARACTERISTICS

11/29	113	59a	PCR 210/F/A/Y/U	WID 30	RWS 150

AERODROME AND APPROACH LIGHTING

RWY 11/29	LIRL(1)		SDBY PWR AVBL
RWY 11/29	PAPI(2)	3.0 DEG42FT	SDBY PWR AVBL

(1) HN.
(2) Left side. Activated H24.

OTHER LIGHTING

1. SDBY PWR switchover time: 15 SEC. Automatic activation.
2. TWY LGT: Blue edge.
3. TWY holding point LGT: 2 x yellow.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	118.95 On Ground
UNICOM	MOUNT KEITH UNICOM (1)	126.5

(1) AVBL during scheduled movements.

LOCAL TRAFFIC REGULATIONS

1. All ACFT performing 180 DEG turns on RWY must be at MNM speed and MAX RAD WI the RWY turning nodes.
2. ACFT must be at taxiing speed when turning into and out of TWY/RWY.
3. Q400 ACFT to use F100 lead in taxi line on APN.
4. All HN OPS use Bay 1 only.

FLIGHT PROCEDURES

Right hand CCTS required when OPR RWY 11.

CTAF - AFRU 126.5

AFRU not AVBL on ground.

ADDITIONAL INFORMATION

1. Blasting HJ:
   a. BRG 348 DEG MAG 3.4NM FM ARP. SFC to 2,000FT AGL. CTC ARO for blasting times.
   b. BRG 170 DEG MAG 9.1NM FM ARP. SFC to 2,000FT AGL. CTC ARO for blasting times.
2. Wildlife hazards increase following rainfall events - typically between January and June.

CHARTS RELATED TO THE AERODROME

1. WAC 3345.
2. Also refer to AIP Departure and Approach Procedures

Information may be continued on the next page: PTO