MURWILLUMBAH

ELEV 18

FULL NOTAM SERVICE NOT AVBL

NSW UTC +10 YMUR
281952S 1532449E VAR 12 DEG E UNCR
AD OPR Tweed Shire Council, PO Box 816, Murwillumbah, NSW, 2484.
PH 02 6670 2400. Website: www.tweed.nsw.gov.au.

REMARKS

1. AD Charges: All ACFT.
2. Pilot notes refer to Tweed Shire Council website.
3. Publicly accessible webcams AVBL.

HANDLING SERVICES AND FACILITIES

AVGAS AVBL (AH by appointment). PH 02 6672 4545.

PHYSICAL CHARACTERISTICS

01/19	34c	Unrated. Central 15M of first 500M S of RWY 19 DTHR grass/hard shale. Remainder grass. RWY LEN 1,045M.	WID 40	RWS 70

RWY 19 DTHR 245M.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	119.5

LOCAL TRAFFIC REGULATIONS

1. TWY on NE side of RWY is not AVBL due to drains and trees.
2. In dry conditions, TWY on W and SE sides are AVBL.
3. When RWY wet, taxi on crown with care.
4. Due to industrial buildings at northern end of RWY, ACFT on approach for RWY 19 may not be visible. Please complete all checks in run-up bay provided.

FLIGHT PROCEDURES

1. Left hand circuits.
2. When departing RWY 19, at 600FT turn due to terrain.

CTAF 127.55

NOISE ABATEMENT PROCEDURES

1. No circuits below 1,000 FT.
2. RWY 01 - make wide left circuit to reduce noise to Murwillumbah Hospital.

ADDITIONAL INFORMATION

1. PJE HJ 1.5NM NW of the airfield.
2. Bird hazard exists.
3. RWY subject to flooding during high rain/Tweed River flooding events.
4. All areas may be unusable due SWS after rain. Airfield not inspected.
5. Cleared areas outside gable markers mown, taxi at pilot risk.

CHARTS RELATED TO THE AERODROME

WAC 3357.

MUTTABURRA

ELEV 753

FULL NOTAM SERVICE NOT AVBL

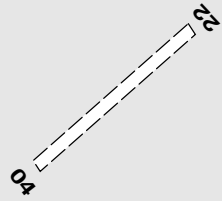

QLD UTC +10 YMTB
223500S 1443200E VAR 7 DEG E UNCR
AD OPR Barcaldine Regional Council, PO Box 65, Aramac, QLD, 4726.
PH 07 4658 7191. ARO 0427 587 191.

Information may be continued on the next page: PTO

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 122.1 Circuit Area

CTAF 126.7

ADDITIONAL INFORMATION

CAUTION: Animal hazard exists

CHARTS RELATED TO THE AERODROME

WAC 3234.

MYRUP

ELEV 30

FULL NOTAM SERVICE NOT AVBL

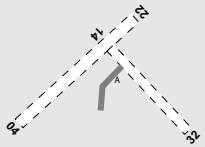

WA		UTC +8	YMYU
334722S	1215725E	VAR 0 DEG E	UNCR

AD OPR Myrup Fly-in Estate, PO Box 2227, Esperance, WA, 6450.
Email: noel.limestones@gmail.com. PH 0427 783 063:
Caretaker 0427 715 846 or 08 9071 5846.

REMARKS

1. Landing charge $10.00 all aircraft. Honesty box on N side of Club House.
2. AD not AVBL HN.

HANDLING SERVICES AND FACILITIES

Nil fuel AVBL. Nearest fuel - YESP.

PASSENGER FACILITIES

WC/ME (RAAus) Mobile phone coverage on ground.

METEOROLOGICAL INFORMATION PROVIDED

YEST (Esperance Town) METAR AVBL.

PHYSICAL CHARACTERISTICS

04/22	43c	Unrated. Red gravel. RWY LEN 1,300M. RWY 22 DTHR 200M.	WID 18
14/32	30c	Unrated. Red gravel. RWY LEN 900M.	WID 18

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 133.2

CTAF 126.7

ADDITIONAL INFORMATION

1. Animal hazard exists especially near dawn and dusk.
2. Caution: ultralight flight training OPS.
3. 120DEG 10 NM FM YESP (CTAF[R]).
4. Access to the terminal building, toilets and ACFT parking via TWY A.

CHARTS RELATED TO THE AERODROME

WAC 3461.