THE MONUMENT

ELEV 949

AVFAX CODE 4318

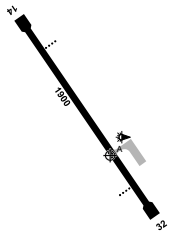

QLD UTC +10 YTMO
214843S 1395524E VAR 6 DEG E CERT
AD OPR Incitec Pivot Ltd (Southern Cross Fertilisers), L3, 19 Stanley Street, Townsville, QLD, 4810.
Email: au_ipl_pho_aviation_aros@incitecpivotlimited.onmicrosoft.com.
PH Site 07 4747 0997: AD Manager 0408 297 265: AH 0438 603 224.
ARO 0407 967 029.

REMARKS
Restricted OPS. PPR for all OPS.

HANDLING SERVICES AND FACILITIES
Ground handling and fuel by prior arrangement with ARO.

METEOROLOGICAL INFORMATION PROVIDED
1. TAF CAT C, METAR/SPECI.
2. AWIS PH 07 3564 3741 - Report faults to BoM.
3. AWIS FREQ 129.2 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS
14/32 140 62a PCR 280/F/D/1.01 MPa/U WID 30 RWS 150

AERODROME AND APPROACH LIGHTING

RWY 14/32	LIRL	PAL 119.65		SDBY PWR AVBL
RWY 14/32	PAPI(1)	PAL 119.65	3.0 DEG49FT	SDBY PWR AVBL

(1) Left hand side only.
RWY edge light spacing: 14/32: 90M.

OTHER LIGHTING
1. SDBY PWR switchover time: Manually activated - 1HR PN.
2. TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA BRISBANE CENTRE 122.4 5500FT

FLIGHT PROCEDURES
All pilots are required to BCST their intentions inbound on company FREQ 129.45.

CTAF - AFRU 127.3

CHARTS RELATED TO THE AERODROME
1. WAC 3233.
2. Also refer to AIP Departure and Approach Procedures.

THE OAKS

ELEV 880

FULL NOTAM SERVICE NOT AVBL

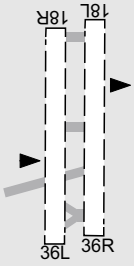

NSW UTC +10 YOAS
340502S 1503337E VAR 13 DEG E UNCR
AD OPR Grahame Onus, 995 Burragorang Road, The Oaks, NSW, 2570.
PH 0421 106 900.

REMARKS
1. Private airfield.
2. AD Charges: $5 all ACFT.
3. Entry gate locked when airfield unattended.

HANDLING SERVICES AND FACILITIES
Nearest AVGAS: Camden AD (YSCN, 7NM ENE).
Nearest MOGAS: BP Service Station, 38 John St, The Oaks (2KM FM airfield).

Information may be continued on the next page: PTO

PHYSICAL CHARACTERISTICS
1. RWY 18R/36L 900M. Grass.
2. RWY 18L/36R 800M. Grass.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA SYDNEY CENTRE 124.55

FLIGHT PROCEDURES
1. All CCT to W of AD.
2. Avoid overflying township of The Oaks.

CTAF 126.7

ADDITIONAL INFORMATION
1. CAUTION: All surfaces become soft after heavy rain.
2. CAUTION: Tall trees in close proximity to THR of RWY 36L/R and 18L.
3. CAUTION: Burragorang Rd runs in close proximity to the THR of RWY 18L/R. Cross at a safe height.

CHARTS RELATED TO THE AERODROME
WAC 3456.

THE VALE

ELEV 723

FULL NOTAM SERVICE NOT AVBL

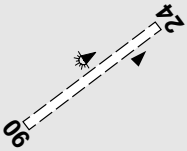

TAS UTC +10 YVAL
412548S 1461548E VAR 14 DEG E UNCR
AD OPR The Vale Tasmania Pty Ltd, 864 Claude Road, Sheffield, TAS, 7306.
Email: airfield@thevale.com.au. PH 03 6287 6995.
Website: www.thevale.com.au/the-vale-airfield.

REMARKS
Landing fees apply for commercial operators. Contact AD OPR for details.

PASSENGER FACILITIES
LG/WC/AC.

AERODROME OBSTACLES
1.2M fence at the end of each RWY.

PHYSICAL CHARACTERISTICS

06/24	43c	Unrated. Grass. RWY LEN 1,300M. Slope RWY ends level, centre section 3.6% up to SW then 3.5% down. Turn pad THR RWY 24.	WID 35

ATS AND AERODROME COMMUNICATION FACILITIES
FIA MELBOURNE CENTRE 120.7 Circuit Area

LOCAL TRAFFIC REGULATIONS
1. Preferred landing direction RWY 24.
2. Visiting ACFT PRKG on concrete pad.

CTAF 126.7

ADDITIONAL INFORMATION
1. Bird hazard exists.
2. Severe TURB BTW RWY and Mt Roland with southerly wind blowing.
3. Caution due to high trees, high ground and possible wind shear on both approaches.
4. Animal hazards exists.
5. See website for further information.

CHARTS RELATED TO THE AERODROME
WAC 3556.