SEABUOY

AVFAX CODE 6820 **FULL NOTAM SERVICE NOT AVBL**

WA		UTC +8	YSBY
202548S	1164251E	VAR 1 DEG E	UNCR

AD OPR Auriga Group, 14 Argyle St, Albion, QLD, 4010. Email: westcoastaviation@auriga.com.au. ARO 0427 061 441.

REMARKS

All enquiries to Head of Flying Operations (HOFO) via AD OPR. Include “ATTN HOFO” in email subject.

METEOROLOGICAL INFORMATION PROVIDED

AWIS FREQ 135.85 - Report faults to AD OPR.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	122.4
ATIS	KARRATHA ATIS	134.55
TWR	KARRATHA TOWER	127.35

CTAF 127.35

CHARTS RELATED TO THE AERODROME

1. WAC 3229.
2. Also refer to AIP Departure and Approach Procedures.

SERPENTINE

ELEV 30

FULL NOTAM SERVICE NOT AVBL

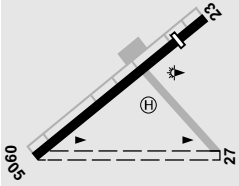

WA		UTC +8	YSEN
322342S	1155224E	VAR 2 DEG W	UNCR

AD OPR Sport Aircraft Builder's Club of WA Inc, Yangedi Road North, Hopeland, WA, 6125. Email: secretary@sabc.org.au. Website: www.sabc.org.au.

REMARKS

PPR. Email request for permission to committee@sabc.org.au.

HANDLING SERVICES AND FACILITIES

PPR to confirm fuel AVBL. AVGAS and MOGAS 95 AVBL H24. Accepts Dunning Card and credit card (V and MC). Other cards not accepted. For system faults: PH 0407 199 681.

AERODROME OBSTACLES

1. High voltage powerlines running North to South 900M West of AD boundary.
2. Trees to 10M short final RWY 27.

PHYSICAL CHARACTERISTICS

05/23	30a	Unrated. Sealed. RWY LEN 900M. RWY 23 DTHR 100M.	WID 12	RWS 15
09/27	20c	Unrated. Grass. RWY LEN 600M.	WID 24	RWS 30

AERODROME AND APPROACH LIGHTING

RWY 05/23 MIRL PAL 125.3

RWY 05/23 edge LGT spacing: 96M.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	PERTH CENTRE	135.25 On ground

LOCAL TRAFFIC REGULATIONS

1. No flight school training permitted.
2. ACFT should manoeuvre on TWY and RWY only due to soft sand.

FLIGHT PROCEDURES

1. RWY 05 MNM CCT HGT 1,000FT.
2. CCTS not permitted before 0800 on SUN.

CTAF 119.1

Information may be continued on the next page: PTO

ADDITIONAL INFORMATION

1. Displaced holding point RWY 05 and RWY 09 due overlap.
2. RWY 09/27 grass sprinklers may operate during summer months.
3. Murray Field (YMUL) has identical RWY designators and CTAF.
4. Kangaroo and bird hazard exists.
5. Low level aerobatics in VCY.
6. Emergency Services HEL OPS H24.
7. Refer Perth VTC and VNC.

CHARTS RELATED TO THE AERODROME

WAC 3462.

SHARK BAY — ELEV 129

AVFAX CODE 6504

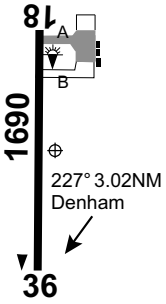

WA UTC +8 YSHK
255338S 1133438E VAR 1 DEG W CERT
AD OPR RTA Leisure Pty Ltd, PO Box 47, Denham, WA, 6537.
Email: aro@nationwestaviation.au. ARO H24 0401 662 215.

REMARKS

1. Landing fees are $30 (inc GST) for ACFT BLW 5,700KG. Cash only in honour box in terminal. Invoice fee will apply if not paid in cash.
2. Airfield main access gate open 0700-1800 Local. CTC AD Manager/ ARO 24HR PN for arrangements outside operating times.

PASSENGER FACILITIES

LG/WC/AC - Monkey Mia Dolphin Resort, phone: 08 9948 1320.
BU (local shuttle), phone: 0412 626 074. HC - Shark Bay Car Hire, phone: 0474 556 296.

APRONS AND TAXIWAYS

1. TWY A 15M, code C.
2. TWY B 7.5M, code A.

AERODROME OBSTACLES

1. Unlit mast 224DEG/2.55NM FM ARP top height 320FT AMSL.
2. Lit wind farm 228DEG/1.8NM to 238DEG/1.82NM FM ARP top 315FT AMSL.
3. Line of trees 50M both E and W of CL for full length of RWY. Infringes transitional SFC by 5FT.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS PH 08 6216 2636 - Report faults to BoM.

PHYSICAL CHARACTERISTICS

18/36 179 55a PCR 100/F/A/0.70 MPa/U WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 18/36 LIRL(1) AFRU+PAL 126.7
(1) Powered by onsite generator. SDBY PWR NOT AVBL.

OTHER LIGHTING

TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 122.1 2000FT

LOCAL TRAFFIC REGULATIONS

1. All ACFT under 5,700KG to park south of the PRKG clearance.
2. ACFT ABV 5,700KG other than RPT to give AD Manager 24 HR PN.
3. Light ACFT tie-downs not strength rated.