THEODORE

ELEV 560

AVFAX CODE 4065

QLD UTC +10 YTDR
245911S 1500535E VAR 10 DEG E CERT
AD OPR Banana Shire Council, PO Box 412, Biloela, QLD, 4715.
Email: enquiries@banana.qld.gov.au. PH 07 4992 9500, H24 0429 340 390.



REMARKS

AD AVBL HJ only.

AERODROME OBSTACLES

Lit mast 912FT AMSL BRG 311 MAG 2.7NM FM ARP. Infringes horizontal SFC by 214FT.

PHYSICAL CHARACTERISTICS

17/35 170 44a Unrated. WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 17/35 PTBL(1) BY PRIOR ARRANGEMENT
(1) EMERG use only.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 135.3 2500FT

CTAF 126.7

ADDITIONAL INFORMATION

1. Kangaroo hazard exists.
2. PRKG bay on APN to be kept clear BTN 0830-1500 Local MON, WED and THU for Saab 340 scheduled CHTR FLT PRKG.

CHARTS RELATED TO THE AERODROME

1. WAC 3340, 3341.
2. Also refer to AIP Departure and Approach Procedures.

THUNDERBOX

ELEV 1704

AVFAX CODE 6116

WA UTC +8 YTHN
280914S 1205621E VAR 1 DEG E CERT
AD OPR Northern Star (Thunderbox), Locked Bag 2, Leonora, WA, 6438.
Email: tboaerodrome@nsrltd.com. PH 08 6228 9500. AD Manager PH 0428 666 673.
Email: alabrown@nsrltd.com. ARO H24 0483 188 518. Website: www.nsrltd.com.



REMARKS

1. PPR from AD OPR.
2. AD AVBL HJ only EXC for EMERG.

HANDLING SERVICES AND FACILITIES

Ground handling and fuel (JET A1) by prior arrangement with AD OPR.

PASSENGER FACILITIES

WC.

Information may be continued on the next page: PTO

AERODROME OBSTACLES

1. Fence parallel to RWY CL, 53M S of RWY CL, infringes transitional SFC by 2FT.
2. Mine site BRG 119 DEG MAG 4.5NM FM ARP.
3. Unmarked and unlit mast 1,893FT AMSL BRG 068 DEG MAG 2.8NM FM ARP, infringes conical SFC by 40FT.
4. Trees located parallel to RWY 07/25 CL, EXTD APRX 100M N, 100M S and along full length of RWY. Infringes transitional SFC by up to 4FT.

PHYSICAL CHARACTERISTICS

07/25 075 62a PCR 230/F/A/Y/T Sealed. WID 30 RWS 90

AERODROME AND APPROACH LIGHTING

RWY 07/25 PAPI(1) 3.0 DEG52FT

(1) Left side. Manually activated 2HR PN. PAPI intensity manually controlled by ARO via CTAF 126.5.

OTHER LIGHTING

RWY 07/25: Night emergency lights AVBL 2HR PN.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 118.95

LOCAL TRAFFIC REGULATIONS

1. RWY 07/25: all fixed wing ACFT must make MAX RAD turns at MNM speed at all RWY ends to avoid SFC damage.
2. Day VMC OPS only.

CTAF 126.5

CHARTS RELATED TO THE AERODROME

WAC 3352.

THYLUNGRA

ELEV 540

FULL NOTAM SERVICE NOT AVBL

QLD UTC +10 YTHY

260536S 1432709E VAR 8 DEG E UNCR

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 118.8 6000FT

CTAF 126.7

CHARTS RELATED TO THE AERODROME

WAC 3342.

TIBOOBURRA

ELEV 584

AVFAX CODE 2209

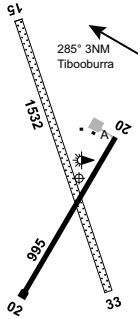

NSW UTC +10 YTIB

292704S 1420328E VAR 8 DEG E CERT

AD OPR Tibooburra Aviation Reserve Trust, PO Box 1840, Dubbo, NSW, 2830. PH 02 6883 5400. ARO 0419 283 663. Fax 02 6884 2067.

HANDLING SERVICES AND FACILITIES

Tracy Hotchin (Tibooburra Hotel). Phone to check fuel availability. Airport transfers and accommodation AVBL. PH 08 8091 3310. AVGAS, JET A1.

AERODROME OBSTACLES

1. Lit OBST - 853FT 300 DEG MAG 5,231M from ARP.
2. Unlit OBST - 930FT 286 DEG MAG 5,194M from ARP.

METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS PH 02 9353 6454 - Report faults to BoM.