TANAMI

ELEV 1400

FULL NOTAM SERVICE NOT AVBL

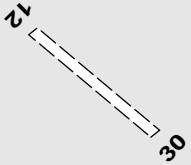

NT UTC +9:30 YTMN
195800S 1294332E VAR 3 DEG E UNCR
AD OPR Northern Star (Tanami) Pty Ltd, Level 1/388 Hay Street, Subiaco, WA, 6008. Email: TanamiAdmin@nsrltd.com. PH 08 6211 2650.

REMARKS

PPR - Contact AD OPR

AERODROME OBSTACLES

1. RWY 12 APCH surface infringed - stockpile 445M prior to THR 41F ABV inner edge.
2. RWY 30 stockpile 2,174M FM SOT 61.4M L of EXT CL 62FT ABV RWY gradient 2.91%.
3. RWY 30 stockpile 2,209M FM SOT 13.1M R of EXT CL 63FT ABV RWY gradient 2.79%.
4. Refer AD OPR for OBST chart.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	118.9 6500FT
UNICOM	TANAMI UNICOM	128.9 (1)

(1) CS "Tanami Mine".

LOCAL TRAFFIC REGULATIONS

1. Initial contact is on UNICOM 128.9 to Tanami Ground then change to CTAF 126.7.
2. Preferred night OPS - land RWY 30, TKOF RWY 12.

CTAF 126.7

ADDITIONAL INFORMATION

Night OPS for emergencies only i.e. RFDS - land RWY30, TKOF RWY 12

CHARTS RELATED TO THE AERODROME

WAC 3222, 3231.

TARA

ELEV 1180

FULL NOTAM SERVICE NOT AVBL

QLD UTC +10 YTAA
270924S 1502836E VAR 10 DEG E UNCR
AD OPR Western Downs Regional Council, PO Box 551, Dalby, QLD, 4405.
Email: info@wdrc.qld.gov.au. PH 07 4679 4000. ARO 0437 735 919: 0475 579 399.

REMARKS

1. Avdata fees apply.
2. Approval RQ FM AD OPR for agricultural OPS at AD.

PASSENGER FACILITIES

Passenger facilities AVBL. Telephone facilities not AVBL.

AERODROME AND APPROACH LIGHTING

LIRL. PAL on 119.65.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	123.95 Circuit Area

CTAF 126.7

ADDITIONAL INFORMATION

1. Bird and animal hazard exist.
2. AD OPR requires CTAF broadcast for ACFT ground and approach movements.

CHARTS RELATED TO THE AERODROME

WAC 3340.