PASSENGER FACILITIES
WC.

PHYSICAL CHARACTERISTICS
07/25 42c Unrated. Grass. RWY undulating with slight rise WID 55 RWS 150
APRX 250M from RWY 25 THR. RWY LEN 1,270M.

AERODROME AND APPROACH LIGHTING
RWY 07/25 PTBL(1) BY PRIOR ARRANGEMENT
(1) EMERG only. 60MIN PN.
RWY 07/25 edge light spacing: 100M.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA BRISBANE CENTRE 126.8 Circuit Area

CTAF 126.7

ADDITIONAL INFORMATION
1. RWY soft after heavy rain.
2. Bird and animal hazard exists.
3. Mower may be on RWY at any time HJ.
4. Tenterfield township 10KM south by road.

CHARTS RELATED TO THE AERODROME
WAC 3357.

TESSA SHOALS

AVFAX CODE 6817 **FULL NOTAM SERVICE NOT AVBL**
WA UTC +8 YTES
203323S 1171437E VAR 1 DEG E UNCR
AD OPR Auriga Group, 14 Argyle St, Albion, QLD, 4010. Email: westcoastaviation@auriga.com.au. ARO 0427 061 441.

REMARKS
All enquiries to Head of Flying Operations (HOFO) via AD OPR. Include “ATTN HOFO” in email subject.

METEOROLOGICAL INFORMATION PROVIDED
AWIS FREQ 135.85 - Report faults to AD OPR.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA MELBOURNE CENTRE 122.4
ATIS KARRATHA ATIS 134.55
TWR KARRATHA TOWER 127.35

CTAF - AFRU 127.35

CHARTS RELATED TO THE AERODROME
1. WAC 3229.
2. Also refer to AIP Departure and Approach Procedures.

THANGOOL

ELEV 644

AVFAX CODE 4025

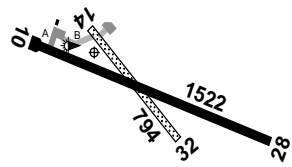

QLD UTC +10 YTNG
242938S 1503434E VAR 10 DEG E CERT
AD OPR Banana Shire Council, PO Box 412, Biloela, QLD, 4715. PH 4995 8241. ARO AH 0439 873 182. Council PH 07 4992 9500: Fax 4992 3493. Website: www.banana.qld.gov.au.

REMARKS
AD Charges: refer to website for details.

Information may be continued on the next page: PTO

HANDLING SERVICES AND FACILITIES
Fuel supplied by IOR Aviation Pty Ltd. AVGAS 100LL AVBL H24 Self-Serve Bowser - payment method via IOR Aviation tag for account holders or via the Fuel charge APP. JET A1 H24 Call out fee applies outside 0700 -1700 Local. PH: 0423 393 033.

AERODROME OBSTACLES
Lit TWR:

a. 820FT AMSL, BRG 010 MAG 0.8NM FM ARP. Infringes inner HZS.
b. 1,214FT AMSL, BRG 010 MAG 1.54NM FM ARP. Infringes inner HZS.

METEOROLOGICAL INFORMATION PROVIDED
1. TAF CAT D, METAR/SPECI.
2. AWIS PH 07 3564 3739 - Report faults to BoM.
3. AWIS FREQ 134.05 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

10/28	102	50a	Unrated. Sealed.	WID 30	RWS 90
14/32	130	26c	Unrated. Grey sand silt clay	WID 30	RWS 60

AERODROME AND APPROACH LIGHTING
RWY 10/28 LIRL AFRU+PAL 126.7 SDBY PWR AVBL
RWY 10/28 edge light spacing: 60M.

OTHER LIGHTING
1. SDBY PWR switchover time: APRX 5 SEC.
2. TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA BRISBANE CENTRE 119.55 Circuit Area

LOCAL TRAFFIC REGULATIONS
APN PRKG not AVBL when DH8C ACFT refuelling. Cone markers placed across front of ACFT.

FLIGHT PROCEDURES
Right hand CCTS required RWY 10.

CTAF - AFRU 126.7

CHARTS RELATED TO THE AERODROME
1. WAC 3340.
2. Also refer to AIP Departure and Approach Procedures.

THARGOMINDAH ELEV 433

AVFAX CODE 4132

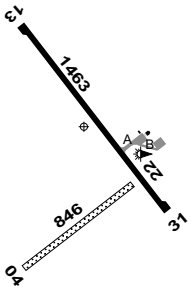

QLD UTC +10 YTGM
275911S 1434839E VAR 8 DEG E CERT
AD OPR Bulloo Shire Council, PO Box 46, Thargomindah, QLD, 4492.
ARO 0437 252 979. Council PH 07 4621 8000. Fax 07 4655 3131.

REMARKS
This AD is a Security Controlled Airport.

HANDLING SERVICES AND FACILITIES
Phone ARO. AVGAS and JET A1. Self-serve bowser AVBL H24 (Credit card swipe machine (pin only)).

METEOROLOGICAL INFORMATION PROVIDED
1. TAF CAT D, METAR/SPECI.
2. AWIS PH 07 3564 3740 - Report faults to BoM.

PHYSICAL CHARACTERISTICS

04/22	043	28c	Unrated. Red gravel	WID 30	RWS 90
13/31	132	48a	PCR 150/F/A/0.90 MPa/U	WID 30	RWS 90