**CTAF** 126.7

**ADDITIONAL INFORMATION**

Animal hazard exists.


**CHARTS RELATED TO THE AERODROME**

WAC 3223.

## MOUNT HOWITT

**ELEV 345**

**FULL NOTAM SERVICE NOT AVBL**




| | | | |
|---|---|---|---|
| QLD | | UTC +10 | YMHW |
| 263040S | 1421700E | VAR 7 DEG E | UNCR |

AD OPR Western Grazing Co. Mount Howitt Station, via Quilpie, QLD, 4480. PH 07 4656 4770.

**PASSENGER FACILITIES**

Telephone facilities not AVBL.

**ATS AND AERODROME COMMUNICATION FACILITIES**

| | | |
|---|---|---|
| FIA | BRISBANE CENTRE | 118.8 2500FT |

**CTAF** 126.7


**CHARTS RELATED TO THE AERODROME**

WAC 3342.

## MOUNT ISA

**ELEV 1121**

**AVFAX CODE 4301**

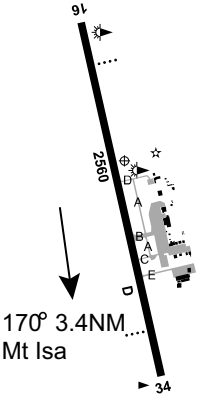


| | | | |
|---|---|---|---|
| QLD | | UTC +10 | YBMA |
| 203950S | 1392919E | VAR 5 DEG E | CERT |

AD OPR Mount Isa Airport Pty Ltd, PO Box 2305, Mount Isa, QLD, 4825. Email: aro@isaairport.com.au. PH 07 4409 3000. ARO 0428 030 409 H24. Website: www.mountisaairport.com.au.

**REMARKS**

1. Conditions of Use and AD Charges apply to Mount Isa Airport, details available on website (navigate Regulatory > Charges).
2. This AD is a Security Controlled Airport.
3. All pilots and operators must possess and display a current Aviation Security Identification Card (ASIC) when in all areas airside unless under escort. Passengers must be escorted at all times.
4. Parking for ACFT ABV 5,700KG MTOW requires 48HR PN. Email ARO with request.
5. For airside access CTC ARO. Access from GA to RPT terminal and landside through Gate 7, remaining clear of Security Restricted Area.
6. Operating hours: H24.

**HANDLING SERVICES AND FACILITIES**

BP - Air Fuel Isa: H24. PH/Fax 07 4743 4843, 0419 735 998, VHF 129.9. AVGAS 24HR AIR BP Carnet cardswipe bowser, JET A1, O117, O125, MC and V. AVFAX Briefing Facilities AVBL.
VIVA Energy Australia - NQ Fuel Services MON-FRI 0700-1900 Local, SAT 0700-1100 Local, SUN 0830-1900 Local. TEL 07 4743 7211 or 0407 961 355. Email: mtisa@nqfuelservices.com.au. AH 1HR PN (call-out fee applies).
Airside Logistics: PH 07 4744 8500, 0407 111 211 (H24). Ground handling services - marshalling, baggage/freight, check-in, crew and PAX transfers, Email: isaops@airsidelogistics.com.au, Website: www.airsidelogistics.com.au

**General**

The OPR does not provide ACFT marshalling services. All requests for ACFT marshalling should be directed to the airlines or FBO (if applicable).

## AERODROME OBSTACLES

1. Lit stack 2,129FT AMSL BRG 179 DEG MAG 3.6NM FM ARP. Infringes COS by 690FT.
2. Fence 1,115FT AMSL BRG 162 DEG MAG 0.9NM FM ARP. Infringes TNS by 3FT.
3. Power pole 1,157FT AMSL BRG 159 DEG MAG 1.1NM FM ARP. Infringes TNS by 5FT.
4. Towers:
   a. Lit 1,585FT BRG 142 DEG MAG 3.1NM FM ARP infringes COS by 305FT.
   b. Lit 1,545FT BRG 156 DEG MAG 4.6NM FM ARP.
   c. Powerline TWR 1,254FT AMSL BRG 339 DEG MAG 2.1NM FM ARP.
   d. Powerline TWR 1,281FT AMSL BRG 342 DEG MAG 2.4NM FM ARP.
   e. Powerline TWR 1,257FT AMSL BRG 334 DEG MAG 1.9NM FM ARP.
5. Trees on hill:
   a. 1,282FT AMSL BRG 141 DEG MAG 1.1NM FM ARP. Infringes inner HZS by 24FT.
   b. 1,306FT AMSL BRG 155 DEG MAG 2.2NM FM ARP. Infringes inner HZS by 47FT.
   c. 1,292FT AMSL BRG 156 DEG MAG 2.2NM FM ARP. Infringes inner HZS by 34FT.

## METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT B, METAR/SPECI.
2. AWIS PH 07 3564 3729 - Report faults to BoM.
3. AWIS FREQ 135.8 (requires one-second pulse to activate). Report faults to AD OPR.

## PHYSICAL CHARACTERISTICS

| | | | | | |
|---|---|---|---|---|---|
| 16/34 | 162 | 84a | PCR 305/F/A/1.47 MPa/U Grooved | WID 45 | RWS 150 |

## AERODROME AND APPROACH LIGHTING

| | | | | |
|---|---|---|---|---|
| RWY 16/34 | MIRL | AFRU+PAL 126.5 | | SDBY PWR AVBL |
| RWY 16/34 | PAPI(1) | AFRU+PAL 126.5 | 3.0 DEG53.3FT | SDBY PWR AVBL |
| RWY 16/34 | PTBL(2) | | | BY PRIOR ARRANGEMENT |

(1) Left side.
(2) 120MIN PN. CTC ARO.
RWY edge light spacing: 16/34: 60M.

## OTHER LIGHTING

ABN FLG 8 WG
1. Secondary PWR switchover time: 15 SEC.
2. TWY LGT: Blue edge on B.

## ATS AND AERODROME COMMUNICATION FACILITIES

| | | |
|---|---|---|
| FIA | BRISBANE CENTRE | 122.4 On Ground |

## RADIO NAVIGATION AND LANDING AIDS

| | | | | | | |
|---|---|---|---|---|---|---|
| DME | MA | 117.5/122X | 203952.7S | 1392908.9E | | (1) |
| NDB | MA | 338 | 204031.5S | 1392911.6E | Range 100 (HN 60) | (2) |
| VOR | MA | 117.5 | 203952.6S | 1392908.3E | | |

(1) Antenna ELEV 1,138FT.
(2) Antenna ELEV 1,185FT
TACAN also AVBL. PTBL facility, deployed as required by MIL authorities. IDENT code, channel assignment and activation by NOTAM.

## LOCAL TRAFFIC REGULATIONS

1. Local helicopter OPS are to be conducted from/to the eastern grass helicopter APN, which is the area contained by the blue cone markers off the E end of TWY C.
   The eastern grass helicopter APN is not a designated HLS and separation is not provided BTN ACFT and/or obstructions on the ground while operating within the confines of the eastern grass helicopter APN.
2. Skid mounted ACFT are not permitted to park on any sealed or asphalt surface, including bowsers, TWY, APN, run-up bay, etc.
3. Air taxi to/from the eastern grass helicopter APN to the RWY via TWY C is to be avoided unless necessary. If necessary, air taxiing is to be conducted as high and as quickly as practical, to minimise dispersion of debris into hangars and workshops.
4. Training flights permitted BTN 2100-1200 UTC only.
5. No turns permitted in the overrun beyond RWY THR.
6. All turns to be MNM speed, MAX RAD.

Information may be continued on the next page: PTO

7. Due to the grades on RWY 16/34, the opposite ends of the RWY are not visible when TKOF. Mandatory CTAF BCST required before OPR on RWY.
   a. From the TWY holding point, ACFT at THR RWY 16 may not be visible.
   b. ACFT at THR 16 and 34 may not be visible to one another.
   c. CTAF BCST FM ACFT at the TWY holding point may not be received by ACFT at THR RWY 16.
8. TWY E limited to Royal Flying Doctor Service (RFDS) and LifeFlight ACFT.

### FLIGHT PROCEDURES
Right hand circuits RQ when OPR on RWY 34.

### CTAF - AFRU 126.5

### NOISE ABATEMENT PROCEDURES
Noise Abatement Procedures (NAP) apply. Refer AIP DAP.

### ADDITIONAL INFORMATION
1. Blasting will be conducted at various sites WI 6NM RAD of Mount Isa AD. SFC - 2,500FT.
2. A wildlife hazard exists year round at this AD.
   a. Bird activity is significantly increased after rainfall events.
   b. Whistling kite, magpie lark, bustard and nankeen kestrel present all year round.
   c. Black kites occur year round and occur in very high numbers during insect swarms, NOTAM will be issued in these events.
   d. Australian pratincole present in greater numbers OCT to APR but may occur seasonally year round.

   For current information refer to NOTAM.
3. Flying foxes are a seasonal risk at dawn and dusk on the APCH to the RWY (on and off airfield). Peak risk period is AUG through until FEB although potential risk exists year round.
4. Multiple gas turbine facilities emit high velocity plume rise at locations APRX 7NM S of AD.
5. Weather balloon launch APRX 2315 FM 1.5KM S ARP. Launches may occur at other times.

### CHARTS RELATED TO THE AERODROME
1. WAC 3233.
2. Also refer to AIP Departure & Approach Procedures.


---

## MOUNT KEITH — ELEV 1792

### AVFAX CODE 6605

| | | | |
|---|---|---|---|
| WA | | UTC +8 | YMNE |
| 271711S | 1203317E | VAR 1 DEG E | CERT |

AD OPR BHP Nickel West Pty Ltd (Mount Keith), PO Box 238, Welshpool Delivery Centre, WA, 6986. Email: mountkeithaerodrome@bhp.com. PH AD MGR 0450 031 931. Email: joseph.buchanan@bhp.com. ARO 08 9037 8748: 0499 821 780 (H24).

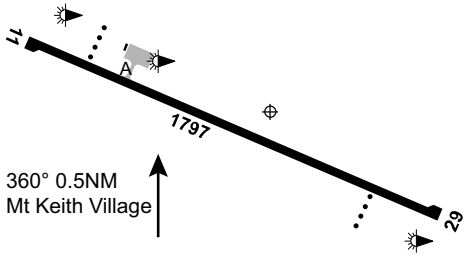


### REMARKS
1. PPR for all OPS. Email ARO.
2. AD charges: ALL ACFT.

### HANDLING SERVICES AND FACILITIES
No fuel AVBL.