ADDITIONAL INFORMATION
1. Railway tracks are close to the threshold of RWY 15 and 19.
2. Kangaroo hazard may exist.

CHARTS RELATED TO THE AERODROME
WAC 3469.

CROKER ISLAND ELEV 51

AVFAX CODE 8022

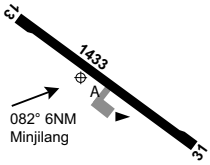

NT UTC +9:30 YCKI
110955S 1322902E VAR 2 DEG E CERT
AD OPR Minjilang Community Inc, Croker Island, NT, 0822.
Email: contracts@westernhem.nt.gov.au. PH 08 8970 3500 BH.
ARO EMERG Satellite PH 0147 182 356 H24. Mobile 0419 947 865 H24.

PASSENGER FACILITIES
Telephone facilities not AVBL.

PHYSICAL CHARACTERISTICS
13/31 133 47a Unrated. Sealed WID 23 RWS 90

AERODROME AND APPROACH LIGHTING
RWY 13/31 PTBL(1) BY PRIOR ARRANGEMENT
(1) EMERG only. Solar powered, automatically activates.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA BRISBANE CENTRE 118.15 8000FT

CTAF 126.7

ADDITIONAL INFORMATION
Possibility of animals on movement area.

CHARTS RELATED TO THE AERODROME
WAC 3098.

CROOKWELL ELEV 2953

FULL NOTAM SERVICE NOT AVBL

NSW UTC +10 YCRL
343000S 1492700E VAR 12 DEG E UNCR
AD OPR Advanced Aero Components Pty Ltd, 245 Old Hume Hwy, Mittagong, NSW, 2575.
Email: advancedaerocomponents@gmail.com. Mobile 0436 000 560.
Website: www.crookwellaerodrome.com.au: www.advancedaerocomponents.com.

REMARKS
1. AD charges - Refer to website.
2. Day OPS only.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA MELBOURNE CENTRE 121.2 to East - on ground 121.2
FIA MELBOURNE CENTRE 124.1

CTAF 126.7

ADDITIONAL INFORMATION
1. Turbulence due to Gullen range to West.
2. Down drafts over west end Gullen range in westerly winds.
3. West end Gullen Range may be higher than climb path.
4. Traffic on Kialla Road oriented North/South adjacent to E end of strip.
5. Radio contact may not be possible on ground.

CHARTS RELATED TO THE AERODROME
WAC 3456, 3457.