ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	120.75 Only AVBL ABV 3700FT (Circuit HT)

FLIGHT PROCEDURES

1. Right hand circuits RWY 30 and 36.
2. Landing on grass on E side of 18/36 beside tarmac is encouraged and preferred.

CTAF 118.1

ADDITIONAL INFORMATION

1. Gates are locked and cattle graze on airfield when no OPS scheduled.
2. GPS Approach AVBL on RWY 18.
3. Glider OPS at Bunyan airstrip, 6NM to N, HJ generally weekends. Monitor 122.7 for glider OPS. Tug ACFT monitor 122.7 and 118.1 when airborne.
4. Cooma - Snowy Mountains AD located 9NM SW, FREQ 118.1. Separate ERSA entry.
5. Model ACFT OPR WI 500M radius of PSN 361312.00S 1490936.00E BRG 029 MAG 0.8NM FM Cooma-Polo Flat (YPFT) SFC to 1,000FT AGL.

CHARTS RELATED TO THE AERODROME

1. WAC 3470.
2. Also refer to AIP Departure and Approach Procedures.

COOMA - SNOWY MOUNTAINS — ELEV 3087

AVFAX CODE 2113

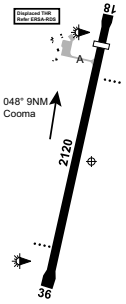

NSW UTC +10 YCOM
361802S 1485826E VAR 13 DEG E CERT

AD OPR General Manager, Snowy Mountains Airport - Cooma, PO Box 35, Jindabyne, NSW, 2627. Email: aviation@snowymountainsairport.com.au. ARO H24 0415 582 069. Website: www.snowymountainsairport.com.au.

REMARKS

1. AD charges apply. Contact AD OPR for details.
2. Prior notice required for charter OPS with 5 or more PAX.
3. Prior notice recommended for overnight PRKG.
4. This AD is a Security Controlled Airport.

HANDLING SERVICES AND FACILITIES

AVGAS and JET A1 H24 self-service bowsers accept MC, V and Skyfuel Carnet. JET A1 tanker service AVBL for larger turbine ACFT. Call-out fees may apply. Skyfuel TEL 0468 559 310. Further information: www.snowymountainsairport.com.au/fuel.

PASSENGER FACILITIES

TX - 02 6452 7777 (taxi's travel from Cooma township)/LG and RF - AVBL HS/WC - H24.

AERODROME OBSTACLES

Lit hazard lights:

a. 3,775FT AMSL BRG 334 DEG MAG 5,056M FM ARP. Obstructs inner HZS by 559.06FT. Flashing.
b. 3,558FT AMSL BRG 111 DEG MAG 2,284M FM ARP. Obstructs inner HZS by 342.52FT. Flashing.
c. 3,270FT AMSL BRG 352 DEG MAG 3,616M FM ARP. Obstructs RWY 36 TKOF climb SFC by 63.65FT.
d. 3,223FT AMSL BRG 358 DEG MAG 3,698M FM ARP. Obstructs RWY 36 TKOF climb SFC by 8.53FT.
e. 3,248FT AMSL BRG 002 DEG MAG 3,944M FM ARP. Obstructs RWY 36 TKOF climb SFC by 17.72FT.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS PH 02 9353 6414 - Report faults to BoM.

PHYSICAL CHARACTERISTICS

18/36 180 70a PCR 120/F/B/0.65 MPa/U WID 30 RWS 150

AERODROME AND APPROACH LIGHTING

RWY 18/36	LIRL	AFRU+PAL 118.1		SDBY PWR AVBL
RWY 18/36	PAPI(1)	AFRU+PAL 118.1	3.0 DEG40FT	SDBY PWR AVBL

(1) Left side. Lighting status confirmed on PAL.
RWY edge light spacing: 18/36: 60M.

OTHER LIGHTING

HBN Locations as per AD OBSTACLES.
1. SDBY PWR supplied by AD generator in the event of mains PWR failure.
2. SDBY PWR switchover time: 10 SEC.
3. TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 120.75 Circuit area (On ground COM contact 119.4)

RADIO NAVIGATION AND LANDING AIDS

DME	COM	114.0/ 87X	362115.5S	1485727.7E		(1)
NDB	COM	293	362113.6S	1485727.1E	Range 80 (HN 70)	(2)

(1) Antenna ELEV 3026FT.
(2) 003/3.3 to ARP.

LOCAL TRAFFIC REGULATIONS

1. **Parking restrictions**
   a. To avoid OBST to RPT ACFT, parking for GA ACFT BLW 5,700KG MTOW AVBL E and ADJ to RPT Bay 3 and 3A. GA ACFT tiedowns unrated.
   b. ACFT parking in RPT bays require PN on Monday, Thursday, Friday 0800-1800 Local.
   c. RPT Bays 1 and 2 suitable up to DH8D.
   d. RPT Bays 1A and 2A suitable up to SF34.
   e. RPT Bays 3 and 3A suitable up to JS32.
2. **RWY 18/36 turning restrictions**
   a. Pilots to use full RWY width when turning (no sharp turns).
   b. ACFT ABV 5,700KG MTOW must only turn at the turn pads.

CTAF - AFRU 118.1

ADDITIONAL INFORMATION

1. Bird and animal hazard exists.
2. Gliders OPR FM Bunyan Airstrip 12.5NM NE Cooma HJ, generally JF, and monitor 122.7, or CTAF when WI 10NM of Cooma AD. Tug ACFT when airborne monitor CTAF and 122.7.
3. Polo Flat airfield located adjacent to Cooma Township and 9NM NE of Cooma - Snowy Mountains AD. Polo Flat has a separate ERSA entry.
4. Risk of snowfall or heavy frost year-round. Highest risk from May to October. No snow clearing or de-icing equipment AVBL.

CHARTS RELATED TO THE AERODROME

1. WAC 3470.
2. Also refer to AIP Departure and Approach Procedures.

COOMBING PARK

ELEV 2350
FULL NOTAM SERVICE NOT AVBL

NSW UTC +10 YCPK
333743S 1490729E VAR 12 DEG E UNCR
AD OPR The Whitney Pastoral Co, Coombing Park, Carcoar, NSW, 2791.
Email: george.king@onfarm.co. PH 0427 673 021 (H24).

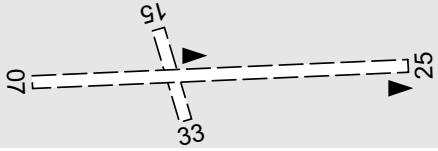

Information may be continued on the next page: PTO