FLIGHT PROCEDURES

1. No simultaneous RWY OPS.
2. In nil wind conditions 32L/32R are to be used.
3. Circuits are to be flown to the west of the field with right hand circuits for RWY 14L/14R due to heavily forested areas to the east. Base leg for RWY 32L/32R are to be flown over a path indicated by white tyres mounted on fences 1.1KM south of RWY THR. No flying over houses in the circuit. For further information CTC AD OPR PH: 03 6394 8119.

CTAF 126.7

ADDITIONAL INFORMATION

1. Rabbits may dig on RWY surface.
2. Soft wet surface at mid length of RWY after heavy rain.

CHARTS RELATED TO THE AERODROME

WAC 3556.

CRESSY

ELEV 420

FULL NOTAM SERVICE NOT AVBL

VIC		UTC +10	YCRE
380224S	1433911E	VAR 11 DEG E	UNCR

AD OPR CSS Investments, 175 Aerodrome Road, Cressy, VIC, 3320.
Email: cressyaerodrome@iinet.net.au. PH 0481 327 587.

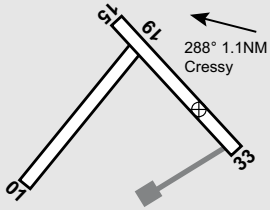

REMARKS

PPR.

HANDLING SERVICES AND FACILITIES

No fuel AVBL.

PASSENGER FACILITIES

WC/RF/HC/AC.

AERODROME OBSTACLES

1. Powerlines on the approach to RWY 33.
2. Unlit TWY 355 DEG MAG 0.8NM FM ARP.

PHYSICAL CHARACTERISTICS

01/19	36c	Unrated. Grass. RWY LEN 1,100M	WID 50
15/33	30c	Unrated. Grass. RWY LEN 900M	WID 50

AERODROME AND APPROACH LIGHTING

RWY 01/19 PTBL(1) BY PRIOR ARRANGEMENT

(1) 30MIN PN.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	126.8

FLIGHT PROCEDURES

1. Right hand circuits when operating on RWY 01 and 33.
2. Pilots are encouraged to avoid overflying Cressy township and properties to the S.
3. Aircraft approaching from NW or W to track via Lake Rosine and when approaching from S track via the eastern shore of Lake Weering.

CTAF 126.7

Information may be continued on the next page: PTO

ADDITIONAL INFORMATION
1. Railway tracks are close to the threshold of RWY 15 and 19.
2. Kangaroo hazard may exist.

CHARTS RELATED TO THE AERODROME
WAC 3469.

CROKER ISLAND ELEV 51

AVFAX CODE 8022

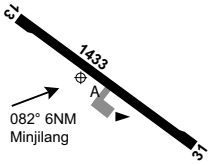

NT UTC +9:30 YCKI
110955S 1322902E VAR 2 DEG E CERT
AD OPR Minjilang Community Inc, Croker Island, NT, 0822.
Email: contracts@westernhem.nt.gov.au. PH 08 8970 3500 BH.
ARO EMERG Satellite PH 0147 182 356 H24. Mobile 0419 947 865 H24.

PASSENGER FACILITIES
Telephone facilities not AVBL.

PHYSICAL CHARACTERISTICS
13/31 133 47a Unrated. Sealed WID 23 RWS 90

AERODROME AND APPROACH LIGHTING
RWY 13/31 PTBL(1) BY PRIOR ARRANGEMENT
(1) EMERG only. Solar powered, automatically activates.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA BRISBANE CENTRE 118.15 8000FT

CTAF 126.7

ADDITIONAL INFORMATION
Possibility of animals on movement area.

CHARTS RELATED TO THE AERODROME
WAC 3098.

CROOKWELL ELEV 2953

FULL NOTAM SERVICE NOT AVBL

NSW UTC +10 YCRL
343000S 1492700E VAR 12 DEG E UNCR
AD OPR Advanced Aero Components Pty Ltd, 245 Old Hume Hwy, Mittagong, NSW, 2575.
Email: advancedaerocomponents@gmail.com. Mobile 0436 000 560.
Website: www.crookwellaerodrome.com.au: www.advancedaerocomponents.com.

REMARKS
1. AD charges - Refer to website.
2. Day OPS only.

ATS AND AERODROME COMMUNICATION FACILITIES
FIA MELBOURNE CENTRE 121.2 to East - on ground 121.2
FIA MELBOURNE CENTRE 124.1

CTAF 126.7

ADDITIONAL INFORMATION
1. Turbulence due to Gullen range to West.
2. Down drafts over west end Gullen range in westerly winds.
3. West end Gullen Range may be higher than climb path.
4. Traffic on Kialla Road oriented North/South adjacent to E end of strip.
5. Radio contact may not be possible on ground.

CHARTS RELATED TO THE AERODROME
WAC 3456, 3457.