GUNDAROO

ELEV 1860

FULL NOTAM SERVICE NOT AVBL

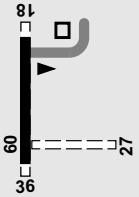

NSW UTC +10 YGDO
350242S 1491530E VAR 13 DEG E UNCR
AD OPR DSI, PO Box 418, Terrey Hills, NSW, 2084. PH Manager 0429 443 260.

REMARKS
PPR.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	CANBERRA APPROACH	124.5 On ground

FLIGHT PROCEDURES

Where practical;

a. Approach from and depart to the South.
b. Avoid flying over township or homestead.

CTAF - AFRU 126.7

ADDITIONAL INFORMATION

ACFT to give way to steam train on TWY.

CHARTS RELATED TO THE AERODROME

WAC 3456, 3457.

GUNNEDAH

ELEV 866

AVFAX CODE 2034

NSW UTC +10 YGDH
305740S 1501502E VAR 11 DEG E CERT
AD OPR Gunnedah Shire Council, PO Box 63, Gunnedah, NSW, 2380. PH 02 6740 2100. Fax 02 6740 2119.

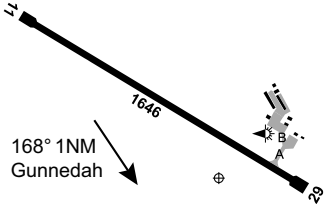

REMARKS

AD charges: in accordance with council fees and charges.

HANDLING SERVICES AND FACILITIES

Gunnedah Aero Club: H24, fuel general enquiries PH 0408 453 030. AVGAS, JET A1 self-service card swipe bowsers. MC, V and AMEX only. Carnet cards not accepted.

PASSENGER FACILITIES

TX/HC/LG/WC

AERODROME OBSTACLES

1. TWR 1,588FT AMSL, PSN 310007.9S 1501541.9E. Infringes COS by 497FT. Lit by red intermittent light.
2. Transient obstacles:
   a. Road, 4.5M, 879FT AMSL, PSN 305746.9S 1501520.7E
   b. Road, 4.5M, 880FT AMSL, PSN 305741.8S 1501524.6E

3. Groups of trees:
   a. 951FT AMSL, PSN 305755.4S 1501557.2E. Infringes TKOF SFC.
   b. 991FT AMSL, PSN 305811.7S 1501623.5E. Infringes TKOF SFC.
   c. 944FT AMSL, PSN 305806.0S 1501547.9E. Infringes TKOF SFC.
   d. 906FT AMSL, PSN 305750.1S 1501539.4E. Infringes TKOF SFC.
   e. 920FT AMSL, PSN 305756.4S 1501541.6E. Infringes TKOF SFC.
   f. 920FT AMSL, PSN 305756.2S 1501543.0E. Infringes TKOF SFC.
   g. 926FT AMSL, PSN 305755.2S 1501543.8E. Infringes TKOF SFC.
   h. 928FT AMSL, PSN 305653.8S 1501353.9E. Infringes TKOF SFC.
   i. 919FT AMSL, PSN 305702.2S 1501356.7E. Infringes TKOF SFC.
   j. 926FT AMSL, PSN 305657.6S 1501350.9E. Infringes TKOF SFC.
   k. 921FT AMSL, PSN 305743.5S 1501529.9E. Infringes TNS.
   l. 928FT AMSL, PSN 305748.5S 1501518.6E. Infringes TNS.
   m. 934FT AMSL, PSN 305747.2S 1501514.4E. Infringes TNS.
   n. 940FT AMSL, PSN 305748.6S 1501517.4E. Infringes TNS.
   o. 919FT AMSL, PSN 305740.3S 1501525.1E. Infringes TNS.
   p. 925FT AMSL, PSN 305746.9S 1501516.9E. Infringes TNS.
   q. 944FT AMSL, PSN 305754.5S 1501527.7E. Infringes TNS.
   r. 922FT AMSL, PSN 305736.0S 1501520.8E. Infringes TNS.
   s. 915FT AMSL, PSN 305737.5S 1501521.9E. Infringes TNS.
4. Tree:
   a. 905FT AMSL, PSN 305745.3S 1501533.0E. Infringes TKOF SFC and APCH SFC.
   b. 894FT AMSL, PSN 305746.9S 1501518.7E. Infringes TNS.
   c. 948FT AMSL, PSN 305727.8S 1501435.5E. Infringes TNS.

METEOROLOGICAL INFORMATION PROVIDED

1. METAR/SPECI.
2. AWIS PH 02 9353 6425 - Report faults to BoM.
3. AWIS FREQ 133.275 (requires one-second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

11/29 111 54a PCR 110/F/D/Y/T WID 30 RWS 150

AERODROME AND APPROACH LIGHTING

RWY 11/29 LIRL AFRU+PAL 127.4
RWY edge light spacing: 60M.

OTHER LIGHTING

TWY LGT: Blue edge on TWY A only.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 127.1 On Ground

FLIGHT PROCEDURES

Right hand circuits RQ when OPR on RWY 29.

CTAF - AFRU 127.4

ADDITIONAL INFORMATION

1. Bird hazard exists.
2. Kangaroos present within RWY strip area and AD year round.
   a. Species-specific NOTAM will be issued during periods of increased activity.

CHARTS RELATED TO THE AERODROME

1. WAC 3357.
2. Also refer to AIP Departure and Approach Procedures.

Information may be continued on the next page: PTO