
HORN ISLAND

ELEV 43

AVFAX CODE 4502

QLD		UTC +10	YHID
103511S	1421724E	VAR 5 DEG E	CERT

AD OPR Torres Shire Council, PO Box 171, Thursday Island, QLD, 4875.
Email: aro.hiairport@torres.qld.gov.au. PH Airport 07 4069 1314. ARO H24 0429 691 338.

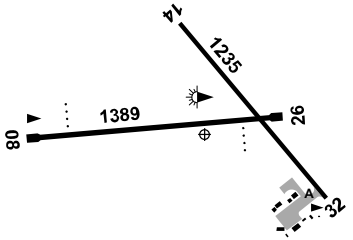

REMARKS

1. Australian Borderforce and Biosecurity.
2. AD Charges: parking, passenger and landing fees applicable.
3. Limited ACFT parking AVBL. Contact ARO with 48HR PN.
4. Security controlled AD. All aircrew to wear safety visibility vest while on APN area.
5. Access requirements - contact ARO.
6. Extensive HEL OPS ranging FM light to medium/heavy OPR HJ and HN. HEL OPS HJ are not restricted to RWY and may be OPR in accordance with HEL procedures in *AIP ENR*.

HANDLING SERVICES AND FACILITIES

AIR BP: 2000-0800 UTC MON-SAT, 2100-0700 UTC SUN. No AH service AVBL.
Phone 07 4069 2224, H24 0499 692 411. VHF 129.9. JET A1, AVGAS, O117, O125. MC, V, AIR BP Carnet Card.
Viva Energy: 2130-0700 UTC MON-FRI. SAT-SUN with PN. AH service AVBL on request. Phone 0484 251 671. JET A1, AVGAS.

PASSENGER FACILITIES

WC/PT/RF/Public Transport.

AERODROME OBSTACLES

1. Lit terrain 130FT AMSL BRG 73 MAG 0.9NM FM ARP.
2. Lit terrain 144FT AMSL BRG 79 MAG 0.9NM FM ARP.
3. Lit terrain 226FT AMSL BRG 89 MAG 0.9NM FM ARP.
4. Lit terrain 398FT AMSL BRG 103 MAG 1.8NM FM ARP.
5. Unmarked and unlit communication TWR 222FT AMSL APRX BRG 256 MAG 1.8NM FM ARP. Infringes inner HZS by 13FT.
6. Trees infringe TNS by up to 20FT either side of RWY 08/26.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT A, METAR/SPECI.
2. AWIS Phone 07 3564 3718 - Report faults to BoM.
3. AWIS FREQ 122.125 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

08/26	080	46a	PCR 124/F/A/0.97 MPa/T Grooved.	WID 30	RWS 150
14/32	135	41a	PCR 124/F/A/0.97 MPa/T - NW of RWY08/26 PCR 26/F/A/0.64 MPa/U.	WID 23	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 08/26	PTBL(1)			BY PRIOR ARRANGEMENT
RWY 08	LIRL	AFRU+PAL 126.5		SDBY PWR AVBL
RWY 08	PAPI(3)	AFRU+PAL 126.5	3.0 DEG44FT	SDBY PWR AVBL
RWY 26	LIRL(2)	AFRU+PAL 126.5		SDBY PWR AVBL
RWY 26	PAPI(3)	AFRU+PAL 126.5	3.2 DEG50FT	SDBY PWR AVBL
RWY 14/32	PTBL(1)			BY PRIOR ARRANGEMENT

(1) PN
(2) Lighting WID 33.6M
(3) Left hand side
RWY edge light spacing: 08/26: 90M.

OTHER LIGHTING

HBN SE of AD
1. Secondary PWR switchover time: 15 SEC.
2. TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 120.3 On Ground

RADIO NAVIGATION AND LANDING AIDS

NDB HID 356 103531.4S 1421733.2E Range 50 (HN 50) OW 100 (OW HN100)

FLIGHT PROCEDURES

1. Due to terrain, TKOF RWY 14 and land RWY 32 not AVBL.
2. For special procedures which apply to Torres Strait biosecurity requirements, see ERSA GEN - SPECIAL PROCEDURES.

CTAF - AFRU 126.5

ADDITIONAL INFORMATION

Bird hazard exists (migratory).


CHARTS RELATED TO THE AERODROME

1. WAC 3097.
2. Also refer to AIP Departure and Approach Procedures.

HORSHAM ELEV 445

AVFAX CODE 3022

VIC UTC +10 YHSM
364011S 1421022E VAR 10 DEG E CERT
AD OPR Horsham Rural City Council, PO Box 511, Horsham, VIC, 3402. PH 03 5382 9777.
ARO 0408 504 255.

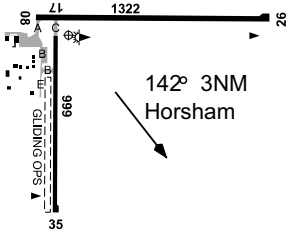

HANDLING SERVICES AND FACILITIES

BP - Horsham Aero Club: 2200-0700 UTC MON-FRI. H24 BP JET A1 and AVGAS card swipe bowser. Credit card or BP carnet only. TEL 0418 811 737, 1HR PN required. Call-out fee will apply.

PASSENGER FACILITIES

WC/PT (local only)/ME - ACFT and glider repairs AVBL.

Information may be continued on the next page: PTO