MILLICENT

ELEV 56

FULL NOTAM SERVICE NOT AVBL

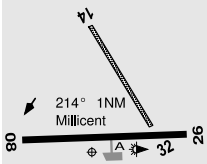

SA		UTC +9:30	YMCT
373501S	1402158E	VAR 10 DEG E	UNCR

AD OPR Wattle Range Council, PO Box 27, Millicent, SA, 5280.
PH 08 8733 0900: 0407 611 459 (H24).

AERODROME OBSTACLES

RWY 08 APCH end, transition S side infringed by trees.

AERODROME AND APPROACH LIGHTING

PAL 123.9

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	125.8 Circuit Area

CTAF 126.7

ADDITIONAL INFORMATION

1. Bird hazard exists.
2. Gliding OPS HJ JF. Gliders operate WI RWS. Wire Launching.

CHARTS RELATED TO THE AERODROME

WAC 3469.

MILLMERRAN

ELEV 1312

FULL NOTAM SERVICE NOT AVBL

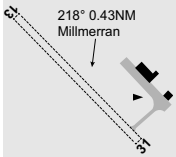

QLD		UTC +10	YMMN
275148S	1511630E	VAR 11 DEG E	UNCR

AD OPR Toowoomba Regional Council, PO Box 3021, Toowoomba, QLD, 4350.
Email: aerodrome@tr.qld.gov.au. PH BH Aerodrome 07 4688 6117.
Council PH AH 0497 099 111. Website: www.tr.qld.gov.au/aerodromes.

REMARKS

1. AD charges apply: see website.
2. ACFT BLW 2,000KG day use only.
3. Pavement concession required for larger ACFT. Contact AD OPR.
4. Access AVBL in accordance with Toowoomba Region Aerodromes Conditions of Access and Use. See website.
5. Due to safety/security hazards, ensure vehicle gates are closed and locked when not in use.

PASSENGER FACILITIES

LG/WC.

APRONS AND TAXIWAYS

1. TWY to APN and hangar area.
2. GA APN.

AERODROME OBSTACLES

1. Transitional OLS tree infringement exists up to 24FT left and right of APCH to SE THR 31 end.
2. Unlit primary wind indicator located BTN RWS and apron infringes transition OLS by 10FT (based on a 60M wide RWS).

PHYSICAL CHARACTERISTICS

13/31	40a/c 2000 kg/0.60 MPa Grass. Central 11M sealed. RWY LEN 1,230M.	WID 18	RWS 80

Caution: outer 2M each side of sealed central runway section may be soft due to sub-surface moisture, particularly during wet weather. Central 6M are firm and stable.

Information may be continued on the next page: PTO