ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 120.3 5,500FT

FLIGHT PROCEDURES

For special procedures which apply to Torres Strait biosecurity requirements, see ERSA GEN - SPECIAL PROCEDURES.

CTAF 126.7

CHARTS RELATED TO THE AERODROME

WAC 3097.

MURRIN MURRIN — ELEV 1535

AVFAX CODE 6107

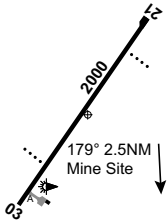

WA UTC +8 YMMI
284219S 1215326E VAR 1 DEG E CERT

AD OPR Minara Resources Pty Ltd, Murrin Murrin Operations, PO Box Z5523, Perth, WA, 6831. Email: siteservices.supt.coord@glencore.com.au. PH 08 9088 5957 (BH). ARO 0408 941 791. Mobile 0408 657 461 (AH).

REMARKS

Restricted Operations. PPR from AD Manager/AROs.

HANDLING SERVICES AND FACILITIES

Nil fuel AVBL.

PASSENGER FACILITIES

LG/WC/PT

AERODROME OBSTACLES

1. Illuminated WDI 209M N of RWY 03 start of TORA 100M E of RWY CL infringes transitional SFC by 10FT.
2. Transient E190 ACFT tail 1,567FT AMSL BRG 209 DEG MAG 885M FM ARP. Infringes TNS by 11FT.

PHYSICAL CHARACTERISTICS

03/21 034 66a PCR 220/F/A/1.10 MPa/T Sealed. WID 30 RWS 150

AERODROME AND APPROACH LIGHTING

RWY 03/21 LIRL SDBY PWR AVBL
RWY 03/21 PAPI(1) 3.0 DEG50FT SDBY PWR AVBL

(1) Left side.

1. RWY edge light spacing: 03/21: nominal 90M.
2. Lighting manually activated. 30MIN PN.

OTHER LIGHTING

1. Standby PWR derived from generator. Switchover time: 10 SEC.
2. TWY LGT: Blue edge.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 118.4 Circuit Area

LOCAL TRAFFIC REGULATIONS

1. ACFT ABV 5,7000KG to use MAX RAD MNM speed turns at RWY ends only.
2. Due to ACFT turn limitations on apron, simultaneous bay occupation may not be AVBL. ARO will advise parking instruction via company frequency on inbound contact.

CTAF - AFRU 126.8

AFRU signal not AVBL on ground Laverton, Murrin Murrin or Sunrise Dam. AFRU located at Leonora.

ADDITIONAL INFORMATION

Mine site 2.5NM, BRG 179DEG M.

CHARTS RELATED TO THE AERODROME

1. WAC 3352.
2. Also refer to AIP Departure and Approach Procedures.

MURWILLUMBAH

ELEV 18

FULL NOTAM SERVICE NOT AVBL

NSW UTC +10 YMUR

281952S 1532449E VAR 12 DEG E UNCR

AD OPR Tweed Shire Council, PO Box 816, Murwillumbah, NSW, 2484.
PH 02 6670 2400. Website: www.tweed.nsw.gov.au.

REMARKS

1. AD Charges: All ACFT.
2. Pilot notes refer to Tweed Shire Council website.
3. Publicly accessible webcams AVBL.

HANDLING SERVICES AND FACILITIES

AVGAS AVBL (AH by appointment). PH 02 6672 4545.

PHYSICAL CHARACTERISTICS

01/19	34c	Unrated. Central 15M of first 500M S of RWY 19 DTHR grass/hard shale. Remainder grass. RWY LEN 1,045M.	WID 40	RWS 70

RWY 19 DTHR 245M.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	119.5

LOCAL TRAFFIC REGULATIONS

1. TWY on NE side of RWY is not AVBL due to drains and trees.
2. In dry conditions, TWY on W and SE sides are AVBL.
3. When RWY wet, taxi on crown with care.
4. Due to industrial buildings at northern end of RWY, ACFT on approach for RWY 19 may not be visible. Please complete all checks in run-up bay provided.

FLIGHT PROCEDURES

1. Left hand circuits.
2. When departing RWY 19, at 600FT turn due to terrain.

CTAF 127.55

NOISE ABATEMENT PROCEDURES

1. No circuits below 1,000 FT.
2. RWY 01 - make wide left circuit to reduce noise to Murwillumbah Hospital.

ADDITIONAL INFORMATION

1. PJE HJ 1.5NM NW of the airfield.
2. Bird hazard exists.
3. RWY subject to flooding during high rain/Tweed River flooding events.
4. All areas may be unusable due SWS after rain. Airfield not inspected.
5. Cleared areas outside gable markers mown, taxi at pilot risk.

CHARTS RELATED TO THE AERODROME

WAC 3357.

Information may be continued on the next page: PTO