
MILLICENT

ELEV 56

FULL NOTAM SERVICE NOT AVBL

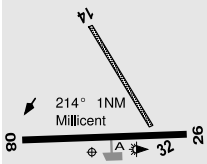

SA		UTC +9:30	YMCT
373501S	1402158E	VAR 10 DEG E	UNCR

AD OPR Wattle Range Council, PO Box 27, Millicent, SA, 5280.
PH 08 8733 0900: 0407 611 459 (H24).

AERODROME OBSTACLES

RWY 08 APCH end, transition S side infringed by trees.

AERODROME AND APPROACH LIGHTING

PAL 123.9

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	125.8 Circuit Area

CTAF 126.7

ADDITIONAL INFORMATION

1. Bird hazard exists.
2. Gliding OPS HJ JF. Gliders operate WI RWS. Wire Launching.


CHARTS RELATED TO THE AERODROME

WAC 3469.

MILLMERRAN

ELEV 1312

FULL NOTAM SERVICE NOT AVBL

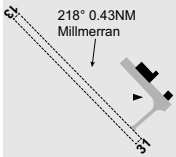

QLD		UTC +10	YMMN
275148S	1511630E	VAR 11 DEG E	UNCR

AD OPR Toowoomba Regional Council, PO Box 3021, Toowoomba, QLD, 4350.
Email: aerodrome@tr.qld.gov.au. PH BH Aerodrome 07 4688 6117.
Council PH AH 0497 099 111. Website: www.tr.qld.gov.au/aerodromes.

REMARKS

1. AD charges apply: see website.
2. ACFT BLW 2,000KG day use only.
3. Pavement concession required for larger ACFT. Contact AD OPR.
4. Access AVBL in accordance with Toowoomba Region Aerodromes Conditions of Access and Use. See website.
5. Due to safety/security hazards, ensure vehicle gates are closed and locked when not in use.

PASSENGER FACILITIES

LG/WC.

APRONS AND TAXIWAYS

1. TWY to APN and hangar area.
2. GA APN.

AERODROME OBSTACLES

1. Transitional OLS tree infringement exists up to 24FT left and right of APCH to SE THR 31 end.
2. Unlit primary wind indicator located BTN RWS and apron infringes transition OLS by 10FT (based on a 60M wide RWS).

PHYSICAL CHARACTERISTICS

13/31	40a/c 2000 kg/0.60 MPa Grass. Central 11M sealed. RWY LEN 1,230M.	WID 18	RWS 80

Caution: outer 2M each side of sealed central runway section may be soft due to sub-surface moisture, particularly during wet weather. Central 6M are firm and stable.

Information may be continued on the next page: PTO

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 121.2 500FT

CTAF 126.7

ADDITIONAL INFORMATION

1. Assume that bird and animal hazard exists. Arriving ACFT should conduct aerial RWY inspection prior to landing.
2. Tyre pressure is in accordance with AIP unrated pavements.
3. Unsealed areas not suitable in wet weather or after rain.
4. Qantas Group Pilot Academy operates from YBWW. CAUTION: increased flight training traffic YMMN circuit and adjacent areas extending to Leyburn, Millmerran and Cecil Plains.
5. CAUTION: Mining operations (blasting possible) BRG 176 MAG APRX 8KM FM AD.

CHARTS RELATED TO THE AERODROME

WAC 3340.

MINDEROO

ELEV 50

FULL NOTAM SERVICE NOT AVBL



WA UTC +8 YMDR
215936S 1150242E VAR 0 DEG E UNCR
AD OPR Minderoo Station, PO Box 48, Onslow, WA, 6510.
Email: riley.wilton@harvestroad.com:
jackson.howes@harvestroad.com.
PH 0438 528 230: 0438 887 915.

REMARKS

PPR for all OPS including the use of the ACFT hangar.

HANDLING SERVICES AND FACILITIES

No fuel or ground handling services.
LTD catering and galley supplies by request to station manager.
Hangar marshalling for Global Express AVBL by prior arrangement.

PHYSICAL CHARACTERISTICS

08/26 50c Unrated. Sealed. RWY LEN 1,524M. WID 30

AERODROME AND APPROACH LIGHTING

RWY 26 PAPI(1) 3.0 DEG47FT SDBY PWR AVBL
(1) Left side. Manually activated. 2HR PN.
RWY 08/26 portable RWY edge lighting. PPR.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 122.4 6000FT

LOCAL TRAFFIC REGULATIONS

1. ACFT above 5,700KG must turn RWY ends, MAX radius, MNM speed.
2. Visiting ACFT are to use the parking bay on the N side of the RWY (Global Express G550).

CTAF 126.7
“Minderoo Traffic”.

ADDITIONAL INFORMATION

1. CAUTION: ACFT hangar located at the THR RWY 08. 30M from RWY edge.
2. CAUTION: Bird and kangaroo hazard exists sunrise to sunset.

CHARTS RELATED TO THE AERODROME

WAC 3229.