MONARTO SAFARI PARK

ELEV 387

FULL NOTAM SERVICE NOT AVBL

SA UTC +9:30 YOAR
350512S 1390934E VAR 8 DEG E UNCR
AD OPR Monarto Safari Park, 63 Monarto Road, Monarto, SA, 5254.
Email: monartooperations@zoossa.com.au. PH Duty Manager: 0428 425 906. ARO 08 8230 1401: 0428 425 906.

REMARKS

1. PPR from Duty Manager.
2. Landing fee of a $50.00 tax deductible donation to the Zoos SA conservation program applies.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA ADELAIDE CENTRE 130.45

CTAF 126.7

CHARTS RELATED TO THE AERODROME

WAC 3458.

MONKIRA

ELEV 350

FULL NOTAM SERVICE NOT AVBL

QLD UTC +10 YMNK
244907S 1403312E VAR 7 DEG E UNCR
AD OPR Monkira Pastoral Co, Monkira Station, via Boulia, QLD, 4829.
PH 07 4656 4956. Fax 07 4656 4959.

PASSENGER FACILITIES

Telephone facilities not AVBL.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 125.4 4500FT

CTAF 126.7

CHARTS RELATED TO THE AERODROME

WAC 3342.

MONTO

ELEV 757

FULL NOTAM SERVICE NOT AVBL

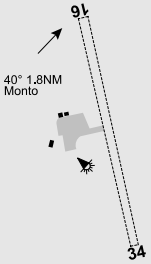

QLD UTC +10 YMTO
245332S 1510607E VAR 10 DEG E UNCR
AD OPR North Burnett Regional Council, PO Box 390, Gayndah, QLD, 4625.
Email: admin@northburnett.qld.gov.au. Council PH 1300 696 272.
Fax 07 4161 1425.

PASSENGER FACILITIES

PT/WC/LG/TX (07 4166 1124, AH 4166 1254)/HC (4166 1755)/AC (4166 1377, 4166 1777)/ Terminal shelter.

APRONS AND TAXIWAYS

Sealed TWY and APN.

AERODROME OBSTACLES
Assume APCH OLS and transition OLS infringements exist.

PHYSICAL CHARACTERISTICS
16/34 43a Unrated. Sealed. RWY LEN 1,310M. WID 30 RWS 90
Slope 0.3% down to N.

AERODROME AND APPROACH LIGHTING
RWY 16/34 LIRL AFRU+PAL 126.7

ATS AND AERODROME COMMUNICATION FACILITIES
FIA BRISBANE CENTRE 124.1 3000FT

CTAF - AFRU 126.7

ADDITIONAL INFORMATION
1. Assume bird and animal hazards exist.
2. Model ACFT OPR WI 1,000M RAD FM ARP. OPR will monitor CTAF.

CHARTS RELATED TO THE AERODROME
WAC 3340.

MOOMBA ELEV 143

AVFAX CODE 5204

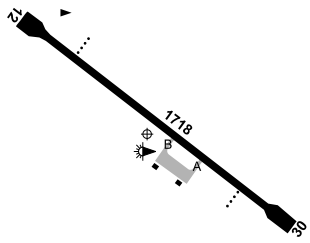

SA UTC +9:30 YOOM
280558S 1401149E VAR 7 DEG E CERT
AD OPR Santos Ltd, PO Box 2319, Adelaide, SA, 5001.
PH 08 8116 5213. ARO 0419 847 168 (H24). Fax 08 8116 5057.

REMARKS
1. PPR.
2. AD charges to all unauthorised ACFT.

HANDLING SERVICES AND FACILITIES
Sodexo refuelling: Phone 0491 970 912. AVBL HJ. JET A1 only.
Refuelling: PH 08 8678 4107 AVBL H24. Account holders only.

AERODROME OBSTACLES
1. Lit COM TWR:
   a. 313FT AMSL PSN 280704.8S 1401242.1E. Infringes HZS by 25FT.
   b. 315FT AMSL PSN 280712.1S 1401243.5E. Infringes HZS by 27FT.
2. Apron flood lights:
   a. 183FT AMSL PSN 280605.4S 1401154.7E. Infringes TNS by 9.5FT.
   b. 183FT AMSL PSN 280606.4S 1401156.2E. Infringes TNS by 9.5FT.

METEOROLOGICAL INFORMATION PROVIDED
1. TAF CAT C, METAR/SPECI.
2. AWIS Phone 08 8150 3808 - Report faults to AD OPR.
3. AWIS FREQ 128.55 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS
12/30 120 56a PCR 232/F/B/1.03 MPa/U Graded. WID 30 RWS 150

AERODROME AND APPROACH LIGHTING
RWY 12/30 LIRL(1) PAL+AA 120.6 SDBY PWR AVBL
RWY 12/30 PAPI(2) PAL+AA 120.6 3.0 DEG52FT SDBY PWR AVBL
RWY 12/30 PTBL(3) BY PRIOR ARRANGEMENT
(1) PAL will not ACT RWY lighting by day in good VIS.
(2) Left side.
(3) EMERG only. 60MIN PN.
RWY edge light spacing: 12/30: 60M.

Information may be continued on the next page: PTO