PHYSICAL CHARACTERISTICS

02/20 29a/c 2000 kg/0.60 MPa Grass. Central 10M sealed. RWY LEN 880M. AVG Slope 0.37% down to S (FM N end 0.35% up to S for 595M, then 1.61% down to S). WID 18 RWS 60

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 121.2 500FT

FLIGHT PROCEDURES

Right hand circuits RWY 02 due township and noise abatement.

CTAF 126.7

ADDITIONAL INFORMATION

1. Assume that bird and animal hazard exists. Arriving ACFT should conduct an aerial RWY inspection prior to landing.
2. Pilot to be satisfied that the ALA is suitable for their OPS. CTC AD OPR for serviceability information.
3. Tyre pressure is in accordance with AIP unrated pavements.
4. Unsealed areas not suitable in wet weather or after rain.
5. Qantas Group Pilot Academy operates from YBWW. CAUTION: Increased flight training traffic YPWH circuit and ADJ areas extending to Leyburn, Millmerran and Cecil Plains.

CHARTS RELATED TO THE AERODROME

WAC 3340.

PLUTONIC ELEV 1896

AVFAX CODE 6613

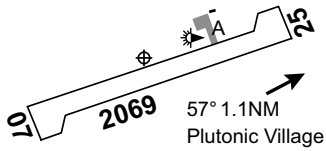

WA UTC +8 YPLU
251900S 1192524E VAR 1 DEG E CERT
AD OPR Catalyst Metals Ltd, Level 1, 30 Richardson Street, West Perth, WA, 6005. Email: plutonic.aro@sirromcorp.com. PH 08 6324 0090: AD MGR 0400 134 718.
ARO 0484 311 325.

REMARKS

Restricted OPS: PPR from AD OPR. CTC ARO in first instance.

AERODROME OBSTACLES

1. Lit mast 2,070FT AMSL BRG 74.9 MAG 1.4NM FM ARP. Infringes inner HZS by 45FT.
2. Unlit TWR 2,058FT AMSL BRG 108 MAG 0.86NM FM ARP. Infringes inner HZS by 33FT.
3. Terrain 2,047FT AMSL PSN BTN BRG 104-121 MAG 0.84-1.94NM FM ARP. Infringes inner HZS by 23FT.

PHYSICAL CHARACTERISTICS

07/25 065 68c PCR 130/F/A/Y/T Unsealed WID 30 RWS 90

The stated PCR is limited to a B462 all-up mass limitation of 38,600KG.

AERODROME AND APPROACH LIGHTING

RWY 07/25 PTBL(1) BY PRIOR ARRANGEMENT

(1) 90MIN PN required.

AD LGT not AVBL EXC for EMERG OPS.

OTHER LIGHTING

SDBY PWR AVBL with 90MIN PN for windsock and APN.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 122.6 5,000FT

Information may be continued on the next page: PTO

LOCAL TRAFFIC REGULATIONS

1. ACFT PRKG advised by ARO on CTAF or as indicated by the marshaller.
2. To avoid damage FM heavy braking, ACFT must use full length and back track to TWY. All ACFT must turn at turn pads.
3. APN AVBL HN for medical evacuation only.
4. All ACFT: on-site marshalling service is provided. CTC the Duty ARO via CTAF or phone.

CTAF - AFRU 126.7

ADDITIONAL INFORMATION

RPA operations occur in the vicinity of the aerodrome and mine site. RPA operators monitor CTAF during operations. For further information, CTC Chief RPA Pilot, TEL 0405 740 663 or email aporo@catalystmetals.com.au.

CHARTS RELATED TO THE AERODROME

WAC 3346.

POINT COOK — ELEV 14

AVFAX CODE 3006

VIC		UTC +10	YMPC
375556S	1444512E	VAR 12 DEG E	MIL

AD OPR RAAF Airbase Operations Centre, RAAF Base Point Cook Aerodrome, VIC, 3030.
Email: pck.aboc@defence.gov.au. PH 03 7301 5531.

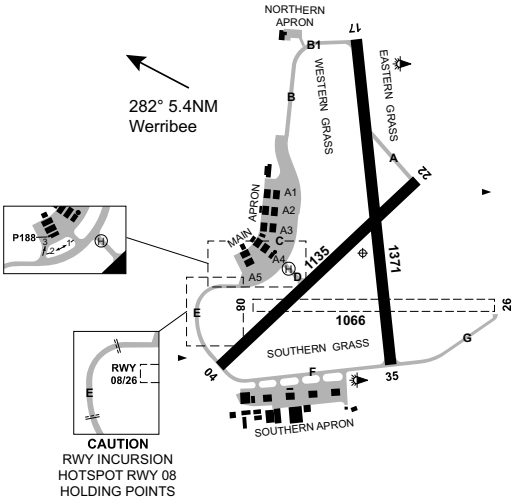

REMARKS

1. CIV ACFT landings not permitted without prior approval FM aerodrome commanding officer.
2. Airbase Operations Centre is manned 0700-1600 Local MON-THU and 0700-1500 Local FRI. AH CTC AD OPR.
3. All Point Cook based and itinerant civil ACFT: CTC AD OPR prior to operating at Point Cook.
4. AD Charges: All civilian ACFT as applicable.