PORTLAND ELEV 266

AVFAX CODE 3013

VIC UTC +10 YPOD
381905S 1412816E VAR 10 DEG E CERT
AD OPR Glenelg Shire Council, PO Box 152, Portland, VIC, 3305. PH 0427 360 578 H24. Council PH 03 5522 2200. Fax Council 03 5522 2290.

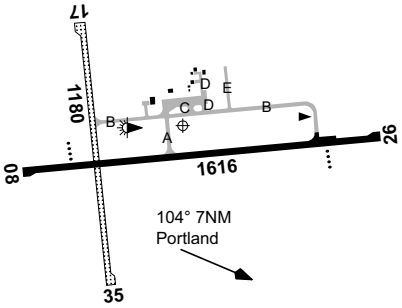

REMARKS

AD Charges: All commercial ACFT.

HANDLING SERVICES AND FACILITIES

Portland Aero Club: AVGAS H24 self-service bowser. V and MC. Phone 0417 163 324.
Glenelg Shire Council: JET A1 H24 self-service bowser. V and MC. Phone 0427 360 578.

APRONS AND TAXIWAYS

1. TWY A, TWY B (FM TWY A to TWY C) and TWY C, sealed, unrated.
2. TWY D and TWY E, sealed MAX 5,700KG.
3. TWY B west of TWY A and east of TWY E, grassed MAX 5,700KG.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS PH 03 8470 3204 - Report faults to BoM.
3. AWIS FREQ 118.75 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

08/26	077	53a	PCR 90/F/B/0.87 MPa/U	WID 30	RWS 150
17/35	167	39c	5700 kg/0.55 MPa Natural Surface. Central 23M Gravel	WID 30	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 08/26	LIRL	AFRU+PAL 127.95		SDBY PWR AVBL
RWY 08/26	PAPI(1)	AFRU+PAL 127.95	3.0 DEG39.4FT	SDBY PWR AVBL

(1) Left side.

1. RWY edge light spacing: 08/26: 60M.
2. HJ selection of PAL will only activate PAPI. RWY lights will only OPR when poor light levels exist.
3. PAL 30 MIN cycle, 10 MIN warning.

OTHER LIGHTING

1. Secondary PWR switchover time: 20 SEC.
2. TWY A, TWY B (from TWY A to TWY C) and TWY C Green CL.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA MELBOURNE CENTRE 125.8 Circuit Area

CTAF - AFRU 127.95

ADDITIONAL INFORMATION

Bird and animal hazard exists.

CHARTS RELATED TO THE AERODROME

1. WAC 3469.
2. Also refer to AIP Departure and Approach Procedures.