SEABUOY

AVFAX CODE 6820 **FULL NOTAM SERVICE NOT AVBL**

WA		UTC +8	YSBY
202548S	1164251E	VAR 1 DEG E	UNCR

AD OPR Auriga Group, 14 Argyle St, Albion, QLD, 4010. Email: westcoastaviation@auriga.com.au. ARO 0427 061 441.

REMARKS

All enquiries to Head of Flying Operations (HOFO) via AD OPR. Include “ATTN HOFO” in email subject.

METEOROLOGICAL INFORMATION PROVIDED

AWIS FREQ 135.85 - Report faults to AD OPR.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	122.4
ATIS	KARRATHA ATIS	134.55
TWR	KARRATHA TOWER	127.35

CTAF 127.35

CHARTS RELATED TO THE AERODROME

1. WAC 3229.
2. Also refer to AIP Departure and Approach Procedures.

SERPENTINE

ELEV 30

FULL NOTAM SERVICE NOT AVBL

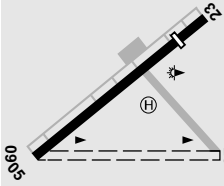

WA		UTC +8	YSEN
322342S	1155224E	VAR 2 DEG W	UNCR

AD OPR Sport Aircraft Builder's Club of WA Inc, Yangedi Road North, Hopeland, WA, 6125. Email: secretary@sabc.org.au. Website: www.sabc.org.au.

REMARKS

PPR. Email request for permission to committee@sabc.org.au.

HANDLING SERVICES AND FACILITIES

PPR to confirm fuel AVBL. AVGAS and MOGAS 95 AVBL H24. Accepts Dunning Card and credit card (V and MC). Other cards not accepted. For system faults: PH 0407 199 681.

AERODROME OBSTACLES

1. High voltage powerlines running North to South 900M West of AD boundary.
2. Trees to 10M short final RWY 27.

PHYSICAL CHARACTERISTICS

05/23	30a	Unrated. Sealed. RWY LEN 900M. RWY 23 DTHR 100M.	WID 12	RWS 15
09/27	20c	Unrated. Grass. RWY LEN 600M.	WID 24	RWS 30

AERODROME AND APPROACH LIGHTING

RWY 05/23 MIRL PAL 125.3

RWY 05/23 edge LGT spacing: 96M.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	PERTH CENTRE	135.25 On ground

LOCAL TRAFFIC REGULATIONS

1. No flight school training permitted.
2. ACFT should manoeuvre on TWY and RWY only due to soft sand.

FLIGHT PROCEDURES

1. RWY 05 MNM CCT HGT 1,000FT.
2. CCTS not permitted before 0800 on SUN.

CTAF 119.1

Information may be continued on the next page: PTO