PHYSICAL CHARACTERISTICS

12/30 117 100a PCR 500/F/C/W/T WID 45 RWS 150
Arrestor system not permanently installed. Units requiring hookcable are to provide system and crew.

AERODROME AND APPROACH LIGHTING

RWY 12/30	MIRL	PAL+AA 120.6		SDBY PWR AVBL
RWY 12/30	PAPI	PAL+AA 120.6	3.0 DEG48FT	SDBY PWR AVBL
RWY 12/30	RTIL	PAL+AA 120.6		SDBY PWR AVBL

1. DIST to run markers lit.
2. PWR supplied by generator on base. SDBY PWR AVBL 15-20 SEC delay.
3. RWY edge LGT and PAPI not AVBL EXC with 24HR PN to RAAF Base Townsville ABOC via email.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 122.1 Circuit Area
TWR, SMC and ATIS availability and HR of service promulgated by NOTAM.

RADIO NAVIGATION AND LANDING AIDS

TAC SGR 123710.9S 1420520.0E (1)
(1) PTBL FAC ACT as required by MIL authorities. Channel assignment and ACT by NOTAM.

LOCAL TRAFFIC REGULATIONS

180 DEG turns on RWY not permitted for ACFT with outer main gear wheel span greater than 9M.

FLIGHT PROCEDURES

1. **REMOTELY PILOTED AIRCRAFT SYSTEM (RPAS)**

1.1. All RPAS requests and enquiries are to be sent to adf.airspace@defence.gov.au with at least 5 business days PN. OPS are subject to MIL OPS and may be restricted or cancelled at any time.

CTAF 126.7
Except when Scherger CTR and Restricted areas active.

ADDITIONAL INFORMATION

1. Animal hazard exists.
2. Two-way COM BTN ACFT on the ground at Weipa and Scherger on CTAF may be prevented by terrain shielding.
3. No AFRU exists at Scherger. ACFT to coordinate alternate means to check COM. Note that Scherger and Weipa use the same CTAF FREQ and use Weipa AFRU.

CHARTS RELATED TO THE AERODROME

1. WAC 3112.
2. MIL Aerodrome Obstruction Chart Type A: NOV 2024.
3. Also refer to AIP Departure and Approach Procedures.

SCONE

ELEV 745

AVFAX CODE 2023

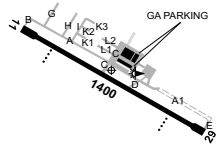

NSW UTC +10 YSCO
320214S 1504956E VAR 12 DEG E CERT
AD OPR Upper Hunter Shire Council, PO Box 208, Scone, NSW, 2337.
PH 02 6540 1100: AH AD Manager 0439 428 134. Fax 02 6545 2671.

REMARKS

1. AD Charges: Refer to http://upperhunter.nsw.gov.au/ for current fees and charges. Bookings for ACFT PRKG is compulsory over 5,700KG.
2. Gate access code from landside to main apron is: C then the YSCO CTAF.

HANDLING SERVICES AND FACILITIES

Aero Refuellers - AVGAS and JET A1 H24 self-service bowsers. Accept Aero Refuellers cards, V and MC. PH: 0413 003 808.

PASSENGER FACILITIES

Terminal facilities AVBL in Scone Memorial Airport BLDG. Access code is C then YSCO CTAF. RF (cafe WED-FRI: 0800-1500, SAT/SUN: 0900-1500 Local).

AERODROME OBSTACLES

Trees:

a. 748FT AMSL PSN 320233.88S 1505031.55E. Infringes OLS by 5FT.
b. 745FT AMSL PSN 320234.02S 1505031.84E. Infringes OLS by 1FT.
c. 773FT AMSL PSN 320221.58S 1505013.00E. Infringes TNS by 4FT.
d. 757FT AMSL PSN 320221.74S 1505011.27E. Infringes TNS by 4FT.
e. 755FT AMSL PSN 320222.78S 1505013.29E. Infringes TNS by 3FT.
f. 751FT AMSL PSN 320223.95S 1505015.44E. Infringes TNS by 5FT.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS PH 02 9353 6449 - Report faults to BoM.
3. AWIS FREQ 134.55 (requires 1 second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

11/29 110 46 PCR 240/F/D/X/T Uneven SFC due to soil movement WID 30 RWS 90 RWS not AVBL due rough SFC.

AERODROME AND APPROACH LIGHTING

RWY 11/29	LIRL(1)	PAL 128.0	
RWY 11	PAPI(2)	PAL 128.0	3.0 DEG45FT
RWY 29	PAPI(3)	PAL 128.0	3.0 DEG46FT

(1) PAL requires three one-second pulses to activate.
(2) Right side. PAL requires three one-second pulses to activate.
(3) Left side. PAL requires three one-second pulses to activate.

OTHER LIGHTING

TWY LGT: Blue edge on TWY C.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	BRISBANE CENTRE	124.8 4000FT

LOCAL TRAFFIC REGULATIONS

1. Exit TWY at the RWY 11 end is 7.5M wide.
2. Two gravel TWY to the fire bombing base is restricted to fire bombing ACFT only.
3. Main TWY BTN ‘Air Pasture’ and hangars not AVBL due to uneven SFC.
4. Helicopter parking AVBL on TWY A between TWY C and D.

CTAF 128.0

ADDITIONAL INFORMATION

1. Animal hazard (kangaroos, foxes and birds) exists WI VCY RWY 11/29.
2. Caution: The pilot in command should be aware of the terrain and obstacles in the circling area prior to conducting Night IFR OPS into Scone.
3. Caution: During rain, GA APN holds excessive water at entrance and near refuelling bowser.

CHARTS RELATED TO THE AERODROME

1. WAC 3456.
2. Also refer to AIP Departure and Approach Procedures.

Information may be continued on the next page: PTO