
TEMORA

ELEV 921

AVFAX CODE 2203

NSW		UTC +10	YTEM
342517S	1473042E	VAR 12 DEG E	CERT

AD OPR Temora Shire Council, PO Box 262, Temora, NSW, 2666.
Email: temshire@temora.nsw.gov.au. PH 02 6980 1100 H24. ARO AH 0427 455 629.

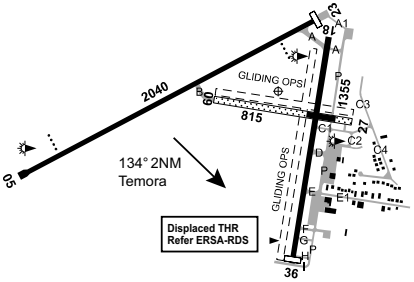

HANDLING SERVICES AND FACILITIES

Temora Aero Club: 2200-0800 UTC MON-FRI, JF HJ, PN during BH. Phone 02 6977 2733, Fax 6978 1080. AVGAS, O117, O125.
Aero Refuellers: AVGAS bowser. Accepts Aero Refuellers card, V and MC. PH 02 6054 2200 BH or website: www.aerorefuellers.com.au.
Skyfuel Australia: JET A1 + FSII and AVGAS. H24 DLY, card operated pump accepts V, MC and Skyfuel Carnet Card. PH 0418 862 100. Website: www.skyfuel.com.au, for site orientation.

AERODROME OBSTACLES

Lit silo 1,020FT AMSL, 177DEG/2710M FM SOT RWY 18.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS Phone 02 9353 6453 - Report faults to BoM.
3. AWIS FREQ 134.45 (requires one-second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

05/23	050	67a	PCR 390/F/D/X/T	WID 30	RWS 90
09/27	087	27c	Unrated. Gravel.	WID 30	RWS 60
18/36	177	44a	PCR 350/F/D/X/T	WID 30	RWS 90

AERODROME AND APPROACH LIGHTING

RWY 05/23	LIRL	PAL+AA 119.6		SDBY PWR AVBL
RWY 05/23	PAPI(1)	PAL+AA 119.6	3.0 DEG41.3FT	SDBY PWR AVBL

(1) Left side.

OTHER LIGHTING

1. SDBY PWR AVBL with 60 SEC switchover time.
2. TWY LGT: Blue edge TWY A, D and RWY 18/36 BTN TWY A and D.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	134.65 Circuit Area
UNICOM	TEMORA UNICOM	126.15 (1)

(1) UNICOM operates during air display periods.

FLIGHT PROCEDURES

1. Gliding OPS HJ FM separate parallel RWS marked with orange markers immediately W of RWY 18/36 and immediately N of RWY 09/27.
2. Gliding OPS FM RWY 05/23 may be conducted from mid-field TWY B.
3. Gliders and tugs use common left CCTS.
4. Contra CCTS are not permitted under normal circumstances.
5. Independent RWY OPS are not permitted.

CTAF 126.15

ADDITIONAL INFORMATION


1. Bird hazard exists.
2. Aerobatics 300-5,000FT AGL immediately W of RWY 18/36, HJ.
3. Gliders and Tugs are radio equipped and will broadcast and monitor CTAF 126.15 within 10NM of the AD.
4. Gliders outside 10NM from the AD may use Glider FREQ 122.5, 122.7 or 122.9.
5. Temora Aviation Museum air displays:
   a. D427 and R406 ACT on display weekends.
   b. Check SUA NOTAM for activation details. Check www.aviationmuseum.com.au for display dates.
   c. No flight permitted except with permission of controlling authority - Temora Historic Flight Club - UNICOM 126.15 or 0407 391 431. Non participating aircraft should plan to arrive or depart outside the display times. Priority given to display aircraft except for aircraft in emergency or Emergency Services aircraft.

CHARTS RELATED TO THE AERODROME

1. WAC 3456, 3457.
2. Also refer to AIP Departure and Approach Procedures.

TENNANT CREEK — ELEV 1236

AVFAX CODE 8401

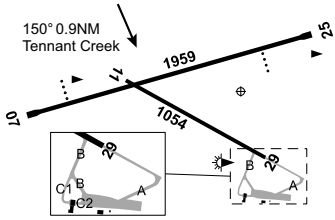

NT UTC +9:30 YTNK
193804S 1341100E VAR 4 DEG E CERT
AD OPR Tennant Creek Airport Pty Ltd, PO Box 796, Alice Springs, NT, 0871. Email: operationstca@adgnt.com.au.
PH 08 8963 3700. ARO 0402 088 160 (primary CTC).
PH AH 0402 088 151.
Website: www.tennantcreekairport.com.au.

REMARKS

1. AD Charges: All ACFT. Copies of Conditions of Use can be obtained from AD OPR or website.
2. AD OPR does not provide ACFT marshalling. All requests to Airline or fixed base operators.
3. PPR for all ACFT ABV 5,700KG MTOW to remain at, transit or use Tennant Creek as planned ALTN. Obtainable FM Tennant Creek Airport Pty Ltd, 24HR PN, email or PH 08 8951 1211 or AH MOB.

HANDLING SERVICES AND FACILITIES

VIVA Energy Australia. JET A1 2200-0800. AH call-out fee applies, weekends by prior arrangement. AVGAS bowser H24. Credit cards or Fuel2Sky cards only. Phone 0419 821 668. Email: tennantcreek@hmair.com.au.

PASSENGER FACILITIES

LG/WC/HC 08 8962 3040.

APRONS AND TAXIWAYS

1. TWY B - PCR 60/F/B/0.70MPa/T.
2. TWY A and eastern portion of apron not AVBL to ACFT ABV 5,700KG MTOW.

AERODROME OBSTACLES

1. Lit TWR 1,403FT AMSL PSN 193842.2S 1341101.5E. Infringes inner HZS by 35FT.
2. Lit TWR 1,565FT AMSL PSN 193803.3S 1341324.9E. Infringes inner HZS by 197FT.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT C, METAR/SPECI.
2. AWIS PH 08 7922 2513 - Report faults to BoM.
3. AWIS FREQ 128.65 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

07/25	071	64a	PCR 60/F/D/0.70 MPa/T	WID 30	RWS 150
11/29	115	35a	PCR 60/F/B/0.70 MPa/U	WID 23	RWS 90

Information may be continued on the next page: PTO